







# THE METALLIC ALLOYS.

.

# THE

# METALLIC ALLOYS.

# A PRACTICAL GUIDE

FOR THE

MANUFACTURE OF ALL KINDS OF ALLOYS, AMALGAMS, AND SOLDERS, USED BY METAL-WORKERS;

TOGETHER WITH

THEIR CHEMICAL AND PHYSICAL PROPERTIES AND THEIR APPLICATION IN THE ARTS AND THE INDUSTRIES ;

WITH AN

APPENDIX ON THE COLORING OF ALLOYS AND THE RECOVERY OF WASTE METALS.

EDITED BY

WILLIAM T. BRANNT,

EDITOR OF THE "TECHNO-CHEMICAL RECEIPT BOOK," AND "THE METAL WORKER'S HANDY BOOK."

ILLUSTRATED BY THIRTY-FOUR ENGRAVINGS.

A NEW, REVISED, AND ENLARGED EDITION.

PHILADELPHIA:

10132,

HENRY CAREY BAIRD & CO., 48 INDUSTRIAL PUBLISHERS, BOOKSELLERS AND IMPORTERS, 810 WALNUT STREET.

LONDON : SAMPSON LOW, MARSTON & CO., LIMITED, ST. DUNSTAN'S HOUSE, FETTER LANE, FLEET STREET. 1896. Copyright, by HENRY CAREY BAIRD & CO., 1896.

-15 138:

8-23-37

PRINTED AT THE WICKERSHAM PRINTING HOUSE, 53 and 55 North Queen Street, LANCASTER, PA., U. S. A.

# PREFACE.

THE rapid sale of the first edition of "The Metallic Alloys," and the constant demand for it, are the best evidence that no apology is necessary for presenting a second edition.

The present volume is designed to be an improvement on the former. Mistakes have been corrected wherever detected, and in some instances the order of treatment of different parts has been revised so as to bring them into strict logical sequence. Chapters have been added, and the physical and chemical relations of the metals, as well as the special properties of the alloys, have been more fully treated. But, whilst the scope of the work has been enlarged, it has been endeavored to preserve its popular character so that it will be easily understood by those readers who have not made Metallurgy and its kindred Arts subjects of special study, and be of practical utility to them. In short, the object aimed at has been to present a reliable guide to all persons professionally interested in the manufacture and use of alloys, amalgams and solders.

Great care has been exercised in selecting only such processes and formulas as have stood the test in practice; and many journals, both foreign and domestic, have been searched for the purpose of gathering together the results of recent experiments by acknowledged authorities. Various text-books and encyclopædias, previously published in this country and abroad, have also been freely consulted, with the object of

#### PREFACE.

rendering the present work as complete as possible. In particular the editor desires to express his indebtedness to the following works: Thurston, A Treatise on Brasses, Bronzes and Other Alloys; Krupp, Die Legirungen; Ledebur, Die Metallverarbeitung auf chemisch-physikalischem Wege; Muspratt's Theoretische, praktische und analytische Chemie.

Finally, it remains only to be stated that the publishers have spared no expense in the mechanical production of the book; and, as is their universal custom, have caused it to be provided with a copious table of contents, and a very full index, which will add additional value by rendering any subject in it easy and prompt of reference.

W. T. B.

PHILADELPHIA, July 4th, 1896.

vi

# CHAPTER I.

#### INTRODUCTION.

|  | FAGE   |
|--|--------|
| Constitution of technically-prepared metals; Explanation of the terms alloy    |        |
| and amalgam; Change in the properties of a metal by alloying                   | 1      |
| Earliest historical data in reference to the compounding of metals; Early      |        |
| general use of brass; Preparation of alloys by the Greeks; Early alloying      |        |
| of the noble metals  | $^{2}$ |
| Bronze the earliest product of mixed metals; Historical order of alloys; Use   |        |
| of amalgams by the Greeks and Arabians; Ancient use of fire-gilding me-        | Ť      |
| tallic articles; Alloys known at the commencement of the reign of Charle-      |        |
| mague  | 3      |
| Development of chemistry principally due to the Arabs; Influence of alchemy    |        |
| upon modern chemistry; Use of mixtures of metals in the middle ages;           |        |
| Coinage in the middle ages   | 4      |
| Preparation of metals from minerals by chemical action; Number of metals       |        |
| found among the elementary bodies; Present knowledge of metals; The            |        |
| science of metallic alloys a wide field for the activity of the chemist        | 5      |
| Facts which might indicate that an alloy is a chemical combination; Pro-       |        |
| cesses taking place in making solutions  |        |
| Variation in the physical properties of ordinary solutions from those of their |        |
| constituents; Concentration of the salt in sea water                           |        |
| The properties of alloys not a certain proof of their character as chemical    |        |
| combinations; Crystallization of alloys; Not every alloy a pure chemical       |        |
| combination  | 8      |
| Formation of actual chemical combinations between two or more metals; Ex-      |        |
| planation of the variation in apparently the same alloys when prepared in      |        |
| a different manner; Solubility of various bodies                               |        |
|  |        |

### CHAPTER II.

## PHYSICAL AND CHEMICAL RELATIONS OF THE METALS.

(vii)

|   | $\mathbf{P}$ | AGE |
|---|--------------|-----|
| Physical relations of the metals; General understanding of the term metal     | ;            |     |
| The term metal from the standpoint of the chemist; Characteristic lustr       | е            |     |
| found in metals; Malleability of metals                                       | •            | 12  |
| Differences in the ductility of metals; Opacity of metals; Fusibility, weight | ,            |     |
| ductility, solidity and conductility of metals                                | •            | 13  |
| Chemical relations of the metals; Affinity of the different metals for oxygen | ;            |     |
| Division of metals into base and noble  | •            | 14  |
| Heavy and light metals; Properties and uses of light metals                   | •            | 15  |
| Alkali metals; Metals of the alkaline earths; Metals of the earths proper     | •            | 16  |
| Decomposition of water by the light metals; Division of the heavy metals int  | 0            |     |
| four groups   | •            | 17  |
| Influence of non-metallic bodies upon metals                                  | •            | 18  |
| Illustrations of the influence of non-metallic bodies upon iron; Influence of | f            |     |
| carbon, sulphur or phosphorus upon iron                                       | •            | 19  |
| Definition of a chemical combination  | •            | 20  |
| Table of elementary bodies with their symbols and atomic weights .            |              | 21  |

# CHAPTER III.

# SPECIAL PROPERTIES OF THE METALS.

| Alkali metals; Metals of the alkaline earths                                | 22      |
|---|---------|
| Metals of the earths proper; Aluminium and its properties; Specific heat of |         |
| and conductivity of heat by aluminium                                       | 23      |
| Distribution of aluminium   | $^{24}$ |
| Deposits of bauxite in Europe and in the United States; Cryolite; Former    |         |
| industrial preparation of aluminium; Description of the methods in vogue    |         |
| at Salindres, France  | 25      |
| Principle of reduction by electrolysis; Process of manufacture as conducted |         |
| by the Pittsburg Reduction Co   | 27      |
| Analyses of commercial aluminium ; Effect of iron on aluminium ; Aluminium  |         |
| alloys; Furnace of the Cowles Electric Smelting and Aluminium Co            | 30      |
| Magnesium and its occurrence; Isolation of magnesium by Davy, in 1808;      |         |
| Properties of magnesium   | 33      |
| Difficulty in preparing magnesium alloys; Magnesium alloys and amalgams.    | $^{34}$ |
| Heavy metals; Iron group  | 35      |
| Iron; Native iron; Iron considered as an alloy with carbon; Preparation of  |         |
| chemically pure iron  | 36      |
| Oxidation of iron; Alloying power of iron                                   | 37      |
| Manganese; First extraction of metallic manganese                           | 38      |
| Alloying power of manganese; Cobalt; Principal naturally occurring com-     |         |
| pounds of cobalt; Alloying power of cobalt                                  | 39      |
| Nickel; Discovery of nickel; Occurrence of nickel ores; Commercial nickel;  |         |
| Properties of nickel  | 40      |

4

|   | AGE      |
|---|----------|
| Dr. Fleitmann's process of refining and toughening nickel; Alloying power of nickel | 41       |
| The subject of nickel and steel alloy first called attention to by Mr. James        |          |
| Riley, of Glasgow; Harveyized plates; Chromium; Hardening of metals                 |          |
| by the addition of chromium   | 42       |
| Process of uniting iron and chromium; Ferro-chrome from Kapfenberg in               |          |
| Styria ; Uranium  | 43       |
| Zinc group; Zinc; Occurrence of zinc ores; Metallic zinc first mentioned by         |          |
| Paracelsus in 1541; Commencement of the manufacture of zinc in Ger-                 |          |
| many and in England   | 44       |
| Manufacture of zinc in the United States; Properties of metallic zinc; Zinc-        |          |
| white   | 45       |
| Alloying powers of zinc; Cadmium; Discovery of cadmium; Manner of ob-               |          |
| taining pure metallic cadmium   | 46       |
| Properties and alloying powers of cadmium   | 47       |
| Indium; Gallium; Discovery and properties of gallium                                | 48       |
| Alloys of gallium ; Tungsten group  | 49       |
| Tungsten; Discovery and principal native compounds of tungsten; Manner              | 10       |
| of obtaining metallic tungsten : Ferro-tungsten ; General effect of tungsten        |          |
| on steel; Molybdenum; Vanadium  | 50       |
| Tin group; Tin; Occurrence of tin ore; Tin ore in the United States .               | 51       |
| Table of analyses of commercial tin; Properties of chemically pure tin; The         |          |
| "tin-crv"   | 52       |
| Putty-powder; Forms of unmanufactured tin; Alloying power of tin; Lead              | 02       |
| group; Lead; Properties of pure lead  | 53       |
| Affinity of lead for oxygen; Alloying power of lead; Thallium                       | 55 - 54  |
| Silver group: Copper; Properties of copper; Alloying power of copper; Im-           | 01       |
| portance of many of the copper alloys   | 55       |
| Mercury; Properties and alloying power of mercury; Amalgams                         | 56       |
| Silver ; Occurrence and properties of silver  | 57       |
| Gold group; Gold; Wide distribution of gold; Properties of gold                     | 58       |
| Platinum; Occurrence and properties of platinum                                     | 59       |
| Bismuth group; Bismuth; Antimony  | 60       |
| Arsenic; Occurrence and properties of arsenic                                       | 61       |
| Sulphur; Affinity of sulphur for metals; Characteristics of combinations of         | 01       |
|   | 62       |
| the metals with sulphur   | 04       |
| Carbon; Wide distribution of carbon throughout nature; Crystallized forms           | 0.9      |
| of carbon; Solution of carbon in melted metals                                      | 63<br>64 |
| Phosphorus; Effect of phosphorus upon metals ,                                      | 64       |
| Table of specific gravities and melting points of the principal metals              | 65       |

# CHAPTER IV.

# GENERAL PROPERTIES OF ALLOYS.

| r.   | AGE |
|--|-----|
| Alterations which certain metals undergo by melting together or alloying;            |     |
| Liquation  | 66  |
| Means of preventing liquation ; Change in the properties of one and the same         |     |
| alloy by remelting   | 67  |
| Definition of constant alloys and their composition                                  | 68  |
| Tendency of copper-tin alloys towards liquation; Tin-stains; Constant cop-           |     |
| per-tin alloys; Composition of French pieces of ordnance                             | 69  |
| Tendency towards liquation of copper-zinc, copper-lead, and silver-copper            |     |
| alloys; Constant copper-silver alloy   | 70  |
| Tendency towards liquation of gold-copper, gold-silver, lead-silver and zinc-        |     |
| tin alloys; Specific gravity or density of alloys; Correspondence of the             |     |
| actual, with the calculated, specific gravity  | 71  |
| Causes to which change in volume may be due; Point of greatest density of            |     |
| water; Expansion of cast-iron in solidifying   | 72  |
| Variation between wide limits of the specific gravity of every metal; Formula        |     |
| for calculating the specific gravity of an alloy                                     | 73  |
| Copper-tin alloys; Riche's and Thurston's investigations                             | 74  |
| Table of specific gravities of copper-tin alloys; Observations on the table .        | 75  |
| Results of Riche's experiments with copper-tin alloys                                | 76  |
| Alloys with 20,80 per cent. tin : Alloys with 18 per cent. tin ; Alloys with 20      |     |
| per cent. tin  | 77  |
| Alloys with 12 per cent. tin; Alloys with 10 per cent. tin                           | 78  |
| Alloys with 6 per cent. tin; Copper-zinc alloys                                      | 79  |
| Table of specific gravities of copper-zinc alloys; Copper-silver alloys .            | 80  |
| Table of specific gravities of copper-silver alloys; Copper-gold alloys              |     |
|  | 81  |
| Table of specific gravities of copper-gold alloys; Silver-gold alloys                | 82  |
| Table of specific gravities of silver-gold alloys; Lead-gold alloys; Table of        |     |
| specific gravities of lead-gold alloys   | 83  |
| Silver-lead alloys; Table of specific gravities of silver-lead alloys; Amtimony-     |     |
| tin alloys   | 84  |
| Table of specific gravities of antimony-tin alloys; Antimony-bismuth alloys;         |     |
| Table of specific gravities of antimony-bismuth alloys                               | 85  |
| Antimony-lead alloys; Table of specific gravities of antimony-lead alloys;           |     |
| Tin-cadmium alloys   | 86  |
| Table of specific gravities of tin-cadmium alloys; Tin-bismuth alloys; Table         |     |
| of specific gravities of tin-bismuth alloys  | 87  |
| Fin-silver alloys; Table of specific gravities of tin-silver alloys; Tin-lead alloys | 88  |
| Table of specific gravities of tin-lead alloys; Tin-gold alloys; Table of specific   |     |
| gravities of tin-gold alloys   | 89  |
| Cadmium-bismuth alloys; Table of specific gravities of cadmium-bismuth               |     |
| alloys : Cadmium-lead alloys   | 00  |

|   | PAGE  |
|---|-------|
| Table of specific gravities of cadmium-lead alloys; Bismuth-silver alloys;        |       |
| Table of specific gravities of bismuth-silver alloys; Bismuth-lead alloys .       | 91    |
| Table of specific gravities of bismuth-lead alloys; Bismuth-gold alloys; Table    |       |
| of specific gravities of bismuth-gold alloys                                      | 92    |
| Tin-mercury alloys (tin amalgams); Table of specific gravities of tin-mercury     |       |
| alloys; Lead-mercury alloys (lead amalgams); Table of specific gravities of       |       |
| lead-mercury alloys   | 93    |
| Division of the alloys examined into three groups; Alloys which plainly show      | 00    |
| contraction; Alloys which plainly show expansion; Alloys which do not             |       |
|   |       |
| show plainly either expansion or contraction                                      | 94    |
| Crystallization; Copper-tin alloys  | 95    |
| Copper-zinc alloys; Antimony-zinc alloys; Gold-silver, lead-silver and silver-    |       |
| mercury alloys; Gold-tin alloys; Iron-tin alloys; Iron-manganese alloys .         | 96    |
| Importance of the crystallization of alloys; Strength; Copper-tin alloys .        | 97    |
| Copper-zinc alloys; Values for the breaking strength of copper-zinc alloys .      | 98    |
| Copper-nickel and copper-nickel-tin alloys; Various alloys of copper with         |       |
| manganese, tin, iron and zinc; Deductions from the results of Künzel's in-        |       |
| vestigations  | 99    |
| Copper-aluminium alloys; Copper-gold and copper-silver alloys; Hardness .         | 100   |
|   | 101   |
|   | 102   |
| Hardness of gold-copper and silver-copper alloys; Lead-antimony alloys;           | 102   |
|   | 103   |
| Hardness of zinc-tin alloys; Ductility; Effect of alloying one metal with an-     | 103   |
|   | 104   |
|   | 104   |
|   | 105   |
| 8 1   | 106   |
| 0 1   | 107   |
|   | 108   |
| Fusing points of silver-copper alloys, of silver-gold alloys and of gold-platinum |       |
| alloys  | 109   |
| Fusing points of lead-tin alloys, of tin-antimony alloys, and lead-antimony       |       |
| alloys  | 110   |
| Alloys with a fusing point below the boiling point of water; Expansion by         |       |
| heat; Copper-tin alloys; Copper-zinc alloys; Lead-antimony alloys; Zinc-          |       |
|   | 111   |
| Law of the specific heat of alloys as announced by Regnault; Conductivity for     | ~ ~ ~ |
| heat; Investigations by Calvert and Johnson; Injurious effect upon the            |       |
|   | 112   |
|   | 112   |
| Conducting power of several alloys; Conductivity for electricity; Matthiessen's   | 110   |
|   | 113   |
| Color; Effect on the color of a metal by the addition of determined quantities    |       |
|   | 114   |
|   | 115   |
| Comparison of the scale of color of copper-tin and copper-zinc alloys; Color-     |       |
|   | 116   |

.

xi

|  | PAGE  |
|--|-------|
| Coloring power of gold; Resistance to chemical influences; Practical impor   | t-    |
| ance of the resistance of alloys to chemical influences                      | . 117 |
| Action of the atmosphere on alloys; Reduction in the chemical action of      | a     |
| body by alloying a metal with another  |       |
| Experiments of St. Claire Deville; Investigations of the resistance of coppe | r-    |
| tin and copper-zinc alloys to acids and salts by Calvert and Johnson .       | . 119 |
| Influence of sea-water upon copper-zinc and copper-zinc-tin alloys; Form.    |       |
| tion and composition of patina   |       |
| Action of chemical agents upon copper-silvers and gold-silver alloys .       | . 121 |
| Action of acids and salt solutions upon lead-tin alloys; Results of Knapp    | o's   |
| investigations of lead-tin alloys  | . 122 |
| R. Weber's experiments with lead-tin alloys; Composition of alloys for vesse | els   |
| intended for measuring fluids as fixed by law in Germany                     | . 124 |
|  |       |

# CHAPTER V.

#### PREPARATION OF ALLOYS IN GENERAL.

| General method of preparing alloys; Utensils used; Necessity of preservi     | ng  |     |
|--|-----|-----|
| a deoxidizing flame within the furnace                                       | • • | 125 |
| Precautionary measures in preparing alloys in a crucible; Bodies used i      | for |     |
| covering the surface of the metals; Anhydrous borax; Glass; Charcos          | al; |     |
| Effect of fat  | •   | 126 |
| Crucibles for the preparation of alloys from noble or costly metals; Graph   | ite |     |
| crucibles; Melting the metals  | •   | 127 |
| Alloying two metals with greatly varying densities; Effect of stirring t     | he  |     |
| mixture with sticks of dry, soft wood; Change in the nature of alloys        | by  |     |
| repeated remelting   | •   | 128 |
| Causes of the advance in the alloy industry ; Metals chiefly used in the man | iu- |     |
| facture of alloys; Want of information regarding the manufacture of allo     | ys. | 129 |
| Methods of making experiments in the preparation of new alloys; Combinati    | on  |     |
| of metals with non-metallic elements   |     | 130 |
|  |     |     |

# CHAPTER VI.

#### COPPER-ALLOYS.

| Difficult   | y in th | ie en | ployn   | nent ( | of cop | per f | for va | rious  | purp    | oses; | Influ   | ence  | of for |       |
|---|---------|-------|---------|--------|--------|-------|--------|--------|---------|-------|---------|-------|--------|-------|
| eign bodies upon the properties of copper and of its alloys; Effect of a con- |         |       |         |        |        |       |        |        |         |       |         |       |        |       |
| tent of   | lead    |       |         |        |        |       |        |        |         |       |         |       |        | . 132 |
| Effect of   | vario   | ous n | etals   | upon   | copp   | er;   | Influe | ence d | of an   | admi  | xture   | of c  | uprou  | 3     |
| oxide   |         |       |         |        |        |       |        |        |         |       |         |       |        | . 133 |
| Effect of   | sulph   | ur, s | iliciur | n and  | l phos | phor  | us; I  | Iamp   | e's res | earcl | ies reg | gardi | ng the | 3     |
| behav   | ior of  | copp  | er tow  | ards   | admi   | xture | es     |        |         |       |         |       |        | . 134 |

| PA  | GE  |
|---|-----|
| Sources of commercial copper; Detection of foreign bodies in copper 1.  | 35  |
| The most important copper-alloys; Copper-gold alloys 1  | 36  |
| Copper-silver alloys; Alloys of copper with the base metals; Antiquity of   |     |
| bronze; Ancient method of preparing brass   | 37  |
| Copper-zinc alloys; Earliest accounts of the alloy of copper and zinc; Brass,   |     |
| its properties, manufacture and uses; Introduction of the manufacture of  |     |
| brass into Germany and England  | 38  |
| Composition of commercial varieties of brass; Researches regarding the color  |     |
| of copper-zinc alloys   | 39  |
| Physical properties of copper-zinc alloys; Crystalline structure of brass; S.   | 4.0 |
| Kalischer's researches in regard to metals becoming crystalline 1   |     |
| Examination in regard to crystalline structure of sheet-brass and bronze-sheet. 1   | 41  |
| Preparation of very ductile brass; Strength of brass; Change in the mole-<br>cular structure of brass; Melting point of brass | 19  |
| Use of old copper in the manufacture of brass; Effects of foreign metals upon   | 42  |
|   | 10  |
|   | 43  |
| Mallet's table of the properties of copper-zinc alloys; Sheet brass, for the  |     |
| manufacture of sheet and wire   | 44  |
| Brands of zinc suitable for the manufacture of brass; Proportions of copper   |     |
| to zinc for sheet-brass which is to resist the action of acid and alkaline  |     |
| fluids; Brass for cartridge shells; Best evidence of the quality of a brand   |     |
| of copper   | 45  |
| Table showing the composition of various varieties of brass for sheet and   |     |
| wire; Japanese brass (Schin-chiu); Cast brass 1   | .46 |
| Analysis of various kinds of cast brass; Ordinary cast brass (potin jaune,  |     |
| potin gris, sterling metal)   | .47 |
| Fine cast brass; Tough brass for tubes  | 48  |
| Hamilton's metal, mosaic gold, chrysorin; French cast brass for fine castings. 1  | 49  |
| Bristol brass (Prince's metal); Ronia metal; D'Arcet's gilding metals; Mal-   |     |
| leable brass  | 50  |
| Early patents for malleable brass; Malleable brass, Muntz metal, yellow   |     |
| metal, etc.; Yellow metal   | 51  |
| Yellow metal or Muntz metal; Macht's yellow metal; Bobierre's metal . 1   | 52  |
| Aich's metal  | 53  |
| Sterro-metal; Sterro-metal from Rosthorn's factory in Lower Austria; Eng-   |     |
| lish sterro-metal (Gedge's alloy for ship-sheathing)  | 54  |
| Results of tests of sterro-metal; Delta metal   | 55  |
| Table of analyses of Delta metal; Advantages claimed for Delta metal; Ulti-   |     |
| mate tensile strength of Delta metal  | 56  |
| Tobin bronze; Table of analyses of Tobin bronze; Tests of Tobin bronze;   | 00  |
| Deoxidized bronze   | 57  |
| Influence of small variations in the quantitative composition of brass upon its   | 01  |
| physical qualities; Manufacture of brass; Early manufacture of brass . 1  | 58  |
| Manufacture of brass according to the old method with the use of zinciferous  | 50  |
|   | 50  |
| ores  | 55  |

•

xiii

|  |        | PAGE  |
|--|--------|-------|
| Manufacture of brass by fusing the metals together                     |        | . 160 |
| Results of experiments in fusing the metals directly in special fu     | irnace | es;   |
| Construction of furnaces for crucibles                                 | •      | . 161 |
| Description of a furnace for coke                                      |        | . 162 |
| Size of crucibles; Another construction of a brass furnace             |        | . 163 |
| Furnace for heating the moulds for plate-brass                         |        | . 164 |
| Modifications in the arrangement of furnaces for the use of coal .     |        | . 165 |
| Construction of furnaces in which the fusion is effected directly u    | pon t  | the   |
| hearth; Manner in which fusion is effected                             |        | . 166 |
| Casting brass; Casting of ingots                                       |        | . 168 |
| Moulds for casting ingots of brass                                     |        | . 169 |
| Moulds for casting articles of brass; Temperature of the fused brass   | ; Ca   | st-   |
| ing of plate-brass; Use of iron moulds                                 | •      | . 170 |
| Loam moulds; Granite moulds and their preparation                      | •      | . 171 |
| Subsequent treatment of plate-brass                                    |        | . 172 |
| Furnaces for heating sheets ; Reverberatory furnace for wood-firing    |        | . 173 |
| Cleansing or pickling of brass; Operation of pickling or dipping       |        | . 175 |
| Substances used as pickles; Organic substances used as additions       | to t   | the   |
| pickle; Mode of imparting a dull, lustreless surface to the articles   |        | . 176 |
| Subsequent treatment of the pickled articles; Red brass                |        | . 177 |
| Content of copper in red brass; Tombac; Origin of the word tombac      | •      | . 178 |
| Table giving the composition of various kinds of tombac; Berlin a      |        |       |
| lamps and chandeliers: Lyons gold; Color of tombac; Composition        | ition  | of    |
| alloys for candlesticks, inkstands, etc                                | •      | . 179 |
| Manheim gold or similor; Chrysochalk (gold copper); Chrysorin          | •      | . 180 |
| Pinchbeck; Orëide or oroide (French gold)                              | •      | . 181 |
| Special receipt for the preparation of orëide; Talmi or talmi gold .   |        | . 182 |
| Table giving the composition of alloys used in the manufacture of ar   | ticles | of    |
| talmi gold; Tissier's metal  | •      | . 183 |
| Tournay's metal; Platina; Manilla gold; Dutch leaf or Dutch gold       | •      | . 184 |
| Bronze powders   | •      | . 185 |
| Table giving the composition of the alloys for some colors of bronze p | owder  | rs;   |
| English bronze powders; Brocade  | •      | . 187 |
| White metal  | •      | . 188 |
| Birmingham platinum; Other alloys for white buttons; Sorel's alloy     | •      | . 189 |
| Bath metal   | •      | . 190 |
| Guettier's button metal; Ordinary English white metal                  | •      | . 191 |
| Table exhibiting the properties of the alloys of copper and zinc as de | escrib | ed    |
| by the best authorities  |        | . 192 |
| Note on the table by Prof. Robert H. Thurston                          |        | . 196 |

xiv

# CHAPTER VII.

#### COPPER-TIN ALLOYS.

|   | PAGE       |
|---|------------|
| Bronze in general; Definitions of the terms bronze and white metal; Consti-<br>tution of bronze   | -<br>. 199 |
| Ductility of bronze; Application of bronze; Influence of admixtures of foreign  |            |
| bodies upon the properties of bronze; Effect of zinc  | . 200      |
| Influence of an admixture of lead ; Effect of iron  | . 201      |
| Effect of nickel and other metals; Effect of arsenic, sulphur and phosphorus  |            |
| Variations in the color of bronze according to the content of tin; Ductility  |            |
| and hardness of bronzes   | . 203      |
| Deductions from the results of modern researches regarding the strength and   | 1          |
| hardness of bronzes; Molecular change in alloys rich in copper by forging   | . 204      |
| Results of quickly cooling off red-hot bronze in cold water ; How to secur-   |            |
| the greatest strength of bronzes  | . 205      |
| Table exhibiting the density of various copper-tin alloys; Table of melting   | <u>z</u>   |
| points of bronzes   | . 206      |
| Chemical behavior of bronzes towards the oxygen of the atmosphere   | . 207      |
| Preventative against the absorption of oxygen; Phosphorus as a deoxidizing  | ,<br>,     |
| agent; Influence of the construction of the melting furnace upon the los  | <i>,</i>   |
| of metal and the qualities of the castings  | . 208      |
| Behavior of the solidified alloys towards the atmosphere.   | . 209      |
| Melting and casting of bronze   | . 210      |
| Preparation of large quantities of bronze   | . 211      |
| Arrangement of a reverberatory furnace especially adapted for melting no  | t          |
| too large a quantity of bronze  | . 212      |
| Construction of a furnace especially adapted for melting a large quantity o   | f          |
| bronze  | . 213      |
| The different kinds of bronze   | . 214      |
| Bronzes of pre-historic times   | . 215      |
| •   | . 216      |
| Ordnance or gun metal; Historical notice of the use of bronze for casting   |            |
| cannon; Properties demanded of a good gun metal   | . 217      |
| Additions to actual bronze  | . 218      |
| Content of tin in bronze suitable for ordnance; Outline of the operation o  |            |
| melting and casting gun-metal   | . 219      |
| Description of a double furnace in use in the gun-foundry at Spandau .  | . 220      |
| Shaft furnace after the principle of Herbetz's steam-injector furnace .   | . 221      |
| Use of old cannon in casting ordnance   | . 222      |
| Influence of the casting temperature upon the physical properties of ordnance   |            |
| bronze; Moulds used in casting; Steel-bronze  | . 223      |
| Table showing the composition of ordnance bronze of various times and dif   |            |
| ferent countries; Bell metal  | . 224      |
| the boundary point mount in the transferred in the |            |

|   | PAGE       |
|---|------------|
| Ancient use of bells and cymbals; Introduction of actual church bells: Weigh  | t          |
| of some large bells; Principal requisite of good bell-metal   | . 225      |
| Properties of bell-metal; Important features on which the tone of a bell materially depends; Melting and casting of bell metal                        | -<br>. 226 |
| Reason for bells acquiring a disagreeable tone by repeated remelting; Chines  |            |
| tam-tams or gongs   | . 227      |
| Table showing the composition of some bell-metals; Alloys for small clock   |            |
| bells, table bells, sleigh bells, etc   | . 228      |
| Algiers metal (metal d' Alger); Silver bell metal; Bronzes for various purposes   |            |
| Designation of various kinds of bronzes; Medal and coin bronzes .   | . 230      |
| Composition of the baser coin of several countries; Greek and Roman coin  |            |
| bronze; Medal bronze  | . 231      |
| Ormolu (Or moulu); Actual ormolu  | . 232      |
| Bronze for small castings; Gold bronze  | . 233      |
| Bronze to be gilded; Bronze for ship-sheathing; Machine bronze .  | . 234      |
| Alloys for bearings   | . 235      |
| Table of metals for bearings  | . 236      |
| Table of machine metals for various purposes; Bronze for articles exposed to  |            |
| shocks and very great friction; Bronze for valve balls and other constituen   |            |
| parts to which other parts are to be soldered with hard solder; Bronze re   |            |
| sisting the action of the air; Beautiful bronze to be used as a substitute for  |            |
| brass   | . 237      |
| Chinese bronzes   | . 238      |
| Alloys in imitation of the Chinese bronze; Japanese bronzes   | .238       |
| Old Peruvian bronze; Composition of a Turkish bronze basin and of an an   |            |
|   |            |
| tique bronze weapon; Speculum metal   | . 240      |
|   |            |
| for speculum metal according to David Ross  | . 241      |
| Table showing the composition of some alloys used for speculum metal; Com<br>position of the mirror of the Rosse telescope; Alloy for concave mirrors |            |
|   |            |
| Phosphor bronze   | . 242      |
| Reducing action of phosphorus; Discovery of phosphor-bronze   | . 243      |
| Methods of making phosphor bronze   | . 244      |
| Preparation of phosphor-copper and of phosphor-tin  | . 245      |
| Phosphor bronze wire; Properties of correctly prepared phosphor bronze  |            |
| Results of physical tests of phosphor-bronze  | . 246      |
| Variation in the content of phosphorus in bronze; Varieties of phosphor   |            |
| bronze which are considered to answer all requirements  | . 247      |
| Analyses of different kinds of phosphor bronzes; Uses of phosphor bronze  | . 248      |
| Höper's phosphor-bronze wire; Analyses of Höper's phosphor bronze; Phos   |            |
| phor lead bronzes; Phosphor aluminium bronze  | . 249      |
| Silicon bronze; Weiller's alloy; Action of silicon upon copper; Properties o  |            |
| silicon bronze  | . 250      |
| New type of telegraph wire and its use in Europe  | . 251      |
| Composition of silicon telegraph wire and of silicon-bronze telephone wire  | ·          |
| Compositions of silicon-bronze ; Bronze for telephone lines   | 252        |

|                      |            |         |       |        |        |        |        |       |         |       | PAGE  |
|----------------------|------------|---------|-------|--------|--------|--------|--------|-------|---------|-------|-------|
| Results of Dr. Van d | ler Ven's  | researd | ches  | •      |        |        |        |       |         |       | . 253 |
| Statue bronze; Pro   | perties of | good    | stati | lary   | bronz  | ze     |        |       |         |       | .254  |
| Most suitable propor | ctions for | statua  | ry bi | onze   | ; Co   | lor of | ' stat | uary  | bronz   | е     | . 255 |
| Table of a series o  | f alloys o | f diffe | rent  | color  | rs sui | itable | for    | statu | ary b   | ronze | ;     |
| Statue bronze acc    | ording to  | D'Arc   | et; ' | Fable  | e exhi | ibitin | g the  | comp  | oositio | on of | a     |
| few celebrated st    | atues      |         |       |        |        |        |        |       |         |       | . 256 |
| Melting and casting  |            |         |       |        |        |        |        |       |         |       | t     |
| Munich .             |            |         |       |        |        |        |        | ••    |         |       | . 257 |
| Moulds for large ca  | stings     |         | •     |        |        |        |        |       |         |       | . 258 |
| Table of different a | lloys of c | opper   | and   | tin, ş | giving | g son  | ne of  | their | mech    | anica | .1    |
| and physical prop    | oerties    |         |       |        |        |        |        |       |         |       | . 259 |
| Note on the table    |            |         | •     | •      |        |        |        |       |         |       | . 265 |
|                      |            |         |       |        |        |        |        |       |         |       |       |

# CHAPTER VIII.

.

# NICKEL ALLOYS.

| Early knowledge of nickel alloys; Meaning of the Chinese name packfong of         | c     |
|---|-------|
| packtong; Analyses of packfong; Suhl white copper                                 | . 268 |
| Prize for the invention of an alloy as a substitute for silver offered in Prussia |       |
| Historical notice of German silver; Various names under which German              | 1     |
|   | . 269 |
| Nickel-copper alloys; Composition of modern small coins of various coun-          | -     |
| tries; Limited use of nickel-copper alloys; Berthier's alloy                      | . 270 |
| Properties of copper sheet with 1 to 3 per cent. nickel; Experiments of Künze     | 1     |
| and Montefiore-Levi to produce a nickel-copper alloy not subject to liqua-        | -     |
| tion; Nickel-copper-zinc alloys; Properties of German silver                      | . 271 |
| Sources of nickel; Reduction of nickel ores                                       | . 272 |
| Relationship between nickel and cobait and nickel and iron; Addition of iron      | 1     |
| to German silver; Effect of an addition of silver to German silver .              | . 273 |
| Effect of an addition of tin to German silver; Summary of the properties o        | f     |
| nickel alloys; Mechanical manipulation of German silver                           | . 274 |
| Use of nickel alloys for thermo-electric piles; German silver or argentan         | . 275 |
| Composition of alloys used by various factories; Table of analyses of different   | 5     |
| kinds of German silver  | . 276 |
| Effect of additions of various kinds of metals to German silver                   | . 277 |
| Substitutes for German silver; Nickel-bronze; Bismuth-bronze                      | . 278 |
| Manganese-German silver; Aphtit; Arguzoid; Ferro German silver .                  | . 279 |
| Silver-like alloy; Platinoid  | . 280 |
| Manganin; Dienett's German silver; Pirsch's patented German silver;               | ;     |
| Alfenide, argiroide and allied alloys   | . 281 |
| Touca's alloy; Alloy according to Trabuk  | . 282 |
| Table of a number of nickel alloys arranged according to their compositions       |       |
| Copper, zinc and nickel   | 283   |

|  |        |        |        |        | PAGE  |
|--|--------|--------|--------|--------|-------|
| Copper, zinc, nickel, lead; Copper, zinc, nickel, iron |        |        |        |        | . 284 |
| Copper, tin, nickel, with or without zinc; Copper,     | nick   | ael, s | silver | (Ruo   | olz   |
| alloys)  |        |        |        |        | . 285 |
| Other alloys   | •      |        |        | •      | . 286 |
| Manufacture of German silver on a large scale; Impo    | rtano  | ee of  | the I  | ourity | of    |
| the metals used ; Different methods of manufacturin    | g Gc   | rman   | silve  | er; G  | er-   |
| man process  |        |        |        |        |       |
| Casting the alloy                                      |        |        |        | •      | . 288 |
| Moulds used in casting plates; Principal difficulty in | cast   | ing p  | lates  | of G   | er-   |
| man silver   |        |        |        |        |       |
| English process; Mode of melting the metals together   |        |        |        |        |       |
| Manner of ascertaining how the alloy will act in ca    | asting | g; Ca  | asting | g of t | he    |
| plates ; Solder for German silver                      |        |        | •      |        | . 291 |
| Uses of German silver; Manufacture of German silver    | sbee   | t.     |        |        | . 292 |
| Heating furnace for direct firing; Muffle furnace .    |        |        | •      | •      | . 293 |
| Nickel steel; M. Henri Schneider's patents             |        |        |        |        | . 294 |
| Specifications of the first patent                     |        |        |        |        | . 295 |
| Marbeau's nickelo-spiegel; Riley on nickel steel       |        |        |        |        | . 297 |
| Tests of nickel steel made by Carnegie, Phipps & Co.   | for t  | he U   | . S. N | lavy I | )e-   |
| partment; Conductivity of nickel steel                 |        |        |        |        | . 298 |

# CHAPTER IX.

# ALLOYS OF TIN, W1TH LITTLE COPPER, AND ADDITIONS OF ANTIMONY, ETC.

| Composition of tin alloys most frequently used; Effect of the different metals  |             |
|---|-------------|
| upon the properties of the tin  | 29 <b>9</b> |
| Most important alloys of tin ; White metals ; Bearing metals ; Impracticability |             |
| of combining many metals into one and the same alloy                            | 300         |
| Principal use of the so-called white metals; Red-brass bearings; Properties     |             |
| and advantages of white metal bearings  | 301         |
| On what the degree of hardness of white metal bearings depends                  | 302         |
| Table of white metals for bearings; Babbit's anti-attrition metal               | 303         |
| Addition of aluminium to Babbit metal; Babbit metal patented by A. W.           |             |
| Cadman; Kingston's metal  | 304         |
| Fenton's alloy for axle boxes, for locomotives and wagons; Dewrance's patent    |             |
| bearing for locomotives; Alloy for anti-friction brasses; Alloy for metal       |             |
| stopcocks which deposits no verdigris; English white metal; Composition         |             |
| of white metal for machines; Hoyle's patent alloy for pivot bearings;           |             |
| Alloys for white metal bearings used in the factory of H. Roose, of Breslau     | 305         |
| C. B. Dudley's investigations of bearing metals; Camelia metal; Anti-friction   |             |
| metal; White metal; Metal for lining car brasses; Salgee anti-friction          |             |
| metal; Graphite bearing metal; Carbon bronze; Magnolia metal; Ameri-            |             |

# xviii

PAGE

# CHAPTER X.

#### ALLOYS OF COPPER WITH OTHER METALS.

| Copper-arsenic alloys; Various names under which these alloys were known; |    |
|---|----|
| White, brittle, lustrous alloy capable of taking a high polish 3          | 08 |
| Copper-lead alloys; Copper-iron alloys; Composition of a statue of Buddha |    |
| from Hindostan  | 09 |
| Copper-steel; Patent of M. Henri Schneider                                | 10 |
| Possible uses of copper-steel; Alloys of copper and much zinc 3           | 11 |
| Table of cheaper bearing metals; Dunlevie & Jones' bearing metal; Alloys  |    |
| which can be filed; Cupro-manganese                                       | 12 |
| Preparation of cupro-manganese  | 13 |
| Valenciennes' method of preparing cupro-manganese; Parkes' method; Uses   |    |
| of cupro-manganese  | 14 |
| Manganese-bronze; Properties of manganese bronze; Experiments of Monte-   |    |
| fiore-Levi and Künzel with manganese bronze                               | 15 |
| Biermann's investigations; Manganese-brass; Copper-tungsten alloys 3      | 16 |
| Copper-cobalt alloys; Cobalt bronze; Copper-magnesium alloys 3            | 17 |
| Copper-antimony alloys; Mira metal  | 18 |

#### CHAPTER XI.

#### ALUMINIUM ALLOYS.

| Alloying power of aluminium; Practical production of aluminium alloys .     | 319 |
|---|-----|
| Properties of aluminium alloys  | 320 |
| Aluminium iron alloys; Aluminium steel; Mode of applying the aluminium.     | 321 |
| J. W. Langley on the practice in the United States; Aluminium-copper alloys | 322 |
| Aluminium bronze; Properties of aluminium bronze                            | 323 |
| Melting point of aluminium bronze; Importance of the purity of the metals   |     |
| used in the preparation of aluminium-bronze                                 | 324 |
| Directions of the "Magnesium and Aluminium Fabrik of Hemelingen" for        |     |
| making aluminium bronzes  | 325 |
| Dilution of a high per cent. bronze to a lower one; Casting of aluminium    |     |
| bronze  | 326 |
| Thomas D. West on casting aluminium brouze and other strong metals          | 328 |
| Forging of aluminium-bronze   | 331 |

xix

| PAG   | Æ |
|---|---|
| Examples of rolling given by the "Cowles Electric Smelting and Aluminium<br>Company"  | 2 |
| Table of results obtained at the South Boston Iron Works, with pieces of the          | - |
|   |   |
| Cowles Company alloys; Table of tests made at the Washington Navy                     |   |
| Yard; Mode of preparing aluminium-copper alloys according to Thurston. 33             |   |
| Aluminium-brass; Action of aluminium upon brass                                       |   |
| Uses of aluminium-brass   | 5 |
| Table of results of tests made at the Cowles Bros. works in Lockport; Richards'       |   |
| bronze; Aluminium-nickel copper alloys  | 6 |
| Alloys manufactured by the Webster Crown Metal Company                                | 7 |
| Lechesne  | 9 |
| Alloys recommended by G. F. Andrews; Sun-bronze; Metalline; Nickel-                   |   |
| aluminium; Rosine; Aluminium alloy for dentists' fillings                             | 0 |
| Alloy for type-metal; Aluminium-bronze alloy; Hercules metal; Alloy of                |   |
| aluminium and chromium; Alloy of aluminium and tin; Brazing alumin-                   |   |
| ium bronze; Soldering aluminium bronze  | 1 |
| / 0   | 1 |
| Mierzinski on soldering aluminium bronze; Solders for aluminium bronze for            | ~ |
| jewelry; Schlosser's directions for preparing solder for aluminium bronze. 34         |   |
| Soldering aluminium; Mourey's aluminium solders                                       | 3 |
| Bourbouze's aluminium solder; Frishmuth's aluminium solders; M. H. Lan-               |   |
| con's method of preparing aluminium solder  | 4 |
| Solder for fine wire and thin articles; Solder for large pieces of aluminium          |   |
| and aluminium sheets; Schlosser's solder for aluminium; Platinum-alumin-              |   |
| ium solder; Gold aluminium solder; O. M. Knowles' solder                              | 5 |
| C. Sauer's solder ; Chloride of silver for soldering aluminium ; Richards' solder. 34 |   |
| ,   |   |

# CHAPTER XII.

### TIN ALLOYS.

| Alloys of tin and lead; Densities of alloys of tin and lead        |         | . 349 |
|--|---------|-------|
| Use and properties of alloys of tin and lead; Fahlun brilliants .  |         | . 350 |
| Table of melting points of alloys of tin and lead; Baths used by c | utlers  | and   |
| others in tempering and heating steel articles                     |         | . 351 |
| Britannia metal; Regulations of the Pewterers' Company of Engla    | und; Pr | rop.  |
| erties of Britannia metal  |         | . 352 |
| Influence of other metals on Britannia metal                       |         | . 353 |
| Table showing the composition of several varieties of Britannia r  | netal;  | Dr.   |
| Karmarsch's investigations of Britannia metal                      | ,       | . 354 |
| Preparation of Britannia metal; Shaping and casting Britannia me   | tal; Pr | rep_  |
| aration of the moulds for casting                                  |         | . 355 |
| Polishing Britannia metal articles                                 |         | . 357 |
| Biddery metal  |         | . 358 |
| Ashberry metal; Minofor metal; English metal                       |         | . 359 |

# CHAPTER XIII.

# LEAD ALLOYS.

|  |          | PAGE |
|--|----------|------|
| Importance of some lead alloys; Effect of other metals upon lead .       |          | 360  |
| Type metal   |          | 361  |
| Table of some alloys suitable for casting type; French and English type- |          | 362  |
| Ledebur on type-metal; Erhart's type-metal; Manufacture of type          |          | 363  |
| Plates for engraving music; Alloy for keys of flutes and similar parts   | of in-   |      |
| struments; Shot metal; Mixture of metals used; Precautions to be ob      | served   |      |
| in preparing the alloy   |          | 364  |
| Preparation of the alloy   |          | 365  |
| Proportions of arsenic to lead used in England and in France; Effect     | t of the |      |
| arsenic; Use of the other metals besides lead and arsenic                |          | 366  |
| Casting of shot; Invention of Watts; Shot-towers and shot-wells; Wa      | ater for |      |
| the reception of the shot  |          | 367  |
| Formation of shot by centrifugal power; Invention of David Smith         | for the  |      |
| manufacture of drop-shot   |          | 368  |
| Sorting the shot   |          | 370  |
| Preparation of large shot; Alloys of lead and iron; Utilization of the   | affinity |      |
| of lead and iron   |          | 371  |
| Alloys of lead and other metals  |          | 372  |
|  |          |      |

# CHAPTER XIV.

#### CADMIUM ALLOYS.

| Properties of cadmium alloys; General composition of cadmium alloys 3         | 173 |
|---|-----|
| Lipowitz's alloy; Cadmium alloy (melting point 170° F.)                       | 74  |
| Cadmium alloy (melting point 167° F.); Cadmium alloys (melting point 203°     |     |
| F.); Very fusible alloy; Wood's alloy or metal; Cadmium alloy (melting        |     |
| point 179.5° F.); Cadmium alloy (melting point 300° F.); Cliché metal . 3     | 75  |
| Hauer's researches on the melting points of fusible alloys; Stability of cad- |     |
| mium alloys   | 76  |

# CHAPTER XV.

### BISMUTH ALLOYS.

| Behavior of bismuth towards other useful metals; Alloys of bism | nuth | and   |
|---|------|-------|
| copper; Alloys of bismuth and zinc; Alloys of bismuth and tin.  |      | . 378 |
| Alloys of bismuth and lead; Alloys of bismuth and iron          |      | . 379 |

|   | PAGE  |
|---|-------|
| Alloys of bismuth with antimony; Cliché metal; Alloy for filling out defe   | et-   |
| ive places in metallic castings; Alloys of bismuth, tin and lead; Newto     |       |
| metal; Bose's alloys; Safety-plates for steam boilers                       | . 380 |
| Composition of some alloys which are said to melt at a certain pressure     | of    |
| steam; Onion's fusible alloy; D'Arcet's fusible alloys                      | . 381 |
| Bismuth alloys for delicate castings; Bismuth alloy for cementing glass     | . 382 |
| Parkes and Martin's table of fusing points of the fusible combinations of t | ois-  |
| muth, lead and tin; Baths for tempering small steel tools and their use     | , 383 |
| Alloys of lead and bismuth and of bismuth and tin for the same purpose; N   | ew    |
| fusible alloy   | . 384 |

# CHAPTER XVI.

# SILVER ALLOYS.

| Various uses of silver alloys; Alloys of silver and aluminium .      |          | . 385   |
|--|----------|---------|
| Tiers argent (one-third silver); Alloys of silver and zinc           |          | . 386   |
| Composition for coins; Alloys of silver, copper and nickel; Argent   | -Ruolz   | . 387   |
| Alloys containing silver and nickel patented by C. D. Abel           |          | . 388   |
| Purification of nickel; Treatment of nickel-speiss                   |          | . 389   |
| Preparation of Abel's alloys   |          | . 390   |
| Alloys of silver, copper, nickel and zinc                            |          | . 391   |
| Alloys for Swiss fractional coins; Mousset's silver alloy; Alloys of | silver a | nd      |
| arsenic; Alloys of silver, copper, and cadmium                       |          | . 392   |
| Alloys of silver with various metals; Alloys of silver and copper.   |          | . 393   |
| Liquation of alloys of copper and silver; Silver formerly used in    | coinag   | re ;    |
| Present determination of the fineness of coins                       |          | . 394   |
| Table showing the composition of the silver coins of various countri | es: Fir  | ne-     |
| ness of silver used in the manufacture of silverware                 | · ·      | . 395   |
| Casting of silver; Blanching; Remarkable series of alloys of the .   | Japanes  | se;     |
| Shakudo  | -        | . 396   |
| Shibu-ichi, with typical analyses                                    |          | . 397   |
| Pickling solution used by the Japanese; The antimony of the Jap      |          |         |
| metal workers; Variety of copper called "kuromi"                     |          |         |
| Action of the pickling solutions; Production of various Japanes      |          |         |
| Moku-me (wood grain); Miyu-nagashi (marbled)                         | v        | · · · · |
| Alloys resembling silver; Warne's metal; Minargent; A beauti         |          |         |
| alloy closely resembling silver                                      |          | . 400   |
| Delalot's alloy; Tournu-Leonard's alloy; Clark's patent alloy        |          |         |
| Baudoin's alloy  |          | . 401   |
|  | •        |         |

xxii

#### GOLD ALLOYS.

| PAGE  |
|---|
| Early use of gold dust as the principal medium of exchange, the instrument    |
| of association; Sacred value placed on gold by the Egyptians; Inutility of    |
| the majority of gold alloys   |
| Mutual affinity of gold and copper; Combinations of gold and silver; Modifi-  |
| cations of the color of gold; Various colors of gold; Behavior of lead        |
| towards gold ,  |
| Alloys of arsenic or antimony and gold; Alloys of gold and palladium; Alloy   |
| of aluminium and gold; Nürnberg gold; Action of cadmium on an alloy           |
| of gold and silver ,  |
| Preparation of gold alloys; Manufacture of gold articles; Casting gold for    |
| coinage; Casting ingots for the preparation of gold plate; Melting the        |
| metals constituting the alloys ,  |
| Furnace used by manufacturers of gold-ware; Preparation of granulated         |
| gold; Production of very tough gold; Remelting scrap gold 408                 |
| Legally fixed standards for gold alloys; Conversion of carats and grains into |
| thousandths ,   |
| Use of gold alloys ; Standard gold ; Remedy allowed by English law for        |
| abrasion or loss by wear; Table showing the fineness of gold coins of var-    |
| ious countries  |
| Gold alloys for the manufacture of jewelry; Legally fixed standards for gold  |
| jewelry; Table of gold alloys legally fixed by the various governments . 411  |
| Gold alloys which can be legally used in various countries; Pforzheim gold-   |
| ware; Table showing the proportions of various metals incorporated in         |
| the gold alloys used by jewelers  |
| Colored gold; Table showing the composition of the alloys most frequently     |
| used, with their specific colors  |
| Preparation of alloys of gold by the galvanic process; Coloring finished gold |
| articles  |

# CHAPTER XVIII.

#### ALLOYS OF PLATINUM AND PLATINUM METALS.

| Properties of platinum alloys; Composition of platinum occurring in | n nature  | ;     |
|---|-----------|-------|
| Furnace for melting platinum  |           | . 415 |
| Preparation of platinum alloys on a small scale                     |           | . 416 |
| Alloys of platinum and iridium; Alloys of platinum and gold .       |           | . 417 |
| Platinum-gold alloys for dental purposes; Alloys of platinum an     | nd silver | ;     |
| Platine au titre ; Alloys of platinum, gold, silver and palladium   |           | 418   |

|  | P.        | AGE |
|--|-----------|-----|
| Platinor; Platinum bronze ,  | •         | 419 |
| Alloys of platinum with the base metals; Alloys with iron; Properties in     | <b>m-</b> |     |
| parted to steel by an addition of platinum                                   |           | 420 |
| Alloys of platinum and copper; Golden-yellow alloys of platinum and copp     | per       | 421 |
| Cooper's gold ; Alloys suitable for ornaments ; Cooper's investigations of t | he        |     |
| properties of platinum alloys  |           | 422 |
| Cooper's mirror-metal; Cooper's pen-metal; Palladium alloys; Alloys          | of        |     |
| palladium and silver   |           | 423 |
| Palladium bearing metal; Palladium alloys; Alloys of platinum and iridiu     | m;        |     |
| Rhodium and iridium steel; Alloy of iridium with osmium; Alloys              | for       |     |
| watch manufacturers  |           | 425 |
| Phosphor-iridium, and Mr. John Holland's process of preparing it             |           | 425 |

# CHAPTER XIX.

# ALLOYS OF MERCURY AND OTHER METALS, OR AMALGAMS.

| Properties of mercury; Amalgams as a means of studying the behavior   | of th  | e   |                  |
|---|--------|-----|------------------|
| metals towards each other   |        | . 4 | 427              |
| Affinity of metals for mercury; Gold amalgam                          |        | . 4 | 428              |
| Preparation of an amalgam suitable for fire-gilding                   |        | . 4 | 129              |
| Amalgam of silver and its preparation                                 |        | . 4 | 430              |
| Fire-gilding and fire-silvering; Amalgamating water                   |        | . 4 | 431              |
| Amalgams of the platinum metals; Amalgam of copper                    |        | . 4 | 432              |
| Peculiar property of amalgam of copper; Preparation of amalgam of co  | pper   | . 4 | 33               |
| Solder for low temperatures; Vienna metallic cement; Dronier's ma     | lleabl | e   |                  |
| bronze; Amalgam of tin  |        | . 4 | 134              |
| Amalgam of tin for filling teeth; Amalgam for mirrors and looking gla | sses   | . 4 | 435·             |
| Disadvantages of this method of silvering; Amalgam for electric mac   | hines  | ;   |                  |
| Amalgam for tinning   |        | . 4 | 436              |
| Amalgam of zinc; Amalgam of cadmium                                   |        | . 4 | 137              |
| Amalgams for filling teeth; Evans' metallic cement                    |        | . 4 | 138              |
| Amalgams of the "fusible alloys"; Amalgam of Lipowitz's metal; P      | roduc  | -   |                  |
| tion of impressions of objects of natural history; Manufacture of     | sma    | 11  |                  |
| statuettes  |        | . 4 | 439 <sup>.</sup> |
| Amalgam of iron   |        | . 4 | 140              |
| Amalgam of bismuth; Amalgam for silvering glass globes                |        | . 4 | 441              |
| Amalgam of bismuth for anatomical preparations; Amalgam of sodiur     |        | . 4 | 442              |
| Mackenzie's amalgam ; Other amalgams                                  |        | . 4 | 143              |

# xxiv

•

# CHAPTER XX.

#### MISCELLANEOUS ALLOYS.

| PAG  | E |
|--|---|
| Mixture especially adapted for serving as a protective cover in remelting me-  |   |
| tallic alloys; Alloy for spoons; Alloy resembling German silver; Alloy re-   |   |
| sembling silver; Non-oxidizable alloy; Calin; Alloy for moulds for pressed   |   |
| glass  | 4 |
| New method of preparing alloys; Alloys of indium and gallium; Alloys of  |   |
| iridium and gallium  | 5 |
| Steel composition; Malleable ferro-cobalt and ferro-nickel   | 8 |
| Bronze which resists acids; Zinc-iron; An alloy which expands on cooling;  |   |
| Spence's metal   | 7 |
| Lutecine or Paris metal; Alloys for small patterus in foundries  | 3 |
| Alloys for calico-printing rollers; Composition of English roller material;  |   |
| Analysis by J. Dépierre and P. Spiral of the composition of scrapers;  |   |
| Tables showing the physical properties and chemical composition of calico-   |   |
| printing rollers   | 9 |
| Alloy for silvering; Operation of silvering  | 1 |
| Robertson alloy for filling teeth; American sleigh bells 45.   | 2 |
| Alloy for casting small articles; Arnold's iron alloy; Lemarquand's non-   |   |
| oxidizable alloy; Marlie's non-oxidizable alloy; Alloy for sign-plates . 45.   | 3 |
| Durano metal   | 4 |
| Alloy for casting small articles; Arnold's iron alloy; Lemarquand's non-<br>oxidizable alloy; Marlie's non-oxidizable alloy; Alloy for sign-plates . 453 | 3 |

# CHAPTER XXI.

#### SOLDERS AND SOLDERING.

| Conditions to be observed in soldering; Autogenous soldering; Binding the work in soldering       456         Binding wire; Handling the work in soldering; Soft solders; Tin as a solder.       457         Table of soft solders; Solders for plumber's work, for lead and tin pipes, Britannia metal, etc.; Plumbers' sealed solder       458         Preparation of soft solder; Judging the quality of a solder; Bismuth solder.       459         Hard solders; Brass solder       460         Preparation of brass solders       461         Table showing the composition of various kinds of brass solder       462         Prechtl's brass solders       463         Brass solders according to Karmarsch; Argentan solders       464         Readily fusible argentan solder; Less fusible argentan solder       465         Solders containing precions metals; Ordinary hard silver solder       466 | Definition of soldering ; Varieties of solders ; Metals to be united 1 | by sole | lering. | 455 |
|---|--|---------|---------|-----|
| Binding wire; Handling the work in soldering; Soft solders; Tin as a solder. 457         Table of soft solders; Solders for plumber's work, for lead and tin pipes,         Britannia metal, etc.; Plumbers' sealed solder  | Conditions to be observed in soldering; Autogenous soldering;          | Bindi   | ng the  |     |
| Binding wire; Handling the work in soldering; Soft solders; Tin as a solder. 457         Table of soft solders; Solders for plumber's work, for lead and tin pipes,         Britannia metal, etc.; Plumbers' sealed solder  | work in soldering  |         |         | 456 |
| Britannia metal, etc.; Plumbers' sealed solder       458         Preparation of soft solder; Judging the quality of a solder; Bismuth solder. 459         Hard solders; Brass solder       460         Preparation of brass solders       461         Table showing the composition of various kinds of brass solder       462         Prechtl's brass solders       463         Brass solders according to Karmarsch; Argentan solders       464         Readily fusible argentan solder; Less fusible argentan solder       465   |  |         |         | 457 |
| Preparation of solder; Judging the quality of a solder; Bismuth solder. 459Hard solders; Brass solder   | Table of soft solders; Solders for plumber's work, for lead an         | nd tin  | pipes,  |     |
| Hard solders; Brass solder  | Britannia metal, etc.; Plumbers' sealed solder                         |         |         | 458 |
| Preparation of brass solders  | Preparation of soft solder; Judging the quality of a solder; Bis       | muth    | solder. | 459 |
| Preparation of brass solders  | Hard solders; Brass solder   |         |         | 460 |
| Table showing the composition of various kinds of brass solder <td< td=""><td>Preparation of brass solders</td><td></td><td></td><td>461</td></td<>   | Preparation of brass solders   |         |         | 461 |
| Brass solders according to Karmarsch; Argentan solders  |  |         |         | 462 |
| Brass solders according to Karmarsch; Argentan solders  | Prechtl's brass solders  |         |         | 463 |
|   |  |         |         | 464 |
| Solders containing precious metals; Ordinary hard silver solder 466   | Readily fusible argentan solder; Less fusible argentan solder          |         |         | 465 |
|   | Solders containing precions metals; Ordinary hard silver solder        |         |         | 466 |

|  |          | PAGE  |
|--|----------|-------|
| Brass silver solder; Soft silver solder; Hard silver solder; Soft silver | er solde | ers;  |
| Silver solder for cast iron; Silver solder for steel                     |          | . 467 |
| Gold solders; Table of gold solders                                      |          | . 468 |
| Solder for enameled work; Fine gold solder                               |          | . 469 |
| Aluminium gold solder; Treatment of the various solders in sold          | ering a  | and   |
| soldering fluids; Substances used for removing oxide, grease, e          | etc.; Ac | ids   |
| used for pickling  |          | . 470 |
| Soldering fluid and its preparation; Soldering fat                       |          | . 471 |
| Fluxes used in hard soldering ; Hard soldering fluid ; Use of quartz     | sand a   | ıs a  |
| flux   |          | . 472 |
| Soldering copper and brass   |          | . 473 |
| Table giving the composition and melting points of solders, and flux     | ces use  | 1.474 |
| Soldering jewelry; Soldering pan, described and illustrated .            |          | . 475 |

# CHAPTER XXII.

# DETERMINATION OF THE CONSTITUENTS OF METALLIC ALLOYS, OF THE IMPURITIES OF THE TECHNICALLY MOST IMPORTANT METALS, ETC.

| Manner of dissolving metals; Characteristics that indicate the presence o      | f     |
|--|-------|
| various metals in the solution   | . 477 |
| Manner of testing for mercury; Precipitation of metallic sulphides; Ap-        | -     |
| paratus for the preparation of sulphuretted hydrogen                           | . 478 |
| Determination of magnesium, and of nickel and cobalt                           | . 480 |
| Determination of iron, chromium, manganese, zinc, alumina, chloride o          | f     |
| silver, chloride of lead and subchloride of mercury                            | . 481 |
| Determination of gold, platinum, antimony, tin, oxide of mercury, bismuth,     | ,     |
| copper, and cadmium  | . 482 |
| Determination of arsenic; Marsh's apparatus for the detection of arsenic, de-  |       |
| scribed and illustrated  | . 483 |
| Testing brass  | . 484 |
| Testing Britannia metal; Testing bronze  | 485   |
| Testing German silver; To test gold-ware                                       | . 486 |
| Resistance of a few metals and alloys to calcium bydrate; To distinguish       |       |
| tin-foil from lead-foil  | 487   |
| To test mercury as to its purity; To test tin; Testing soft solders; To detect |       |
|  | 488   |
| Testing nickel   | 489   |

xxvi

xxvii

# APPENDIX.

# COLORING OF ALLOYS.

| PAGE  |
|---|
| Lacquers used; Graham's table of lacquers   |
| Patina and its production   |
| Patina like deposit upon a statue; Coating articles of brass with a green         |
| patina  |
| Brown patina upon medals; To color copper articles brown; To brown gun-           |
| barrels   |
| New bronze upon French bronze figures   |
| Graham's bronzing liquids; For brass (by simple immersion) 495                    |
| For copper (by simple immersion); For zinc (by simple immersion); To pro-         |
| vide articles of brass or bronze with a very lustrous gray or black coating. 496  |
| Production of iridescent coatings; Pure golden yellow, gray-green and violet      |
| upon small articles of brass; Production of a beautiful gold color upon           |
| articles of brass   |
| Beautiful silver color upon brass; Ebermayer's directions for coloring brass. 498 |
| Coloring of soft solders  |
| Bronzing of copper, bronze-metal and brass; Production of brown bronze            |
| color; Red-brown or copper brown upon copper                                      |
| Green bronze color  |

## RECOVERY OF WASTE METALS.

| Recovery of gold and silver from sweepings and from wash water in gold        |     |
|---|-----|
| workers' shops  | 501 |
| Recovery of gold from coloring baths; Recovery of gold from auriferous fluids |     |
| Recovery of gold from old cyanide solutions                                   | 502 |
| Recovery of gold by the wet process; Separating silver                        | 503 |
| Recovery of silver from old cyanide solutions; Recovery of silver by the well |     |
| method; Utilization of nickel waste   | 504 |
| Recovery of copper; To separate silver from copper                            | 505 |
| Recovery of tin from tin plate waste; Another method; To separate lead from   |     |
| zinc; Recovery of brass from a mixture of iron and brass turnings .           | 506 |
| Index   | 507 |



# THE METALLIC ALLOYS.

# CHAPTER I.

## INTRODUCTION.

A CHEMICAL examination of a technically prepared metal shows in most cases the presence of smaller or larger quantities of one or more foreign metals. Thus, in commercial iron are nearly always found : manganese, copper, and frequently cobalt and nickel; in commercial copper : iron, lead, silver, gold, nickel, antimony and other metals; in zinc : iron, arsenic, etc. But the presence of these foreign metals can with certainty be established only by chemical analysis; they cannot be recognized as independent bodies by the eye, nor is it possible to separate them by purely mechanical means.

These facts indicate a quite strong endeavor of the metals to combine with one another; and a combination of two or more metals in such a manner that the separate metals in the combination can no longer be distinguished is called an *alloy*. However, when mercury is one of the metals entering into combination, the result, as a rule, is not termed an alloy, but an *amalgam*.

By alloying a metal with one or more other metals its properties are changed in a remarkable manner; the fusing point may be lowered, the hardness and strength increased,

#### THE METALLIC ALLOYS.

etc. Hence, by properly alloying a metal its properties may be so affected as to render it more suitable for the purpose for which it is to be used; injurious properties may be decreased and desirable ones produced. This is the reason why gold, silver, copper, lead, tin, and other metals are actually more rarely worked in a pure, than in an alloyed state.

The earliest historical data in reference to the development of the art of preparing, so to say, new metals by melting together several metals are very meagre, and though it appears from several passages in sacred as well as profane history that no metallic compound was in more general use with the ancients than brass, the mode of its manufacture is left in obscurity by the historiographers of subsequent ages. Pliny says that a flourishing trade in brass was carried on in Rome shortly after the founding of that city, and that Numa, the immediate successor of Romulus, formed all the workers in this alloy into a kind of community.

The Greeks possessed considerable knowledge in the art of mixing metals, and knew how to prepare alloys with special properties which rendered them suitable for particular purposes. They understood, for instance, the preparation of alloys which were especially hard, or well adapted for casting. The oldest alloys we know of always contain copper, which is, no doubt, due to the fact that this metal occurs native in many places, and is also readily reduced from its ores. Next to alloys containing copper, we find those of the noble metals —silver and gold—with a base metal, generally copper.

It is not difficult to explain why the noble metals were alloyed in early times with other metals. On the one hand, these metals were much more expensive than at the present time, and, being subject to considerable wear on account of

#### INTRODUCTION.

their softness, it was but natural that some one, recognizing the great similarity between the heavy metals as regards ductility, weight, and lustre, should have instituted experiments in order to see how these metals would behave towards each other when melted together. Experience then showed that by melting together, for instance, a certain quantity of silver with copper, the properties of silver, especially its white color, were retained, while the hardness and power of resistance of the alloy were considerably increased.

There can scarcely be any doubt that the alloys of copper with tin, generally called bronze, were the earliest mixtures of metals, because zinc, in a metallic state, has only been known at a later period, while tin was known in the earliest historic Next in historical order follow the alloys of the noble times. metals with each other and with copper. Mercury, which occurs free in nature, was also known to the ancients, and its metallic properties recognized by them, as is evident from the name — hydrargyrus (water-silver) — by which it was designated. It is certain that compounds of it, which, at the present time, are known as amalgams, were used by the Greeks and Arabians. From what has been said, it would seem likely that the ancients understood the art of fire-gilding metallic articles with the assistance of gold amalgam; and, in fact, some old statues which had evidently been gilded have been found-the best example of it being the statue of the Roman emperor Marcus Aurelius, which now stands in front of the capitol at Rome.

Up to the commencement of the reign of Charlemagne, when the development of the technical arts commenced in Europe, the only mixtures of metals were the alloys of copper, tin, zinc, silver, and gold, and some amalgams. To pre-

pare other alloys a greater knowledge of chemistry was required than that possessed by the early races of mankind. The development of chemistry was principally due to the Arabs, and especially to those settled in Spain-the Moorswho were well learned in the chemical sciences and in all branches of natural history, and probably well aware of many mixtures of metals still used at the present time. At later periods it was alchemy, the vague hallucination of making gold from lead and other base metals, which prompted men to undertake investigations fruitful of chemical deductions and promotive of a knowledge of the metals. Many an alchemist found in his crucible alloys, which he threw away unsatisfied, because they did not possess the properties of the desired gold, but which at the present time are profitably used. It may be said without exaggeration that modern chemistry would not have reached such a degree of excellence if it were not for the great abundance of facts collected by the alchemist to be marshaled into a science thereafter.

From what has been said, it will be seen that at the time when chemistry as a science did not exist, considerable was known in regard to alloys, and we find that in the middle ages a large number of mixtures of metals were used in the different arts and industries. The preparation of the alloys, however, was always effected in a very crude manner, but little being known about the definite proportions in which the metals had to be melted together in order to obtain alloys of determined properties. The only exception to this were the alloys obtained by the direct melting together of the pure metals, for instance, those prepared from the noble metals and copper. As is well known, everything relating to coinage had reached a considerable degree of excellence in the middle ages,

#### INTRODUCTION.

and the fineness of a mixture of metals which was to be used for coinage could be determined with considerable accuracy.

The art of preparing alloys, however, became only a branch of chemistry when the latter, somewhat more than a century ago, entered the ranks of the sciences. The chemists gradually investigated all the bodies occurring in nature, and showed how from minerals a series of metals could be gained which were not known up to that time. These metals were examined in regard to their intrinsic properties and their behavior towards each other, and it was observed that a great number of their mixtures possessed properties which made them suitable for technical purposes.

Of the sixty-four elementary or simple bodies at present recognized, no less than fifty belong to the class of metals. Several of these are of recent discovery, and are, as yet, imperfectly known. Nevertheless, there is but a small number of them which cannot be used for the preparation of alloys.

Though it may be said that our knowledge of chemistry has advanced so far that at present all metals of importance in the arts and industries are known, our knowledge of the metals themselves cannot be considered complete, as, during the last twenty-five years, several new metals have been discovered which may become of a certain importance in the preparation of alloys. The fact that these metals are very rare at the present time, and that their preparation is connected with enormous expense, is not adverse to this conjecture, since many examples could be enumerated of bodies, for example aluminium, which not many years ago were considered expensive rarities, but are now produced on a large scale, and used for industrial purposes.

From what has been said, the science of metallic alloys

must be considered as a branch of knowledge which, though brought to a high degree of perfection, is by no means complete. It rather opens a wide field for the activity of the chemist, and the invention of a new alloy belongs to the most important and valuable discoveries, since nearly every alloy possesses certain specific properties which make its application to many branches of industry especially valuable.

From the explanation previously given, it is evident that an alloy cannot be a mere mechanical mixture of several metals, and hence there remains only the possibility of its being either a chemical combination or simply a solution of one metal in another, similar to a solution of common salt in water, of ether in alcohol, of sulphur in carbon disulphide, etc.

A chemical combination would seem to be indicated by the development of heat which takes place when certain metals in a fused state are mixed one with the other (aluminium with copper, silver, gold; lead with bismuth, etc.); further by the frequently considerable variations in the physical properties of the alloys from those of their constituents (color, specific gravity, fusing point, power of conducting electricity, etc.); by the crystallizing power of many alloys; and finally by the fact that from alloys in a liquid state, when heated but little above the fusing point, solid crystals of varying composition are not unfrequently separated-Pattinson's desilverizing process of argentiferous lead, whereby from the fused lead, crystals of an alloy poorer in silver may be separated and skimmed off, while the lead richer in silver remains behind in a liquid state. However, it must be remembered that very similar processes also take place in numerous cases with solutions, but with this difference, that

#### INTRODUCTION.

solutions are, as a rule, liquid at the ordinary temperature, while alloys, almost without exception, acquire a fluid form only at a higher temperature. On mixing sulphuric acid with water, development of heat takes place in all cases and with all proportions of weight, without a new hydrate of sulphuric acid being formed every time; the same phenomenon may be observed when absolute alcohol is mixed with water, and in many other mixtures. However, the physical properties of ordinary solutions very frequently vary from those of their constituents in the same manner as we are accustomed to see in many alloys. If common salt is dissolved in water, the specific gravity of the solution is greater, hence the volume smaller, than it should be according to calculation if a mere mechanical mixture had taken place; the same phenomenon being exhibited also with solutions of numerous other salts and liquids, of water with alcohol, with sulphuric acid and many other bodies. On the other hand, it frequently occurs that the specific gravity is less and the volume greater than according to the average calculation, this being the case with most solutions of ammonia in water. While the melting point of sodium chloride (common salt) lies at about 1112° F. and that of pure frozen water at 32° F. solutions of the salt in water solidfy only at temperatures below 32° F. Numerous other solutions show a similar behavior. However, on slowly cooling a common salt solution to below the freezing point, a solidified solution poorer in salt is first separated, while one richer in salt remains temporarily behind in a fluid state; by continuing the cooling a second separation into a solidifying solution poorer in salt and one richer in salt remaining behind takes place, and so on. This process is used in northern climates for the concentration of

the content of the salt in sea water, as well as in working poor brine, and, in fact, closely resembles the above mentioned Pattinson process of enriching the content of silver in lead. In this respect numerous other analogies might be shown; for instance, on solidifying an aqueous solution of alcohol, one poorer in alcohol is first separated, and so on.

From these comparisons it will be seen that the above-mentioned properties of alloys are by no means a certain proof for their character of chemical combinations; nor is their power of crystallizing always a sure sign of chemical union. Although the crystals of alloys occasionally belong to another system of crystallization than the crystals of each respective separate metal, their composition does not always correspond to definite atomic proportions, but frequently moves within Thus gold-tin alloys, with a content of 27 very wide limits. to 43 per cent. of gold, crystallize in the dimetric system without a composition according to atomic proportions being necessary therefor. Antimony-zinc alloys in all proportions of from 30 to 70 per cent. of zinc, yield beautifully-formed rhombic prisms or octahedrons, etc. As is well known, when solutions, fluid at the ordinary temperature, are subjected to freezing, crystals are formed in them, the composition of which is not always dependent upon chemical atomic proportions, but chiefly upon the solidifying temperature, and hence, are nothing but solidified solutions, as, for instance, the common salt solutions in water, previously mentioned.

The property of many metals, already referred to, to alloy with each other in all desired proportions by weight, independent of their chemical atomic weight, shows that at least not every alloy represents a pure chemical combination, but that in most cases a solution of one metal in another, or of one or

more chemical combinations, in the excess of one of the constituent metals must be present. That actual chemical combinations between two or more metals may be formed and remain dissolved in the excess of the metal, scarcely admits of any doubt. The manner of these combinations will depend partly upon the general chemical behavior of the metals to one another, partly upon the proportions by weight in which the metals are present in the alloy, partly upon the aggregate state, and, with alloys in a liquid state, upon the temperature to which they have been heated above their fusing points. It is very probable that by strong overheating above the fusing point a different grouping of the atoms may in some cases be attained than that by slight heating, and that during the tran sition into the solid state a change in the mutual relations may again take place. The time of reciprocal action, the manner of mixing, etc., may also be of influence thereby. This explains partly the frequently observed variations in apparently the same alloys when prepared in a different manner, heated to different temperatures, or kept in a fluid state for a time of varying duration. Hence every alloy may be considered a solution of various metals one in another, in which, according to the different aggregate state and according to the varying high temperature, chemical combinations of the metals among each other may be formed and again disintegrated, however, without the nature of the alloy being conditional upon the presence of such combinations.

As frequently observed in daily life, some bodies liquid at the ordinary temperature, dissolve one in another with perfect ease and in all proportions (water and alcohol, ether and alcohol); others possess this property only to a limited extent (water and ether, each of these fluids dissolving only a limited

quantity of the other); while others again do not dissolve mutually one another, but when mechanically mixed, reseparate on account of their different specific gravities. The same phenomenon may be observed in metals. When mixed in a liquid state, some of them alloy readily and in every proportion; others with more difficulty and to a limited extent, and some scarcely at all. A definite general law for the alloying power of metals towards each other does not exist. Generally speaking, it may be said that metals of similar chemical behavior alloy, as a rule, with greater ease than when great differences exist in this respect.

## CHAPTER II.

## PHYSICAL AND CHEMICAL RELATIONS OF THE METALS.

BEFORE entering upon the description of the manufacture of alloys, it will be necessary to give a general review of the physical and chemical properties of the metals; such knowledge of the elements to be alloyed being required in order to proceed according to a determined plan, as otherwise satisfactory results could only be obtained by a happy accident.

Most of our readers, no doubt, possess this information; but memory might fail some of them, and some essential, though elementary, details may escape others. Nevertheless, a book like this should be complete, and include all the rudiments absolutely necessary for the understanding of the subject, without the trouble of searching for the information in other books.

Chemists divide the elementary bodies into two large groups, viz., the metals and metalloids or non-metals, the latter term being decidedly preferable for the second group, as it definitely expresses the existence of an essential difference between these two groups of elementary bodies. Though chemists do not by any means agree as to which bodies are to be termed metals and which non-metals, it is not difficult for our purposes to give certain distinctive characteristics, so that, as regards the metals to be considered in connection with the manufacture of alloys, a sharp boundary can be drawn between them and the non-metals in the actual sense of the word.

# a. Physical Relations of the Metals.

By the term metal is, as a rule, understood in ordinary life, a body, which, besides high specific gravity, a characteristic color, and especially a characteristic lustre, shows other definite properties. It is, for instance, frequently supposed that all metals possess a high degree of ductility, that they are opaque, fuse only at a high temperature, and on exposure to the air undergo a slow alteration or, as is the case with the socalled noble metals, retain their color under all circumstances.

The properties above named undoubtedly belong to the metals ordinarily understood by that term and chieffy used in the industries. In considering, however, the bodies termed metals from the standpoint of the chemist, we find that many of them, which must unquestionably be included in that group, show properties differing very much from those enumerated above. If we first turn to the ordinary well-known metals, we find them distinguished by a characteristic lustre, termed metallic lustre, this property being even possessed in a very high degree by such metals as appear entirely lustreless in consequence of their chemical properties (*i. e.*, in contact with the air). If a lump of lead be cut across with a knife, the fresh surface shows a beautiful lustre, but will very speedily tarnish by the lead undergoing a rapid alteration on exposure to the air.

Besides high specific gravity and metallic lustre, other general properties are ordinarily ascribed to metals, prominent among which is malleability. It is, however, well known to every one handling metals that they manifest great variations in capacity of extension under the hammer or between rollers. Some of them, like gold and silver, may be obtained in exceedingly thin leaves, while others, like antimony and bismuth,

## PHYSICAL AND CHEMICAL RELATIONS OF THE METALS. 13

appear to be perfectly unmalleable. Similar differences are noticeable in the ductility of the metals; some of them can be drawn out into very fine wire, while others are altogether destitute of ductility.

Even the property of opacity belongs only conditionally to the metals, for gold and silver are translucent in thin plates, the former transmitting green rays and the latter blue rays, though none of the other metals have been obtained in sufficiently thin leaves to allow of the transmission of light.

From what has been said it will be seen that the properties of metals vary very much from those ordinarily ascribed to them, and the same must be said in regard to their fusibility. While some fuse at a temperature below that of boiling water, others melt only at the very highest temperature, and the determination of the exact point is a matter of great difficulty. Certain of them soften before actual fusion occurs, so that they can be hammered or welded into compact masses. There are, however, some points in which all metals to be here discussed agree :

They are distinguished by great weight : lead, iron, gold, and platinum being representatives of those prominent in this respect.

They are, as a rule, very ductile bodies: copper, silver, gold, etc., being representatives of this group. Others, like zinc, antimony, and bismuth, show, however, a high degree of brittleness.

With the exception of mercury, they are all solids at an ordinary temperature and become fluid only at higher temperatures, the degree of heat at which this takes place varying, however, very much.

They are, without exception, excellent conductors of heat

and electricity; that is, they rapidly absorb them, but just as rapidly yield them up again.

These general points quite exhaust the physical properties of metals possessed by them in common. It remains to be remarked that they show considerable differences in regard to specific gravity, ductility, conductivity, etc., which will be referred to in speaking of the special properties of the metals available for alloys.

# b. Chemical Relations of the Metals.

Chemically, the metals are distinguished by their ability to form combinations with the non-metallic elements; the combinations with the oxygen of the air being especially energetic. The affinity of the different metals for oxygen, however, varies greatly, the majority of the metals used in ordinary life combining with it at an ordinary temperature. This phenomenon can be readily observed on the previously-mentioned lump of lead. The fresh surfaces lose their lustre by the lead combining with the oxygen from the air, which gives rise to a coating of oxide. Copper, having less affinity for oxygen, remains bright for some time and then acquires a brown-red coloring, which is also due to the formation of a layer of oxide. Many other metals remain bright at an ordinary temperature, and only lose their characteristic lustre by oxidation taking place at a higher temperature—this last phenomenon being, for instance, observed with tin and antimonial metals which become oxidized by heating. In ordinary language all metals losing their metallic lustre at an ordinary temperature or by heating are termed base metals, while the term noble metals is applied to those which have so little attraction for oxygen that they cannot be induced directly to unite with it even at

## PHYSICAL AND CHEMICAL RELATIONS OF THE METALS. 15

high temperatures. The number of noble metals is very small in comparison with that of the base metals and of those more frequently used; mercury, silver, gold, and platinum only can be actually counted among them.

From what has been said, it will be seen that the metals may be divided according to their behavior towards oxygen, such a division being in fact well supported, as we will have occusion to demonstrate in the course of our explanation.

In a chemical sense, the metals can be further divided with reference to certain physical properties into *heavy* and *light* metals. There is a series of metals whose specific gravity is so small that they float upon water, that of some of them being not greater than ordinarily exhibited by glass. Chemists term such metals light metals, in contradistinction to those which are distinguished by great weightiness.

The properties of the light and heavy metals allow, however, of an easy separation as regards their chemical relations, and, by taking these relations into consideration, the result will be a suitable division of the metals into determined groups which, together with their special properties, will be mentioned.

The metals belonging to the group of light metals have a very small specific gravity, which does not exceed four (the weight of a volume of water being always taken as a unit). These metals find, but a limited application by themselves, most of them having such strong affinity for oxygen as to be very speedily converted into oxide on coming into contact with the air. Only two of them, magnesium and aluminium, form an exception in this respect, and are, therefore, used in the arts and industries, though the former only to a limited extent, According to their occurrence, these metals are

divided into several groups, viz.: alkali metals, metals of the alkaline earths, and metals of the earths proper.

To the alkali metals belong *potassium*, *sodium* and *lithium*, and a few other very rare metals, which have only become known in more modern times. The first two metals named occur generally in the ashes of land and marine plants, but, on account of their great instability, are not generally employed in the industries, they serving only for the preparation of certain seldom-used metals. Lithium is a very widely diffused element, being found in many micas, in feldspar, in the ashes of many plants, and in sea-water; it has also been detected in certain meteorites. It is the lightest solid known, being lighter even than any known liquid.

The metals of the alkaline earths have nearly the same properties as the alkali metals, but their affinity for oxygen, though very considerable, is somewhat less. Chemists include in this group *calcium*, occurring in gypsum, limestone, and many other minerals; *barium*, contained in heavy spar; and *strontium*, the principal naturally-occurring compounds of which are the sulphate, or *coelestin*, and the carbonate, or *strontianite*. Like the alkali metals, the metals of the alkaline earths do not find a direct application in the industries, their great affinity for oxygen rendering such use impossible.

The metals of the earths proper occur in many minerals, and a large number of metals belonging to this group are known, but only two of them—aluminium, occuring in alum, clay, feldspar, and a large number of other minerals, and magnesium, found in dolomite, etc.—have any claim to our attention on the ground of their technical importance. Their affinity for oxygen is not so energetic as that of the other metals of this group, since both can be kept in contact with dry air

## PHYSICAL AND CHEMICAL RELATIONS OF THE METALS. 17

without entering into combination with oxygen, aluminium even retaining its lustre for a comparatively long time.

All light metals have, however, the property of readily decomposing water, the alkali metals and metals of the alkaline earths effecting this at an ordinary temperature. When a piece of potassium is thrown upon water, a vigorous development of hydrogen immediately takes place. The metal melts in consequence of the heat liberated by the chemical process, and the developed hydrogen ignites. The metal combines immediately with the oxygen to potassium oxide, which dissolves in water. After the combustion of the potassium, a colorless globule, consisting of the melted potassium oxide, floats upon the surface of the water. With a peculiar fizzing noise this globule suddenly bursts into pieces, which speedily dissolve in the water to potassium hydroxide.

The metals of the earths proper act less energetically on meeting with water, though they decompose it at a boiling heat; magnesium, for instance, when strongly heated in contact with air, burning with the development of considerable light and heat.

The heavy metals, i. e., those which are chiefly used in ordinary life, can, according to their chemical behavior, be brought into four well-defined groups, the group into which each metal is to be placed depending on its behavior in contact with steam or with water in the presence of an acid. In reference to this we distinguish the following groups :—

1. Metals which decompose water at the ordinary temperature in the presence of an acid, and which possess the further property of decomposing water at a higher temperature (at a red heat). To this group belong iron, zinc, nickel, cobalt, chromium, cadmium, tin, and a few rarer metals.

 $\mathbf{2}$ 

2. Metals which decompose water at the temperature of a red heat, but lack the property of decomposing water in the presence of an acid. Of the more important metals, only antimony and tungsten belong to this group.

3. Metals which are incapable of sensibly decomposing water either at a red heat or in the presence of an acid, and are entirely indifferent towards it at an ordinary temperature. The metals belonging to this group, of which bismuth, lead, copper, and mercury are representatives, possess, however, the property of oxidizing when heated red hot in contact with air.

4. Noble metals are, finally, such as do not combine with oxygen when strongly heated in contact with air, and at a red heat remain entirely indifferent towards water. Silver, gold, and platinum are the most important of the metals belonging to this group.

Besides the metals enumerated in the preceding groups, there are a number of others, which, according to their behavior, belong to one or the other. But, as previously mentioned, these metals are of no technical importance, being on account of their rarity too expensive to be used for industrial purposes. Moreover, we would here remark that among the enumerated metals are some, for instance, cobalt and tungsten, whose application in the industries is very limited, though they can be procured in large quantities. A more extensive use may, however, be found for them in the future, as has been the case with nickel, with which nothing could be done for a long time, but which is now used in large quantities in the preparation of very important alloys.

While certain metals possess the property of considerably hardening other softer and more ductile metals, certain nonmetallic bodies exert a still greater influence upon the properties of a metal. It will, therefore. be necessary briefly to consider these bodies.

Carbon, sulphur, phosphorus, and arsenic are the most prominent of the non-metallic bodies, which are capable of changing to a considerable degree the properties of a metal, and these bodies being much used for that purpose in the industry, we will have to consider their combinations with the metals, though they do not belong to the actual alloys.

The exceedingly great influence exerted by these bodies upon the properties of metals, even if admixed only in very small quantities, is best shown by the behavior of iron.

Pure iron, such as is used for piano strings or good shoe nails, is a metal of great hardness and extraordinary tenacity, which can only be fused at the highest temperature capable of being produced in our furnaces. It contains at the utmost one-half per cent. of foreign substances, consisting of varying quantities of manganese, silicium, and carbon. But iron containing a quantity of foreign substances amounting to  $1\frac{1}{2}$  per cent., of which carbon constitutes the greater portion, shows, however, entirely different properties and is termed *steel*.

As is well known, the properties of steel are quite different from those of iron. It is harder, more elastic, and more tenacious, and fuses somewhat more readily. By still further increasing the carbon in the iron to about three per cent., we have what is known as cast-iron. It is more fusible than steel, but brittle, and cannot be worked under the hammer (it cracks). According to the content of carbon, it shows a gray to nearly white color (gray and white cast-iron) and a crystalline structure.

A content of sulphur or phosphorus exerts a still greater effect upon the properties of iron than one of carbon. Iron,

containing but a few thousandths of sulphur, can only be worked in the heat; if hammered in the "cold" it cracks; it having become what is termed "cold-short," *i. e.*, brittle when cold. With a still smaller content of phosphorus, the iron cannot be worked with the hammer, even at red heat, and at a white heat cracks under the hammer; it having become "red-short" or "hot-short." The admixture of these bodies (carbon, sulphur, and phosphorus) with the metals is frequently an unintentional one, it being due to the nature of the ores used.

Before proceeding with the description of the properties of the alloys and the manner of their manufacture, it will be convenient in order to avoid unnecessary repetition later on to give a short sketch of the special properties of the separate metals. As previously mentioned, some metals can be readily combined according to certain fixed proportions. In such case we have not alloys in the actual sense of the word (*i. e.*, mixtures of metals), but rather chemical combinations.

By a chemical combination is understood the union of two or more simple elements in unalterable proportions or multiples thereof. Each element possesses the property of combining with the other according to a proportion of weight admitting of no variation whatever, and the quantity of weight which enters into the combination, and is capable of so completely invalidating the properties of the other bodies that, so to say, a new body is formed, is termed the atomic or indivisible weight. The names of the most important elements are given in the annexed table, together with their symbols and atomic weights, which express the proportions in which they combine together, or simple multiples of those proportions. The symbols are formed of the first letters of

the Latin names of the elements, a second letter being added when the names of two or more elements begin with the same letter.

Table of elementary bodies with their symbols and atomic weights. NON-METALS.

| Name.              | Sym-<br>bol. | Atomic<br>weight.   | Name.              | Sym-<br>bol.           | Atomic<br>weight. |  |  |  |  |  |  |  |
|--------------------|--------------|---|--------------------|------------------------|-------------------|--|--|--|--|--|--|--|
| Hydrogen           | н            | 1   | Phosphorus         | P                      | 31                |  |  |  |  |  |  |  |
| Chlorine           | CI           | 35.5  | Boron              | Bo                     | 11                |  |  |  |  |  |  |  |
| Oxygen             | Ō            | 16  | Carbon             | C                      | 12                |  |  |  |  |  |  |  |
| Sulphur            |              | 32  | Silicium           | Si                     | 28                |  |  |  |  |  |  |  |
| -                  |              | ME  | TALS.              |                        |                   |  |  |  |  |  |  |  |
| 0 1. (DT /         |              |   |                    | . A                    | 00.4              |  |  |  |  |  |  |  |
| Sodium (Natrium).  |              | $\begin{vmatrix} 23 \\ 20 \\ 20 \\ 20 \\ 20 \\ 20 \\ 20 \\ 20 \\$ | Copper (Cuprum) .  | Cu                     | 63.4              |  |  |  |  |  |  |  |
| Potassium (Kalium) |              | 39.3  | Mercury(Hydrargy-  |                        | 000               |  |  |  |  |  |  |  |
| Calcium            | Ca           | 40  | rum)               | $\mathbf{H}\mathbf{g}$ | 200               |  |  |  |  |  |  |  |
| Magnesium          | Mg           | 24  | Silver (Argentum). | $\operatorname{Ag}$    | 108               |  |  |  |  |  |  |  |
| Aluminium          | Al           | 27.4  | Gold (Aurum)       | Au                     | 196               |  |  |  |  |  |  |  |
| Zinc               | Zn           | 65  | Platinum           | $\mathbf{Pt}$          | 197.5             |  |  |  |  |  |  |  |
| Cadmium            | Cd           | 112   | Antimony(Stibium)  | $\mathbf{Sb}$          | 120               |  |  |  |  |  |  |  |
| Lead (Plumbum) .   | Pb           | 207   | Arsenic            | As                     | 75                |  |  |  |  |  |  |  |
| Iron (Ferrum).     | Fe           | 56  | Bismuth            | Bi                     | 208               |  |  |  |  |  |  |  |
| Chromium           | Cr           | 52.2  | Tin (Stannum)      | Sn                     | 118               |  |  |  |  |  |  |  |
| Manganese          | Mn           | 55  | Tungsten or Wolf-  |                        |                   |  |  |  |  |  |  |  |
| Cobalt.            | Co           | 59  | ram                | W                      | 184               |  |  |  |  |  |  |  |
| Nickel.            | Ni           | 58  |                    |                        |                   |  |  |  |  |  |  |  |
|                    |              |   |                    |                        |                   |  |  |  |  |  |  |  |

# CHAPTER III.

## SPECIAL PROPERTIES OF THE METALS.

a. Alkali-metals.-As previously mentioned, the alkalimetals occur in the ashes of land and marine plants, potassium especially in that of land plants, and sodium in that of marine plants. Both metals can be prepared in large quantities by treating their carbonates-potassium carbonate or sodium carbonate—with charcoal and chalk in iron retorts at a white heat. They are brilliant-white with a high degree of lustre. At an ordinary temperature they are soft and may be easily cut with a knife. They have a very low melting point, potassium melting completely at 144.5° F., and sodium at 207.5° F. Exposed to the air both metals rapidly oxidize, and must, therefore, be preserved under a fluid containing no oxygen (petroleum). In consequence of these properties neither potassium nor sodium can be used in the industries, and serve only for the indirect preparation of some metals. For instance, by a combination of alumina and chlorine with potassium or sodium, the latter, in consequence of their stronger affinity for chlorine, withdraw it from the combination, whereby metallic aluminium is liberated. Several other metals can be prepared in a similar manner.

b. Metals of the alkaline earths.—To this group belong, besides calcium, occurring in limestone, gypsum, and several other minerals, barium and strontium. The affinity of these metals for oxygen is so great, that, like potassium and sodium, they have to be kept under petroleum, and are not used in the form of metals in the industries.

c. Metals of the earths proper.—The most important of this group is aluminium (Al., atomic weight 27.4). It is a white metal very nearly approaching silver in appearance. It melts at a red heat, about 1300° F., but will not vaporize. It changes very little at the ordinary temperature, or even when moderately heated, but if heated in a stream of oxygen it burns brightly. Nitric acid does not affect aluminium, sulphuric acid only dissolves it on boiling, while it is readily soluble in hydrochloric acid. But the action of these acids is greatly modified by the purity of the metal and also by the mechanical conditions under which the metal has been prepared, hammered aluminium being least attacked, rolled metal next, and then the drawn metal, while cast metal is much more easily attacked than either. Caustic alkalies in solution readily attack aluminium; in ammonia it is turned gray, but does not lose strength or weight. Chlorine, bromine, iodine and fluorine attack aluminium and corrode it. It is, however, not affected by sulphuretted hydrogen or other sulphur vapors.

The specific heat of aluminium is, according to Richards, 0.2270, water being 1.0000, that is, the same quantity of heat that would raise a mass of aluminium 0.2270 of a degree C., would raise the same mass of water 1.0000 full degree C.

The conductivity of heat, taking silver as 100, is 38 for unannealed wire of 98.52 per cent. aluminium, and 38.90 in the same wire annealed. The following table enables us to compare its conductivity with that of other metals :

 $\overline{23}$ 

| Silver, 100.                | Tin, 14.5.     |
|-----------------------------|----------------|
| Copper, 73.6.               | Iron, 11.9.    |
| Gold, 53.2.                 | Steel, 11.6.   |
| Annealed aluminium, 38.9.   | Platinum, 8.6. |
| Unannealed aluminium, 38.0. | Bismuth, 1.8.  |

The *electric conductivity* of aluminium, as compared with copper, has been determined by Mr. C. K. McGee, of the University of Michigan. He found that in an aluminium unannealed wire 0.0325 inch in diameter the electrical resistance was 0.05749 "legal ohms" of one yard, while that of pure copper wire of same diameter was only 0.03150; temperature  $57^{\circ}$  F. In the annealed aluminium wire of same dimensions it was 0.05484. The aluminium was 98.52 per cent. pure. Pure aluminium shows no polarity. An ingot of aluminium containing 1.5 per cent. iron showed a very faint polarity; with two per cent. iron the polarity was distinct and very decidedly marked.

Aluminium has become important only within a few years past. Forty years ago it was as much a chemical curiosity as any one of the rare metals is to-day. Through the efforts of H. St. Claire Deville it first acquired a commercial character, and its extraction was transferred from the sphere of laboratory experiment to become a metallurgical process.

Aluminium is the most widely distributed metal on earth. It is never found in the metallic state, but always combined with oxygen, and in this form,  $Al_2O_3$ , is the basis of many of the commonest rocks and the chief constituent of most clays. It is found in porphyries, igneous rocks, and in connection with quartz in granite, gneiss, mica, schist, syenite, and some sandstones, while sapphire and ruby consist exclusively of it.

A very large per cent. of aluminium-bearing rocks contain

#### SPECIAL PROPERTIES OF THE METALS.

over sixty per cent. of aluminium, while a large number contain over eighty and nearly ninety per cent. of the oxide. These minerals are widely distributed both in this country and Europe, but from reasons partly of a commercial nature, the deposits of bauxite at Baux, near Arles, France, and in Georgia, Alabama and Arkansas in the United States, the English and Irish clays and the cryolite from Evigtok (Greenland), and from Norway, are the most familiar as aluminiumproducing ores. The utility of cryolite and bauxite was early discovered, and upon the use of one or both of these minerals, most of the early and many later methods depend.

The industrial preparation of the pure metal was formerly effected by heating the double chloride of aluminium and sodium, or the native double fluoride or cryolite with sodium. A mixture of 10 parts of the double chloride, 5 parts of fluorspar or cryolite, and 2 parts of sodium is thrown upon the red-hot hearth of a small reverberatory furnace, and the dampers are closed to prevent the entrance of air. Intense reaction occurs, and the materials are completely liquefied. When the reduction is finished, the slag (consisting of a mixture of common salt and aluminium fluoride) and the reduced aluminium are run out through a hole at the back of the furnace. In preparing the metal from cryolite, this mineral is mixed with half its weight of common salt, and the mixture is heated with sodium in an iron or earthen crucible. The metal obtained by reduction with sodium usually contains more or less silicon, iron, and admixed slag.

The following description of the methods in vogue at Salindres, France, is given by E. D. Self:\*—

\* Journal Franklin Institute, March, 1887.

The process differs from the one first used industrially in that the double chloride of aluminium and sodium is substituted for the single chloride  $Al_2Cl_6$ , though it is very hygroscopic, and, on becoming moistened, oxidizes to  $Al_2O_3$ . The material chiefly employed at Salindres is bauxite, and the process consists, briefly, of the following steps :---

1. Preparation of the aluminate of soda and the solution of this salt to separate the oxide of iron contained in the ore.

2. Preparation of  $Al_2O_3$  by precipitating it from the soda solution with  $CO_2$ .

3. Preparation of the mixture of  $Al_2O_3$ , carbon and salt, and drying and treating with chlorine gas to obtain the double chloride.

4. Treatment of the double chloride with sodium to obtain metallic aluminium.

The aluminate of soda  $Al_2O_3.3(NaO)$  is produced by calcining a mixture of bauxite ( $Al_2O_3$  and sesquioxide of iron) and carbonate of soda, and then dissolving and filtering off the soluble aluminate from the sesquioxide of iron. The alumina is now precipitated from the soda solution by  $CO_2$  thus :—

 $Al_2O_3.3(Na_2O) + 3CO_2 + 3H_2O = Al_2O_3.3H_2O + 3(Na_2CO_3).$ 

The formation of the double chloride by the action of chlorine on a mixture of alumina, carbon, and salt is thus expressed :

 $Al_2O_3 + 3C + 2NaCl + 6Cl = Al_2Cl_6.2NaCl + 3CO.$ 

Finally, the reduction of the double chloride by sodium is:

 $Al_2Cl_6.2NaCl + 6Na = 2Al + 8NaCl.$ 

Considerable difficulty was at first experienced in the man-

ufacture of aluminium to find a flux whose density was low enough and, at the same time, was free from iron. Cryolite, however, seems to answer the purpose very well, and produces a very fusible slag, beneath which the metal collects. The proportions for the constituents of a charge are: Double chloride 200 lbs., cryolite 90 lbs., sodium 70 lbs.

The double chloride and cryolite are mixed, and then divided into four equal parts. The sodium is divided into three parts, and is so put in that it has a layer of the double chloride and cryolite beneath it on the hearth of the furnace, and between it in successive layers, the top one being composed of the cryolite mixture.

As heat is applied the first flow is melted slag, then aluminium, and finally a gray cinder containing small portions of the metal.

However, so long as aluminium could be prepared only by the reduction of its chloride by means of sodium, its use for other purposes, besides the manufacture of expensive fancy articles, was out of the question. But since the efforts to reduce  $Al_2O_3$  by means of a current of electricity have been successful, the price of the metal has been sufficiently low to allow of its being used for technical purposes.

The principle of reduction by electrolysis is that alumina is decomposed in the presence of a melted fluoride by the electric current, and metallic aluminium is liberated. The process of manufacture, as conducted by the Pittsburgh Reduction Company of Pittsburgh, Pa., is the invention of Charles M. Hall, and consists essentially is dissolving alumina in a melted bath composed of the fluoride of some metal more electro-positive than aluminium; passing an electric current through the melted mass, and the production of alu-

minium by electrolysis of the dissolved alumina; the fluorides of sodium and calcium with the fluoride of aluminium being the preferable salts used in the melted bath, although the fluorides of aluminium and sodium have been used successfully alone, without the fluoride of calcium, in some of their commercial work. The fluoride bath material, when melted, is almost permanent; the only loss being small mechanical lots of material sticking to the pokers and ladles, and a very small loss from volatilization, when the process is working correctly. Fresh fluoride bath material is more or less impure, containing oxides of silicon and iron, in the form of quartz, sand and spathic iron, and these metals are alloyed with the first aluminium produced in the new bath, as all of the silicon and iron are reduced before almost any aluminium is reduced, and the first metal produced contains nearly all these impurities from the melted fluoride salts. The double fluorides of aluminium and sodium, as used by the Pittsburgh Reduction Company, are found in the native mineral cryolite, which is mined at Evigtut, near Arksut, Greenland, and costs about six cents per pound. The fluoride of calcium is the more common mineral, fluorspar, which is found in a reasonably pure state, in quantity, in Illinois, and costs only about \$20 per ton.

In the process as carried on by the Pittsburgh Reduction Company, these chemicals are placed upon carbon-lined iron pots, which are arranged in series with the electric current. The pure oxide (alumina) dissolves to the extent of over 30 per cent. in the melted fluoride salts. The electric current is passed through the melted mass by the aid of carbon cylinders used as anodes which extend down into the melted metal, these carbon anodes being attached by copper rods

#### SPECIAL PROPERTIES OF THE METALS.

to the main portion of the line conducting the electric current from the positive end of the electric generating machinery. The pot itself, with its lining and the metal deposited upon the bottom, becomes the negative electrode or the cathode, and the pot is connected by copper connections to the line extending to the positive electrode in each pot. The electric current passing through the melted material causes the aluminium to be deposited by electrolysis as a melted mass at the bottom of the pot, the freed oxygen going out as carbonic oxide or carbonic acid gas in connection with the carbon of the anode, wearing it away in proportion of a little less than an equal weight of the anode to the aluminium produced. The wear upon the walls of the pot is very small, and as the metal is tapped out from the pots each day by heavy cast-iron dippers, replacing the electrolyte on the top of each ladleful of metal with the carbon rods, the operation in this way is kept continuous for many months at a time.

The fact of the alumina having become reduced to a small amount in the bath is indicated by a rise in the electrical resistance of the melted fluid to the passage of the electric current; and thus by the aid of some form of volt-meter to measure the electrical resistance of the current in its passage through each pot, the time for furnishing a fresh supply of alumina to the bath is properly told. The heat is retained in the melted bath of fluoride salts by the aid of a raft of finely divided carbon, which is kept floating upon its top, on the surface of which a fresh supply of alumina is usually kept for each further addition. The temperature of the melted bath is kept constant by the passage of the electric current through it, the resistance of the bath generating sufficient heat for this purpose. Currents of very large quantities in

amperes are used and of low voltage; only sufficient pressure being required to overcome the electrical resistance of the number of pots arranged in each series, each pot requiring from six to eight volts with the pots now in use.

Commercial aluminium is frequently contaminated by foreign metals. The following analyses show the composition of various kinds of commercial aluminium :

| -  | Ι.                            | 11.       | 111.  | IV.  | v.                      | VI.   | VII. | VIII.                     |
|--|-------------------------------|-----------|-------|------|-------------------------|---|------|---------------------------|
| Aluminium            Silicon            Iron            Copper            Lead            Sodium | 2.87<br>2.40<br>6.38<br>trace | 4.882<br> | 0.454 | 0.45 | 92.5<br>0.7<br>6.8<br>— | $ \begin{array}{r} 96.16 \\ 0.47 \\ 3.37 \\ - \\ - \\ - \\ - \\ - \\ - \\ - \\ - \\ - \\ -$ |      | 97.20<br>0.25<br>2.40<br> |

A content of iron in aluminium is very injurious, it rendering the metal uncommonly hard. However, the varieties of aluminium prepared by electrolysis are, as a rule, quite pure, copper being the chief impurity contained in them. The greatest value of aluminium, perhaps, is in the wonderful alloys it is capable of producing. They are exceedingly numerous, and the range of proportions of the ingredients to produce useful alloys is very wide. In a general way, aluminium may be said to improve the qualities of every metal to which it is added in small quantities; increasing the strength. The most important alloys are the alloys with copper. These form a siriking series, of which the alloy of 10 per cent. of aluminium and ninety per cent. of copper is the most prominent. These and other alloys of aluminium will be described later on, but it may be of interest to give here a brief sketch of the production of aluminium bronze.

The furnace used by the Cowles Electric Smelting and Alu-

minium Company consists of a fire-brick box, 1 foot wide, 5 feet long, and 15 inches deep. From opposite ends enter two immense electrodes, that are really electric-light carbons, 3 inches in diameter and 30 inches long. These are partly contained in pipes that, in turn, pass through stuffing boxes in the ends, to exclude the air, and, at the same time, admit of adjusting the electrodes.

To protect the walls of the furnace from the intense heat, it is lined with finely powdered charcoal, which, having been first washed in a solution of line water, retains its non-conductivity even after the particles have been partially converted into graphite by heat. The bottom of the furnace is now lined to a depth of 2 or 3 inches with this fine, prepared charcoal, and, by means of a sheet-iron gauge, the walls of the furnace are covered with charcoal to the thickness of 2 inches.

The charge, consisting of about 25 lbs. of corundum, 12 lbs. of charcoal and carbon, and 50 lbs. of granulated copper, is placed about the electrodes to within a foot of each end of the furnace. A layer of coarsely-broken charcoal is now spread over the charge, and the sheet-iron gauze withdrawn. The coarse charcoal on top allows of the escape of carbonic oxide gas formed during the process.

The charge is now prepared, and the furnace ready to be connected with a Brush dynamo capable of producing ninety horse-power of electric energy. In the circuit between the dynamo and furnace, is an ammeter, designed to register from 50 to 20,000 ampères of current, which is controlled by a large resistance-box, as the ends of the electrodes may at first be too close together to make it safe to start the dynamo. By watching the ammeter and moving the electrodes, the resistance-box can be taken gradually out of circuit, without producing a

"short circuit" at the beginning of the operation. In about ten minutes, after the copper about the electrodes has become melted, the latter are slowly moved apart until the current becomes steady. It is now increased to about 1,300 ampères and fifty volts. Carbonic oxide begins to escape from the orifices made in the top, and burns in two white plumes of flame. By regulating the distance between the electrodes, the current is kept constant for about five hours, and all parts of the charge are brought into the reducing zone.

When the operation is completed, a resistance is placed in the box and the current is switched into another furnace charged in a similar manner. The product is an alloy of copper containing fifteen to thirty per cent. of aluminium, and having a beautiful silver color when broken. The copper performs no part in the reduction, but is employed to absorb the aluminium, which would otherwise be converted into a carbide.

This alloy is now melted in an ordinary crucible-furnace and run into ingots, which, after being analyzed, are remelted and sufficient copper added to produce the standard bronzes.

Two runs from the furnace described will produce about, 100 pounds, containing about fifteen per cent. of aluminium. From these data, it is estimated that pure metal can be produced, in its alloys, at about forty cents per pound, with a large plant.

It is evident that a large electrical smelting plant need not be restricted to the production of aluminium and its bronzes, but also boron, sodium, potassium, calcium, magnesium, chromium and titanium can be reduced by varying the details of operation.

#### SPECIAL PROPERTIES OF THE METALS.

Magnesium (Mg; atomic weight 24). This element, in a state of combination, occurs widely distributed, and is found in a great variety of minerals. It is met with as hydrate, carbonate, chloride, bromide. sulphate, phosphate, and nitrate; it exists in large numbers of bodies in combination with silica, as, for example, in hornblende, augite, tale, soap-stone, asbestos, etc. It is found in many mineral waters; sea water containing considerable quantities of the chloride and sulphate.

The metal was isolated by Davy in 1808, and is now prepared on a considerable scale, either by separating it from its chloride with the assistance of the electric current, or from its double combinations of magnesium chloride with calcium chloride, or of magnesium fluoride with sodium fluoride by means of sodium.

Magnesium, in a pure state, possesses a silvery white color and acquires a high lustre by polishing. Its specific gravity is 1.743. Its hardness is nearly that of calcite. At the ordinary temperature it is somewhat brittle, but at a red heat it is malleable, and scarcely more ductile than zinc. Recent experiments have shown that its tensile strength is higher than that of aluminium and brass, and nearly equal to that of bronze or of Delta metal. In dry air it does not change and does not lose its lustre; in moist air it soon becomes coated with a white layer of magnesium hydrate; but as the latter is very coherent, this alteration does not extend beyond the surface. Its fusing point is generally given at about 932° F., but, according to Victor Meyer, it is much higher. It fuses with greater difficulty than sodium bromide, and is nearly as fusible as sodium carbonate, the latter melting at 1482° F. When heated to somewhat above its fusing point

it burns, similar to zinc, with an intensely bright white light, rich in chemically active rays. The preparation of magnesium alloys is connected with great difficulties on account of the oxidability of the metal. The alloys may be obtained by melting the metals together in a current of hydrogen, or under fluxes of fluor spar and common salt or cryolite; or, according to White, the other constituent metal is fused and the magnesium quickly immersed by means of tongs. According to Parkinson, magnesium furnishes alloys with sodium, mercury, tin, cadmium, bismuth, lead, zinc, antimony, silver, platinum, gold, copper and aluminium; it alloys also with copper and nickel when combined, but not with iron, cobalt or nickel. The color of the white metals combined with magnesium is not essentially affected, except when the content of magnesium is very large, as in certain alloys with tin, silver and lead. All magnesium alloys are very brittle, tarnish more or less in the air, and decompose water more or less readily.

With potassium and sodium, magnesium yields malleable alloys which decompose water at the ordinary temperature. Eighty-five parts tin and 15 parts magnesium give a lavenderblue, hard, brittle alloy, which also decomposes water.

With mercury magnesium does not amalgamate at the ordinary temperature, but by shaking magnesium with mercury in dilute sulphuric acid, amalgamation takes place (Hartley and Phipson, and J. Parkinson). By heating magnesium with mercury to nearly the boiling point of the latter, amalgamation also takes place under violent reaction. Such an amalgam, containing 1 part magnesium and 200 parts mercury, on exposure to the air, becomes immediately dull and swells up; it decomposes water as vigorously as sodium

#### SPECIAL PROPERTIES OF THE METALS.

amalgam (Wanklyn and Chapman). Magnesium also combines with lead and zinc, alloys with 5 to 20 per cent. being suitable for fireworks, and may, for instance, in the form of powder, be added to rocket charges. With thallium, magnesium combines in all proportions, alloys with 5 to 25 per cent. thallium, burning with a steady and bright flame, whereby the intense magnesium light suppresses the green color of the thallium, which is only slightly noticeable even with 50 per cent. thallium.

According to Holtz, expectations regarding the technical availability of magnesium alloys have not been fulfilled. Iron, steel, copper, brass and bronze are not rendered malleable and softer by an addition of manganese, but brittle.

d. Heavy metals.—To this group belong the metals of the most importance to the industries. They are divided according to their chemical behavior into several sub-divisions, named after the most common metal occurring in them. We speak, therefore, of a zinc group, an iron group, a silver group, etc., and this division will here be retained, it being very suitable to make clear the connection existing between certain minerals.

# 1. Iron Group.

## (Iron, Manganese, Cobalt, Nickel, Chromium, Uranium.)

Among the metals belonging to this group, iron is most widely distributed and most frequently used. It forms, however, but a small number of alloys available in the industries. Nevertheless, on close examination it will be found that many alloys contain a small quantity of iron, which, however, has not been added intentionally, but is simply a contamination of the metals constituting the alloy. But, as we shall see

later on, a very small quantity of a metal frequently suffices to exert considerable influence upon the physical properties of an alloy.

Iron (Fe., atomic weight 56). Native iron is of exceedingly rare occurrence, but it enters into the composition of those curious stones which have fallen to the earth from space, and are known as meteorites. All iron prepared on a commercial scale contains carbon, the purest being wrought iron with about 0.15 per cent. carbon, then steel with from 0.15 to 1.5 per cent., and cast-iron with upwards of 1.5 per cent. In a general way it may be said that the properties of the various grades of iron depend upon the varying proportions of carbon present, and hence, in this sense, iron may be considered an alloy with carbon. Silicon and manganese also are sometimes present, not as incidental, but as intentional constituents. The preparation of such varieties of iron, however, belongs more particularly to the metallurgy of iron proper.

Chemically pure iron may be obtained by reducing peroxide of iron by hydrogen at a red heat, or by remelting the purest varieties of malleable iron with an oxidizing flux in order to remove the last traces of combined carbon. The physical properties of the metal vary very considerably according to the means adopted for its production. When obtained by reducing peroxide of iron by hydrogen at the lowest possible temperature at which the change can be effected (according to Magnus between 600° and 700° F.) it forms a dark-gray powder, which combines energetically with oxygen, taking fire spontaneously when slightly heated and thrown into the air. When, however, the reduction takes place at a higher temperature, the metallic powder agglutinates to a sponge of filamentous texture, a silvery-gray color, and metallic lustre which is no longer pyrophoric.

Larger and more compact masses may be obtained by removing the last traces of carbon and other foreign substances from the purest commercial wrought iron in the following manner: A small quantity of good wrought iron, such as piano-forte wire or Russian black plate, cut up into small pieces, and either rusted by exposure to steam or mixed with about 20 per cent. of pure peroxide of iron, is to be melted under glass free from metallic oxides, in a refractory crucible, at a strong white heat, the operation requiring about an hour's full heat of a good wind furnace. The small quantity of carbon present in the metal is expended in reducing a portion of the sesquioxide, the remainder passing into the slag. The result is a brilliant well-melted button of metal, which exhibits a decidedly crystalline structure, similar to that observed in meteorites when treated with an etching liquor, and is somewhat softer, but less tenacious than the iron originally employed. This last method of producing pure iron is recommended for experimenting in the preparation of alloys with iron, though, if too troublesome, the best quality of piano-forte wire will answer the purpose.

Iron oxidizes very readily; in a damp atmosphere the rust has a very destructive action, and necessitates the employment of varnishes and other preservative coatings. In the melted state or at a red heat, iron in contact with the air oxidizes rapidly, and acids attack and dissolve it with ease.

Iron alloys with great ease and in all proportions with manganese, chromium, tungsten, molybdenum, nickel, cobalt, gold, platinum, aluminium, antimony, arsenic; not quite so readily with copper, though smaller quantities of the latter are very readily absorbed by iron, and smaller quantities of iron by copper. With bismuth, tin and zinc, iron alloys to a

limited extent only, and not at all with lead, silver and mercury.

Iron alloys are of no technical importance, except the combinations of iron with nickel, tungsten, chromium and manganese, which play a role in working crude iron and especially in the preparation of steel; further combinations with tin and zinc, which have to be considered in tinning and galvanizing iron; and finally in the preparation of ferriferous brass (Delta metal) and of iron containing aluminium (mitis castings).

Manganese (Mn; atomic weight 55) is so intimately associated with iron that it is rare to find an ore of it that does not contain the other in greater or less proportion. There are many compounds of manganese, one of the most commonly occurring being the black oxide  $MnO_2$ , the mineralogical name of which is pyrolusite. Manganese having an extraordinarily great affinity for oxygen is never found in nature in a metallic state. Although actual manganese ores in larger quantities do not occur in many localities, the element is very widely distributed, it accompanying nearly everywhere iron in ores and rocks; it is found in every soil, and passes from it into plants and into animal substances (blood, urine, liver, excrements); it occurs in wine, in sea and mineral waters, in meteorites, in the solar spectrum, etc.

Metallic manganese was first extracted, in 1774, by Gahn. It may be obtained by reducing the dioxide  $MnO_2$  or the carbonate  $MnCO_3$  with charcoal or soot at a very high temperature. The fused mass, which is combined with a little carbon (as in cast-iron) is freed from its carbon by reheating with manganese carbonate. As thus obtained the metal has a grayish-white color and a fine-grained structure: It is much harder than wrought iron, very brittle, and feebly attracted by

the magnet. It rapidly oxidizes when exposed to air. Its specific gravity is 8.013. It fuses only at the highest temperature of a blast furnace, and is rapidly attacked by dilute mineral acids, with evolution of hydrogen.

Manganese readily unites to alloys with many metals. The most important of these alloys for technical purposes are ferro-manganese, ferro-silicon manganese and cupro-manganese, the latter, amongst others, being used for the preparation of manganese bronze, manganese German silver and manganese brass.

Cobalt (Co; atomic weight 59). Compounds of cobalt appear to have been known to the ancients and used by them in coloring glass. The metal itself was first isolated by Brand in 1733. Metallic cobalt is occasionally found in meteoric iron, associated with nickel and phosphorus. Its principal naturally occurring compounds are the arsenide, smaltine, or tin-white cobalt; cobalt bloom or erythrine, and cobalt glance. The pure metal is unalterable in air, even when moist, of a red-white color, very difficult to fuse, highly malleable and ductile, and capable of taking a polish; its specific gravity is about 8.9. It is slightly magnetic, and preserves this property even when alloyed with mercury. It bears in many respects a close resemblance to nickel, and is often associated with the latter in nature. It is not used by itself, and only very seldom as an intentional addition to alloys. The protoxide is used in the color industry, the colors prepared from it being much employed in painting glass and porcelain.

Cobalt alloys more readily with copper than with iron, and gives alloys which melt at a temperature near the fusing point of copper, are ductile, and by repeated heating can be worked under the hammer. According to Wiggin, cobalt bronze possesses all the properties of the pure metal without its high price. According to Guillemin, alloys of copper with 1 to 5 per cent. cobalt are red, very ductile and tenacious, and possess a tensile strength of 88 lbs. per 0.001 square inch. Knoop uses an alloy of 100 parts iron and 5 to 10 cobalt for pressed glass moulds.

Nickel (Ni; atomic weight 58). This metal was discovered in 1751 by Cronstedt, in the arsenide NiAs, a copper-colored mineral termed Kupfer nickel (i. e., false copper) by the German miners. This compound, together with the impure arsenide termed "speiss" formed at the bottom of the melting pots in the manufacture of "smalt," constitute the principal sources of nickel in Europe. Nickel ores are found in France, Sweden, Cornwall, Spain, Germany, New Caledonia, Canada, and in some localities in the United States, the largest and most extensive deposits being those of New Caledonia and at Sudbury, Canada. The preparation of metallic nickel is connected with many difficulties. It is generally found in commerce in the form of small cubes of a dull gray appearance. By melting these cubes at a very high temperature, the metal is obtained as a silver-white mass of considerable hardness, which takes a fine polish and is unalterable in dry air. It is slightly magnetic at ordinary temperatures, but temporarily loses this property on heating. Its specific gravity is greater than that of iron, being 8.3 to 8.9, and with about an equal fusibility is far less subject to oxidation and corrosion. Its oxide is white, and defaces the polished metal comparatively little, and is easily removed. Nickel can be either cast or forged, but is mostly used in preparing alloys or for electroplating more oxidizable metals.

The malleability of nickel allows of its being chased, as are

silver and gold, and with the result of greater lustre, while the qualities of brilliancy, hardness, and durability, whether used solidly or in electro-plating, make it very suitable for tableservice.

Dr. Fleitmann, of Iserlohn, has devised a simple and successful process of refining and toughening nickel, which is now very largely used. It produces a homogeneous metal, from which castings may be made with much less liability to the presence of blow-holes than with other methods. Fleitmann's procedure consists in adding to the melted charge in the pot, when ready to pour, a very small quantity of magnesium. The magnesinm is added, in very small portions at a time, and stirred into the charge. About one ounce of magnesium is found to be sufficient for purifying 60 lbs. of nickel. The theory of the operation is that the magnesium reduces the occluded carbonic oxide, uniting with its oxygen to form magnesia, while carbon is separated in the form of graphite. The nickel refined by this method is said to become remarkably tough and malleable, and may be rolled into sheets and drawn into wire. Cast plates (intended for anodes in nickel-plating) after reheating, can be readily rolled down to the required thickness, which greatly improves them for plating purposes, as they dissolve with greater uniformity in the plating bath. Nickel so heated may be rolled into sheets as thin as paper, and has been successfully welded upon iron and steel plates.

Nickel alloys completely with copper, iron, manganese, zinc, tin, silver and cobalt, probably also with gold; incompletely, or not all, with lead. Some of the nickel alloys possess properties which, for certain purposes, render them almost indispensable. The alloys known as argenton, German silver, China silver, similor, argent Ruolz, etc., are prepared with the assistance of nickel. It is also occasionally employed for coinage, nickel coinage having been commenced about 1850, by Switzerland, and in the United States in 1857. The subject of nickel and steel alloy was first called attention to by Mr. James Riley, of Glasgow, in a paper read by him before the British Iron and Steel Institute, at their meeting in May, 1889. Quite recently the subject has acquired much greater notoriety, owing to the results of armor-plate tests made by the United States government. Plates of all descriptions, with and without nickel, were exhaustively experimented with. High and low carbon steels were shot at; plates just as they were rolled or forged, and others which had been surface-hardened (Harveyized) were again and again subjected to the fire of the most formidable modern ordnance made, rifles as high as 12-inch calibre being used-the results having demonstrated beyond all doubt the superiority of nickel-steel for armor purposes. The tough, tenacious material flows under the impact of the shot, and in the case of the "Harveyized" plates, the extreme hardness of the exterior surface, reinforced by the tough, untreated steel behind, shatters the forged steel Holtzer projectiles, which have hitherto proved irresistible.

*Chromium* (Cr; atomic weight 52.2). The principal naturally-occurring compound of this element is chrome-iron stone. It is isomorphous with magnetic oxide of iron; it has a brownish-black color and sub-metallic lustre. The metal is obtained by strong ignition of the sesquioxide with charcoal, or by heating chromic chloride with zinc or potassium. It has a steel-gray color, and is exceedingly hard. Its specific gravity is 6.81.

Many metals are hardened even by the addition of very

#### SPECIAL PROPERTIES OF THE METALS.

small quantities of chromium. According to the investigations of Berthier, Frémy, Smith and others, iron and chromium unite in all proportions by strongly heating the mixed oxides of iron and chromium in brasqued crucibles, adding powdered charcoal if the oxide of chromium is in excess, and fluxes to scorify the earthy matter and prevent oxidation. According to Howe,\* this is substantially the same method for preparing ferro-chrome as employed at Brooklyn, New York, and at Unieux Works in France, where chrome steel has been produced in large quantities for a number of years. According to the method of Guétat and Chavanne,<sup>†</sup> a neutral solution of potassium calcium chromate or sodium calcium chromate is mixed with an equivalent quantity of ferrous chloride, the precipitate of ferric chromate washed, roasted, mixed with a sufficient quantity of coal dust, and heated to a white heat in well-luted graphite crucibles in which the ferro-chrome melts together to a regulus.

The ferro-chrome from Kapfenberg in Styria contains, according to Schneider, 44.5 per cent. chromium and 48.2 per cent. iron, besides fixed carbon. From this and similar alloys the excess of iron may be extracted with dilute hydrochloric acid or with chloride of copper, whereby acicular crystals of the composition  $Fe_4C.Cr12C_4$  remain behind.

Ferro-chrome is almost tin-white, very hard and brittle, and non-magnetic. Its specific gravity is 6.97.

Chrome-steel is easily made from ferro-chrome by simply melting it with wrought iron or steel in graphite crucibles.

Uranium (U; atomic weight 240). The most abundant source of this element is pitchblende, found principally in

<sup>\*</sup> Metallurgy of Steel, p. 75.

<sup>†</sup> Jahresberichte der chem. Technol., 1883, p. 220.

Saxony and Cornwall. The metal is obtained by heating uranous chloride with sodium or potassium as a black powder, or as a reguline mass. In a metallic state uranium finds no application whatever; it is used in the manufacture of the peculiarly fluorescent uranium glass.

Among the metals belonging to the iron group, nickel is the most important for our purposes, on account of the numerous alloys which can be prepared with its assistance. Among the other metals iron is of some importance, small quantities of it, as previously mentioned, being frequently met with as accidental impurities in many alloys.

#### 2. Zinc Group.

# (Zinc, Cadmium, Indium, Gallium).

Zinc (Zn; atomic weight 65). The most valuable zinc ore is the native carbonate or *calamine*, which, together with the sulphide or *blende*, constitutes the principal source of the zinc of commerce. Zinc ores occur abundantly in the United States, the best being obtained in New Jersey, Pennsylvania, and Virginia, and in a line of deposits running through West Virginia and the Middle States, across to Illinois, Missouri, and Kansas, and north into Wisconsin. Large quantities are mined in Missouri and other parts of the country, and in Europe. Zinc in the metallic state was not familiar to the ancients, although they were accustomed to use its ores in the manufacture of brass. The alchemist Paracelsus, in 1541, makes mention of metallic zinc, but it was doubtless known before his time, and was probably discovered by Albertus Magnus, who called it marchasita aurea. It became a regular article of manufacture about 1720, in Germany, and in England fifteen or twenty years later. It has been regularly

manufactured in the United States since about 1850, first in New Jersey and later on in a number of other localities.

Metallic zinc is a bluish-white metal known to the trade as "spelter." Its properties are rather peculiar, and, as it plays an important part in the manufacture of alloys, will have to be more closely considered. Zinc is hard and brittle, and, when fractured, exhibits a highly crystalline structure. It experiences very little alteration in the air, it becoming very slowly coated with a permanent and impenetrable coating—a basic carbonate—which renders it very valuable for sheathing and for work exposed to the weather. Zinc can be cast, and makes good architectural ornaments. The castings made at a high temperature are brittle and crystalline; when cast at near the melting-point they are comparatively malleable. Zinc is hardened by working, and must be occasionally annealed.

Zinc at an ordinary temperature shows a considerable degree of brittleness, and if a piece of sheet-zinc be several times bent backward and forward it soon breaks. By heating the zinc, however, to between 230° and 302° F., it acquires a considerable degree of ductility, and can be rolled out into thin sheets. At a still higher temperature it again becomes brittle, and, when heated to 392° F., can readily be reduced to a powder. Its density varies between 6.9 and 7.2, the latter being that of the rolled metal. Zinc melts at 773.5° F. By heating the fused metal but a little above its meltingpoint with the admission of air, it ignites, and burns with a bright, white flame to a very spongy, pure, white powder, forming the oxide known under the name of "zinc-white," and employed as a pigment. It is chiefly valued for its permanency, as it is not blackened by exposure to sulphuretted

hydrogen like white lead. At a white heat zinc boils, and can be distilled.

Zinc alloys in all proportions with copper, tin, gold, silver, nickel and antimony, and to a very limited extent, with iron From zinc melted in an iron vessel, a more refractory, coarsecrystalline iron-zinc alloy with about three per cent. iron separates out. In acicular crystals detatched from a piece of distilled zinc, Erdmann found 93.2 per cent. zinc, 6.5 per cent. iron and 0.3 per cent. lead. With bismuth zinc alloys scarcely at all; according to the experiments by Matthiesen zinc dissolves at the utmost 2.4 per cent. bismuth, and bismuth at the utmost 14.3 per cent. zinc. With lead zinc unites to a very limited extent, zinc dissolving at the utmost 1.6 per cent. of lead, and lead at the utmost 1.6 per cent of zinc.

Cadmium (Cd, atomic weight 112), occurs in nature in a few minerals, for instance, combined with sulphur in greenockite. Compounds of this metal frequently occur, associated with zinc ores; as cadmium is more volatile than zinc, it is mainly found in the first portion of the distilled metal when the ores are reduced by carbon. Cadmium was discovered by Strohmeier in 1818.

Pure metallic cadmium is obtained by precipitating from a solution of zinc containing cadmium in sulphuric or hydrochloric acid, the cadmium by pure zinc, or by dissolving commercial cadmium in sulphuric or hydrochloric acid, precipitating cadmium sulphide by sulphuretted hydrogen, dissolving the thoroughly washed cadmium sulphide in concentrated hydrochloric acid, precipitating the solution with excess of ammonium carbonate, and igniting the washed and dried cadmium carbonate with  $\frac{1}{10}$  pulverized coal in a glass or porcelain retort in order to distil over cadmium. Reduction may also

#### SPECIAL PROPERTIES OF THE METALS.

be effected with hydrogen. Dissolve commercial, zinkiferous cadmium in hydrochloric acid, so that a small quantity of the metal remains undissolved, filter the dilute solution, add ammonia in excess, filter again, and add potash solution as long as turbidity results. Wash the prepititate of cadmium oxyhydrate, dry, dehydrate it completely by continued beating in a covered crucible at 572°F., and convert into brown cadmium oxide, which is reduced.

Cadmium is a silver-white crystalline metal and possesses the same property as tin, of giving out a crackling sound when bent. It is so soft that it somewhat discolors, but a small content of zinc makes it brittle. On account of its ductility it can be readily rolled or beaten into sheet and very thin foil, the latter being more coherent than tin foil and having, similar to lead foil, a dull sound. By rolling, cadmium does not completely lose its crystalline structure. Its specific gravity is 8.6, it melts at 608°F., and boils at 1580°F. It is readily dissolved by mineral acids; contact with platinum preserves it from the action of strong nitric acid.

With gold, platnium, copper and partially with mercury, cadmium yields brittle alloys; but with lead, tin, and in certain proportions with silver and mercury, very ductile combinations, for instance, 1 and 2 parts of silver with 1 cadmium, while an alloy of 2 parts cadmium and 1 silver is brittle. Cadmium 1 part and mercury 1, gives a very plastic, malleable amalgam, while that obtained from cadmium 1 part and mercury 2 is just malleable and not so tough. According to de Souza, cadmium amalgam retains mercury at 680°F., but no longer at 824°F. Alloys of cadmium with bismuth and lead are readily fusible, and those of tin and cadmium very ductile. By combining cadmium with tin, bismuth, lead in

certain proportions, alloys are formed which on account of their low fusing point, find many technical applications.

Indium. (In; atomic weight 113.4). This rare metal was discovered, in 1863, by Reich and Richter in the zinc blende of Freiberg, and has since been found in a few other zinc ores, and in the flue dust of zinc furnaces. It occurs associated with zinc in blende to the extent of 0.006 to 0.1 per cent. and is best obtained from the crude metal or "spelter." It is a silver-white, soft, ductile metal, of specific gravity 7.4. It melts at 348.8°F., and oxidizes at a high temperature. It is less volatile than cadmium or zinc. When heated to redness in the air, it burns with a violet flame, and is converted into the yellow sesquioxide. Heated in chlorine it burns with a yellow-green light, and forms a chloride which sublimes without fusion in soft white laminæ at an incipient red heat.

Gallium (Ga; atomic weight 69.9). This metal was discovered in 1875, by Lecoq de Boisbaudran in a zine blende from the mine of Pierrefitte, in the valley of Argeles, Pyrenees, and has likewise been found, though always in very small quantity, in blendes from other localities. Gallium has a bluish graywhite color, but in a fused state appears silver-white and shows a stronger lustre than mercury. It melts at 86.2°F. so that it liquefies when pressed between the fingers. In case a portion of the metal remains solid and the fused portion be brought in contact with it, the latter slowly solidifies at 86°F. However, gallium in a perfect state of fusion exhibits, to a considerable extent, the phenomenon of over-fusion; it remains liquid for months at the ordinary temperature, and for hours even at 32°F. It does not become solid by rubbing with a piece of platinum wire or a steel needle, but solidifies slowly when brought in contact with the smallest piece of solid

#### SPECIAL PROPERTIES OF THE METALS.

49

gallium. It adheres to glass, forming a whiter mirror than produced by mercury. Although it is quite hard, it can be readily cut with a knife; it also decolorizes, and yields upon paper a bluish-gray streak. Although it can be somewhat drawn out under the hammer, it soon becomes brittle and crumbles. Small pieces possess considerable strength and thin sheets stand bending several times without breaking. The specific gravity of solid gallium is 5.935 to 5.956, and that of fused gallium 6.069.

Gallium shows but little inclination towards oxidation; it remains bright at the ordinary temperature, as well as at 500°F. in dry oxygen, and loses its lustre only at the initial red heat, when, without showing evaporation, it becomes covered with a thin layer of oxide, which protects the metal underneath from further oxidation. It is but little affected by moist air and remains unchanged in boiling water; but the metal separated by electrolysis shows, probably on account of its containing some alkali metal, the phenomenon of decrepitation, whereby gas-bubbles escape. With hydrochloric acid, as well as with potash lye and ammonia, gallium evolves hydrogen; under heated nitric acid it fuses to a bright mercury-like globule, and very slowly dissolves. Chlorine attacks gallium at the ordinary temperature, heat being evolved; bromine acts less vigorously, and iodine only on heating.

Up to the present time only alloys of gallium with aluminum and iridium have been prepared.

#### 3. Tungsten group.

#### (Tungsten, Molybdenum, Vanadium).

In regard to their properties the three metals forming this group approach the iron group, but tungsten alone has found some application in the manufacture of alloys. Tungsten (Wo; atomic weight 184). This element was discovered by d'Elhujar in 1781. It is sparingly distributed in nature and is never found free, its principal native compounds being wolfram, a tungstate of iron and manganese, calcium tungstate or scheelite, and lead tungstate. Metallic tungsten is obtained by reducing the trioxide in hydrogen, or by passing the vapor of tungstic chloride mixed with hydrogen through a red hot tube, or by passing the vapor of the chloride over heated sodium. It is an infusible steel-gray crystalline powder of specific gravity 18.0; when heated in the air it burns, forming tungstic oxide. When mixed with other netals it forms exceedingly hard, infusible alloys.

Although tungsten itself is infusible, it readily unites with iron, forming an alloy known as ferro-tungsten. In this form it is used in the preparation of tungsten steel. The steel is first melted, and ferro-tungsten of known composition added to the same. The general effect of tungsten on steel is to render it intensely hard and brittle. It is very difficult to forge, and it cannot be welded when the amount of tungsten present exceeds two per cent. One peculiarity of tungsten-steel is that in the absence of carbon it is not strengthened or increased in hardness by tempering. When the amount of tungsten present becomes considerable, these steels can be worked only with the greatest difficulty. The higher grades cannot be cut by the file, and as none of it can be tempered, it must be shaped at one forging, and then ground to the form desired. Like chrome steel, tungsten tool steel can be worked easily at red heat, but to obtain the best results it must be handled with the greatest care.

The other two metals of the tungsten group, *molgbdenum* (Mo; atomic weight 96) and *vanadium* (V; atomic weight 51.3)

have only been found in small quantities in some rare minerals, and have thus far found no application in the manufacture of alloys.

# 4. Tin group.

#### (Tin, Titanium, Zirconium, Thorium.)

This group contains the metals above mentioned, but with the exception of tin, they are of no industrial importance whatever, and belong to the greatest rarities. We, therefore, have only to deal with tin.

Tin (Sn; atomic weight 118.) Native tin is of exceedingly rare occurrence, and then it is combined with lead, and even with gold in Siberia. It can, however, be readily extracted from tin-stone or cassiterite, occurring in great abundance in Cornwall, Devonshire, and other localities. A considerable quantity of tin ore is obtained from Saxony, South America, and Australia. The nodular or rounded grains of tin found in beds of streams and in alluvial soil, are called stream-tin, and are very pure tin-stone; as found in the alluvial soil of the island of Banca, it is considered the best in the world. Only a small part of this island has been explored for tin, and that in the north part, but the yield is about 4,000 tons annually. In Cornwall the tin mines have been worked from remote antiquity, but the tin is mixed with various sulphurets and minerals, as copper, blende (zinc), arsenic, fluor, apatite and tungsrate of iron and manganese (wolfram). In the United States, tin in the form of cassiterite occurs in Maine, Massachusetts, New Hampshire, New York, Virginia, North Carolina, Georgia, California, Idaho and other states, but not in quantities sufficient to invite much outlay for working.

At present the appearance of large quanties of tin ore in

Dakota, with various associations, and in some parts almost pure, seems to indicate that it has a wide and valuable distribution. The district in Dakota where the chief deposit has been found is at the central portion of the Black Hills, in Pennington county, about 20 miles southwest of Rapid City, two miles from Harney City. It is at the claim known as the Etta, on an isolated conical granitic hill rising about 250 feet above the surrounding valley, 4,500 feet above the sea.

Tin-stone has also been discovered in the northwest parts of the Black Hills in Wyoming, and stream tin on Jordan creek, Idaho, with gold in the placer deposits of that stream.

Commercial tin is never pure. The following table shows a set of analyses given by Bruno Kerl :\*

|                                     | Banca.                     |     | British. |                           | Peruvian.               |                         | Saxon. | Bohemian. |       |
|-------------------------------------|----------------------------|-----|----------|---------------------------|-------------------------|-------------------------|--------|-----------|-------|
|                                     | Ι.                         | 11. | I.       | II.                       | Ι.                      | II.                     |        | I.        | II.   |
| Tin            Iron            Lead | $99.961 \\ 0.019 \\ 0.014$ | 0.2 |          | $98.64$ $\overline{0.24}$ | $93.50 \\ 0.07 \\ 2.76$ | $95.66 \\ 0.07 \\ 1.93$ | _      | 99.59     | 98.18 |
| Copper<br>Antimony .                |                            |     | 0.24     | 0.24<br>0.16              | $\frac{2.10}{3.76}$     | 2.34                    | <br>   | 0.406     | 1.60  |
| Bismuth                             | -                          |     | -        | —                         | —                       | _                       | 0.1    | —         | —     |

Chemically pure tin is a white metal with a strong lustre; it has a specific gravity of 7.28 to 7.4, according to the method of preparation, the purest being the lightest. It scarcely oxidizes in moist air, and entirely retains its metallic lustre in dry air. It possesses but little tenacity, but is quite malleable, and can be rolled into very thin .plates (tin-foil). It is highly crystalline, and when bent gives out a crackling noise, the socalled "tin-cry," caused by the crystals rubbing against each

\*Metalhüttenkunde, 1873.

other. It possesses a peculiar odor. It melts at 453° F. When fused in contact with air it acquires a film of oxide, and at a white heat burns with a bright flame, and is converted into a whitish powder, known as "putty-powder," and used in the arts for polishing.

Unmanufactured tin comes into market as "block tin," as "grain tin," and in small bars or "sticks." Block tin is cast in ingots or blocks in moulds of marble; grain tin is made by heating these ingots until very brittle, and then breaking them upon stone blocks; it is sometimes granulated by melting and pouring into water.

Tin, though soft by itself, possesses the remarkable property of imparting to certain alloys a high degree of hardness. It being quite indifferent towards certain organic acids, it is extensively used for coating other metals, as iron, copper, lead, etc.

Tin alloys readily with lead, antimony, zinc, bismuth, copper, gold, silver and other metals.

# 5. Lead group.

#### (Lead, thallium.)

Lead (Pb; atomic weight 207).—This metal is much used in the manufacture of alloys. It is so soft that it may be easily scratched with the finger nail, but it has too little tenacity to be drawn into fine wire, although some lead wire is found in the market. It is very malleable, and is extensively used in the forms of sheet-lead and lead-pipe. It was formerly employed for casting statues, but its use for this purpose has been almost entirely abandoned at the present time, experience having shown that, though such statues resist the action of the air quite well, they gradually collapse.

Pure lead is a bluish-white, lustrous, inelastic metal; when

freshly cut or melted it shows a bright surface, which, however, rapidly tarnishes on exposure to the air. It is very heavy, its specific gravity being 11.4, and is easily fusible, melting at about 620° F. It boils and volatilizes at a white heat, but cannot be distilled from closed vessels. The affinity of lead for oxygen is so great, that in melting the surface becomes coated with a yellow layer of oxide; on removing this layer with a hook, the pure white color of the metal shows itself, but immediately disappears again. In this manner large quantities of lead can in a short time be converted into oxide. The alloys of lead are distinguished by great fusibility, a valuable property for some purposes, and by being, as a rule, much harder than the lead itself.

Lead alloys readily with tin, antimony, bismuth, silver and gold; scarcely at all with zinc (see zinc); and but little with iron; on mixing iron and lead the latter sinks down, and the iron remains almost free from lead. However, in iron blast furnaces partly cubic and partly acicular crystals have been found, which, according to Sonnenschein, contained 88.76 per cent. lead and 11.14 per cent. iron, and probably had been formed by the action of gaseous lead upon reduced iron.

Thallium (Tl; atomic weight 203.64) is a metal very much resembling lead. It is widely distributed, being found in iron and copper pyrites, in blende, in native sulphur, and in lepidolite. It is most profitably extracted from the flue dust of the pyrites burners. It has a strong metallic lustre, but quickly tarnishes by oxidation. Its specific gravity is about 11.8, and it is softer even than lead. Several alloys exhibiting characteristic properties have been prepared with the assistance of thallium, but the metal is too expensive to be used for technical purposes.

# 6. Silver Group. (Silver, mercury, and copper.)

The metals belonging to this group are of great importance in the manufacture of alloys, copper being especially distinguished in this respect, since there is an exceedingly large number of alloys used for various industrial purposes of which it forms the principal constituent. The other two metals belonging to this group are also much employed for the same purpose, and it may be said that this group is the one most deserving the attention of all interested in alloys.

*Copper* (Cu; atomic weight 63.4).—This metal has been known from very early times, it being found native in many parts of the earth and requiring, therefore, simply to be melted in order to obtain it in a form suitable for technical purposes. It was used for the manufacture of tools and weapons long before the discovery of methods for the extraction of iron.

Copper has a characteristic yellowish-red (copper-red) color, but on exposure to the air becomes gradully coated with a brown layer of oxide. Heated to redness in the air it is quickly oxidized, becoming covered with a black scale. It has a specific gravity of 8.9, and is tough, very malleable, and ductile, so that it can be rolled out into very thin leaves and drawn out to fine wires. It melts at a bright red heat, and seems to be slightly volatile at a strong white heat.

Copper alloys readily with most metals, especially with gold, silver, zinc, tin, nickel, antimony, aluminium, etc., but partially only, or with difficulty, with lead and iron. Many of the copper alloys are of great importance. All alloys known as bronze, brass, bell-metal, gun-metal, as well as German silver, argentan, etc., contain copper in varying quan-

tities, and possess properties which render them indispensable for certain branches of the metal industry.

Mercury (Hg; atomic weight 200).-This remarkable metal, sometimes called quicksilver, has also been known from remote times, and, perhaps more than all others, has excited the attention and curiosity of experimenters by reason of its peculiar physical properties. Metallic mercury is occasionally found free, and in union with silver and gold, but its chief source is the sulphide or *cinnabar*. Mercury has a nearly silver-white color and a very high degree of lustre. It is liquid at ordinary temperatures and solidifies only when cooled to -40° F. In this state it is soft and malleable. The density of pure mercury is 13.596. It boils at 662° F., but volatilizes to a sensible extent at all temperatures. In regard to its behavior in the air, it is a medium between the metals, readily combining with oxygen and those which show no special affinity for it. Since it does not combine with oxygen at an ordinary temperature, and retains its metallic lustre even in a moist atmosphere, it is generally included among the so-called noble metals.

But when it is heated for some time to near its boiling point, it slowly absorbs oxygen and is gradually converted into a bright-red, crystalline powder—mercuric oxide. By heating the oxide thus formed somewhat more strongly, it is again decomposed into its constituents, oxygen and metallic mercury.

Mercury readily alloys or, as it is generally called, *amalgamates* with other metals, forming in many cases definite chemical combinations. The amalgams are either liquid, the degree of fluidity depending on the quantity of metals compounded with the mercury, or they form solid bodies with

#### SPECIAL PROPERTIES OF THE METALS.

perceptible crystallization and frequently a high degree of hardness. Several of these amalgams are employed in the arts, tin amalgam in the manufacture of mirrors, amalgams of tin, gold, and silver by dentists.

Silver (Ag; atomic weight 108).-This element is frequently found in the metallic or native state crystallized in cubes or octahedra, which are sometimes aggregated together. It is more frequently met with, however, in combination with sulphur, forming the sulphide of silver, which is generally associated with large quantities of the sulphides of lead, antimony, and iron. The metal has been known from very early times, and although quite widely diffused is found in comparatively small quantity, and hence bears a high value, which adapts it for a medium of currency. It has a characteristic (silver-white) color, which it retains even when fused in contact with air, and by reason of this property has to be classed with the noble metals. Its specific gravity is about 10.48 and may be increased by hammering. It is harder than gold, but somewhat softer than copper, and next to gold is the most ductile of all metals. It can be rolled out into thin leaves, so that a small quantity of silver suffices to cover a large surface, and on account of its toughness can be drawn out into wires so fine as to be scarcely perceptible by the naked eye. It melts at about 1680° F.; at a white heat a strong volatilization takes place, whereby the silver is converted into bluish-purple vapor. The behavior of silver when fused in contact with the air is very remarkable. It absorbs a considerable quantity of oxygen without, however, chemically combining with it, the oxygen being again expelled as the metal solidifies.

Silver is too soft to be worked by itself, pure silver being

only used for special purposes where the presence of another metal would exert an injurious effect. For all other purposes alloys of silver, especially such as contain a certain quantity of copper, are employed; silver coins and silver utensils consisting, for instance, of an alloy of silver and copper.

# 7. Gold Group. (Gold and Platinum.)

The metals belonging to this group are distinguished by a high specific gravity, and are the densest bodies known. Their chief characteristic is, however, their slight affinity for oxygen. They can be melted in contact with the air and exposed to the highest temperatures without combining with oxygen. Even their combinations with oxygen, which can be obtained in an indirect manner, are so unstable that on slight heating they yield up the oxygen and are decomposed, the pure metal being left behind. On account of being found in comparatively small quantities, they bear a high value and are the most precious of all metals.

Gold (Au; atomic weight 196).—Gold has been known from the earliest times, and its comparative rarity, its exceptional color, and its power of resisting atmospheric influences have caused it to be esteemed as one of the most precious metals. As might be expected from its want of direct attraction for oxygen, gold is one of those few metals which are always found in the metallic state; and it is remarkable as being one of the most widely distributed elements, although seldom met with in large quantity in any one locality. Gold has a beautiful yellow color, a strong metallic lustre unalterable in the air, a density of 19.5, is the most ductile of all metals, and can be drawn out into extremely fine wire. It

surpasses all other metals in malleability, and can be beaten out into thin leaves which transmit the light with a green color. It has a very high melting point (about 2372° F.) and becomes fluid only at a white heat. It can readily be volatilized at a high temperature produced by means of electricity.

Pure gold is nearly as soft as lead, so that articles manufactured from it would speedily wear out. In order to increase its hardness when used for articles of jewelry or coinage, it is alloyed with silver or copper or with both. It also alloys readily with most other metals.

Platinum (Pt; atomic weight 197.5).-This metal is always found in the metallic state in the form of grains and irregular pieces. As a rule it is, however, not pure, but the grains or pieces are generally associated with a group of other metals possessing similar properties, viz., rhodium, palladium, iridium, ruthenium, as well as gold, silver, and iron. Platinum has a gray-white color, resembling that of some brands of steel. It is heavier than gold, its specific gravity being 21.5. Up to the commencement of the present century platinum was considered infusible, but at the present time an quantity of platinum up to 450 pounds can be readily fused with the assistance of a heat produced by the use of an oxyhydrogen blow-pipe. Platinum is distinguished by great chemical indifference, it being scarcely acted upon by any single acid, but like gold only dissolves in a mixture of nitric acid and hydrochloric acid (nitromuriatic acid). On account of this indifference and its comparatively great hardness, it is especially used in the manufacture of chemical utensils, it being in this respect equal to gold but cheaper.

In a certain respect platinum has some similarity with

iron: It can be welded, and readily combines with carbon to a mass with a lower melting point than that of pure platinum. Hence, platinum vessels to be heated should always be provided with a coating of another metal to prevent it from absorbing carbon from the flame. Platinum forms alloys with most other metals.

# 8. Bismuth Group.

(Bismuth, antimony.)

*Bismuth* (Bi; atomic weight 210).—This element is found in the metallic state, as well as associated with sulphur, copper, and lead. It has a peculiar reddish lustre, a highly crystalline structure, and is little oxidized by the air. Its degree of hardness is small, but it is so brittle as to be readily pulverized in a mortar. It melts at about 500° F., and volatilizes at a high temperature. Its specific gravity is 9.79.

Bismuth being too brittle to be used by itself, its chief employment is in the preparation of certain alloys with other metals. Some kinds of type metal and stereotype metal contain bismuth, which confers upon them the property of expanding in the mould during solidification, so that they are forced into the finest lines of the impression. This metal is also remarkable for its tendency to lower the fusing-point of alloys, which cannot be accounted for merely by referring to the low fusing-point of the metal itself. It is also employed together with antimony in the construction of thermo-electric piles.

Antimony (Sb; atomic weight 120).—This metal occurs in a native state as well as in connection with other bodies, the sulphide of antimony—known as gray antimony ore, and occurring in long, needle-like crystals—being, however, the

chief source. Antimony has a bluish-white color, retains its lustre in the air, crystallizes in rhombohedrals, and has a specific gravity of 6.72. It melts at 842° F., and is volatile at a white heat. In contact with air at a red heat, it takes fire and burns with a white flame and the evolution of hot vapors, forming the trioxide. It is so brittle that it can be converted into a fine powder by pounding in a mortar, and hence, like bismuth, cannot be used by itself. It is, however, an important metal for the manufacture of several useful alloys, and possesses the property of increasing the hardness of a metal, even if only mixed with it in small quantity.

Arsenic (As; atomic weight 75).—This element is often classed among the metals on account of its physical properties, it having a metallic lustre and conducting electricity. But it is not capable of forming a base with oxygen, and the chemical character and composition of its compounds connects it in the closest manner with phosphorus. Arsenic is sometimes found native, but far more abundantly in connection with various metals, forming arsenides, which frequently accompany the sulphides of the same metals. In a pure state it is a light-gray body, which under exclusion of air shows a strong metallic lustre, but assumes a black color on coming in contact with air. It has a specific gravity of 5.7, and volatilizes at a red heat. If arsenic be thrown upon glowing coals, it volatilizes with the diffusion of a peculiar odor somewhat resembling that of garlic. An addition of arsenic renders metals harder and at the same time more brittle, and it is, therefore, somewhat employed in the manufacture of alloys. But, on account of its poisonous nature,

its use must be avoided in alloys to be employed for the manufacture of utensils in which food is to be preserved.

### Supplement.

An alloy, as generally understood, is a combination of two or more metals, but there are some so-called alloys consisting of but one metal, whose properties have been changed in a remarkable manner by the addition of a non-metallic element. It has been previously pointed out that the properties of iron are sensibly changed by a very small addition of sulphur or phosphorus, and that carbon acts in a similar manner. It will, therefore, be necessary to briefly describe these elements.

Sulphur (S; atomic weight 32).—This element is remarkable for its abundant occurrence in nature in the uncombined state. It is purified by distillation, and then forms a crystalline mass of a characteristic pale-yellow color, which melts at 232° F., and at about 780° F. is converted into ruby-colored vapors. By the admixture of organic substances sulphur acquires a black color in melting. The affinity of sulphur for most metals is so great that they combine with it with great If, for instance, copper be thrown into a vessel conenergy. taining sulphur heated to the boiling point, the combination takes place and is attended with vivid combustion. An intimate mixture of iron and sulphur needs only be slightly heated to effect the union of both bodies, which is accompanied by vivid glowing. The combination can even be introduced by moistening a large quantity of the mixture with water.

The combinations of the metals with sulphur are in most cases distinguished by a high degree of brittleness, a small admixture of sulphur being generally sufficient to impart to

#### SPECIAL PROPERTIES OF THE METALS.

them this property. And this property being by no means a desirable one, care should be had in making experiments in the preparation of alloys to use only metals absolutely free from sulphur. It may also be remarked that in such experiments the presence of every foreign body exerts a disturbing influence, and, in order to obtain satisfactory results, it is recommended to use only chemically pure metals.

Carbon (C; atomic weight 12).—Carbon is the most widely diffused element, it forming a never-wanting constituent of all animal and vegetable bodies. Few elements are capable of assuming so many different aspects as carbon. It is met with transparent and colorless in the diamond, opaque and black and quasi-metallic in graphite or black lead, velvety and porous in wood charcoal and, under new conditions, in anthracite, coke, and gas-carbon.

In nature carbon appears crystallized in the hexagonal form as graphite, in the tessular form as diamond, and amorphous as coal in the ordinary sense of the word.

For our purposes only the modifications known as graphite or plumbago and as amorphous coal are of interest.

Carbon, for which no actual solvent is known, has the remarkable property of dissolving in considerable quantities in several melted metals, the best known example of this being its behavior towards iron.

As is well known, in the manufacture of iron pure iron is never obtained, but the so-called cast-iron, which contains a certain quantity of carbon. There can be no doubt that the carbon is actually dissolved in the iron, for in cooling certain varieties of cast-iron containing much carbon a certain quantity of it is separated out in a crystalline form as graphite.

The content of carbon, as previously stated in speaking of

iron, exerts a considerable influence upon the qualities of a metal, the special properties of the various kinds of iron known as wrought-iron, steel, and cast-iron being chiefly due to the varying quantity of carbon they contain. Generally speaking, it may be said a content of carbon makes the metal more fusible, but it is impossible to state in a general way what other influence is exerted upon its properties, this influence depending essentially on the quantity admixed. It is, therefore, only possible to determine in each case the influence exerted upon the properties of a metal by the presence of carbon.

*Phosphorus* (P; atomic weight 31).—This element is never known to occur uncombined in nature, and its properties render the use of special precautions necessary for its management, it being very inflammable. A stick of phosphorus held in the air always appears to emit a whitish smoke, which in the dark is luminous, this effect being chiefly due to a slow combustion the phosphorus undergoes by the oxygen of the air. Larger quantities of phosphorus exposed to the air become so thoroughly heated by oxidation as to commence to melt and spontaneously ignite. A content of phosphorus in metals is only possible if ores containing phosphoric acid are used in their preparation, whereby a reduction of the phosphoric acid to phosphorus takes place, which combines with the metal.

In speaking of iron it has already been pointed out that a small content of phosphorus renders it red-short or hot-short, *i. e.*,, it makes it so brittle that it cannot be worked under the hammer even at red heat. If metals be intentionally mixed with phosphorus, the mixtures—they cannot be called alloys in the strict sense of the word—show also a high degree of

65

brittleness, though it is not so far-reaching as is the case with iron, and the metal acquires certain properties making it especially suitable for many purposes. The so-called phosphor-bronze consists of a mass which besides copper contains a very small quantity of phosphorus, and shows properties rendering it especially desirable for some uses.

| Name.  | Date of<br>Discovery.      | Name of<br>Discoverer.        | Specific<br>Gravity.                        | Melting Point.<br>Degrees F.                 |
|--|----------------------------|-------------------------------|---|--|
| Platinum   | 1741                       | Wood.<br>Descotils.           | 21.5<br>21.15                               |  |
| Iridium  | 1803                       | Descoths.                     | 19.26                                       | 2192° (?)                                    |
| Mercury<br>Palladium                                 | 1803                       | Wollaston.                    | $\begin{array}{c}15.5\\11.80\end{array}$    |  |
| Lead   | _                          | _                             | $\begin{array}{c} 11.33\\ 10.57\end{array}$ | $\begin{array}{c} 609.3 \\ 1832 \end{array}$ |
| Bismuth  |                            |                               | $\begin{array}{c}9.80\\8.94\end{array}$     | $500 \\ 2192(?)$                             |
| Nickel   |                            | Cronstedt.<br>Gahn ; Scheele. | $\begin{array}{c} 8.82 \\ 8.02 \end{array}$ | _  |
| $\begin{array}{cccccccccccccccccccccccccccccccccccc$ | _                          | _                             | 7.84<br>7.30                                | $3632(?) \\ 458.6$                           |
| Zine   | _                          | _                             | $\begin{array}{c} 7.13 \\ 6.80 \end{array}$ | $\begin{array}{c} 773.6\\842\end{array}$     |
| Aluminium · · ·<br>Magnesium · · ·                   | $     1828 \\     1829   $ | Wöhler.<br>Bussey.            | $\begin{array}{c} 2.56 \\ 1.74 \end{array}$ | 773.6  |
|  |                            |                               | •   | 5  |

The following table gives the specific gravities and melting points of the principal metals :

# CHAPTER IV.

# GENERAL PROPERTIES OF ALLOYS.

FROM what has been said in the preceding chapters it will be seen that the properties of the different metals vary very much, and that but few possess properties in common, to which expression has been given by arranging the allied metals in groups. It will next be necessary to consider the alterations which certain metals undergo by melting together or alloying.

a. LIQUATION. It has previously been mentioned that when melted alloys are slowly cooled below their fusing points, a separation into several alloys of different composition takes place. In the mass, while still liquid, the alloys with a higher fusing point solidify first, and the entire mass becomes only gradually solid by further cooling. The same process may also be induced by carefully heating a solid alloy; an alloy fusible at a lower temperature becoming liquid, and may frequently be entirely separated from an alloy fusing only at a higher temperature. This process, which resembles the dicintegration of chemical combinations, but as previously stated, depends solely on the difference in the solidifying or fusing points of solutions of varying compositions, is called liquation. In obtaining metals this process is occasionally made use of in order to separate a metal, or an alloy richer in noble metal, from another metal or another alloy (Pattinson's process, liquation of argentiferous lead from copper-thorn); however, in working metals, liquation is always troublesome, and it is, GENERAL PROPERTIES OF ALLOYS.

67

therefore, sought to avoid it as much as possible. Since the physical properties of an alloy-strength, ductility, hardness, color, etc.-are closely related to its average composition, and as a slight change in the latter frequently produces not inconsiderable variations, the properties of a piece of metal solidified with liquation will not only be different and less suitable for the intended purpose than would be the case with uniform solidification, but in various parts of the same article variations will show themselves, which may injure its usefulness or render it entirely useless. Generally speaking liquation shows itself the plainer and the variation in the composition of the alloy becomes the greater, the slower the process of cooling the fused alloys is effected. Hence, rapid cooling of an alloy while solidifying is an effective means of preventing liquation, or to limit it to a slighter degree.

From this it will be seen that the properties of one and the same alloy may be changed by remelting and renewed cooling, if in one case liquation is more promoted or rendered more difficult than in another; and further that liquation will appear to a greater extent the thicker the cross sections of a casting are.

Since in the solidification of liquid metals and alloys cooling progresses from the exterior towards the centre, advancing more rapidly here and more slowly there, a concentration of more refractory alloys usually takes place on the outside and one of more fusible alloys in the centre; but generally liquation is more perceptible in the centre of a casting than on the outside. However, since many bodies expand, hence, decrease their specific gravity, at the moment of solidification, and therefore float upon the non-solidified surface (ice upon water, solid cast-iron upon fused), it will be understood that

when liquation takes place, not only the exterior surfaces of the solidified piece of metal show a concentration of the more refractory alloy, but also the upper cross sections; while in other cases where this behavior does not take place, where briefly the alloy solidifying first is specifically heavier than that remaining fluid, it accumulates on the bottom of the piece of metal. Hence variations in the composition of the upper and lower cross-sections prove by no means, as has frequently been supposed, that a separation of alloys of different composition has taken place while in a fluid state, but only that the alloy first separated in consequence of liquation possessed at that temperature a different specific gravity from the non-solidified more readily fusible alloy; and from this it may be further inferred that in a cooled state the specific gravities of the separated alloys stand in the same relation to each other as at the moment of liquation, or in other words that, after cooling, the uppermost alloy is also specifically the lightest.

However, the property of liquation does not show itself to the same extent in all alloys. In some it is so strong that it cannot be avoided even with as rapid cooling as possible, while others scarcely show a trace of it even with quite slow cooling. Such alloys showing no liquation are sometimes called *constant alloys*. Such constant alloys occasionally separate from a larger group of liquating alloys containing the same metals, and are then generally composed according to definite atomic proportions, so that in this case the presence of an actual chemical combination may be inferred. Since, however, the formation of such chemical combinations depends undeniably on exterior conditions—temperature, duration of the liquid state, etc.—it is evident that the mode of

preparing the alloys is not without influence upon their power of liquation, and that many contradictions regarding the composition of constant alloys are met with even in the statements of reliable investigators.

Most copper-tin alloys show a very distinct tendency towards liquation, which generally increases with the content of tin. From alloys richer in copper, crystals richer in tin separate in the slower cooling portions of the casting, which may be plainly distinguished from the actual alloy by their lighter color and are called *tin-stains*. In alloys containing more than 50 per cent. tin, the upper cross sections are, according to Riche, richer in tin, and the lower richer in copper; in alloys poorer in tin no difference, however, is perceptible in the lower and upper cross sections. According to Künzel all copper-tin alloys with less than 5 per cent. tin (more than 95 per cent. copper) are constant, as well as an alloy of 17.7 per cent. tin and 82.3 per cent. copper (Cu<sub>17</sub>Sn<sub>2</sub>). Riche, however, gives the following alloys as constant: 38.2 per cent. tin with 61.8 per cent. copper (SnCu<sub>3</sub>) and 31.7 per cent. tin with 68.3 per cent. copper (SnCu<sub>4</sub>), and states that liquation is proportionately least in alloys in which the quantity of tin to copper is at the ratio of 1:5, the composition of which, therefore, approximately corresponds to the alloy Cu<sub>17</sub>Sn<sub>2</sub> designated as constant by Künzel.

By the addition of small quantities of zinc to copper-tin alloys, it is frequently endeavored to decrease their power of liquation. French pieces of ordnance examined by Riche, contained

|                      | Cu    | $\mathbf{Sn}$ | $\mathbf{Zn}$ | $\mathbf{Pb}$ |
|----------------------|-------|---------------|---------------|---------------|
| In the interior      | 89.44 | 8.91          | 1.39          | 0.16          |
| In the circumference | 89.04 | 9.51          | 1.30          | 0.16          |

while in the tin stains accumulated around the axes of the pieces of ordnance the content of tin amounted to 12.3 to 14.5 per cent. At any rate liquation was not considerable; and, what is remarkable, the average composition shows a concentration of the content of tin towards the circumference.\*

*Copper-zinc alloys* possess very 'little or no tendency towards liquation, and in this respect are favorably distinguished from the copper-tin alloys.

*Copper-lead alloys* show strong tendency towards liquation. From cupriferous lead the lead, by careful heating, may be melted out, the copper remaining behind in the form of socalled copper-thorns.

Silver-copper alloys have been examined by Levol and later on by Roberts, and nearly all showed strong tendency towards liquation, a fact which is of considerable importance as regards the use of such alloys for coins, and renders the preparation of blanks of uniform composition more difficult. Levol considers the alloy  $Ag_3Cu_2$  (containing 71.893 per cent. silver) as constant, and supposes that all other silver-copper alloys represent solutions of the above-mentioned alloy in an excess of copper or an excess of silver. Although the correctness of this theory may be combated, Levol's experiments show with

\*However, this proves by no means that the composition of the exterior parts, as found, accurately represents the composition of the alloy when originally solidifying. After solidification the erust formed on the circumference contracts, and thereby exerts a powerful pressure upon the more readily fusible alloys—in this case richer in tin—enclosed in the centre, whereby they are forced into the pores of the solidified crust. In some alloys richer in tin (bell bronzes) these alloys solidifying last, and forced through the pores of the crust, frequently apppear in the form of globules on the exterior surface of the casting and sometimes form masses of excrescences.

#### GENERAL PROPERTIES OF ALLOYS.

considerable certainty that of all silver-copper alloys, the composition mentioned above belongs to the alloys showing the least tendency towards liquation. In alloys with a larger content of silver than 71.893 per cent., the content of silver increases towards the centre of the casting, while in alloys poorer in silver, the content of copper increases in that direction. In an alloy with 69.5 per cent. silver, the upper cross sections were moreover richer in copper and the lower richer in silver.

Gold-copper alloys, of which Levol examined a series with 23.7 to 92.5 per cent. gold, showed scarcely any sign of liquation after actual alloying of the two metals had taken place; however, to effect this, especially with alloys richer in gold, several re-meltings and frequent stirring were required.

Gold-silver alloys behave, according to Levol's experiments, analogous to gold-copper alloys; i. e., they show no tendency towards liquation after actual alloying has taken place.

Lead-silver alloys possess strong tendency towards liquation, as shown by the use made of this behavior in the Pattinson process. Levol found the content of silver considerably greater in the centre of the cast and solidified alloys.

Zinc-tin alloys also show considerable liquation, especially when the content of zinc predominates.

b. SPECIFIC GRAVITY OF DENSITY. The specific gravity or density of alloys corresponds in an approximately accurate manner only in a few cases with that which would result by calculation from the specific gravities of the constituents and their percentage of content; *i. e.*, with the specific gravity which a purely mechanical mixture of the constituents would possess. In some cases the actual specific gravity is greater than the calculated, and, hence, condensation or concentration has resulted from the process of alloying; in others, it is

smaller, the volume of the alloy is greater, and, therefore, expansion has—at least apparently—taken place.

Since the relative determinations refer only to alloys in a solidified and cooled state, the change in volume-contraction or expansion-may be due to three different causes: It may be caused either by the alloying process itself, and hence take place while the constituents are in the liquid state; or, secondly, it may be due to a change in the co-efficient of expansion of the alloyed metal, the specific gravity of the cooled alloy, if the co-efficient increases, increasing with it; or, finally, the change may arise from a process which may be observed in many bodies at the moment of transition from the liquid into the solid state, and which consists in a more or less sudden expansion at the moment of solidification. It is well-known that the point of greatest density of water is 4.08° C. (39.34° F.), that by further cooling it expands and on freezing bursts the vessel containing it; another result of this expansion is that ice floats upon water. Many metals possess the same property, as may be proved notwithstanding many doubts raised against it.\* Now if the expansion of an alloy is greater than it should be in proportion to the expansion of the separate metals, the specific gravity will evidently be less after cooling; and vice versa. Although as regards the use of alloys for castings it would in every case be of importance to know to which of the above-mentioned

\* To prove that cast-iron actually expands in solidifying, Schott had a wheel cast in an iron mould which was divided into two equal halves by two radial cuts running normally to the circumference, but held together by a powerful spring. At the moment of solidification the two halves of the mould were forced apart so that the red-hot iron could be seen sparkling through a crack several millimeters wide, which became closed only on cooling.

#### GENERAL PROPERTIES OF ALLOYS.

causes the change in the specific gravity is due, determinations in this respect are entirely wanting. It must be confessed that reliable investigations in this direction would be beset with many difficulties, and hence, up to the present time, investigators have contented themselves with establishing the total increase or decrease in volume (condensation or expansion) in a cooled state by comparing the specific gravities of alloys resulting from calculation with those actually found.

However, the results of such investigation must be accepted with caution, because, as is well known, the specific gravity of every metal varies between wide limits, and is dependent upon the manner of its previous working and treatment. Hence for every experiment not only the specific gravity of each separate metal used has to be accurately determined, but care must also be taken to avoid as much as possible all sources of error, which may readily arise from the presence of gas bubbles or small hollow spaces in castings, by either converting the metals to a fine powder, or by getting rid of the hollow spaces by mechanical means previous to determining the specific gravity. With alloys it has further to be taken into consideration that in consequence of liquation the specific gravity varies in different places of the casting. Many investigators have committed the error of simply taking for the calculated specific gravity the arithmetical mean from the specific gravities of the constituents and the relative quantity of the latter. Thus if

M is the calculated specific gravity of the alloy, W and w the quantities by weight of the constituents, and P and p their specific gravities, they took

$$\mathbf{M} = \frac{\mathbf{W} \cdot \mathbf{P} + \mathbf{w} \cdot \mathbf{p}}{\mathbf{W} + \mathbf{w}}.$$

That this formula is wrong will be understood by taking into consideration that the specific gravity of a body is dependent upon its volume, that it is equal to its absolute weight divided by the weight of the water displaced by it. However, the weight of water which is displaced by W parts by weight of a body of specific gravity P is  $\frac{W}{P}$ ; the weight of water displaced by w parts by weight of a body of specific gravity p is  $\frac{W}{p}$ ; hence

$$M = \frac{W + w}{\frac{W}{P} + \frac{w}{p}} = \frac{(W + w) Pp}{Wp + wP}$$

Of the determinations of the specific gravities of alloys the following have been selected as the most reliable :

Copper-tin alloys. Determinations made by Riche and Thurston are given in the annexed table. To avoid the above mentioned source of error Riche determined the specific gravity with the assistance of metallic shavings which, to expel air enclosed between them, were boiled in the flask serving for the determination of the specific gravity. Thurston used small pieces as free from flaws as possible, and weighing from  $1\frac{3}{4}$  to  $2\frac{1}{2}$  ounces each. These pieces were cut from a bar previously used for determining the strength. To cleanse them they were first washed in alcohol, dried, boiled two or three hours in water to expel the air enclosed in the pores, and, after allowing them to cool in the vessel used for boiling, were brought under the receiver of an air-pump to completely remove any particles of air remaining, and then quickly into a beaker filled with distilled water, in which they were weighed, being suspended by means of a very fine platinum loop to the beam of the balance.

Specific gravities. Composition of the alloys examined. According to Riche. According to Thurston. Difference. Difference. Atomic formula. Calculated. Calculated. Contrac-tion. Contrac-tion. Expan-sion. Copper. Found. Found. Expan síon. Tin. 100.00 98.10 97.50 96.27  $8.791 \\ 8.564$ Cn 8.89 1.902.50 3.73 7.20 7.50 SnCu<sub>96</sub> \_ \_ \_ 8.511 \_ \_ \_ SnCu48 8.649 8.712 0.063 \_ SnCu<sub>34</sub> 8.694 8.684 92.80 \_ \_ 92.59 90.00 10.00 8.669 8.614 \_ 0.055SnCu16 0.1589.00 11.00 8.84 8.69  $12.50 \\ 13.43$ 8.648 87.50 SnCu<sub>12</sub> SnCu<sub>10</sub> 8.534 0.147 86.57 84.33 ----8.681 8.60 0.27 $15.67 \\ 17.50 \\ 18.85$ 8.87 82.50 8.792 \_ \_ SnCu. 8.84 0.30 81.15 8.54 20.00 8.740 8.444 0.29680.00 79.02 20.98SnCu<sub>7</sub> 8.72 8.50 0.228.917 77.50 22.50SnCu<sub>6</sub> 76.32 23.688.72 8.46 0.268.565(?) \_ 72.9172.5070.0027.0927.5030.00SnCu<sub>5</sub> 8.62 8.40 \_\_\_ 0.228.925 8.932 8.318 0.607 \_  $68.25 \\ 67.50 \\ 65.00$  $31.75 \\ 32.50$ SnCu<sub>4</sub> 8.938 8.907 8.75 8.32 0.43 8.250 0.688 \_ 8,947 8.956 35.00 \_\_\_\_ \_ \_\_\_ --\_ \_\_\_\_ 35.0037.5038.2942.5943.6847.5048.2052.0552.5052.5062.50  $61.71 \\ 57.50$ SnCu<sub>3</sub> 8.91 8.21 0.70 8.970 8.150 0.820 8.781  $56.32 \\ 52.50 \\ 51.80$ \_ Sn<sub>5</sub>Cu<sub>12</sub> \_ ----\_ 8.682 \_\_\_\_ 8.643 SnCu<sub>2</sub> 8.15 8 04 0.11 7.999 0.561 8.560 47.95 47.50  $8.442 \\ 8.446$ Sn7Cu12 ----55.3757.5058.26Sn<sub>2</sub>Cu<sub>3</sub> 7.93 0.13 8.312 7.893 0.419 44.63 8.06 42.5041.7439.208.437 Sn<sub>3</sub>Cu<sub>4</sub> Sn<sub>6</sub>Cu<sub>6</sub> ----8.302 \_ \_ \_ 60.86 8.182 37.5034.9528.7227.5024.3829.5062.5065.0571.2872.508.101 7.90 SnCu 7.79 7.755 0.258\_\_\_ 0.11 8.013 7.948 Sn<sub>4</sub>Cu<sub>3</sub> \_ 7.915 \_ \_ \_ \_ \_ \_\_\_\_ 75.62 Sn<sub>5</sub>Cu<sub>3</sub> 7.835 -\_ \_\_\_\_ \_ ----22.5021.1877.50 7.7747.77078.82 Sn<sub>2</sub>Cu 7.59 7.58 \_ 0.01 7.566 0.21417.50 82.50 7.690 84.81 87.50 88.16 90.30 15.19Sn₃Cu 7.44 7.500.06 7.657 7.487 0.170  $7.543 \\ 7.552$ 12.50----Sn₄Cu Sn₅Cu  $7.31 \\ 7.28$  $7.443 \\ 7.415$  $0.109 \\ 0.072$  $11.84 \\ 9.70$  $7.46 \\ 7.43$ 0.157.4877.4177.3600.15\_  $7.50 \\ 4.29$ 92.50 -\_ 95.71 Sn12Cu 7.346 0.014 \_\_\_ \_ -\_  $7.342 \\ 7.305$ 2.5097.50 \_ \_ \_\_\_ \_  $\frac{Sn_{48}Cu}{Sn_{96}Cu}$ 1.11 98.89 \_  $0.5\bar{5}$ 99.43 \_  $7.299 \\ 7.293$ \_ \_ 7.31 100.00

The numerical values found for the same alloys show, to be sure, quite considerable variations; but comparing the results

obtained as a whole they agree, in many important points. Both series show that when small quantities of tin are added to copper, the alloy, as might be expected on account of the smaller specific gravity of tin, becomes specifically lighter than copper, but as soon as the content of tin exceeds 10 per cent. the decrease in the specific gravity becomes less with an increasing content of tin than it should be according to calculation, i. e., with an increasing content of tin the alloys show an increasing condensation (contraction). From an alloy with 20 per cent. onward, this condensation increases to such an extent that the specific gravity of the alloys increases instead of decreases with the increasing content of tin, until, according to both series, it reaches the maximum in the alloy with 38.3 per cent. tin (SnCu<sub>3</sub>) and then gradually approaches again the specific gravity according to calculation. According to Thurston's series the condensation is so considerable that alloys with 22.5 to 38.29 per cent. tin are specifically heavier than pure copper, while, according to Riche, the specific gravity of one alloy only (SnCu<sub>3</sub>) exceeds that of copper. Alloys with less than 10 per cent. tin show, according to Thurston, slight expansion, as well as, according to Riche, alloys with less than 16 per cent. copper.

By heating to a red heat copper-tin alloys with a certain content of tin and tempering in water, and *vice versa* by reheating and subsequent slow cooling, the specific gravity is changed in a remarkable manner. From a series of experiments made in this direction, Riche obtained the following results:

Alloys with 20.80 per cent. tin.

Specific gravities.

|            | Ι.    | 11.   | III.  | IV.   | v.    | VI.   | VII.  | VIII. | IX.   | x.    |
|------------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|
| Cast       | 8.787 | 8.858 | 8.825 | 8.862 | 8.863 | 8.780 | 8.715 | 8.822 | 8.842 |       |
| Tempered   | 8.823 | 8.915 | 8.863 | 8.896 | 8.906 | _     |       |       | —     | 8.747 |
| Annealed . | 8.817 | 8.907 | 8.847 | 8.886 | 8.894 | 8.808 | 8.739 | 8.844 | 8.863 | —     |
| Tempered . | 8.849 | 8.927 | 8.874 | 8.907 | 8.922 | _     | -     |       |       | 8.871 |

Alloys with 18 per cent. tin.

|               |   |   |   |   |   |  |   |   |  |   |   | $\mathbf{S}$ | Specific gravities. |       |
|---------------|---|---|---|---|---|--|---|---|--|---|---|--------------|---------------------|-------|
|               |   |   |   |   |   |  |   |   |  |   |   |              | I.                  | 11.   |
| Cast $\ldots$ |   | • | • | • | • |  | • | • |  |   | • | •            | 8.737               | 8.873 |
| Annealed      |   |   |   |   |   |  |   |   |  |   |   |              | 8.733               | 8.863 |
| Tempered      | • |   |   |   |   |  |   | • |  | • |   |              | 8.763               | 8.911 |
| Annealed      |   |   |   |   |   |  |   |   |  |   |   |              | 8.753               | 8.889 |
| Tempered      |   |   |   |   |   |  |   |   |  |   |   |              | 8.775               | 8.926 |
| Tempered      |   |   |   |   |   |  |   |   |  |   |   |              | 8.786               | 8.927 |

# Alloys with 20 per cent. tin.

From a cast block weighing 4 lbs. four bars each weighing about  $4\frac{3}{4}$  ounces were cut and used for the experiments.

| Specific gr          | ravities. | Specific gra         | avities. |
|----------------------|-----------|----------------------|----------|
| І.                   | 11.       | III.                 | IV.      |
| Tempered 8.704       | 8.719     | Annealed 8.752       | 8.686    |
| Annealed 8.712       | 8.728     | Tempered 8.780       | 8.713    |
| Tempered 8.730       | 8.747     | Annealed 8.777       | 8.714    |
| Annealed 8.724       | 8.744     | Tempered 8.804       | 8.736    |
| Tempered 8.756       | 8.763     | Annealed 8.815       | 8.750    |
| Annealed 8.741       | 8.759     | Tempered 8.841       | 8.774    |
| Again annealed 8.751 | 8.769     | Again tempered 8.850 | 8.787    |
| Tempered 8.775       | 8.792     | Annealed 8.807       | 8.760    |

These experiments show that the specific gravity of coppertin alloys with 18 to 21 per cent. tin is progressively increased by repeated tempering, while annealing has a contrary, but less powerful effect, *i. e.* the decrease in the specific gravity produced by annealing is unable to equalize the increase by tempering, so that by alternate tempering and annealing a constant average increase in the density remains perceptible. The limit above which a repetition of annealing produces no effect has not been determined.

The increase in the specific gravities of the above-mentioned alloys by tempering may probably be closely related to liquation decreased by rapid cooling, and the decrease by annealing to liquation promoted by slow cooling.

Alloys poorer in tin, in which liquation, as a rule, is less perceptible, show, however, a different behavior. By rerepeated tempering and annealing, Riche found the following specific gravities:

# Alloys with 12 per cent. tin.

|                             |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | $\mathbf{S}$ | pe | ci | fic gravities. |
|-----------------------------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|--------------|----|----|----------------|
| $\operatorname{Tempered}$ . |   |   |   | • | • | • | • |   |   | • | • |   |   | • |   |              |    |    | 8.625          |
| Annealed .                  | • | • | • |   |   | • | • | • |   |   | • |   | • |   | • |              | •  |    | 8.632          |
| Tempered .                  |   |   |   |   |   | • |   | • | • | • |   | • | • | • |   |              | •  | •  | 8.624          |
| Annealed .                  |   | • |   | • | • | • | • | • | • | • | • | • |   | • | • | •            | •  | •  | 8.635          |
| Tempered .                  |   |   | • |   |   |   | • |   | • |   |   |   |   |   |   |              |    |    | 8.632          |

Alloys with 10 per cent. tin.

|          |       | Specific g | gravities. |       |
|----------|-------|------------|------------|-------|
|          | 1.    | 11.        | III.       | IV.   |
| Cast     | 8.564 | 8.677      | 8.684      | 8.491 |
| Tempered | 8.516 | 8.635      | 8.657      | 8.428 |
| Annealed | 8,528 | 8.643      | 8.670      | 8.431 |
| Tempered | 8.532 | 8.645      | 8.671      | 8.437 |
| Annealed | 8.536 | 8.648      | 8.674      | 8.434 |
| Tempered | 8.529 | 8.648      | 8.673      | 8.436 |
| Annealed | 8.526 | 8.643      | 8.676      | 8.436 |
| Tempered | 8.526 | 8.626      | 8.664      | 8.436 |
|          |       |            |            |       |

Further the same alloy

|                 | ~ Poonice 8 |       |
|-----------------|-------------|-------|
|                 | v.          | VI.   |
| Cast            | . 8.541     | 8.705 |
| Annealed        | . 8.491     | 8.689 |
| <b>Fempered</b> | 8.495       | 8.684 |
| Annealed        | . 8.504     | 8.692 |
| <b>Fempered</b> | . 8.505     | 8.693 |
| Annealed        | . 8.479     | 8.651 |
| ſempered        |             | 8.661 |
|                 |             |       |

( | | | | | | | | | | |

7

Alloys with 6 per cent. tin.

| Specific gravities. | Specific gravities.  |
|---------------------|----------------------|
| . I.                | II. III.             |
| Cast 8.537          | Cast 8.519 —         |
| Tempered 8.491      | Annealed 8.492 8.807 |
| Annealed 8.501      | Tempered 8.491 8.806 |
| Tempered 8.502      | Annealed 8.496 8.802 |
| Annealed 8.507      | Tempered 8.495 8.804 |
| Tempered 8.505      | Annealed 8.496 8.809 |

A glance at the above tables shows that, as in alloys richer in tin, an increase in the specific gravity cannot be obtained by repeated tempering and annealing, but that rather a decrease takes place, and that in some cases the effect of one tempering results in a decrease of density, and of annealing in an increase; further, that the poorer the alloy is in tin the sooner the limit is reached at which further treatment of the alloy produces no change in the specific gravity.

By mechanical working—hammering, pressing, rolling the specific gravity of copper-tin alloys is increased.

*Copper-zinc alloys.*—By experiments executed in the same manner as with copper-tin alloys, Riche obtained the following results :

Specific gravities.

| Composit                  | ion of the amined.                                       | alloys ex-   | Specific gravities.                                    |                           |                       |                         |  |  |  |  |
|---------------------------|--|--|--|---------------------------|-----------------------|-------------------------|--|--|--|--|
|                           |  |  |  | Calcu-                    | Difference.           |                         |  |  |  |  |
| Copper.                   | oper. Zinc. formula.                                     | Found.   | lated.   | Expan-<br>sion.           | Contrac-<br>tion.     |                         |  |  |  |  |
| 100.00<br>90.65           | 9.35   | ZnCu <sub>10</sub>   | 8.890<br>8.834   | 8.707                     |                       | 0.127                   |  |  |  |  |
| $85.34 \\ 79.51 \\ 65.98$ | $\begin{array}{c} 14.66 \\ 20 \ 49 \\ 34.02 \end{array}$ | $rac{\mathrm{ZnCu}_6}{\mathrm{ZnCu}_4}$<br>$\mathrm{ZnCu}_2$                      | $\begin{array}{c} 8.584 \\ 8.367 \\ 8.390 \end{array}$ | $8.602 \\ 8.489 \\ 8.345$ | $0.018 \\ 0.122 \\ -$ | 0.045                   |  |  |  |  |
| $59.26 \\ 49.23 \\ 39.27$ | $\begin{array}{c} 40.74 \\ 50.76 \\ 60.73 \end{array}$   | $egin{array}{c} { m Zn}_2{ m Cu}_3 \ { m ZnCu} \ { m Zn}_3{ m Cu}_2 \end{array}$   | $\begin{array}{c} 8.329 \\ 8.304 \\ 8.171 \end{array}$ | $8.119 \\ 7.947 \\ 7.783$ | -                     | 0.210<br>0.357<br>0.388 |  |  |  |  |
| $32.66 \\ 19.52 \\ 10.82$ | $\begin{array}{r} 67.14 \\ 80.48 \\ 89.18 \end{array}$   | $\begin{array}{c} \mathrm{Zn_2Cu}\\ \mathrm{Zn_4Cu}\\ \mathrm{Zn_8Cu} \end{array}$ | $8.048 \\ 7.863 \\ 7.315$                              | $7.679 \\ 7.478 \\ 7.351$ | 0.036                 | 0.369<br>0.385<br>—     |  |  |  |  |
|                           | 100.00   | Zn   | 7.200  |                           | -                     | -                       |  |  |  |  |

Similar figures were obtained by Calvert and Johnson. While with an increasing content of zinc a steady reduction in the specific gravity seems to take place, alloys with 40 to 80 per cent. zinc show quite considerable contraction.

A series of experiments similar to the above mentioned with copper-tin alloys made by Riche show 1, that the specific gravity of copper-zinc alloys richer in zinc (35 per cent.) is increased by mechanical working as well as by tempering, such increase, however, being largely and occasionally almost entirely equalized by annealing; and 2, that the specific gravities of alloys poor in zinc (9 per cent.) are not effected by such treatment.

*Copper-zinc alloys.* Karmarsch has determined the specific gravities of copper-silver alloys in a coined state (coins) to remove the influence of porosity, and found the values given in the subjoined table.

|         | Composition of the alloys examined. Specific gravities. |        |             |            |              |  |
|---------|---|--------|-------------|------------|--------------|--|
| Silver. | Copper.   | Found. | Calculated. | Diffei     | rence.       |  |
|         |   |        |             | Expansion. | Contraction. |  |
| 100     |   | 10.547 |             |            |              |  |
| 94.4    | 5.6   | 10.358 | 10.399      | 0.041      | _            |  |
| 89.3    | 10.7  | 10.304 | 10.351      | 0.047      | ·            |  |
| 81.0    | 19.0  | 10.164 | 10.203      | 0.039      | _            |  |
| 75.0    | 25.0  | 10.065 | 10.098      | 0.033      | _            |  |
| 66.3    | 33.7  | 9.927  | 9.951       | 0.024      |              |  |
| 62.5    | 37.5  | 9.870  | 9.890       | 0.020      |              |  |
| 56.25   | 43.75   | 9.761  | 9.786       | 0.025      |              |  |
| 51.21   | 48.79   | 9.679  | 9.706       | 0.027      |              |  |
| 49.65   | 50.35   | 9.650  | 9.681       | 0.031      | —            |  |
| 42.43   | 57.57   | 9.532  | 9.568       | 0.036      |              |  |
| 36.7    | 63.3  | 9.439  | 9.482       | 0.043      |              |  |
| 33.3    | 66.7  | 9.383  | 9.430       | 0.047      |              |  |
| 30.4    | 69.6  | 9.333  | 9.386       | 0.053      | -            |  |
| 29.5    | 70.5  | 9.317  | 9.371       | 0.054      | _            |  |
| 22.4    | 77.6  | 9.203  | 9.269       | 0.066      |              |  |
| 22.0    | 78.0  | 9.190  | 9.264       | 0.074      | _            |  |
|         | 100   | 8.956  | -           | _          | _            |  |
|         |   | 1      |             |            |              |  |

The series throughout shows expansion, it being most pronounced in alloys richest in copper, then decreases regularly to the alloy with 37.5 per cent. copper and from there on increases again with the increasing content of silver. Nevertheless the greatest expansion does not attain the same extent as that in copper-tin and copper-zinc alloys.

*Copper-gold alloys.* Roberts has determined the specific gravities of some alloys richer in gold in the form of blanks, and obtained the following values:

| Composit<br>alloys ex | ion of the amined. | Specific gravities. |             |             |              |  |  |  |  |
|-----------------------|--------------------|---------------------|-------------|-------------|--------------|--|--|--|--|
| Gold.                 | Copper.            | Found.              | Calculated. | Difference. |              |  |  |  |  |
|                       |                    |                     |             | Expansion.  | Contraction. |  |  |  |  |
| 100                   |                    | 19.3203             | ×           | _           |              |  |  |  |  |
| 98.01                 | 1.99               | 18.8335             | 18.8355     |             | 0.0030       |  |  |  |  |
| 96.88                 | 3.12               | 18,5805             | 18.5804     |             | 0.0001       |  |  |  |  |
| 95.83                 | 4.17               | 18.3562             | 18.3605     | 0.0043      |              |  |  |  |  |
| 94.84                 | 5.16               | 18.1173             | 18.1378     | 0.0205      |              |  |  |  |  |
| 93.85                 | 6.15               | 17.9340             | 17.9301     |             | 0.0039       |  |  |  |  |
| 93.20                 | 6.80               | 17.7911             | 17.7956     | 0.0045      |              |  |  |  |  |
| 92.28                 | 7.72               | 17.5680             | 17.6087     | 0.0407      | -            |  |  |  |  |
| 90.05                 | 9.95               | 17.1653             | 17.1750     | 0.0097      | -            |  |  |  |  |
| 88.05                 | 11.95              | 16.6082             | 16.8047     | -           | 0.0015       |  |  |  |  |
| 86.14                 | 13.86              | 16.4832             | 16.4630     |             | 0.0202       |  |  |  |  |
| _                     | 100.00             | 8.725               | -           | . —         | —            |  |  |  |  |
|                       | 1                  | 1                   |             | 1           |              |  |  |  |  |

According to the above table neither regularly progressing expansion nor contraction takes place. In most cases the difference between the found and calculated specific gravities is extremely small, and hence it may be supposed that a change in volume is not caused, at least not in the alloys examined. For practical life this is of importance in so far as it allows of calculating the content of gold in a gold coin from its specific gravity.

Silver-gold alloys. Determinations by A. Matthiessen gave the following results :

| Composition of the alloys examined. |        |                    | Specific gravities. |        |                 |                   |  |  |  |
|-------------------------------------|--------|--------------------|---------------------|--------|-----------------|-------------------|--|--|--|
| <u> </u>                            |        |                    |                     | Calcu- | Diffe           | rence.            |  |  |  |
| Silver.                             | Gold.  | Atomic<br>formula. | Found.              | lated. | Expan-<br>sion. | Contrac-<br>tion. |  |  |  |
| 100.0                               | _      | Ag                 | 10.468              | _      | _               | _                 |  |  |  |
| 76.5                                | 23.5   | Ag <sub>6</sub> Au | 11.760              | 11.715 | —               | 0.045             |  |  |  |
| 68.7                                | 31.3   | Ag₄Au              | 12.257              | 12.215 | —               | 0.042             |  |  |  |
| 52.3                                | 47.7   | Ag <sub>2</sub> Au | 13.432              | 13.383 |                 | 0.049             |  |  |  |
| 35.4                                | - 64.6 | AgAu               | 14.870              | 14.847 |                 | 0.023             |  |  |  |
| 21.5                                | 78.5   | AgAu <sub>2</sub>  | 16.354              | 16.315 | _               | 0.039             |  |  |  |
| 12.0                                | 88.0   | AgAu <sub>4</sub>  | 17.540              | 17.493 |                 | 0.047             |  |  |  |
| 8.3                                 | 91.7   | AgAu <sub>6</sub>  | 18.041              | 17.998 |                 | 0.043             |  |  |  |
| -                                   | 100.0  | Ău                 | 19.265              |        | _               | -                 |  |  |  |
|                                     |        |                    | I                   |        | 1               |                   |  |  |  |

Hence in alloying the two metals contraction, though to an inconsiderable extent, takes place throughout.

Lead-gold alloys, according to Matthiessen :

| Composition of the alloys examined.       |  |   | Specific gravities. |                    |                   |                  |  |  |  |  |
|---|--|---|---------------------|--------------------|-------------------|------------------|--|--|--|--|
|   |  |   |                     | Calcu-             | Difference.       |                  |  |  |  |  |
| Silver.                                   | lver. Lead. Atomic<br>formula.             | Found.                                    | lated.              | Expan-<br>sion.    | Contrac-<br>tion. |                  |  |  |  |  |
| 100                                       |  | Pb  | 11.376              |                    | _                 |                  |  |  |  |  |
| $\begin{array}{c} 91.3\\ 84.0\end{array}$ | $\begin{array}{c} 8.7 \\ 16.0 \end{array}$ | Pb <sub>10</sub> Au<br>Pb <sub>5</sub> Au | $11.841 \\ 12.274$  | $11.794 \\ 12.171$ | _                 | $0.047 \\ 0.103$ |  |  |  |  |
| 80.8                                      | 19.2                                       | Pb <sub>4</sub> Au                        | 12.445              | 12.346             | _                 | 0.099            |  |  |  |  |
| 76.1                                      | 23.9                                       | Pb <sub>3</sub> Au                        | 12.737              | 12.618             | _                 | 0.119            |  |  |  |  |
| 67.7                                      | 32.3                                       | $Pb_2Au$                                  | 13.306              | 13.103             | -                 | 0.203            |  |  |  |  |
| 51.2                                      | 48.8                                       | PbAu                                      | 14.466              | 14.210             | -                 | 0.256            |  |  |  |  |
| 34.6                                      | 65.4                                       | PbAu <sub>2</sub>                         | 15.603              | 15.546             |                   | 0.057            |  |  |  |  |
| 20.8                                      | 79.2                                       | PbAu <sub>4</sub>                         | 17.013              | 16.832             |                   | 0.181            |  |  |  |  |
|   | 100  | Au  | 19.265              |                    | -                 | -                |  |  |  |  |

Hence contraction takes place in all proportions and is considerably greater than in silver-gold alloys.

|  | Composition of the alloys examined.                                |   |   | Specific gravities.  |                                  |                             |  |
|--|--|---|---|----------------------|----------------------------------|-----------------------------|--|
| Silver.  | Lead.  | Atomic<br>formula.  | Found.  | Calcu-<br>lated.     | Diffe<br>Expan-                  | contrac-                    |  |
| $\begin{array}{c} 100.0\\ 67.6\\ 51.0\\ 34.2\\ 20.6\\ 11.5\\ 4.5\\ 2.0\\ -\end{array}$ | 32.4     49.0     65.8     79.4     88.5     95.5     98.0     100 | $\begin{array}{c} Ag\\ Ag_4Pb\\ Ag_2Pb\\ AgPb_2\\ AgPb_2\\ AgPb_4\\ AgPb_{10}\\ AgPb_{25}\\ Pb \end{array}$ | $\begin{array}{c} 10.468\\ 10.800\\ 10.925\\ 11.054\\ 11.144\\ 11.196\\ 11.285\\ 11.334\\ 11.376\\ \end{array}$ | $\begin{array}{r} &$ | 0.031<br>0.067<br>0.042<br>0.021 | 0.054<br>0.031<br>0.006<br> |  |

Silver-lead alloys, according to Matthiessen :

The above table shows a quite regular course. The alloys richest in lead possess a less specific gravity than calculated, the difference rising with the content of silver until the latter amounts to 11.5 per cent. From here on the difference decreases with a further increase in the content of silver, and with 34 per cent. silver contraction instead of expansion takes place, the extent of contraction growing also with the content of silver.

Antimony-tin alloys, according to Long:

| Composition of the alloys examined. |  | Specific gravities.  |   |                  |                  |                   |
|-------------------------------------|--|----------------------|---|------------------|------------------|-------------------|
|                                     |  |                      |   | Calcu-           | Difference.      |                   |
| Anti-<br>mony.                      | Tin.                                       | Atomic<br>formula.   | Found.  | lated.           | Expan-<br>sion.  | Contrac-<br>tion. |
| 100.0                               |  | Sb                   | 6.713   |                  |                  | _                 |
| 92.6                                | $\begin{array}{c} 7.4 \\ 10.8 \end{array}$ | $Sb_{12}Sn$          | $\begin{array}{r} 6.739 \\ 6.747 \end{array}$ | $6.752 \\ 6.770$ | 0.013            |                   |
| $89.2 \\ 88.1$                      | 10.8                                       | $Sb_8Sn$<br>$Sb_4Sn$ | 6.747<br>6.781                                | 6.817            | $0.023 \\ 0.036$ |                   |
| 67.7                                | 32.3                                       | $Sb_4Sn$             | 6.844   | 6.889            | 0.030            |                   |
| 51.4                                | 48.6                                       | Sb2051               | 6.929   | 6.984            | 0.055            |                   |
| 34.5                                | 65.5                                       | SbSn,                | 7.023   | 7.082            | 0.059            |                   |
| 26.0                                | 74.0                                       | $SbSn_3^2$           | 7.100   | 7.133            | 0.033            |                   |
| 17.4                                | 82.6                                       | SbSn <sub>5</sub>    | 7.140   | 7.186            | 0.046            | _                 |
| 9.5                                 | 90.5                                       | SbSn <sub>10</sub>   | 7.208   | 7.234            | 0.026            |                   |
| 5.0                                 | 95.0                                       | SbSn <sub>20</sub>   | 7.276   | 7.262            | - 1              | 0.014             |
| 2.1                                 | 97.9                                       | $SbSn_{50}^{20}$     | 7.279   | 7.281            | 0.002            | —                 |
| 1.0                                 | 99.0                                       | $SbSn_{100}$         | 7.284   | 7.287            | 0.003            | _                 |
|                                     | 100.0                                      | $\mathbf{Sn}$        | 7.294   |                  | _                |                   |
|                                     |  |                      | 11  |                  |                  |                   |

Hence expansion takes place almost throughout, increasing from both ends of the series and reaching the highest extent in alloys containing from 50 to 65 per cent. tin. Deviations from the regular course of the series may probably be due to fortuitous circumstances in the preparation of the alloys.

Antimony-bismuth alloys, according to Holzmann :

| Composition of the alloys examined.   |   |   | Specific gravities.  |   |                 |                                      |
|---|---|---|--|---|-----------------|--------------------------------------|
|   |   |   |  | Calcu-                                    | Diffe           | rence.                               |
| Anti-<br>mony.  | Bismuth.                                    | Atomic<br>formula.  | Found.   | lated.                                    | Expan-<br>sion. | Contrac-<br>tion.                    |
| $ \begin{array}{r} 100 \\ 54.0 \\ 37.1 \\ 22.7 \\ 12.8 \\ 8.9 \\ - \\ \end{array} $ | 46.0<br>62.9<br>77.3<br>87.2<br>91.1<br>100 | $\begin{array}{c} Sb\\ Sb_2Bi\\ SbBi\\ SbBi_2\\ SbBi_4\\ SbBi_6\\ Bi\\ \end{array}$ | $\begin{array}{r} 6.713 \\ 7.864 \\ 8.392 \\ 8.886 \\ 9.277 \\ 9.435 \\ 9.823 \end{array}$ | 78.56<br>83.85<br>88.88<br>92.72<br>94.33 | 0.002           | 0.008<br>0.007<br>0.005<br>0.002<br> |

The difference between calculated and found specific gravities is so small that, at least with alloys purer in antimony, it may be supposed that the volume remains unchanged. A slight contraction seems to take place only with a higher content of antimony.

| Composition of the alloys examined. |   | Specific gravities. |                  |                  |                  |                   |
|-------------------------------------|---|---------------------|------------------|------------------|------------------|-------------------|
|                                     |   |                     |                  | Calcu-           | Diffe            | rence.            |
| Anti-<br>mony.                      | Lead.                                       | Atomic<br>formula.  | Found.           | lated.           | Expan-<br>sion.  | Contrac-<br>tion. |
| 100.0                               |   | Sb                  | 6.713            |                  |                  |                   |
| $54.1 \\ 37.1$                      | $\begin{array}{c} 45.9 \\ 62.9 \end{array}$ | $Sb_2Pb$<br>SbPb    | 8.201            | 8.268            | 0.067            |                   |
| 22.7                                | 77.3  | SbPb,               | $8.989 \\ 9.811$ | $9.045 \\ 9.822$ | $0.056 \\ 0.011$ | _                 |
| 16.4                                | 83.6  | SbPb.               | 10.144           | 10.211           | 0.067            |                   |
| 10.5                                | 89.5  | SbPb <sub>5</sub>   | 10.586           | 10.599           | 0.013            | _                 |
| 5.5                                 | 94.5  | SbPb <sub>10</sub>  | 10.930           | 10.952           | 0.022            | _                 |
| 2.3                                 | 97.7  | $SbPb_{25}$         | 11.194           | 11.196           | 0.002            | —                 |
|                                     | 100   | Pb                  | 11.376           |                  | -                | _                 |

Antimony lead-alloys according to Matthiessen :

Hence, as far as this series extends, expansion takes place throughout in alloying. In alloys with more than 22 per cent. antimony, Riche also found expansion, but contraction in alloys poorer in antimony and richer in lead, the maximum of 0.023 being reached in an alloy with about 90 per cent. lead (SbPb<sub>5</sub>).

Calvert and Johnson found expansion in all antimony-lead alloys.

Tin-cadmium alloys, according to Matthiessen :

| Compo                                       | Composition of the alloys examined. |                             | Specific gravities. |                  |                 |                   |
|---|-------------------------------------|-----------------------------|---------------------|------------------|-----------------|-------------------|
|   |                                     |                             |                     | Calcu-           | Diffe           | rence.            |
| Tin.  | Cad-<br>mium.                       | Atomic<br>formula.          | Found.              | lated.           | Expan-<br>sion. | Contrac-<br>tion. |
| 100.0                                       |                                     | Sn                          | 7.294               |                  |                 |                   |
| $\begin{array}{c} 86.1 \\ 80.5 \end{array}$ | $13.9 \\ 19.5$                      | Sn <sub>6</sub> Cd<br>Sn₄Cd | $7.434 \\ 7.489$    | $7.456 \\ 7.524$ | 0.022<br>0.035  | _                 |
| 73.2  | 26.8                                | Sn <sub>2</sub> Cd          | 7.690               | 7.687            | _               | 0.003             |
| 50.8  | 49.2                                | SnCd                        | 7.904               | 7.905            |                 | 0.001             |
| 34.1  | 65.9                                | $SnCd_2$                    | 8.139               | 8.137            | -               | 0.002             |
| 20.5  | 79.5                                | $SnCd_4$                    | 8.336               | 8.335            | -               | 0.001             |
| 14.7  | 85.3                                | SnCd <sub>6</sub>           | 8.432               | 8.424            | -               | 0.008             |
| -   | 100.0                               | Cd                          | 8.655               | _                | _               | -                 |
|   |                                     |                             |                     |                  |                 | 1                 |

The alloys richer in tin plainly show expansion, which, however, disappears when the content of tin amounts to less than about 75 per cent.

Tin-bismuth alloys, according to Carty :

| Сотро | Composition of the alloys examined. |                       | Specific gravities. |        |                 |                   |
|-------|-------------------------------------|-----------------------|---------------------|--------|-----------------|-------------------|
|       |                                     |                       |                     | Calcu- | Diffe           | rence.            |
| Tin.  | Bismuth.                            | Atomic<br>formula.    | Found.              | lated. | Expan-<br>sion. | Contrac-<br>tion. |
| 100.0 |                                     | Sn                    | 7.294               |        |                 |                   |
| 92.4  | 7.6                                 | $Sn_{2}Bi$            | 7.438               | 7.438  | l               | _                 |
| 69.0  | 31.0                                | $Sn_4Bi$              | 7.943               | 7.925  | _               | 0.018             |
| 62.5  | 37.5                                | $Sn_{3}Bi$            | 8.112               | 8.071  | _               | 0.041             |
| 52.7  | 47.3                                | $Sn_2Bi$              | 8.339               | 8.305  | _               | 0.034             |
| 35.8  | 64.2                                | $\operatorname{SnBi}$ | 8.772               | 8.738  | _               | 0.034             |
| 21.8  | 78.2                                | ${ m SnBi}_2$         | 9.178               | 9.132  | —               | 0.046             |
| 12.2  | 87.8                                | ${ m SnBi}_4$         | 9.435               | 9.423  |                 | 0.012             |
| 3.3   | 96.7                                | ${ m SnBi}_8$         | 9.614               | 9.606  |                 | 0.008             |
| 2.3   | 97.7                                | $\mathrm{SnBi}_{12}$  | 9.675               | 9.674  | _               | 0.001             |
| 1.3   | 98.7                                | $\mathrm{SnBi}_{20}$  | 9.737               | 9.731  |                 | 0.006             |
| 0.5   | 99.5                                | $\mathrm{SnBi}_{60}$  | 9.774               | 9.792  | 0.018           | -                 |
| -     | 100.0                               | Bi                    | 9.823               |        | —               | _                 |
|       | 1                                   |                       |                     |        |                 |                   |

These alloys show contraction almost throughout, it reaching its greatest extent in the alloy with 78 per cent. bismuth, and from there on decreases with an increasing content of bismuth and decreasing content of tin. Riche obtained very similar results, he finding the maximum contraction in the alloy  $Sn_2Bi_5$ .

| Composition of the alloys examined. |                                 | Specific gravities. |        |                 |              |        |
|-------------------------------------|---------------------------------|---------------------|--------|-----------------|--------------|--------|
|                                     |                                 |                     |        | Calcu-          | Diffe        | rence. |
| Tin.                                | Fin. Silver. Atomic<br>formula. | Found.              | lated. | Expan-<br>sion- | Contraction. |        |
| 100.0                               |                                 | Sn                  | 7.294  | _               |              | -      |
| 95.1                                | 4.9                             | Sn <sub>18</sub> Ag | 7.421  | 7.404           | _            | 0.017  |
| 90.6                                | 9.4                             | $Sn_9Ag$            | 7.551  | 7.507           | -            | 0.044  |
| 86.5                                | 13.5                            | $Sn_6Ag$            | 7.666  | 7.603           | -            | 0.063  |
| 76.3                                | 23.7                            | Sn <sub>3</sub> Ag  | 7.963  | 7.858           |              | 0.105  |
| 68.2                                | 31.8                            | $Sn_2Ag$            | 8.223  | 8.071           | -            | 0.152  |
| 52.2                                | 47.8                            | SnAg                | 8.828  | 8.543           | -            | 0.205  |
| 34.9                                | 65.1                            | $SnAg_2$            | 9.507  | 9.086           | -            | 0.421  |
| 21.1                                | 78.9                            | $SnAg_4$            | 9.953  | 9.585           |              | 0.368  |
| _                                   | 100.0                           | Ag                  | 10.468 | -               | -            |        |

Tin-silver alloys, according to Holzmann :

All alloys show considerable contraction, which generally increases with the content of silver and reaches its maximum with 65 per cent. silver.

Tin-lead alloys, according to Long :

| Compo | Composition of the alloys<br>examined. |                              |        | Specific gravities. |                 |                   |  |
|-------|--|------------------------------|--------|---------------------|-----------------|-------------------|--|
|       |  |                              | Calcu- | Difference.         |                 |                   |  |
| Tin.  | Silver.                                | Silver. Atomic F<br>formula. | Found. | lated.              | Expan-<br>sion. | Contrac-<br>tion. |  |
| 100.0 |  | Sn                           | 7.924  | _                   | _               | _                 |  |
| 77.0  | 23.0                                   | $Sn_6Pb$                     | 7.927  | 7.948               | 0.021           |                   |  |
| 69.0  | 31.0                                   | $Sn_4Pb$                     | 8.188  | 8.203               | 0.015           | _                 |  |
| 52.7  | 47.3                                   | $\mathrm{Sn}_{2}\mathrm{Pb}$ | 8.779  | 8.781               | 0.002           |                   |  |
| 35.8  | 64.2                                   | SnPb                         | 9.460  | 9.474               | 0.014           | _                 |  |
| 21.8  | 78.2                                   | $\operatorname{SnPb}_2$      | 10.080 | 10.136              | 0.056           |                   |  |
| 12.2  | 87.8                                   | $\operatorname{SnPb}_4$      | 10.590 | 10.645              | 0.055           | _                 |  |
| 8.5   | 91.5                                   | $\operatorname{SnPb}_6$      | 10.815 | 10.857              | 0.042           | _                 |  |
| _     | 100.0                                  | Pb                           | 11.376 |                     |                 | -                 |  |
|       | 1                                      | 1                            | 1      |                     | 1               |                   |  |

All the tin-lead alloys examined show expansion, the maximum being reached with a content of lead of about 80 per cent. Pillichody obtained similar results, only he found considerably greater expansion (minimum 0.29 in the alloy  $\text{SnPb}_4$ ; maximum in the alloy  $\text{SnPb}_4$ ; Kupffer, Thompson, as well as Calvert and Johnson, found expansion throughout.

Tin-gold alloys, according to Holzmann :

|            | Composition of the alloys examined. |  |                | Specific gravities. |                   |          |  |
|------------|-------------------------------------|--|----------------|---------------------|-------------------|----------|--|
|            |                                     |  |                | Calcu-              | Difference.       |          |  |
| Tin        | Gold.                               | Atomic<br>formula.                         | Found. lated.  | Expan-<br>sion.     | Contrac-<br>tion. |          |  |
| 100.0 96.6 |                                     | Sn<br>Sn Au                                | 7.294<br>7.441 | 7.446               | 0.005             |          |  |
| 90.7       | 9.3                                 | Sn <sub>50</sub> Au<br>Sn <sub>15</sub> Au | 7.801          | 7.440               | 0.005             | 0.015    |  |
| 84.2       | 15.8                                | Sn <sub>9</sub> Au                         | 8.118          | 8.092               | _                 | 0.026    |  |
| 77.9       | 22.1                                | Sn <sub>6</sub> Au                         | 8.470          | 8.452               | _                 | 0.018    |  |
| 70.3       | 29.7                                | Sn <sub>4</sub> Au                         | 8.931          | 8.951               | 0.020             |          |  |
| 63.8       | 36.2                                | Sn <sub>3</sub> Au                         | 9.405          | 9.407               | 0.002             |          |  |
| 59.5       | 40.5                                | Sn <sub>5</sub> Au <sub>2</sub>            | 9.715          | 9.743               | 0.028             | _        |  |
| 54.0       | 46.0                                | Sn <sub>2</sub> Au                         | 10.168         | 10.206              | 0.038             | -        |  |
| 47.0       | 53.0                                | Sn <sub>3</sub> Au <sub>2</sub>            | 10.794         | 10.885              | 0.091             |          |  |
| 37.0       | 63.0                                | SnAu                                       | 11.833         | 11.978              | 0.145             | <u> </u> |  |
| 22.7       | 77.3                                | SnAu <sub>2</sub>                          | 14.243         | 14.028              | -                 | 0.216    |  |
| 12.8       | 87.2                                | $\operatorname{SnAu}_4$                    | 16.367         | 15.913              |                   | 0.454    |  |
| _          | 100.0                               | Au   | 19.265         |                     | -                 |          |  |
|            |                                     |  |                |                     | 1                 |          |  |

This series exhibits a peculiar course: The alloys richest in gold show strong contraction, those with a medium content of gold, expansion, and those lowest in gold, again slight contraction. It must, however, be remarked that with the great difference in the specific gravities of the separate materials constituting the alloys, every small variation in the actual specific gravity and that upon which the calculation is based is more perceptible than with approximately equal specific gravities, and hence a small error—especially in the last mentioned contraction—may perhaps be supposed.

| $\begin{tabular}{ c c c c c c c c c c c c c c c c c c c$ | Compos | Composition of the alloys examined. |    |        | Specific gravities. |       |                   |  |
|--|--------|-------------------------------------|----|--------|---------------------|-------|-------------------|--|
| $ \begin{array}{c c c c c c c c c c c c c c c c c c c $  |        |                                     |    |        |                     | Diffe | rence.            |  |
| $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$   |        | Bismuth.                            |    | Found. |                     | 1     | Contrac-<br>tion. |  |
| $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$   | 100.0  | _                                   | Cd | 8.655  |                     |       |                   |  |
| $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$   |        |                                     |    | 9.079  | 9.067               | -     | 0.012             |  |
| $\begin{array}{c ccccccccccccccccccccccccccccccccccc$    |        |                                     |    | 9.195  | 9.181               | i —   | 0.014             |  |
| $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$   |        |                                     |    | 9.388  | 9.380               |       | 0.008             |  |
| $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$   |        |                                     |    | 9.554  | 9.550               |       | 0.004             |  |
| 4.3 95.7 $CdBi_{12}$ 9.766 9.766 — —                     |        |                                     |    |        |                     |       | 0.001             |  |
|  |        |                                     |    |        |                     | 0.003 | _                 |  |
| - 100.0 Bi 9.823 $  -$                                   | 4.3    |                                     |    |        | 9.766               | -     | -                 |  |
|  |        | 100.0                               | Bi | 9.823  |                     | _     |                   |  |

Cadmium-bismuth alloys, according to Matthiessen :

These alloys show slight contraction, increasing toward the middle of the series until the quantity of both metals is approximately the same.

Cadmium-lead alloys, according to Holzmann:

| Compos                                      | Composition of the alloys examined.       |  |   | Specific gravities.                           |                  |                   |  |
|---|---|--|---|---|------------------|-------------------|--|
|   | -   |  |   |   | Diffe            | rence.            |  |
| Cad-<br>mium. •                             | Lead .                                    | Atomic<br>formula.                       | Found.  | Calcu-<br>lated.                              | Expan-<br>sion,  | Contrac-<br>tion. |  |
| 100.0                                       |   | Cd                                       | 8.655   |   |                  |                   |  |
| $\begin{array}{c} 77.2 \\ 68.2 \end{array}$ | $\begin{array}{c} 22.8\\ 31.8\end{array}$ | Cd <sub>6</sub> Pb<br>Cd <sub>4</sub> Pb | $\begin{array}{r} 9.160 \\ 9.353 \end{array}$ | $\begin{array}{r} 9.173 \\ 9.364 \end{array}$ | $0.013 \\ 0.011$ |                   |  |
| 51.8  | 31.8<br>48.2                              | $Cd_4Pb$<br>$Cd_9Pb$                     | 9.555   | 9.504   | 0.011            |                   |  |
| 35.0  | 65.0                                      | CdPb                                     | 10.246  | 10.246  |                  |                   |  |
| 21.2  | 78.8                                      | $CdPb_2$                                 | 10.656  | 10.663  | 0.007            |                   |  |
| 11.8  | 88.2                                      | $CdPb_4$                                 | 10.950  | 10.966  | 0.016            |                   |  |
| 8.3   | 91.7                                      | CdPb <sub>6</sub>                        | 11.044  | 11.088  | 0.044            |                   |  |
|   | 100.0                                     | Pb                                       | 11.376  |   |                  |                   |  |

This series is not distinct, but expansion, which generally increases with the content of lead, may be inferred from it. *Bismuth-silver alloys*, according to Holzmann :

| Composition of the alloys examined.   |   | Specific gravities.   |  |                    |                                      |  |
|---|---|---|--|--------------------|--------------------------------------|--|
|   | Bismuth. Silver. Atomic formula.  |   |  | Calcu-             | Difference.                          |  |
| Bismuth.  |   | Found.  | lated.   | Expan-<br>sion.    | Contrac-<br>tion.                    |  |
| 100.0<br>99.0<br>97.8<br>96.0<br>92.0<br>88.5<br>79.4<br>65.8<br>49.0<br>32.5 | $\begin{array}{c} \hline \\ 1.0 \\ 2.2 \\ 4.0 \\ 8.0 \\ 11.5 \\ 20.6 \\ 34.2 \\ 51.0 \\ 67.5 \\ 100.0 \\ \end{array}$ | Bi<br>Bi <sub>50</sub> Ag<br>Bi <sub>24</sub> Ag<br>Bi <sub>12</sub> Ag<br>Bi <sub>6</sub> Ag<br>Bi <sub>4</sub> Ag<br>Bi <sub>4</sub> Ag<br>BiAg<br>BiAg <sub>2</sub><br>BiAg <sub>4</sub><br>Ag | $\begin{array}{c} - 9.823 \\ 9.813 \\ 9.820 \\ 9.836 \\ 9.859 \\ 9.899 \\ 9.966 \\ 10.068 \\ 10.197 \\ 10.323 \\ 10.468 \end{array}$ | $\begin{array}{c}$ | 0.016<br>0.016<br>0.012<br>0.012<br> |  |

The alloys richest in bismuth exhibit slight expansion, but contraction with an increasing content of silver.

Bismuth-lead alloys, according to Carty :

|  | ition of th<br>examined.  |   | Specific gravities.  |   |                 |   |  |  |  |  |
|--|---|---|--|---|-----------------|---|--|--|--|--|
|  |   |   |  | Calcu-  | Diffe           | rence.  |  |  |  |  |
| Bismuth.   | Lead.   | Atomic<br>formula.  | Found.   | lated.  | Expan-<br>sion. | Contrac-<br>tion.   |  |  |  |  |
| $100.0 \\95.2 \\93.5 \\88.8 \\80.0 \\66.6 \\50.0 \\33.4 \\25.0 \\20.0 \\16.7 \\7.7 \\$ | $\begin{array}{c}\\ 4.8\\ 6.5\\ 11.2\\ 20.0\\ 33.4\\ 50.0\\ 66.6\\ 75.0\\ 80.0\\ 83.3\\ 92.3 \end{array}$ | $\begin{array}{c} \mathrm{Bi}\\ \mathrm{Bi}_{20}\mathrm{Pb}\\ \mathrm{Bi}_{16}\mathrm{Pb}\\ \mathrm{Bi}_{8}\mathrm{Pb}\\ \mathrm{Bi}_{8}\mathrm{Pb}\\ \mathrm{Bi}_{4}\mathrm{Pb}\\ \mathrm{Bi}_{9}\mathrm{Pb}\\ \mathrm{Bi}\mathrm{Pb}_{2}\\ \mathrm{Bi}\mathrm{Pb}_{3}\\ \mathrm{Bi}\mathrm{Pb}_{3}\\ \mathrm{Bi}\mathrm{Pb}_{5}\\ \mathrm{Bi}\mathrm{Pb}_{5}\\ \mathrm{Bi}\mathrm{Pb}_{5}\end{array}$ | $\begin{array}{c} 9.823\\ 9.893\\ 9.934\\ 10.048\\ 10.235\\ 10.538\\ 10.956\\ 11.141\\ 11.161\\ 11.188\\ 11.196\\ 11.280\end{array}$ | $\begin{array}{c}\\ 9.887\\ 9.902\\ 9.974\\ 10.048\\ 10.290\\ 10.541\\ 10.805\\ 10.942\\ 11.026\\ 11.083\\ 11.238\end{array}$ |                 | $\begin{matrix}\\ 0.006\\ 0.032\\ 0.074\\ 0.137\\ 0.248\\ 0.415\\ 0.336\\ 0.219\\ 0.162\\ 0.113\\ 0.042 \end{matrix}$ |  |  |  |  |
| _  | 100.0   | Bi  | 11.280   |   | -               | -   |  |  |  |  |

These alloys show contraction increasing regularly from both ends of the series, and reaching the maximum in the alloy with 50 parts bismuth and 50 parts lead. Similar results were obtained by Riche. The contraction is considerable and exceeds that of nearly all other alloys.

Bismuth-gold alloys, according to Holzmann :

|          | ition of th<br>examined. |                     | Specific gravities. |                  |                 |                   |  |  |  |  |
|----------|--------------------------|---------------------|---------------------|------------------|-----------------|-------------------|--|--|--|--|
|          |                          |                     |                     |                  | Difference.     |                   |  |  |  |  |
| Bismuth. | Gold.                    | Atomic<br>formula.  | Found.              | Calcu-<br>lated. | Expan-<br>sion. | Contrac-<br>tion. |  |  |  |  |
| 100.0    |                          | Bi                  | 9.823               |                  | _               |                   |  |  |  |  |
| 97.6     | 2.4                      | Bi <sub>40</sub> Au | 9.942               | 9.935            |                 | 0.007             |  |  |  |  |
| 95.4     | 4.6                      | Bi <sub>20</sub> Au | 10.076              | 10.046           | —               | 0.030             |  |  |  |  |
| 89.4     | 10.6                     | Bi <sub>8</sub> Au  | $10 \ 452$          | 10.360           |                 | 0.092             |  |  |  |  |
| 80.8     | 19.2                     | Bi <sub>4</sub> Au  | 11.025              | 10.840           | —               | 0.185             |  |  |  |  |
| 67.8     | 32.2                     | $B_{i_2}Au$         | $12\ 067$           | 11.659           |                 | 0.408             |  |  |  |  |
| 51.3     | 48.7                     | BiAu                | 13.403              | 12.898           |                 | 0.505             |  |  |  |  |
| 34.5     | 65.5                     | BiAu <sub>2</sub>   | 14.844              | 14.462           |                 | 0.382             |  |  |  |  |
| -        | 100.0                    | $\Lambda u^{-}$     | 19,265              |                  |                 |                   |  |  |  |  |
|          |                          |                     |                     |                  |                 |                   |  |  |  |  |

93

With an increasing content of gold the alloys show at first considerable contraction, which reaches the maximum with about 50 per cent. of gold, and then decreases with a further increase in gold.

Tin-mercury alloys (tin amalgams), according to Holzmann :

| Compo                              | osition of the examined.  | e alloy   | Specific gravities.   |                                |                          |                             |  |  |  |  |
|------------------------------------|---|---|---|--------------------------------|--------------------------|-----------------------------|--|--|--|--|
| Tin.                               | Mercury.  | Atomic<br>formula.  | Found.  | Calcu-<br>lated.               | Diffe<br>Expan-<br>sion. | rence.<br>Contrac-<br>tion. |  |  |  |  |
| 100.0<br>53.7<br>36.7<br>22.5<br>— | $\begin{array}{c} - \\ 46.3 \\ 63.3 \\ 77.5 \\ 100.0 \end{array}$ | ${ Sn \atop Sn_2Hg \atop SnHg \atop SnHg \atop Hg \atop Hg }$ | $\begin{array}{r} 7.294 \\ 9.362 \\ 10.369 \\ 11.456 \\ 13.573 \end{array}$ | 9.282<br>10.313<br>11.373<br>— | <br><br>                 | 0.080<br>0.056<br>0.083     |  |  |  |  |

The alloys show perceptible and approximately equal contraction. The same results were obtained by Calvert and Johnson.

Lead-mercury alloys (lead amalgams) according to Matthiessen:

| Compo       | sition of th<br>examined. | e alloys   | Specific gravities.                                       |                       |                 |                    |  |  |  |  |
|-------------|---------------------------|--|---|-----------------------|-----------------|--------------------|--|--|--|--|
|             |                           |  |   | Calcu-                | Difference.     |                    |  |  |  |  |
| Lead.       | Mercury.                  | A tomic<br>formula.  | Found.  | lated.                | Expan-<br>sion. | Contrac-<br>tion.  |  |  |  |  |
| 100.0 67.4  | 32.6                      | Pb<br>Pb <sub>2</sub> Hg   | $\frac{11.376}{11.979}$                                   | 12.008                | 0.029           | _                  |  |  |  |  |
| 50.8 $34.1$ | 49.2<br>65.9<br>100.0     | $\begin{array}{c} \operatorname{PbHg} \\ \operatorname{PbHg}_2 \\ \operatorname{Hg} \end{array}$ | $\begin{array}{c} 12.484 \\ 12.815 \\ 13.573 \end{array}$ | $12.358 \\ 12.734 \\$ | =               | 0.126<br>0.081<br> |  |  |  |  |
|             | J                         |  | -   | <u> </u>              |                 |                    |  |  |  |  |

*General conclusions.* All the alloys examined may be divided into three groups:

| Group I.  | Group II.  | Group III.   |
|---|--|--|
| Alloys which plainly<br>show contraction:<br>Copper-tin.<br>Copper-zine with 35 to<br>80 per cent. zine.<br>Silver-gold (slight con-<br>traction).<br>Lead-gold.<br>Lead-silver with more<br>than 30 per cent. sil-<br>ver.<br>Tin-bismuth.<br>Tin-bismuth.<br>Tin-silver.<br>Tin-gold with more<br>than 75 percent. gold.<br>C ad m i um - bismuth<br>with more than 10<br>per cent. cadmium<br>(slight contraction).<br>Bismuth-silver with<br>more than 10 per cent.<br>silver.<br>Bismuth-lead.<br>Bismuth-gold.<br>Tin-mercury.<br>Lead-mercury with<br>more than 40 per<br>cent. mercury. | Alloys which plainly<br>show expansion:<br>Copper-silver.<br>Lead-silver with more<br>than 70 per cent. lead.<br>Antimony-tin.<br>Antimony-lead.<br>Tin-cadmium with<br>more than 75 per<br>cent. tin.<br>Tin-lead.<br>Tin-gold with more<br>than 25 per cent. tin.<br>Cadmium-lead. | Alloys which do not<br>show plainly either<br>expansion or con-<br>traction:<br>Copper-gold.<br>Antimony-bismuth.<br>Tin-cadmium with less<br>than 75 per cent. tin. |

No definite regularity in the behavior of the metals can be recognized. While some metals, for instance, bismuth, gold, tin, produce chiefly contraction, and others, for instance, lead, antimony, expansion, there are still others, such as copper, tin, cadmium, which appear irregularly in all the groups, there can be no doubt that certain chemical processes or actions of the separate metals upon one another play a role in this respect. If, for instance, a metal is capable of dissolving its own oxides (copper dissolves cuprous oxide, etc.) and decreasing thereby its specific gravity, and it is alloyed with

another metal which acts in a reducing manner upon the dissolved oxide, without that the newly formed product of oxidation is dissolved, contraction will evidently take place. But if, on the contrary, a metal, for instance, silver possesses, while in a liquid state, the power of dissolving oxygen, which escapes from the pure metal during the process of solidifying, and this metal is alloyed with another metal which is oxidized by the dissolved oxygen and whose product of oxidation is dissolved by the metal-bath (copper), the specific gravity will evidently be decreased in consequence of this solution of oxides, and expansion take place.

From such or similar processes many apparent contradictions or irregularities in the series of specific gravities might also be deduced.

c. CRYSTALLIZATION. It has previously been mentioned that various alloys show a decided tendency towards crystallization, which, however, does not furnish a proof—as has frequently been supposed—of the presence of chemical combinations of the metals with each other.

If the alloy consists of metals which crystallize in the same system, the crystals of the alloy also belong, as a rule, to this system; otherwise the alloy generally crystallizes in one of the systems of the separate metals.

Copper-tin alloys usually crystallize in the hexagonal system. In an alloy of 19 parts copper with 81 parts tin, Rammelsberg found regular hexagonal prisms. From alloys richer in copper (bronzes), crystals several centimeters in length may, according to Künzel, be obtained by allowing an iron plate to float upon the liquid metal-bath not heated too much above the fusing point. The crystals deposit on the plate with their principal axis at a right angle towards the

cooling surface of the plate, and can be lifted together with the latter from the liquid metal.

Copper-zinc alloys crystallize nearly all in octahedrons of the monometric system, and in the hollow spaces of castings octahedral formations of considerable size are not unfrequently found, the composition of which by no means shows always a chemical combination composed according to atomic proportions. On the other hand, an alloy which corresponds to the chemical formation ZnCu (50.7 parts zinc, 49.3 parts copper) shows a peculiar, long-fibrous texture, and, according to Calvert and Johnson, crystallizes in prisms frequently over 1 inch in length.

Antimony-zinc alloys in all proportions of from 20 to 70 per cent. zinc yield beautifully developed crystals of the rhombic system; those richer in zinc being generally prisms, and those poorer in zinc, octahedrons.

Gold-silver, lead-silver and silver-mercury alloys crystallize in the monometric system.

Gold-tin alloys with a content of gold between 27 and 43 per cent., and moreover, in all possible proportions by weight, crystallize in the dimetric system.

Iron-tin alloys crystallize in the dimetric system. Such an alloy containing about 80.5 per cent. tin and 19.5 per cent. iron remains behind, according to Rammelsberg, in quadrangular prisms, if Banca tin is dissolved in hydrochloric acid.

Iron-manganese alloys, which, as a rule, contain in addition 5 to 7 per cent. carbon, frequently crystallize in finely developed rhombic prisms. The largest and most perfect crystals are found in alloys with 30 to 60 per cent. manganese, though alloys richer in manganese also show distinct formations of crystals, while in alloys with less than 25 per cent.

- 96

97

1 1

manganese the independent crystals are smaller and of more rare occurrence.

For the practice the crystallization of alloys is of importance only in so far as the development of crystals generally goes hand in hand with a deterioration in the properties decrease in strength, ductility, etc.—and besides crystallization is, as a rule, closely related to liquation. But the more slowly a casting is cooled the more opportunity the metal has to follow its inclination towards crystallization or liquation, and, hence, it may be laid down as a general rule that crystallization should be rendered difficult by rapid cooling of the castings.

d. STRENGTH. The strength of metals is affected in a remarkable manner by alloying with other metals. In this case also the strength of an alloy does not always correspond with the arithmetical mean of the strengths of the alloyed metals, but in some cases is less and in others greater, many alloys possessing even a higher degree of strength than each of the constituent metals.

Copper-tin alloys. The average results of a large series of experiments made by the direction of the United States under the direction of Prof. Robert H. Thurston, show that the strength of copper may be considerably increased by the addition of tin, though the latter by itself possesses but little strength. The increase in the tensile and absolute strength appears to attain its maximum with a content of about 17.5 per cent. tin; with a further enrichment in the content of tin it rapidly decreases and finally approaches gradually, though not with entire uniformity, that of tin. The crushing strength, however, reaches its maximum only with 30 per cent. tin. The brittleness of the alloy increases in all cases

with the content of tin, and only when the latter considerably exceeds 50 per cent. is there, in this respect, a gradual approach to the properties of pure tin. Since, however, with a content of over 20 per cent. tin, the strength rapidly decreases and brittleness increases in a still greater degree, it is evident that where great strength is a requisite, alloys richer in tin are quite worthless. The torsional strength of copper-tin alloys is also greatest with a content of 17.5 per cent. tin, it decreasing rapidly with a higher percentage.

By the addition of small quantities of phosphorus to coppertin alloys richer in copper, their strength may be considerably increased and their brittleness decreased. In tin alloys with 9 to 10 per cent. tin and 0.2 to 0.7 per cent. phosphorus, Künzel found the average modulus of absolute strength equal to 2350 kilogrammes per square centimeter; ratio of the limit of elasticity to the modulus of fracture, 0.535; ratio of the total elongation to the original length, 0.03.

*Copper-zinc alloys.* Small additions of zinc also increase the strength of copper, though its influence shows itself in a less pronounced manner than that of tin. Mallet found the following values for the breaking strength of copper-zinc alloys :

| Alloys with:   | Average of 1850 kilo- |
|--|-----------------------|
| Copper 90 parts, zinc 10, to copper $88\frac{1}{2}$ parts, | grammes per square    |
| zinc 11 <sup>1</sup> .                                     | centimeter.           |
| Alloys with:   | Average of 2000 kilo- |
| Copper 87.3 parts, zinc 12.7, to copper 74.5               | grammes per square    |
| parts, zinc 25.5.  | centimeter.           |
| Alloys with :  | Average of 1600 kilo- |
| Copper 66 parts, zinc 34, to copper 34 parts,              | grammes per square    |
| zinc 66.   | centimeter.           |
| Allow with .   | Average of 320 kilo-  |
| Alloy with :   | grammes per square    |
| Copper 31.5 parts, zinc 68.5.                              | centimeter.           |
|  |                       |

All alloys richer in zinc with a content of zinc Average of 340 kiloup to 83.7 per cent.

grammes per square centimeter.

Notwithstanding the incompleteness of the results, it may be concluded that when the content of zinc exceeds about 60 per cent., the alloy loses strength so rapidly as to render it worthless for most purposes.

Copper-nickel and copper-nickel-tin alloys. The maximum strength, according to Künzel's investigations, appears to be attained with an addition of about 10 per cent. nickel. A small quantity of tin (up to 5 per cent.) alloyed with the copper in addition to the nickel, considerably increases the strength of the alloy, but if the content of tin exceeds this limit, the strength decreases. With a content of up to 10 per cent. nickel, brittleness is not sensibly increased, an alloy with 10 per cent. nickel being far less brittle than an alloy with 10 per cent. tin. Brittleness, however, is immediately increased by adding, in addition to nickel, tin to the alloy.

Various alloys of copper with manganese, tin, iron and zinc. From the results of Künzel's investigations the following deductions may be made:

1. The addition of manganese to copper exerts an influence similar to that of tin, zinc or nickel, *i. e.* the strength of the alloy is increased. An alloy of copper 90 parts and manganese 10, possesses approximately the same strength as an alloy of copper 90 parts and nickel 10 or tin 10, but is less tenacious than the former, its behavior in this respect being similar to that of a copper-tin alloy with 90 per cent. tin.

2. Alloys of copper, manganese and tin possess approximately the same strength, but also the same brittleness, as copper-tin alloys with the same content of copper.

3. A content of a few per cent. iron produces a favorable effect upon the strength similar to manganese. Riche also found that by alloying copper with 2 to 4.5 per cent. iron its strength is considerably increased.

4. By a content of zine the strength of a cast alloy with 88 per cent. copper and 10 per cent. tin is not injured but its permanent elongation before breaking. Uchatius, however, found a perceptible decrease in the strength of cold-rolled bars by a content of zinc.

Copper-aluminium alloys.—By alloying copper with up to 10 per cent. aluminium its strength is considerably increased, even to a greater extent than by the addition of the same quantity of tin.

*Copper-gold and copper-zinc alloys*. By alloying copper and silver with certain quantities of copper their strength is considerably increased. Karmarsch found the breaking strength per square millimeter of gold and silver wires as follows :

| Hard-drawn.                                       | Annealed.    |
|---|--------------|
| Kilogrammes.                                      | Kilogrammes. |
| Silver, fine                                      | 18 to 19.5   |
| Silver 75, copper 25 62.8 to 92.3                 | 39.7 to 48.2 |
| Gold, fine  | 17.1 to 18.8 |
| Gold 90, copper 10 45.8                           | _            |
| Gold 58.3, copper 29.7, silver 12 . 92.9 to 111.5 | 68.8 to 79.8 |

e. HARDNESS. By alloying metals the hardness is scarcely ever reduced, while in numerous cases it is greater than that of the separate metals constituting the alloys. Two comparatively soft metals frequently yield an alloy of considerably greater hardness than possessed by each separate constituent, and in working metals for articles of use this increase in hardness and consequent power of resisting mechanical wear is frequently the only reason for alloying them with other metals. This increase in hardness is prominently shown in various copper alloys, and is produced chiefly by tin which in a pure state is comparatively soft.

From a series of experiments made by Calvert and Johnson the following proportional figures for the hardness of coppertin alloys may be deduced :

| Tin .  |         |          | • •     |      | • |   |   |   |   |   | • |   |   |   |   | . 1    |
|--------|---------|----------|---------|------|---|---|---|---|---|---|---|---|---|---|---|--------|
| Copper |         |          | • •     |      | • | • | • |   |   | • | • | • | • |   |   | . 11.1 |
| 93 par | ts copp | er, 7 pa | irts ti | in . |   | • | • | • |   |   |   |   |   |   |   | . 22.2 |
| 91.5   | - 4     | 8,5      | "       |      |   | • |   | • | • | • | • | • | • | • | • | . 23.6 |
| 89     | "       | 11       | "       |      |   |   |   |   | • |   |   | • | • | • | • | .28.5  |
| 84.3   | "       | 15.7     | "       |      |   | • |   | • | • | • |   |   |   | • |   | . 34   |
| 21.2   | **      | 78.8     | "       | •    | • |   | • |   |   |   |   |   | • |   | • | . 5    |
| 10     | "       | 90       | ••      | •    | • | • | • | • | • | • | • | • | • | • |   | . 3.3  |

Similar results were obtained by Riche. According to his experiments the hardness of copper-tin alloys rises, from pure tin upwards, with an increasing content of copper until the latter amounts to 35 per cent. (atomic proportion CuSn). With a further enrichment in copper the alloys become so brittle as to render the examination unreliable until the content of copper amounts to 80 per cent., when the high degree of hardness gradually decreases.

According to an observation first made by d'Arcet, which has later on been frequently confirmed and utilized for technical purposes, the hardness of copper-tin alloys with 18 to 22 per cent. tin decreases by heating to a red heat and cooling or tempering them in water. Alloys poorer in tin, however, are not sensibly affected by this treatment.

By an addition of iron or manganese the hardness of copperas well as of copper-tin alloys is increased.

Copper-zinc alloys. Zinc also increases the hardness of

copper, though not so vigorously as tin. By taking the proportional figures given for copper-tin alloys as a basis, we obtain, according to the experiments of Calvert and Johnson, for

| Zind | e     | •  | •                      | •   |    |    | •  |                | •   |    | •  | • | • | • | • | • | • |   | • |   |   | . 6.8  |
|------|-------|----|------------------------|-----|----|----|----|----------------|-----|----|----|---|---|---|---|---|---|---|---|---|---|--------|
| Cop  | per   |    |                        |     |    | •  | •  |                | •   |    | •  |   |   | • | • | • | • | • | • |   | • | . 11.1 |
| 83   | parts | co | $\mathbf{p}\mathbf{p}$ | er, | 17 | •  | pa | $\mathbf{rts}$ | ziı | nc | •  |   |   |   | • | • |   | • | • | • | • | . 15.8 |
| 79.5 |       | 44 |                        |     | 20 | .5 |    | "              |     |    | to | 1 |   |   |   |   |   |   |   |   |   | . 1.74 |
| 66   |       | "  |                        |     | 34 |    |    | "              |     |    | to | 5 | • | • | • | • | • | • | • | • | • | . 1.74 |
| 49.5 |       | •• |                        |     | 50 | .5 |    | "              |     | 1  | to | • | • | • |   | • | • |   |   | • | • | . 22.3 |

Riche also found the alloy with 49.5 parts copper harder than alloys richer in copper. With a further decrease in the content of copper the alloy becomes so brittle and short that the determination of the degree of hardness did not succeed, only the alloy of 10.8 parts copper and 89.2 parts zinc could again be tested and showed but little less hardness than with 49.5 parts copper.

According to Calvert and Johnson, the hardness of alloys of copper, tin and zinc is less than that of pure copper-tin alloys with the same content of tin. While according to the above scale a copper-tin alloy with 11 per cent. tin possesses the proportional figure 28.5, an alloy of

```
82 copper, 12.8 tin, 5.2 zinc would have the figure 20.8, and
80 '' 10 '' 10 '' '' 28
```

The hardening effect of tin appears to be still more decreased by an addition of lead, because in the above scale the degree of hardness of an alloy of 80 copper, 5 tin, 7.5 zinc and 7.5 lead, would only be 12.7, hence but little harder than copper, while the degree of hardness of an alloy with 7 parts tin without lead and zinc is 22.2.

Copper-aluminium alloys behave similar to copper-tin alloys.

The alloy with 10 per cent. aluminium is still harder than an alloy with the same content of tin, and the hardness increases with an increasing content of aluminium.

Gold-copper and silver-copper alloys are harder than pure gold or pure silver, and, when the content is not too small, also harder than pure copper. The content of copper with which the highest degree of hardness is attained has not been denfiitely established. Karmarsch found that the wear of copper-silver alloys by abrasion in use, which probably is in the inverse ratio to hardness, takes place according to the following proportional figures :

| With | 99.3 per | cent. | silver, | 0.7 per  | cent. co | opper, abrasion | . 2.97  |
|------|----------|-------|---------|----------|----------|-----------------|---------|
| "    | 90.0     | "     | •4      | 10.0     |          |                 | . 1.60  |
| 44   | 75.0     | "     | "       | $25 \ 0$ | 66       | "               | . 1.48  |
| "    | 65,6     | "     | 66      | 34.0     | 44       | 64              | . 1.31  |
| "    | 52.0     | "     | 46      | 48.0     | ••       | <u></u>         | . 1.20  |
| "    | 31.2     | • •   | 66      | 68.8     |          | 66              | . 1.00  |
| " "  | 21.8     | "     | 44      | 78.2     | "        | 66              | . 1.045 |
|      |          | 66    | "       | 100.0    | 66       | 66              | . 1.60  |

Hence, an alloy with 31.2 per cent. silver would be the hardest, and the hardness decrease with an increasing content of silver as well as of copper.

Lead-antimony alloys. The hardness of lead is considerably increased by alloying with antimony. According to the scale of hardness of lead-antimony alloys given by Calvert and Johnson, lead-antimony alloys with 23.5 per cent. antimony are about 4 times as hard as pure lead. Although by a further increase in the content of antimony the hardness may be raised even to twelve times that of pure lead, such alloys find no technical application on account of their great brittleness.

Lead-tin alloys are harder than pure lead, and when the

content of tin exceeds 60 per cent., also harder than pure tin. An alloy of 70 parts tin and 30 parts lead is about one and a half times as hard as pure tin and two and a half times as hard as pure lead.

Zinc-tin alloys are according to experiments of Calvert and Johnson harder than tin, but none of them attains the degree of hardness of zinc. The hardness increases quite uniformly with the content of zinc.

f. DUCTILITY. By alloying a pure metal with another, the ductility is, as a rule, decreased. A content of 0.4 per cent. lead injures the ductility of copper at all temperatures. The effect of bismuth is still more injurious, 0.05 per cent. of metallic bismuth being sufficient to decrease the ductility to a considerable degree and 0.1 per cent. to almost entirely destroy it. Less intense is the action of bismuth in the oxidized state in the presence of antimonic acid, according to Hampe even 0.2 per cent. of bismuth antimonate (containing 0.06 per cent. of bismuth) having scarcely any effect upon the ductility.

Zinc in quantities up to 35 per cent. exerts a stronger influence upon the ductility of copper at higher temperatures than in the cold; however, with 35 to 40 per cent. zinc, the alloy (brass) can also be worked at a red heat.

The ductility of copper is affected to a considerable extent by tin, that of bronzes with 18 to 20 per cent. tin being increased when heated to a red heat and quenched in water. The action of lead and bismuth upon copper-tin and copperzinc alloys is almost as injurious as upon pure copper.

Gold and silver also become less ductile when alloyed with other metals, and are therefore used in a pure state when the highest degree of ductility is demanded (for instance in the

105

preparation of gold leaf and silver leaf). The least injurious effect as regards ductility is produced by copper, and considerable quantities of it may be alloyed with either of the metals without destroying their malleability. Especially injurious is bismuth, about 0.05 per cent. of it being, according to Hatchett, sufficient to destroy the ductility of gold. Lead behaves in a manner similar to bismuth.

A small content of zinc has a beneficial effect upon the ductility of many gold-copper and silver-copper alloys, especially when they contain much copper. According to Peligot, gold-copper alloys with 58 to 60 per cent. gold, for instance, which by themselves are quite difficult to work, become more ductile by replacing 5 to 7 per cent. of copper with the same quantity of zinc; thus 58 to 60 per cent. gold. 35 to 37 per cent. copper, 5 to 7 per cent. zinc. However, if the content of zinc exceeds this limit, the ductility decreases. Alloys with more than 1 to 2.5 per cent. gold also become less ductile by small quantities of zinc.

The ductility of zine is considerably impaired by small quantities of tin, lead or iron, 0.00001 per cent. sensibly decreasing, according to Bischoff, the malleabity of zinc.

g. FUSING POINTS. The fusing point of an alloy is, as a rule, lower than the arithmetic mean of the alloyed metals, and frequently even lower than that of the most fusible constituent. A reliable determination of the fusing point, however, is difficult, errors in this respect being the more readily made the greater the tendency of the alloy towards liquation, because as, soon as in cooling a fused alloy, solidifying crystals begin to separate from the still liquid mass in consequence of liquation, the composition of the alloy remaining liquid of course undergoes an immediate change. Now, even if it

were possible to determine the solidifying point of the latter, it would not exactly correspond to the solidifying point or fusing point of the entire alloy, but be lower. However, this separation of solid crystals sometimes proceeds very gradually with constant change in the composition of the mass remaining fluid, and, as previously mentioned, it may be shown that, for instance, in copper-tin alloys with 20 to 25 per cent. tin, smaller quantities of still liquid metal consisting of the alloys with the lowest fusing point, which are the last to remain fluid during the process of liquation, are frequently to be found enclosed or squeezed in between the crystals, in an apparently solidified, but still hot, alloy. If now, with progressive cooling, strong contraction of the solidified mass takes place before these remaining readily-fusible alloys are solidified, they will, as previously described, be forced through the pores and appear on the outside as globular or flat drops, or sometimes also as dendritic excrescences. The slower cooling takes place, the more pronounced the difference in the solidifying point of one and the same alloy will be. An analogous process, but of course in reverse order, takes place in the gradual fusion of solidified liquated alloys, and hence, even under the most favorable conditions, only approximate values for the average fusing point of liquating alloys can be established. It is partly due to this fact and partly also to the difficulty of determining with certainty high temperatures, that we find but few reliable determinations of the fusing points of alloys. For measuring the temperature of fused metals, the following well-known process is frequently made use of: A small quantity of the metal is poured into a fixed quantity of water of determined temperature and, after an equalization of temperature has taken place, the tempera-

ture of the metal prior to pouring it into the water is calculated from the difference in temperature before and after pouring in, the quantity of water, quantity of metal, and the specific heat of the latter. Or a block or ball of iron is immersed in the metal-bath whose temperature is to be determined until it has acquired the temperature of the bath; it is then thrown into water and the temperature calculated as above described. If

T-designates the temperature sought,

P-the weight of the water used,

p-the weight of the metal poured in or of the iron ball,

t-the temperature of the water before introducing the hot metal,

 $t_1$ —the temperature of the water after the introduction of the metal, e—the specific heat of the alloy or of the iron ball,

Then

$$\mathbf{T} = \frac{\mathbf{P}(\mathbf{t}_1 - \mathbf{t})}{\mathbf{p}. \ \mathbf{c}.} + \mathbf{t}_1.$$

For obtaining comparative results, such as generally suffice for the practice, this simple process is very suitable. By it, we may, for instance, in a very short time determine whether a fused alloy intended for casting possesses the same temperature as in a former case, and whether it is less or more strongly heated. However, absolutely correct degrees of temperature according to the scales of Fahrenheit or Celsius cannot be obtained by it, because the specific heat of metals and alloys in temperatures above 212°F. is not known. By using the known values for the specific heat with temperatures up to 212°F., the temperatures are too high because the specific heat of metals increases with the temperature, and for this reason the difference between the actual and calculated temperatures is, as a rule, the greater the higher the temperature sought.

Regarding the *fusing point of copper-tin alloys*, it may be supposed that it constantly becomes lower with a decreasing content of copper. With the assistance of the above-described method (pouring into water) Künzel found the following figures:

 Content of copper:
 95
 92
 90
 89
 86
 84
 80
 per cent.

 Fusing points:
 2480°
 2354°
 2282°
 2228°
 2102°
 2012°
 1868°
 F.

These figures are evidently too high, as may be seen from the fact that pure copper fuses at about 2012°F.; nevertheless they furnish a proof that the fusing temperature constantly decreases with the decrease in the content of copper and the increase in the content of tin.

Riche measured the fusing point of the two alloys  $SnCu_3$  (with 62 per cent. copper) and  $SnCu_4$  (with 68.3 per cent. copper) which he designated as constant alloys not subject to liquation. He used for the purpose Becquerel's thermo-electric pyrometer, and found the fusing points of these alloys between the fusing point of antimony (1009.6°F. according to Dalton; 1082°F. according to Becquerel) and the vaporizing point of cadmium (1328°F. according to Becquerel) so that they may be estimated at about 1222°F. Now by taking the fusing point of pure copper at 2012°F. and using the figures found by Künzel, the following approximate values for the mean actual fusing points of copper-tin alloys richer in lead are obtained :

 Content of copper:
 100
 95
 90
 85
 80 per cent.

 Fusing points:
 2012°
 1832°
 1650°
 1562°
 1472°
 F.

Copper-zinc alloys behave in a manner analogous to coppertin alloys, *i. e.*, the fusing point rises and falls with the content of copper. The fusing point of an alloy with 50 per

109

cent. copper was found by Daniell to be 1674° F., and, hence, for alloys richer in copper, about the following fusing point may be assumed :

| Content of copper: | 90             | 80             | 70             | 60 per cent. |
|--------------------|----------------|----------------|----------------|--------------|
| Fusing points :    | $1940^{\circ}$ | $1868^{\circ}$ | $1796^{\circ}$ | 1742° F.     |

Silver-copper alloys.—Respecting the fusing points of these alloys, Roberts has made experiments according to the abovedescribed method with the use of an iron block, the specific heat of which at the higher temperature was found by special experiments to be 0.1569 (specific heat of iron at the ordinary temperature = 0.1138). The fusing point of pure silver was assumed at 1904° F., and that of copper, according to Van Riemsdyk at 2426° F.\* The results obtained were as follows:

Content of silver: 92.5 80 75 63 60 57 5046 25 per cent. Fusing points: 1708°  $1629^{\circ}$  $1562^{\circ}$  $1557^{\circ}$ 1575° 1652° 1724° 1760° 2037º F.

Although the absolute correctness of the separate results may be questioned, they show that all alloys with more than 50 per cent. silver have a lower fusing point than pure silver, and that with a content of silver between 60 and 70 per cent., the fusing temperature reaches the lowest point.

*Silver-gold alloys.* By accurate measurements Erhard and Schertel found the following fusing points :

 Content of gold:
 0
 20
 40
 60
 80
 100 per cent.

 Fusing points:
 1745°
 1787°
 1823°
 1868°
 1913°
 1967° F.

Gold-platinum alloys may, as far as their fusing points are known, be used in estimating high temperatures. They have

\*These figures are, without doubt, too high. Becquerel found the fusing point of silver at 1762° F. and Violle at 1749° F.; the fusing point of copper is on no account much higher than 2012° F.

been tested by Erhard and Schertel with the following results:

 Content of platinum:
 0
 10
 20
 30
 40
 50
 60
 70
 80
 90
 100 per cent.

 Fusing points :
 1967°
 2066°
 2174°
 2291°
 2408°
 2525°
 266°
 2795°
 2930°
 3072°
 3227°
 F.

*Lead-tin alloys.* Experiments by Pillichody and others gave the following fusing points :

| Tin<br>per<br>cent.   | Lead<br>per<br>cent.                           | Atomic<br>formula.                       | Fusing points.  | Tin<br>per<br>cent.   | Lead<br>per<br>cent.  | Atomic<br>formula.                        | Fusing<br>points.   |
|---|--|--|---|---|---|---|---|
| $\begin{array}{r} 83.3 \\ 69.5 \\ 63.0 \\ 53.2 \\ 50.0 \\ 45.6 \end{array}$ | $16.7 \\ 30.5 \\ 37.0 \\ 46.8 \\ 50.0 \\ 54.4$ | Sn <sub>3</sub> Pb<br>Sn <sub>2</sub> Pb | $\begin{array}{c ccccccccccccccccccccccccccccccccccc$ | $\begin{array}{r} 36.2 \\ 27.2 \\ 22.1 \\ 15.9 \\ 12.4 \end{array}$ | $\begin{array}{c} 63.8 \\ 72.8 \\ 77.9 \\ 84.1 \\ 87.6 \end{array}$ | ${ Sn_2Pb_3 \ SnPb_2 \ SnPb_3 \ SnPb_3 }$ | 455 ° F.<br>474.8° F.<br>518 ° F.<br>541.4° F.<br>557.6° F. |

Since the fusing point of pure tin is about 446°F. and that of pure lead about 626°F., it is evident that all the lead-tin alloys with more than 40 per cent. tin are fusible at a lower temperature than pure tin.

*Tin-antimony alloys.* Experiments of A. Ledebur gave the following fusing points for these alloys :

| Content of tin Content of antimony | • | • | • | • | • | 90              | 82 . J  | norent    |
|------------------------------------|---|---|---|---|---|-----------------|---------|-----------|
| Content of antimony                |   |   | • | • | • | 10              | 18 Ĵ    | per cent. |
| Fusing point                       | • | • |   |   | • | $456.8^{\circ}$ | 482° F. |           |

Lead-antimony alloys.

| Content of lead<br>Content of antimony | • | • |   | • |   | 90            | ر 82    | norcont   |
|--|---|---|---|---|---|---------------|---------|-----------|
| Content of antimony                    |   | • |   |   | • | 10            | 18      | per cent. |
| Fusing point                           | • | • | • |   | • | $464^{\circ}$ | 500° F. |           |

By the addition of a third metal to a binary alloy, or of a fourth metal to a ternary alloy, the fusing may frequently be still further lowered, an addition of bismuth, or of cadmium,

or of both, being especially effective in this respect. By mixing lead-tin alloys with these metals, alloys with a fusing point far below the boiling point of water are frequently formed, for instance:

| Lead 16 parts          |             |         | 8 parts 7 | 3     |
|------------------------|-------------|---------|-----------|-------|
| Tin 12 "               | 3 " Ose     | 3       | 4 ''      | 000   |
| Bismuth 8 "            | 8 " SI      | 8 "     | 15 ''     | l's I |
| Cadmium — "            |             | 2 "     | 3 ''      | met   |
| Fusing point . 284° F. | 203° F. J 🚆 | 167° F. | 154.4° F. | ] al. |

h. EXPANSION BY HEAT. The actual expansion-coefficient of alloys frequently varies considerably from that deduced by calculation, a small content of foreign metals being sufficient to produce deviations.

According to Calvert and Lowe's investigations the expansion co-efficient of *copper-tin alloys* with a small content of tin is below that of copper, though the tin added has a much higher rate of expansion than copper.

Copper-zinc alloys appear to behave in a similar manner. The expansion co-efficient of brass (with about 65 per cent. copper) is equal to that of pure copper and increases with an increasing content of zinc.

Lead-antimony alloys and zinc-tin alloys possess, according to Calvert and Lowe, a lower expansion co-efficient than the mean.

Matthiessen, on the other hand, states that the expansion due to heat of the metals takes part in that of their alloys approximately in the ratio of their relative volumes.

*i*. SPECIFIC HEAT. This subject being of comparatively small practical importance, but few accurate determinations of the specific heat of the alloys have been published. M. Regnault determined the specific heat of two classes of alloys, first, those which at  $212^{\circ}$  F. are considerably removed from their fusing points; and, secondly, those which fuse at or near  $212^{\circ}$  F. The specific heats of the first series were remarkably near to that calculated from the specific heats of the component metals, so that he announced the following law:

"The specific heat of the alloys, at temperatures considerably removed from their fusing point, is exactly the mean of the specific heats of the metals which compose them."

The mean specific heat of the component metals is that obtained by multiplying the specific heat of each metal by the percentage amount of the metal contained in the alloy, and dividing the sum of the products for each alloy by 100.

By a simple arrangement of the differential thermometer, Matthiessen proved that the specific heat of a copper-tin alloy, with 90 per cent. copper (gun-metal) is the same as the mean of those of its components.

k. CONDUCTIVITY FOR HEAT. Calvert and Johnson have investigated the conductivity for heat of various alloys with the following results:

1. In no case is the conductivity for heat of an alloy greater than the calculated mean of the conducting power of the component metals.

2. The actual conductivity for heat agrees with the calculated conducting power only in some cases, for example in all lead-tin alloys and bismuth-tin alloys.

3. In more numerous cases the conductivity for heat is considerably below the calculated conducting power, and frequently is even less than that of the worst conductor of the component metals.

The injurious effect upon the conductivity for heat is very

GENERAL PROPERTIES OF ALLOYS. 113

plainly shown in most copper alloys. *Copper-tin alloys* with not over 50 per cent. of copper present the curious and unexpected rule that they conduct heat as if they did not contain a particle of the better conductor, the conducting power of such alloys being the same as if the bar was entirely composed of tin. The conductivity for heat slowly increases only with a content of 60 per cent. of copper and upward.

The conducting power of *copper-zinc* alloys is also considerably less than that calculated; in alloys richer in zinc (not over 50 per cent. zinc) it is less than that of zinc, *i. e.*, of the worst conductor of the two metals; and, according to Wiedemann's investigations, even the conducting power of alloys richer in copper (65 to 90 per cent. copper) does not exceed that of zinc.

The conducting power of copper is sensibly affected by 0.25 per cent. arsenic.

Some curious results have been observed in regard to alloys of gold and silver. Silver being the best conductor, its conductivity is rated as 1,000, and that of gold, the next, is 981; but gold alloyed with 1 per cent. of silver has a relative conductivity of only 840.

*l.* CONDUCTIVITY FOR ELECTRICITY. Matthiessen has shown by numerous experiments, that as regards their conductivity for electricity the metals behave similar to their conductivity for heat, *i. e.* 

1. In no case is the actual conducting power of the alloys greater than that calculated from the conductivity for electricity of the component metals and their relative volumes.

2. The actual conducting power corresponds only in comparatively rare cases with the calculated mean conductivity for electricity, lead, tin, zinc and cadmium being the metals

### THE METALLIC ALLOYS.

which, when alloyed with one another, conduct electricity in the ratio of their relative volumes.

3. More frequently the actual conducting power is below the calculated conductivity for electricity, and frequently even less than that of the worst conductor of the component metals.

Very characteristic in the latter respect is the behavior of gold-silver and of copper-tin alloys, a very small addition of silver, which is a good conductor, to gold sensibly affecting the conducting power of the latter. The conductivity for electricity of copper-tin alloys does not fall much below that of tin, but remains about the same until the content of copper amounts to about 90 per cent.

*m.* COLOR. Regarding the color of alloys, it may also be said that the intensity of the effect produced by the addition of determined quantities of one metal to another is not equally strong throughout, but shows considerable variations; the color of an alloy does not always form the compound color from the colors of the alloyed metals, but frequently exhibits independent tones. While, for instance, in coppersilver alloys the color of the one metal passes quite regularly into that of the other, and hence forms an actual compound color, in some copper-tin alloys and still more so in some copper-zinc alloys with a comparatively high content of copper, the red color disappears almost completely, being replaced by a yellow shade which cannot be produced by simply mixing red and white or red and gray.

The diversity in color of the metals used for technical purposes is not very great, one metal, copper, being red and another, gold, yellow; the rest are either white or pale gray, in the various shades of the pure white of silver and tin to

the pale gray of lead, platinum, etc. Two or more white metals alloyed with one another always give white alloys.

White metals alloyed with the red copper give reddish white, reddish yellow, pure yellow, gray or white alloys. White metals alloyed with gold give pale yellow, greenish or white alloys.

As previously mentioned, the intensity of coloration produced in an alloy by the addition of one or another metal, varies considerably. For the metals more frequently used for colored alloys, the following scale may be adopted :

Tin, nickel, aluminium,

Manganese, Iron, Copper, Zinc, Lead, Platinum, Silver, Gold.

Each metal in this series standing before another exerts a stronger influence upon the color than the succeeding one, so that the color of the latter frequently disappears by the addition of comparatively small quantities of the former.

However, the different shades of color do not appear gradually and uniformly with the increase or decrease in the content of the one metal, transitions by leaps or bounds being frequently observed, and it may even happen that an alloy with a larger quantity of a white coloring metal may show a darker tone of color than the same alloy with a smaller quantity of the same metal.

The varying intensity of coloration produced by copper,

tin and zinc, may be very plainly recognized by a comparison of the scale of color of copper-tin and copper-zinc alloys.

|  |  | Copper-tin alloys.  |  | Copper-zinc alloys.   | Copper-tin-zinc alloys. |                       |   |  |  |  |
|--|--|---|--|---|-------------------------|-----------------------|---|--|--|--|
| Content of copper.   | Content of tin.                        | Color.  | Content of zinc.   | Color.  | Content of tin.         | Content of zinc.      | Color.  |  |  |  |
| 95<br>90<br>84<br>80<br>78<br>75<br>73<br>70<br>65<br>62<br>59<br>50<br>40<br>30<br>20 | 30<br>35<br>38<br>41<br>50<br>60<br>70 | Red yellow, gold-like<br>Reddish, gray yellow<br>Reddish gray<br>Yellow gray<br>Reddish white<br>Beddish white<br>Bluish white<br>Bluish white<br>Bluish gray<br>Gray<br>Pale gray<br>Gray white<br>Gray white<br>Whitish | $ \begin{array}{c} 16\\20\\22\\25\\27\\30\\35\\38\\41\\50\\60\\70\end{array} $ | Red, almost copper-color<br>Yellowish, red brownish<br>Reddish yellow<br>Reddish yellow<br>Pale yellow<br>Yellow<br>Yellow<br>Deep yellow<br>Deep yellow<br>Beddish yellow<br>Handsome gold yellow<br>Bismuth gray, with strong<br>Iustre<br>Antimony gray<br>Zine cray |                         | $     \frac{16}{18} $ | Crange red<br>Orange yellow<br>Orange yellow<br>Pale orange<br>Pale yellow<br>Light yellow<br>—<br>—<br>— |  |  |  |
| $     \begin{array}{c}       30 \\       20 \\       10     \end{array}   $            | 80<br>90                               | Whitish<br>Whitish  | 80<br>90   | Zinc gray<br>Zinc gray  | -                       | =                     | _   |  |  |  |

From the above table it will be seen that, while the color of copper, vivid by itself, is almost completely covered by a content of 30 per cent. tin, it is converted by the same quantity of zinc first into yellow, and about 60 per cent. zinc is required to make it entirely disappear. The fact that in copper-zinc alloys with 25 to about 35 per cent. zinc the color appears pure yellow (brass-yellow) and with a still higher content (up to 50 per cent.) of zinc golden yellow, is also of interest and considerable practical importance. Still warmer tones of color are obtained, as shown in the third column of the table, by replacing in the alloys richer in copper (70 to 80 per cent. copper) a portion of the zinc by tin.

The great coloring power of nickel is best shown in nickel coins, which contain 75 per cent. copper and 25 per cent.

nickel. Notwithstanding the large content of copper, the color of the latter has entirely disappeared.

Gold possesses but slight coloring power. Gold-silver alloys with 64 per cent. gold show a greenish-yellow color, and with 30 per cent. gold a perfectly white color like fine silver. When gold is alloyed with copper, the gold color disappears completely with about 75 per cent. copper, the alloys exhibiting the red color of rosette copper, while in a silvercopper alloy with the same quantity of copper, the content or silver can be plainly recognized.

n. RESISTANCE TO CHEMICAL INFLUENCES. A knowledge of the resistance of alloys to chemical influences is of considerable practical importance. Nearly all articles of metal and alloys are exposed to the action of gases contained in the atmosphere (besides the quite indifferent nitrogen: oxygen, carbonic acid, aqueous vapor; in inhabited localities nearly always sulphuretted hydrogen, ammonia, etc.), and many of them to that of rain and snow, while utensils for culinary and technical purposes are in addition affected by acid, alkaline, saline, or fatty fluids. For the manufacture of such utensils it might be desirable, as regards other properties, to alloy the metal to be used for the purpose with another, but the question is whether such an alloy possesses the same power of resisting chemical influences as the pure metal. Thus, for instance, tin containing lead is preferable in many respects to pure tin, it being harder, stronger and filling the moulds better in casting; but if the alloy is to be used for kitchen utensils, drinking vessels or similar purposes, the important question arises whether, in view of the poisonous properties of lead, it is capable of resisting in the same degree as pure tin the chemical influences to which it may be exposed in use.

But few experiments have been made to determine the behavior of alloys in this respect. It is generally found that the action of the atmosphere is less severe on alloys than on their component metals. An instance of this is the ancient bronze statues and coins, some of the latter of which have their characters still legible, although they have been exposed to the effects of air and moisture for upwards of twenty centuries.

The action of the atmosphere on an alloy heated to a high temperature is sometimes quite energetic, as is shown in the alloy of 3 parts lead and 1 of tin, which, when heated to redness, burns briskly to a red oxide. When two metals, as copper and tin, are combined, which oxidize at different temperatures, they may be separated by continued fusion with exposure to the air. Cupellation of the precious metals is a like phenomenon.

By alloying a metal with another the chemical action of a body upon the alloy is frequently reduced to a less degree than would correspond to the simple dilution of the metal, and two metals, which in a pure state are very sensitive to chemical influences, may even show a comparatively great power of resisting these influences when alloyed in definite proportions with one another. However, two alloys composed of the same metals, but in different proportions, may, in this respect, exhibit considerable variations, and it may happen that an alloy with a larger content of a metal possessing but slight power of resisting certain influences, may be less attacked by the same agents than another alloy with a smaller content of the same metal.

Some investigators have considered this peculiarity of some alloys an indication of the presence of actual chemical com-

### GENERAL PROPERTIES OF ALLOYS.

binations. However, a contrary behavior has also been frequently observed. Thus, St. Claire Deville found that a lead-platinum alloy, which he kept in a closet, was entirely decomposed by the action of the air, the lead being converted into lead carbonate (white lead), while a piece of pure lead lying alongside it remained unchanged. Among the silvercopper alloys, that containing 25 per cent. of copper tarnishes to a greater degree in air containing sulphuretted hydrogen than pure silver, etc.

Calvert and Johnson have investigated the resistance of different copper-tin and copper-zinc alloys against acids and salts, and made the remarkable observation that nitric acid of 1.14 specific gravity dissolves the two metals in an alloy or zinc and copper in the exact proportion in which they exist in the alloy employed, while an acid of 1.08 specific gravity dissolved nearly the whole of the zinc and only a small quantity of the copper. Hydrochloric acid of 1.05 specific gravity, which readily dissolves zinc, was found to be completely inactive on all alloys of copper and zinc containing an excess of copper, and especially on the alloy containing equivalent proportions of each metal. Zinc was found to have an extraordinary preventive influence on the action of strong sulphuric acid on copper. The alloy Cu<sub>4</sub>Zn<sub>3</sub> (with 56.5 per cent. copper) was but little attacked by concentrated hydrochloric or nitric acid, and not at all by sulphuric acid.

Copper-tin alloys were found to resist the action of nitric acid more than pure copper, but the preventive influence of tin presents the peculiarity that the action of the acid increases as the proportion of tin increases; thus the alloy  $CuSn_5$  is attacked ten times more than the alloy CuSn.

Among the copper-tin-zinc alloys the two alloys

were found to be only slightly attacked by strong nitric or hydrochloric acid, and, hence, behaved similar to the above mentioned alloy  $Cu_4Zn_3$ . The resistance of these alloys against the action of nitric acid deserves special attention, since the acid readily attacks each of the separate metals.

Regarding the influence of sea water upon copper-zinc and copper-zinc-tin alloys, Calvert and Johnson found that from pure copper-zinc alloys zinc is chiefly dissolved, the copper being therefore protected by an addition of zinc; and that in the ternary alloys of the mentioned metals, the solution of zinc is smaller and that of copper considerably larger than in copper-zinc alloys. Hence by the addition of tin the zinc is protected and the copper more exposed, though with an equivalent proportion of copper a reduction in the total effect could not be recognized. On the other hand, the action of sea water is weakened by a small addition of lead and iron to copper-zinc alloys (see Muntz metal).

Articles of copper-tin alloys richer in copper, when exposed for a long time to the action of the air, acquire a beautiful pale green or brownish crust called *patina*, consisting mostly of the hydroxides and carbonates of the component metals. This patina is highly esteemed, partly on account of the beautiful appearance it presents, and partly as a characteristic of antique articles, and it is sought to promote its formation partly by a suitable choice of the alloy and partly by the use of chemical agents. Upon an alloy consisting of Cu 89.78, Sn 6.83, Pb 1.85, Co, Ni 0.90, Fe 0.28, J. Schuler found a patina of the following composition:

#### GENERAL PROPERTIES OF ALLOYS.

| $\operatorname{SnO}_2$                         |
|--|
| CuO  |
| PbO  |
| $\operatorname{Fe}_2O_3\operatorname{Al}_2O_3$ |
| CO <sub>2</sub>                                |
| $H_2O$   |
| Organic substance                              |
| H 0.65   |
| Insoluble matter 6.16                          |

or, omitting the accidental foreign substances (organic substances, sand, etc.):

| $SnO_3H_2$                                      |  | • | • |   | • | • |   |   | • |  |  |  | 60,92 |
|---|--|---|---|---|---|---|---|---|---|--|--|--|-------|
| $CuCO_3$ . $CuO_2H_2$ .                         |  |   |   | - |   |   | • | • |   |  |  |  | 34.55 |
| $(\mathrm{PbCO}_3)_2\mathrm{PbO}_2\mathrm{H}_2$ |  |   |   |   |   |   |   |   |   |  |  |  | 4.51  |

It is remarkable that in this patina the proportion of copper to the other metals is much smaller than in the bronze.

In copper-silver alloys the copper may protect the silver from the attack of single agents, but the silver, even when present in excess, does not protect the copper. Thus copper is dissolved by acetic acid from alloys with 80 per cent. and upward of silver, a fact which deserves attention in using utensils of silver alloyed with copper for household purposes. By boiling copper-silver alloys with dilute sulphuric acid, the greater portion of the copper is dissolved, while nearly all the silver remains behind. It has previously been mentioned that the action of sulphuretted hydrogen is more pronounced upon silver alloyed with copper than upon pure silver; the article becoming covered first with a yellowish and then a brownish coat, which finally turns blue.

In gold-silver alloys the gold, if present in excess, may weaken or entirely overcome the action of certain acids upon silver. While from alloys poor in gold all the silver may be extracted by sulphuric acid, an alloy containing more than 50 per cent. gold is not affected.

The action of acids and salt solutions upon *lead-tin alloys* has been more thoroughly investigated on account of the poisonous properties of lead, vessels of tin containing lead being much used for household and commercial purposes. Pleischl, Roussin, Reichelt, and others have shown that acetic acid and common salt solution, or a mixture of both, dissolve lead from lead-tin alloys even if they contain but 2 per cent. of lead, the quantity of lead dissolved increasing, of course, with the content of lead in the alloy, and depending on the time of action. It is a curious fact that some alloys richer in lead are said to be more resistant than alloys with a smaller content of lead, Pohl giving an alloy of 5 parts tin and 12 parts lead, and Phlo one of 4 parts tin and 9 parts lead, hence almost identical with Pohl's.

Knapp has investigated lead-tin alloys with the following results: Three alloys of different composition were prepared:

A. 30.8 parts tin and 69.2 parts lead (the above mentioned alloy of Phlo).

B. 21 parts tin and 79 parts lead (corresponding to the formula  $\text{SnPb}_2$ ).

C. 80 parts tin and 20 parts lead.

Toward distilled water with the access of air the alloy A showed the greatest resistance, while from A and B a comparatively large quantity of oxide of lead (consisting of lead, carbonic acid and water) was separated.

Cold vinegar dissolved in the course of seven days per 15.5 square inches surface:

#### GENERAL PROPERTIES OF ALLOYS.

|              | Lead,    | Tin,    | Total,  |
|--------------|----------|---------|---------|
|              | gramme.  | gramme. | gramme. |
| From alloy A | . 0.0677 | 0.0267  | 0.0944  |
| From alloy B | . 0.0773 | 0.0159  | 0.0932  |
| From alloy C | . 0.0027 | 0.0337  | 0.0364  |

Hence the alloy richest in tin showed the greatest resistance toward the action of cold vinegar, while the alloy of Phlo proved no more resistant than the alloy with 79 parts lead. While for the same quantity of tin the alloy A contains about 9 times as much lead as C, it yields to vinegar 26 times as much lead.

Boiling vinegar dissolved in the course of one hour

|              | Lead,    | Tin,    | Total,  |
|--------------|----------|---------|---------|
|              | gramme.  | gramme. | gramme. |
| From alloy A | . 0.0130 | 0.0032  | 0.0162  |
| From alloy B | . 0.0118 | 0.0055  | 0.0173  |
| From alloy C | . 0.0058 | 0.0100  | 0.0158  |

The difference in the resistant power of the alloy richer in tin as compared with the two others is, therefore, considerably diminished by boiling and, by taking into consideration the total quantity of metal dissolved, Phlo's alloy proves nearly as resistant as the alloy richer in tin, the amount of lead dissolved being, however, nearly double. By taking into consideration the short time of action, it will be seen that the effect of the acid is considerably increased by the higher temperature.

Cold common salt solution with about 3.5 per cent. common salt dissolved in the course of seven days from all three alloys only lead, no tin being dissolved. The amount of lead per 15.5 square inches surface was:

| From the alloy A . | • | • | • | • | • | •  | • | • | • | • | • |   |   | 0.0023 gramme |
|--------------------|---|---|---|---|---|----|---|---|---|---|---|---|---|---------------|
| From the alloy B . |   | • | • | • | • |    | • | • |   | • | • | • | • | trace         |
| From the alloy C . | • | • |   |   |   | •- |   | • |   |   | • |   | • | 0.0499 gramme |

In this case the alloy poorest in lead loses the greatest quantity of it.

At a boiling heat the same common salt solution in the course of one hour also dissolved tin, the amount per  $15\frac{1}{2}$  square inches surface being :

|                  | Lead,    | ${ m Tin},$ | Total,  |
|------------------|----------|-------------|---------|
|                  | gramme.  | gramme.     | gramme. |
| From the alloy A | . 0.0078 | 0.0022      | 0.0100  |
| From the alloy B | . 0.0080 | 0.0012      | 0.0092  |
| From the alloy C | . 0.0036 | 0.0020      | 0.0056  |

In this case the alloy richest in tin suffers the smallest total loss in metal, but in proportion to its content of lead, a comparatively large amount of the latter is dissolved.

The results of these experiments show the extent to which the resisting power of one and the same alloy is dependent upon the nature of the influences to which it is exposed and the temperature at which they act.

R. Weber has made quite a number of experiments with lead-tin alloys in regard to their behavior towards vinegar. His investigations show that generally speaking the alloys are the more strongly attacked the greater their content of lead, no exception from this rule as supposed by Pohl and Phlo for some alloys richer in lead, having been found. Further, a content of antimony does not prevent the alloy from being attacked, and that when vinegar is mixed with  $\frac{1}{4}$  its volume of tartaric acid, the quantity of metal dissolved is increased fourfold.

In Germany, by law, vessels intended for measuring fluids must not contain more than 1 part lead to 5 parts tin.

# CHAPTER V.

# PREPARATION OF ALLOYS IN GENERAL.

ALLOYS are generally prepared by directly melting together the metals which are to take part in the mixture. At the first glance this would seem a very simple affair, requiring scarcely any explanation, but in fact great skill and judgment are necessary for the successful accomplishment of the object. Some alloys are in fact very difficult to prepare, and require special precautionary measures.

The utensils used in the manufacture of alloys differ according to whether they are to be prepared on a small or large scale. For small quantities the use of a crucible is recommended, but for manufacturing on a large scale a reverberatory "open-hearth" furnace is used, which is preferably heated with gas prepared in a special furnace. Special precautions must be observed to preserve a deoxidizing flame within the furnace. A small portion of the heat, which otherwise could be used for melting the metals, is sometimes lost thereby; but the great advantage is gained that as long as the gases of combustion passing over the metals absorb oxygen, the melting metals will actually remain in a metallic state. This is especially of great importance with metals which readily oxidize when exposed in a fused state to the action of the air. It may here be remarked that the oxides formed by careless work from the metals seldom take part in the formation of the alloy, so that even if the quantities of metals have been accurately weighed, the resulting alloy will not show the desired composition, since the portion of the metals converted into oxide does not enter into the alloy.

For preparing alloys on a smaller scale in a crucible, special precautionary measures must be taken against oxidation of the metals. For this purpose the surface of the metals is covered with bodies which prevent the access of air, without, however, exerting any influence whatever, or at least only to a very small extent, upon the metals. In many cases anhydrous borax is used; but independently of the fact that borax is rather expensive and unnecessarily increases the cost of the alloys, its employment is accompanied by many evils. It is well known that in borax a portion of the boric acid is not perfectly saturated, and that in melting borax with base metals a certain portion of the acid is always absorbed, which with the sodium borate forms double salts of a glassy nature. Hence by fusing metals under borax a certain portion of them will be lost by forming a combination with the borax.

Glass consists of a mixture of silicates, and forms, when thrown upon fusing metal, a coating which completely excludes the access of air to the surface of the metal. Though it has also the property of absorbing certain metals when brought in contact with them in a liquid state, the influence it exerts upon alloys is, generally speaking, much less than that of an equal quantity of borax. If the metals to be fused together are such that a combination with carbon need not be feared, the fusing mass can also be protected from the influence of the oxygen of the atmosphere by covering it with a layer of pulverized charcoal. Many manufacturers are in the habit of throwing a certain quantity of fat upon the heated metal before fusion. The fat on being suddenly strongly heated decomposes and evolves a considerable quantity of

gas, which exerts a protecting influence upon the surface of the metals. After the evolution of gas has ceased, there remains a very finely divided carbon which protects the metals from oxidation.

For the preparation of alloys from noble or costly metals it is recommended to effect the fusion in crucibles of graphite or of graphite mixed with clay, as the metal readily and completely separates from such crucibles. In regard to graphite crucibles we would draw attention to a circumstance which, though unimportant in itself, may become very disagreeable in preparing alloys from costly metals. It sometimes happens that a graphite crucible a short time after being placed in the furnace bursts with a loud report, and the metals contained in it fall into the fire, from which they have to be rescued with considerable trouble. This phenomenon in most cases is due to faulty work in the making of the cru-If, for instance, the mass of the crucible contains a cible. small bubble filled with air or moisture, these bodies will expand strongly on heating, and this expansion may go so far as to cause the bursting of the crucible. But, as this defect cannot be recognized from the appearance of the crucible, it is recommended to test every crucible before using it for melting metals. This is done by putting them in a place where they gradually become strongly heated. Bad crucibles crack in most cases, and the others are sufficiently dried out so that they can be used for melting the metals without fear of cracking.

In preparing alloys the metal most difficult to fuse should be first melted, and the more fusible ones only introduced after the complete fusion of the first. The varying densities of the metals to be combined frequently render the formation of a homogeneous mass very difficult. Moreover, in many alloys certain chemical combinations are readily formed, while the rest of the metals form alloys, the preparation of which was not intended.

If two metals with greatly varying densities are alloyed and the mass is allowed to be quiescent, it will be observed that, after cooling and taking from the crucible, it shows clearly perceptible layers varying in color and appearance. Bv chemically examining these layers it will be found that each of them contains different quantities of the metals used in alloying. To obtain in such case as homogeneous an alloy as possible, the metals, while in a state of fusion, must not be allowed to remain quiescent, but an intimate mixture be effected by vigorous stirring, sticks of dry soft wood being in many cases used for this purpose. By stirring the fused mass with one of these sticks, the wood is more or less carbonized according to the temperature of the mass. In consequence of the destructive distillation of the wood taking place thereby, there is evolved an abundance of gases which, by ascending in the fused mass, contribute to its intimate mixture. The stirring should be continued for some time and the alloy then cooled as rapidly as possible.

Many alloys possess the property of changing their nature by repeated remelting, several alloys being formed in this case, which show considerable differences, physically as well as chemically. The melting points of the new alloys are generally higher than those of the original alloy, and their hardness and ductility are also changed to a considerable extent. This phenomenon is frequently connected with many evils for the further application of the alloys, and in preparing alloys showing this property, the fusion of the metals and subse-

quent cooling of the fused mass should be effected as rapidly as possible.

While formerly only a few alloys were known, a large number are at present used in the industries, and we find very rare metals sometimes employed for the preparation of alloys to impart special properties. One of the principal causes of this advance in the industry is the progress of mechanics. We need only to consider the bearings of shafts and axles in order to understand the varying demands made by the engineer as regards the properties of alloys. How different must be the nature of an alloy which serves for the construction of the bearing of an axle revolving with a light load perhaps once in a second, from that which has to bear a heavily-loaded shaft making many hundred revolutions per minute! For many purposes alloys possessing great ductility are required, for others the chief requisite is hardness, others again must have a high degree of elasticity, and still others as low a melting point as possible. It will be readily understood that these different demands can only be satisfied by adding to the alloys suitable quantities of metals of varying properties.

Though most heavy metals are at the present time used in the manufacture of alloys, copper, tin, zinc, lead, silver and gold are more frequently employed than others, the alloys of these metals being at the same time those which have been longest known and used. In modern times the alloys prepared with the assistance of nickel have also become of great importance, as well as those of which aluminium forms a constituent.

Every one who occupies himself more closely with alloys knows how meagre is the amount of information which has

## THE METALLIC ALLOYS.

been gained upon this important branch of metallurgy, and that much is to be expected from the progress of chemistry. The metallurgist, if left to himself, cannot be expected to arrive at certain results, because, probably, he may be wanting in chemical knowledge or in the methodical course of investigation which must be possessed by those who are qualified to successfully prosecute such researches. These qualifications are so much the more indispensable when it is remembered that every new alloy, by the fact of its properties being different from those of its constituents, may be regarded as a new metal. Before proceeding with the description of the most important alloys, it may be convenient to say a few words about the best methods of making experiments in the preparation of new alloys.

It is known that the elements always combine with one another in certain quantities by weight, which are termed atomic weights. (A table of the atomic weights of the principal metals is found upon page 21.) By mixing the metals according to equivalent quantities, alloys of determined, characteristic properties are, as a rule, obtained. If these properties do not answer the demands made of the alloy, the object is frequently attained by taking two, three, or more equivalents of one metal. An exception to this rule is only made in certain cases, and especially where, according to experience, a very small quantity of a metal suffices considerably to change the properties of the alloy. It is then most suitable to prepare the mixtures serving for the experiment according to thousandths, and with every new experiment change the proportion between the separate metals a certain number of thousandths.

For combining metals with non-metallic elements, for in-

# PREPARATION OF ALLOYS IN GENERAL. 131

stance with sulphur or with phosphorus, it is, however, not sufficient to choose the proportions according to thousandths, it being necessary to add these bodies according to ten thousandths. For these elements the form in which they are used is also of importance, which, however, will be referred to in speaking of them later on. It may here be remarked that the application of the term alloy to such metals which, so to say, are contaminated by phosphorus or sulphur is entirely incorrect. It is used, however, for want of a better one, since it at least indicates that we are not dealing with a pure metal.

# CHAPTER VI.

# COPPER ALLOYS.

ALTHOUGH, on account of its great ductility and tenacity, the uses of unmixed copper in the arts are various and highly important, its employment for many purposes is connected with difficulties. It is, for instance, seldom cast, in consequence of the difficulty of obtaining sound, strong castings, they being always blown, even if the work is done with the greatest care. In addition to the properties of the copper itself, certain alloys of it have others, which render them especially suitable for certain industrial purposes, and, moreover, it is possible to impart to copper alloys all the properties which can be possibly expected : they can be made soft and very hard, brittle and elastic, malleable and non-malleable, etc.

The manufacture of copper alloys is always attended with certain difficulties, since the copper itself has a very high fusing point, and the presence of very small quantities of foreign bodies exerts a great influence upon its properties and upon those of its alloys. It will therefore be necessary to say a few words about this influence.

A content of lead amounting to from  $\frac{1}{1000}$  to  $\frac{3}{1000}$  somewhat increases the ductility of copper to be rolled; but the presence of one full thousandth of lead renders the metal unfit for the preparation of brass, which is to be rolled out into sheets or drawn out into wire. By adding to copper up to  $\frac{3}{1000}$  of lead, it acquires the property of being red-short or

(132)

hot-short, and by increasing the content of lead to one per cent. it becomes entirely useless, it being both red-short and cold-short. A content of lead always exerts an injurious influence upon the properties of copper, this influence being more strongly observed at a higher temperature than at an ordinary one.

A content of iron exceeding  $\frac{3}{1000}$  has also an injurious effect upon the properties of copper, rendering it hard and brittle. Small quantities of nickel affect copper injuriously in making it less malleable, the evil being still further increased if besides this metal a small quantity of antimony be present. Antimony and arsenic by themselves mixed with copper considerably decrease its highly-valued property of ductility. Copper containing only  $\frac{1}{1000}$  of antimony can no longer be worked for sheet-brass. Bismuth acts in a manner similar to antimony. Zinc mixed with copper up to  $\frac{6}{1000}$ makes it red-short. Certain alloys of copper and zinc can, however, be well worked, the most important of such alloys being brass. A content of tin and silver seems not to have an injurious effect upon the properties of copper, and these two metals, if added in certain proportions, yield alloys which are distinguished by special valuable properties.

An admixture of cuprous oxide, which is sometimes found in brands of copper, makes the metal both red-short and coldshort, especially if present in larger quantities, and further imparts to it the disagreeable property of considerably contracting in casting. Moreover, the castings from such copper show an unequal density, so that plates of it cannot be used for copper-plate printing. It may here be remarked that most brands of copper found in commerce contain certain quantities of cuprous oxide, it being claimed that an admix-

# THE METALLIC ALLOYS.

ture of one-half to two per cent. of it is even beneficial, as it counteracts the injurious influence of foreign metals upon the copper.

Beside the above-mentioned metals, many brands of copper found in commerce frequently contain bodies belonging to the non-metals, such as sulphur, silicium, and phosphorus. The influence of these bodies is, as a rule, very injurious.

A content of sulphur makes the copper red-short and castings of it blown. By a content of silicium the copper loses its pure red color and acquires one shading into white, its ductility being at the same time considerably affected. Copper containing nearly two per cent. of silicium can only be rolled in the cold, as it cracks in the heat. With a still greater content of silicium the copper becomes a yellowish-white metal of extraordinary brittleness, so that it can no longer be worked to advantage.

A content of phosphorus exerts a considerable influence upon the properties of copper, generally increasing its hardness and at the same time making it more fusible. With an admixture of  $\frac{1}{1000}$  of phosphorus the copper can only be rolled in the cold, while with a still greater content it becomes brittle in the cold. Some alloys of copper with phosphorus, known as phosphor-bronze, are, however, used for certain industrial purposes on account of their special properties, they being distinguished by particular strength, ductility, and beautiful color. These combinations will be referred to later on.

According to the more recent researches by Hampe, copper shows the following behavior towards admixtures:—

With a content of between  $\frac{2}{1000}$  and  $\frac{22}{1000}$  of cuprous oxide, the properties of the copper are not sensibly affected, it becom-

ing red-short only in the presence of  $\frac{67}{1000}$ ; and a content of this compound always acts in such a manner as to increase the brittleness of the metal more in the cold than in the heat. One-thousandth of arsenic exerts no influence upon the copper, but  $\frac{20}{1000}$  of it render it cold-short and hard. It only becomes red-short with  $\frac{10}{1000}$  of arsenic, but is not cold-short, which is contrary to the opinions formerly held in regard to the influence of arsenic upon copper. Antimony acts similarly to arsenic, except that a smaller quantity of it will make the copper red-short.

A content of one and a half thousandths of lead exerts no influence upon the properties of copper; a slight brittleness in the heat shows itself, however, with a content of  $\frac{3}{1000}$ , which becomes greater with one of  $\frac{4}{1000}$ , and is clearly perceptible in the cold.

According to these more recent researches a content of bismuth exerts an especially injurious influence upon the properties of copper, an infinitely small quantity sufficing to decrease the ductility in the heat, while with a content of  $\frac{5}{1000}$  the copper becomes exceedingly red-short and sensibly cold-short.

A considerable portion of the copper occurring in commerce is extracted from minerals containing a number of other metals, this holding especially good in regard to those brands obtained from gray copper ore or fahl ore.\* Experts can tell from the external properties of the metal, especially by the color, fracture, and ductility, whether it is suitable for certain purposes or not. But it is, of course, impossible to recognize in this manner the quantities of foreign bodies. In buying a large lot of copper for alloys it is therefore recommended to

\* It contains, copper, antimony, arsenic, and sulphur.

### THE METALLIC ALLOYS.

subject it to an accurate chemical analysis, in order to be sure that it is free from lead and bismuth, which are especially injurious.

As previously mentioned, the number of copper alloys is very large, the most important being those with tin, zinc, nickel, gold, silver, platinum, and mercury, and, further, with aluminium; the alloys of copper with lead, antimony, and iron are less frequently used.

After giving a brief introductory sketch of the alloys of copper with the precious metals, which have been used from very remote times, we shall first speak of the alloys of copper with the base metals, they being of special interest for industrial purposes, and, besides, present more technical difficulties in their preparation.

Copper-gold alloys.—Gold, as previously mentioned, having but a slight degree of hardness, must be alloyed with other metals in order to prevent its wearing too rapidly, copper and silver, either by themselves or together, being generally used for the purpose. Beside the fact that the gold alloys show a greater degree of hardness than the pure metal, the color of the latter is also changed by alloying with silver or copper, there being gold with a color shading into white (alloyed with silver) and other varieties shading into red (alloyed with copper). There is also a green gold, which is an alloy of gold, silver, and copper.

According to the purpose for which gold alloys are to be used, they are prepared either with copper or silver alone, or with the assistance of both metals. The gold coins of Europe consist always of an alloy of gold with copper, a content of silver, which must, however, be very small, being due to the use of argentiferous gold. The preparation of alloys of gold

and of silver has become very extensive on account of their being used for coinage and articles of jewelry, and will be referred to later on.

Copper-silver alloys.—The alloys of copper with silver are extensively used for coinage and silverware. As may be seen from the properties of both metals, these alloys possess a considerable degree of ductility, and if the proportions in which the metals are mixed are so chosen that the copper slightly predominates, their properties are almost exactly a mean between those of the two metals. They will be fully discussed later on, and we only mention here that most alloys of silver and copper contain more of the former than of the latter metal.

The alloys of the other noble metals, especially those of the platinum group, find but a limited application in the industries; they will be referred to later on.

Alloys of copper with the base metals.—Although the number of alloys of copper with the base metals is very large, those known under the general terms of brass and bronze are so extensively used in the various industries as to make most or the others appear unimportant in comparison. Bronze has been known from very remote times, and was used by the ancients in casting statues and other ornaments. The bronze used by the pre-historic nations contained no lead, and came nearest to what is at the present time designated by the term bronze, *i. e.*, an alloy of copper and tin. The bronze used by the Romans and post-Romans was rarely an alloy of pure copper and tin, but contained usually more or less lead.

Brass, the other important alloy of copper mentioned above, was manufactured by cementing sheets of copper with calamine or carbonate of zinc long before zinc in a metallic form was known.

### THE METALLIC ALLOYS.

# Copper-Zinc Alloys.

The several compounds produced by the combination of copper and zinc in different proportions are included in the collective term brass, some varieties, however, being known by specific names, as pinchbeck, tombac, etc. The first account of the alloy of copper and zinc transmitted to the present times was written by Aristotle, who states that a people who inhabited a country adjoining the Euxine Sea prepared their copper of a beautiful white color by mixing and cementing it with an earth found there, and not with tin, as was apparently the custom. Strabo also alludes to the preparation of the alloy of copper and zinc by the Phrygians from the calcination of certain earths found in the neighborhood of Andêra, and other authors, in the time of Augustus, speak distinctly of cadmia and its property of converting copper into aurichalcum, under which title the zinc alloy was subsequently known. Several writers of the Christian era who have referred to this compound are not more explicit than their predecessors; still it is evident, from various recent analyses of old alloys, that zinc was contained in many of those prepared about the commencement of the present era.

# Brass, its Properties, Manufacture, and Uses.

The manufacture of brass was introduced, in 1550, into Germany by Erasmus Ebener, an artist of Nürnberg, who prepared it by fusing copper with so-called *tutia fornacem* or furnace cadmia. By direct melting together of the two metals the alloy was very likely first obtained in 1781 in England, where the art of obtaining the zinc in a metallic form became known a short time previously to that period.

Brass, as already mentioned, should actually contain only

copper and zinc, but most varieties found in commerce contain small quantities of iron, tin, arsenic, and lead. In many cases these admixtures are due to contaminations mixed with the ores from which the copper or zinc is extracted, while in others they have been intentionally added in order to change the ductility, fusibility, etc., of the alloy. Copper and zinc can be mixed together within very wide limits, the resulting alloys being always serviceable. Generally speaking, it may be said that with an increase in the content of copper the color inclines more towards a golden, the malleability and softness of the alloy being increased at the same time. With an increase in the content of zinc the color becomes lighter and lighter, and finally shades into a grayish-white, while the alloys become more fusible, brittle, and at the same time harder. Just as different as the properties of the respective alloys is also the cost of production, the price of brass increasing with the greater content of copper. Very extensive researches have been made in regard to the behavior of alloys of copper and zinc, which may be briefly expressed as follows :----

An alloy containing from 1 to 7 per cent. of zinc still shows the color of copper, or at the utmost only a slight yellow tinge. With 7.4 to 13.8 per cent. of zinc, the color of the alloy undergoes a considerable change, it being a pleasant red-yellow. With from 13.8 to 16.6 per cent. the color may be designated a pure yellow, while that of alloys containing up to 30 per cent. of zinc is also yellow, but not pure. It is a singular fact that with a content of over 30 per cent. of zinc a red color appears again, which is most pronounced with equal parts by weight of the metals, an alloy of 50 parts of copper and 50 of zinc having almost a golden color, but exhibiting also a high degree of brittleness. With a still higher

#### THE METALLIC ALLOYS.

content of zinc the gold color rapidly decreases, becoming reddish-white with 53 per cent., yellowish-white with 56 per cent., and bluish-white with 64 per cent.; with a still higher content of zinc the alloy acquires a lead color.

The physical properties of alloys of copper and zinc differ very much according to the quantities of copper and zinc contained in them. Alloys containing up to 35 per cent. of zinc can be converted into wire or sheet in the cold only, those with from 15 to 20 per cent. being the most ductile.

Alloys with from 36 to 40 per cent. of zinc can be worked in the cold as well as in the heat. With a still higher content the ductility decreases rapidly, and an alloy with, for instance, from 60 to 70 per cent. of zinc is so brittle that it cannot be worked. If, however, the content of zinc is increased up to a maximum (70 to 90 per cent.), the ductility increases again and the alloy can be worked quite well in the heat; but not at a red heat.

Brass shows always a crystalline structure, which is the more pronounced the more brittle the alloy is, and hence that prepared from equal parts of copper and zinc shows the most distinct crystalline structure.

In connection with this some researches in regard to metals becoming crystalline, made by S. Kalischer, may be of interest. By heating rolled zinc to from 302° to 338° F., it suffers a series of permanent changes without its external appearance being directly altered. It loses its clear sound and becomes almost without sound, like lead. It can be more readily bent, but breaks more easily, and in bending emits a noise similar to the "cry of tin." All these alterations are due to a change in the molecular structure of the zinc, it becoming crystalline. This crystallization can be readily ren-

dered perceptible by dipping a heated strip of zinc into a solution of sulphate of copper, the copper, which is immediately precipitated, showing clearly perceptible crystallization. The fracture of the rolled and heated zinc is also crystalline. To avoid this change it is recommended not to exceed a temperature of 266° F. in manufacturing sheet-zinc. Sheets of cadmium and of tin become crystalline at about 392° F. Sheet-iron and sheet-copper are also crystalline, but sheet-steel is not. Kalischer examined four varieties of sheet-brass constituted as follows :—

|        | Parts. |      |          |      |  |  |
|--------|--------|------|----------|------|--|--|
|        | <br>I. | II.  | <br>III. | IV.  |  |  |
| Copper | . 66   | 62.5 | 60       | 56.8 |  |  |
| Zinc   | . 34   | 37.5 | 40       | 43.2 |  |  |

Samples Nos. I. and II. were undoubtedly crystalline, and sample No. III. showed traces of crystallization, while No. IV. did not become crystalline even by heating.

Sheets of tombac composed of-

|        |   |   |   |   |  |   |  |  |   |         | Parts. |       |
|--------|---|---|---|---|--|---|--|--|---|---------|--------|-------|
|        |   |   |   |   |  |   |  |  |   |         |        |       |
|        |   |   |   |   |  |   |  |  |   | I.      | II.    | III.  |
| Copper |   |   |   |   |  |   |  |  |   | . 73.74 | 80.38  | 90.09 |
| Zinc   | • |   |   |   |  |   |  |  |   | . 25.96 | 19.29  | 9.91  |
| Tin    | • | • | • | , |  | • |  |  | • | . 0.30  | 0.33   |       |

were all crystalline. No crystallization could be observed in bronze-sheets composed of—

|        | Parts. |       |  |  |
|--------|--------|-------|--|--|
|        |        | ·     |  |  |
|        | Ι.     | II.   |  |  |
| Copper | . 90   | 88.23 |  |  |
| Zine   | . 5    | 8.82  |  |  |
| Tin    | . 5    | 2.95  |  |  |

Rolled lead is crystalline, but rolled fine silver and gold are not. By reason of these observations and experiments Kalischer is of the opinion that the crystalline state is natural to most metals, but they can be deprived of it by mechanical influences, and many can be reconverted into it under the influence of heat.

If a very ductile brass is to be prepared, great care must be had to use metals of the utmost purity, since exceedingly small admixtures of foreign metals suffice to injure considerably the ductility, rendering the fabrication of very thin sheets or fine wire impossible.

The strength of brass, as shown by many experiments, is also intimately connected with its composition, that containing about 28.5 per cent. of zinc showing the greatest absolute strength. The strength depends, however, to a considerable extent, also on the mechanical treatment the metal has received. A piece of brass of 0.001 square inch breaks with the following loads :—

| Cast brass                    | breaks with | 2777.5 pc    | ounds. |
|-------------------------------|-------------|--------------|--------|
| Ordinary wire                 | "           | 7293         | "      |
| Hand-drawn thin wire          | 4.6         | 9080.5       | "      |
| Annealed thin wire $\ldots$ . | . 44        | 7100 to 8628 | "      |

The molecular structure of brass can be much changed by treatment, it becoming more brittle by continuous manipulation, so that in drawing wire it must be frequently annealed to prevent them from becoming brittle. If brass is strongly heated and rapidly cooled, its hardness decreases, its behavior in this respect being opposite to that of steel. Brass which, for instance, as a constituent of machines, is subjected to repeated shocks, becomes brittle and fragile.

A very important factor in brass is its melting point, there

being wide deviations in this respect, which are readily explained by the great difference in the melting points of the two constituent metals. Generally speaking, the fusing point of brass lies at about 1832° F. If brass in a fused state is kept for some time in contact with air, its composition undergoes an essential change by the combustion of the greater portion of the zinc contained in it, which explains the change of color frequently observed in brass fused for some time in contact with air.

Old copper derived from worn-out copper articles is frequently used in the manufacture of brass. Such copper contains, however, generally foreign metals in the shape of solder, etc., which may exert either a favorable or an injurious influence upon the properties of the brass. Lead, tin, and iron are the most frequently occurring contaminations. If the brass is to be used for castings, their injurious influence is not so great as in the manufacture of thin sheet or wire. To brass intended for castings up to two per cent. of lead is frequently added, such addition making the alloy somewhat harder, and depriving it at the same time of the disagreeable property of fouling the tools in working, which is of special importance in filing and turning. In casting brass containing lead care must, however, be had to cool the castings very rapidly, as otherwise the lead readily separates in the lower portion of the casting and produces unsightly spots.

By a slight addition of tin the brass becomes more fusible, somewhat denser, and takes a better polish; it is also rendered somewhat less brittle. The presence of a small quantity of iron increases the hardness of brass considerably, such brass on exposure to the air being, however, easily stained by rust.

In the arts brass is commonly employed in the construction

# THE METALLIC ALLOYS.

of scientific apparatus, mathematical instruments, small parts of machinery, and for many other purposes. A distinction is generally made between sheet brass used in the manufacture of wire and sheets and cast-brass, which requires no further mechanical manipulation than turning and filing. A number of alloys occur in commerce under various names, but, as regards their composition, they must be included in the generic term, *brass*, though some of them are especially adapted for certain purposes.

In the following we give Mallet's table of the properties of copper-zinc alloys :---

| Atomic<br>compo-<br>sition.   |                  | Copper.          | Specific<br>gravity. | Color.                      |            |               | Order of-          |                 |   |
|---|------------------|------------------|----------------------|-----------------------------|------------|---------------|--------------------|-----------------|---|
|   |                  |                  |                      |                             | Fracture.  | Tenacity.     | Mallea-<br>bility. | Hard-<br>ness.  | Fusi-<br>bility.                          |
|   |                  | By anal.         |                      |                             |            | Tons per      |                    |                 |   |
| Cu  | Zn               | per cent.        |                      |                             |            | sq. in.       |                    |                 |   |
| 1 :   | 0                | 100              | 8.667                | red                         | _          | 24.6          | $\frac{8}{6}$      | 22              | 15  |
| 10 :  | 1                | 98.80            | 8.605                | red-yellow                  | coarse     | 12.1          | 6                  | 21              | 14  |
| $9: \\ 8: \\ 7: $   | 1                | 90.72            | 8.607                |                             | fine       | 11.5          |                    | 20              | 13  |
| 8 :   | 1                | 88.60            | 8.633                |                             |            | 12.8          | 2                  | 19              | 12  |
| 7 :   | 1                | 87.30            | 8.587                |                             |            | 13.2          | 0                  | 18              | 11  |
| 6 :   | 1                | 85.40            | 8.591                | yellow-red                  | fine fibre | 11.1          | 5<br>11            | 17              | 10  |
| 5 :   | 1                | 83.02            | 8.415                |                             |            | 13.7          |                    | 16              | 9<br>8<br>7<br>6<br>6<br>6                |
| $     \begin{array}{c}       4 & : \\       3 & : \\       2 & : \\       1 & :     \end{array} $ | $\frac{1}{1}$    | 79.65            | 8.448                |                             |            | 14.7          |                    | $\frac{15}{14}$ | 8   |
| 3 :   |                  | 74.58            | 8.397                | pale yellow                 |            | 13.1          | 10<br>3            |                 |   |
| 2   | $\frac{1}{1}$    | $66.18 \\ 49.47$ | 8.299                | deep yellow                 |            | 12.5          |                    | $\frac{13}{12}$ | O C                                       |
| 1: 1:   | $\frac{1}{2}$    | 32.85            | 8.230                |                             | coarse     | $9.2 \\ 19.3$ | $12 \\ 1$          | $\frac{12}{10}$ | 0   |
| 8 :   | $17^{2}$         | 31.52            | $8.263 \\ 7.721$     | dark yellow<br>silver-white |            | 2.1           | very               | 10              | 0   |
| • :   | 11               | 01.02            | 1.121                | suver-white                 |            | 2.1           | brittle            | 5               | 5   |
| e .   | 18               | 30.36            | 7.836                | 44                          | "          | 2.2           |                    | 6               | 5   |
| 8 :   | 19               | 29.17            | 7.019                | light gray                  | 66         | 0.7           |                    | 7               | 5   |
| 8:  | 20               | 28.12            | 7.603                | ash-gray                    | vitreous   | 3.2           | brittle            | 3               | 5   |
| 8 : : : : : : : : : : : : : : : : : : :   | $\tilde{21}$     | 27.10            | 8.058                | light gray                  | coarse     | 0.9           |                    | ğ               | 5<br>5<br>5<br>5<br>5<br>5<br>5<br>5<br>5 |
| 8 :   | $\bar{2}\bar{2}$ | 26.24            | 7.882                | inght gray                  | 44         | 0.8           | **                 | 9<br>1          | 5   |
| 8 :   | 23               | 25.39            | 7.443                | ash-gray                    | 4.6        | 5.9           | slightly           | <u>^</u>        |   |
|   | _0               |                  |                      |                             |            |               | ductile            | 1               | 5   |
| 1 :   | 3                | 24.50            | 7.449                | 66                          | 11         | 3.1           | brittle            | 2               | $5\\4\\3\\2\\1$                           |
| 1 :   | 4                | 19.65            | 7.371                | 44                          | " "        | 1.9           | 44                 | 4               | 3   |
| 1 :   | 5                | 16.36            | 6.605                | dark gray                   | "          | 1.8           | "                  | 11              | 2   |
| 0 :   | 1                | 0                | 6.895                | 5.                          |            | 15.2          |                    | 23              | 1   |
|   |                  |                  |                      | 1                           |            | ,             |                    |                 |   |

In the above table the minimum of hardness and fusibility is denoted by 1.

Sheet brass (for the manufacture of sheet and wire).—Especially pure metals as free as possible from foreign bodies injurious to ductility (bismuth, antimony, arsenic, tin, lead, iron) have to be used for this purpose. Sheet to be stretched very thin under the hammer, for instance, the best quality of German sheet-brass for musical instruments contains as a rule 19 to 21 per cent. zinc, sheet still suitable for most purposes, 22 to 30 per cent., and sheet for toys and articles easily shaped 30 to 40 per cent. Brass for wire requires similar compositions.

Filings and turnings always contain small quantities of iron particles and, hence, are not suitable as an addition to the better qualities of brass. Silesian zinc, as a rule, contains not less than 0.75 per cent. lead. Missouri zinc is very pure, and also Spanish zinc, brand R. C. A. Refinado, the latter being free from arsenic, antimony and sulphur, and contains only 0.05 per cent. lead and a trace of iron; it is used for the best quality of sheet-brass (cartridge shells). The more sheetbrass is to resist the action of acid and alkaline fluids, the richer in copper it should be, and, accordingly, the following proportions of copper to zinc may be recommended : .70: 30, 66: 34, and 60: 40. Brass for cartridge shells contains 72parts copper and 28 parts zinc, with at the utmost 0.25 per cent. lead, or still better entirely free from lead.

The best evidence of the quality of a brand of copper is that it yields brass suitable for the preparation of thin sheet and wire, and the sharpest test for the quality of the copper consists in that when the brass is drawn out to tubes over a corebar, the tubes show no cracks. The following analyses show the composition of various varieties of brass for sheet and wire:

| Brass.     | Place of derivation.               | Copper.          | Zinc.            | Lead.          | Tin. | Silicium. | Antimony. | Iron. |
|------------|------------------------------------|------------------|------------------|----------------|------|-----------|-----------|-------|
| Sheet      | Jemappes<br>Stolberg               | 64.6<br>64.8     | 33.7<br>32.8     | 1.4<br>2.0     | 0.2  |           |           | -     |
| 4.6        | Romilly                            | 70.1             | 29.26            | 0.28           | 0.17 | _         | _         | · ·   |
| 64         | Rosthorn (Vienna)                  | 68.1             | 31.9             | trace          |      | _         | _         | -     |
| 66         | <u> </u>                           | 71.5             | 28.5             | -              | -    | -         | -         | —     |
| 66         | -                                  | 71.36            | 28.15            | _              |      |           | -         | -     |
| <i>" "</i> | —                                  | 71.10            | 27.6             | 1.3            | -    |           | -         | -     |
| 66         | Iserlohn and Romilly               | 70.1             | 29.9             |                | —    | -         | -         | -     |
| "          | Lüdenscheid                        | 72.73            | 27.27            |                | -    |           | -         | -     |
| 46         | (brittle)                          | 63.66            | 33.02            | 2.52           |      | 0.61      | -         | -     |
|            | Hegermühl                          | 70.16            | 27.45            | 0.79           | 0.20 | - 1       |           | 0.23  |
| Wire       | Oker<br>England                    | $69.98 \\ 70.29$ | $29.54 \\ 29.26$ | $0.97 \\ 0.28$ | 0.17 | -         | 0.79      | 0.23  |
| wire       | Augsburg                           | 70.29            | 29.20            | 0.28           | 0.17 | -         | -         | _     |
| 66         | Neustadt-Eberswalde                | 70.16            | 27.05<br>27.45   | 0.85           | 0.79 | _         | _         |       |
| 44         | Neustaut-Eberswalde                | 71.36            | 28.15            | 0.20           | 0.15 |           |           |       |
| 44         |                                    | 71.5             | 28.5             |                |      | _         |           |       |
| "          | _                                  | 71.0             | 27.6             | _              | _    | _         | _         | _     |
| 44         | (Good quality)                     | 65.4             | 34.6             |                | _    | _         |           | _     |
| 44         | (Brittle)                          | 65.5             | 32.4             | 2.1            | -    | -         | _         |       |
|            | (Good composition for              |                  |                  |                |      |           |           |       |
|            | sheet and wire)                    | 67               | 32               | 0.5            | 0.5  | _         | - 1       | _     |
|            | China, best quality                |                  |                  |                |      |           |           |       |
|            | brass                              | 10               | 5                | -              | -    | - 1       | -         |       |
|            | China, ordinary qual-<br>ity brass | 10               | 2.7              | _              | _    | _         | _         | _     |
|            |                                    |                  |                  |                |      | 1         |           |       |

Japanese brass (Schin-chiu) contains as a rule 30 parts zinc to 70 parts copper, though there are also alloys with 35 parts zinc.

Alloys with 34 to 37 and 40 per cent. zinc are frequently used for the manufacture of sheet and wire, sheet with 37 per cent. zinc being distinguished by extraordinary toughness and ductility in a cold state.

*Cast-brass* being used for the most diverse purposes, it is difficult to give a composition of general value, since the demands made on this metal vary much according to the article to be manufactured, it being used for very ordinary wares, such as locks, keys, shields, escutcheons, buttons, hinges, etc., as well as for the finest mechanical instruments and objects of art.

As a rule cast-brass contains more zinc than that which is to be worked into sheet and wire. It is therefore more fusible, but at the same time harder and more brittle than wire-brass. The materials not being chosen with such great

#### COPPER ALLOYS.

care as for wire, a chemical analysis reveals frequently the presence of a considerable number of foreign metals. The turnings, chips, and other brass-waste are generally utilized by melting them together by themselves, or as addition in fusing cast-brass. Such turnings, etc., frequently containing, besides brass, iron and bronze, explain the contamination of the cast-brass with iron, tin, and lead; sometimes a small quantity of arsenic is also found. Cast-brass is also much used in the manufacture of the so-called hard solder for soldering articles exposed to a high temperature. In the following table we give an analysis of various kinds of cast-brass, which shows the great variations in its composition :—

| Variety.  | Copper.<br>Per cent.                        | Zinc.<br>Per cent. | Iron.<br>Per cent.                          | Lead.<br>Per cent.                      | Tin.<br>Per cent. |
|---|---|--------------------|---|---|-------------------|
| Cast brass from Oker                                | 71.88                                       | 24.42              | 2.32  | 1.09                                    | _                 |
| Cast brass from Oker<br>Black Forest clock wheels . | $64.24 \\ 60.66$                            | $37.27 \\ 36.88$   | $\begin{array}{c} 0.12 \\ 0.74 \end{array}$ | 0.59                                    | 1.35              |
| Black Forest clock wheels .                         | 66.06                                       | 31.46              | 1.43  | 0.88                                    | 1.55              |
| Cast brass from Iserlohn                            | 63.7  | 33.5               | _   | 0.3                                     | 2.5               |
| Cast brass from Iserlohn                            | 64.5  | 32.4               |   | 2.9                                     | 0.2               |
| French yellow brass (Potin                          | 71.0  | 21.0               |   | 2.0                                     | 1.0               |
| <i>jaune</i> )                                      | $\begin{array}{c} 71.9 \\ 66.2 \end{array}$ | $24.9 \\ 33.11$    | 0.66  | $\begin{array}{c} 2.0\\ 2.0\end{array}$ | 1.2               |
| English sterling metal                              | 66.66                                       | 26.66              | 0.66  | 0                                       |                   |
|   |   |                    |   |   |                   |

Ordinary cast-brass (potin jaune, potin gris, sterling metal).— The mixture of metals known under these names is the poorest quality of brass, and its composition varies so much as to make it impossible to state it within narrow limits. This quality of brass is generally prepared by fusing together old brass-waste of all kinds and subjecting it to a casting test. If the fracture is not too coarse-grained and the metal not too brittle, it is used without further addition for articles known under the collective term of brazier's ware (spigots, candlesticks, mortars, etc.). Brass of this quality is readily worked with the file, but difficult to turn.

By adding to ordinary cast-brass a certain quantity of lead and tin, a metal of a somewhat whiter color is obtained, which is called *potin gris* by the French, and is more easily worked with the lathe and file. The so-called "sterling metal" is somewhat harder in consequence of a content of iron, and can therefore be much better worked than ordinary brass. By adding to sterling metal some tin, it acquires still greater hardness and takes a good polish.

Fine cast-brass.—Brass to be suitable for the manufacture of fine articles must, besides being readily worked with file and chisel, possess other properties of great importance in the manufacture of such articles. It should allow of being readily cast, and fill the moulds exactly. Further, articles of luxury manufactured from brass are frequently to be gilded, and experience has shown that brass of a beautiful color approaching that of gold requires less gold for the purpose than brass of an unsightly pale-yellow color. In order to be enabled to save gold, it is therefore of importance to manufacture the alloy so as to show a color shading into reddish. Generally speaking, such alloys contain from 20 to 50 parts of zinc to 100 parts of copper; lead or tin, or both, in the proportion of 0.25 to 3 per cent. of each metal being added, according to the purpose for which the alloy is to be used. In the following we give the compositions of several alloys which have stood a practical test in this respect.

Tough brass for tubes.—In chemical factories tubes and other utensils of brass are frequently used, which must be capable of resisting chemical influences as well as pressure. In preparing alloys for this purpose very pure materials should be employed. The following compositions may be recommended :

COPPER ALLOYS.

|        |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | Ι. | II. | III. | IV. |
|--------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|----|-----|------|-----|
| Copper |   | • | • | • | • | • | • | • | • | • | • | • | • | • | • |   | 80 | 70  | 66   | 60  |
| Zinc   | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | 20 | 30  | 34   | 40  |

Alloy No. I. is used chiefly in England; the other three are employed in German factories.

Hamilton's metal, mosaic gold, chrysorin.—The alloys known under the above names have a very beautiful color, closely resembling that of gold, and are distinguished by a very fine grain, which makes them especially suitable for the manufacture of castings to be subsequently gilded. The alloys are, as a rule, composed of copper, 100 parts; zinc, 50 to 55.

In order to obtain a thoroughly homogeneous mixture of the two metals it is recommended first to bring into the crucible one-half of the zinc to be used; place upon this the copper, and fuse the mixture under a cover of borax at as low a temperature as possible. When the contents of the crucible are liquid, heat the other half of the zinc, cut in small pieces, until almost melted, and throw them into the crucible in portions; stir constantly, to effect as intimate a mixture of the metals as possible.

French cast-brass for fine castings.—As is well known, the bronze industry has reached a high degree of perfection in France, where clock-cases, statuettes, and other articles of luxury are manufactured on a large scale. The so-called bronze used for these articles is, however, in most cases not actual bronze, but fine cast-brass. In the following table we give the compositions of a few mixtures of metals generally used by the French manufacturers. They can be readily cast, worked with file and chisel, and easily gilt.

|                |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |                 | Pa   | rts.   |                 |
|----------------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|-----------------|--|--|-----------------|
|                |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | г.              | II.  | III.   | IV.             |
| Copper<br>Zinc | • | • |   | • | • | • | • | • | • | • | • | • | • | • | • | 63.70           | 64.45                                      | 70.90  | 72.43           |
| Tin            |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | $33.55 \\ 2.50$ | $\begin{array}{c} 32.44\\ 0.25\end{array}$ | $\begin{array}{c} 24.05 \\ 2.00 \end{array}$ | $22.75 \\ 1.87$ |
| Lead .         | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | 0.25            | 2.86                                       | 3.05   | 2.95            |

Bristol brass (Prince's metal).—The alloy known by this name possesses properties similar to those of the abovementioned French varieties of brass, and can be prepared according to the following proportions :—

|        |  |   |   |  |   |   |   |   |   |   |   | i.     | II.  | III. |
|--------|--|---|---|--|---|---|---|---|---|---|---|--------|------|------|
| Copper |  | • |   |  |   | • | • | • |   | • |   | . 75.7 | 62.2 | 60.8 |
| Zinc . |  | • | • |  | • |   |   | • | • |   | • | . 24.3 | 32.8 | 39.2 |

Regarding the preparation of this and similar alloys, the same holds good as has been said under Hamilton's metal.

*Ronia metal* consists of brass, with a small quantity of cobalt, manganese, and phosphorus.

D'Arcet's gilding metals have the following composition :

|   |          |     |    |    |    |   |   |   |   |   |   | Ι.    | 1 <b>I</b> . | III.  | IV.   |
|---|----------|-----|----|----|----|---|---|---|---|---|---|-------|--------------|-------|-------|
|   | Copper   | •   |    |    |    | • | • | • |   | • |   | 63.70 | 64.45        | 70.90 | 72.43 |
|   | Zinc .   | •   |    | •  | •  | • | • | • |   |   | • | 33.55 | 32.44        | 24.05 | 22.75 |
| • | Tin      |     | •  | •  |    |   | • | • | • | • | • | 2.50  | 0.25         | 2.00  | 1.87  |
|   | Lead .   | •   | •  |    | •  | • | • |   | • | • |   | 0.25  | 2.86         | 3.05  | 2.95  |
|   | Specific | e g | ra | vi | ty | • | • | • | • | • |   | 8.395 | 8.542        | 8.492 | 8.275 |

Malleable brass.—For castings which are to be shaped by forging or rolling, copper-alloys rich in zinc (Muntz metal) and copper-zinc-iron alloys (Aich metal, sterro-metal, deltametal,) are especially suitable, they possessing great strength, and the valuable property of being ductile in the cold as well as at a red heat. A content of 1 to 3 per cent. of iron is said

to increase the malleability at a red heat; it is not yet decided whether the small content of iron produces these properties or whether they are due to the absorption of the oxygen of the copper by the iron. By a larger addition of iron the ductility of the alloys is injured. Bull claims to produce alloys with more than 9 per cent. iron or manganese. The observation that brass, which as ordinarily composed is brittle at a red heat, becomes ductile at a red heat by a greater content of zinc (not much below 35 per cent. and not much over 40 per cent.) appears to have first been made by J. Keir, of Westbromwich, near Birmingham, who, in 1779, took out a patent for a metallic mixture of copper, 54, zinc, 40.5, and iron, 5, which could be forged cold as well as at a red heat. This alloy was to be used for ship-sheathing, in the manufacture of nails and rivets coming in contact with sea water, etc. The matter fell into oblivion, and in 1832 another Englishman, Muntz, took out a patent for an alloy of copper, 60 parts, and zinc, 40 parts, or copper, 56, zinc,  $43\frac{1}{4}$ , and lead,  $3\frac{3}{4}$ , intended for the same purposes. This alloy became known as Muntz metal or malleable brass. It is still employed, chiefly for shipsheathing, bolts and rivets, instead of copper, because it is claimed that the sea-water attacks the zinc gradually and uniformly over the entire surface, and that it prevents the deposit of barnacles, etc. According to the most recent investigations this brass, however, is corroded not uniformly, but in holes.

To the malleable varieties of brass belong :

Malleable brass, Muntz metal, yellow metal, etc.—These alloys possess the valuable property of being ductile in the heat, and castings prepared from them can be worked warm like iron.

Yellow metal.—This metal possesses the property of being

less attacked by sea-water than pure copper, and it was formerly much used for ship-sheathing and in the manufacture of nails and rivets coming in contact with sea-water. Since the introduction of iron as material for larger vessels it has, however, lost some of its former importance.

Yellow metal or Muntz metal (so-called after its inventor) consists generally of copper 60 to 62 parts, zinc 40 to 38.

The metal is prepared with the observance of certain precautionary measures in order to obtain it with as uniform a grain as possible, experience having shown that only finegrained alloys of uniform density can resist sea-water. To obtain as uniform a grain as possible, small samples taken from the fused mass are quickly cooled and examined as to fracture. If the latter does not show the desired uniform grain, some zinc is added to the fused mass. After its distribution through the entire mass a fresh sample is taken and tested, this being continued until the desired object is attained. It need scarcely be mentioned that considerable experience is required to tell the correct composition of the alloy from the fracture. The mass is finally poured into moulds and rolled cold.

*Macht's yellow metal.*—This alloy, consisting of copper 33 parts and zinc 25, has a dark golden-yellow color, great strength, and can be forged at a red heat, properties which make it especially suitable for fine castings.

*Bobierre's metal*, consisting of copper 66 parts and zinc 34, is claimed to be especially suitable for ship-sheathing.

From experiments made in regard to malleable brass it has been learned that all alloys containing up to 58.33 per cent. of copper and up to 41.67 per cent. of zinc are malleable. There is, however, a second group of such alloys with 61.54

per cent. of copper and 38.46 per cent. of zinc, which are also malleable in the heat. The preparation of these alloys requires, however, considerable experience, and is best effected by melting the metals together in the ordinary manner, and heating the fused mass as strongly as possible; it must, however, be covered with a layer of charcoal-dust to prevent oxidation of the zinc. By the mass becoming thinly-fluid an intimate mixture of the constituent parts is effected. Small pieces of the same alloy previously prepared are then thrown into the liquid mass until it no longer shows a reflecting surface, when it is cast into ingots in iron moulds. The ingots while still red-hot are thrown into water, acquiring by this treatment the highest degree of ductility. The alloy properly prepared must show a fibrous fracture and have a reddishyellow color.

Aich's metal.—This alloy, named after its inventor, consists of a brass to which a considerable degree of tenacity has been imparted by an addition of iron. It is especially adapted for purposes where the use of a hard and, at the same time, strong metal is required.

According to analyses of various kinds of this metal, it shows, like other alloys, considerable variations in the quantity of the metals used in its preparation. Even the content of iron, to which the hardening effect is ascribed, may vary within wide limits without the strength, which is the principal property of this alloy, being modified to a considerable extent.

The best alloy, which can be called an Aich's metal, is composed of copper 60 parts, zinc 38.2, iron 1.8. The content of iron must be limited to from 0.4 to 3.0 per cent. Another Aich's metal showing excellent properties is composed of copper 60.2 parts, zinc 38.2, iron 1.6.

The hardness of Aich's metal is claimed to be not inferior to that of certain kinds of steel. It has a beautiful goldenyellow color, and is said to oxidize with difficulty, which makes it of great value for articles exposed to the action of air and water.

Sterro-metal—The properties of this alloy approach closely those of Aich's metal, it consisting, like it, of an alloy of copper, zinc, and iron, but containing a larger quantity of the latter. The composition of the alloy may vary considerably, a little tin being sometimes added. We give in the following an analysis of two varieties of sterro-metal of excellent quality :

Sterro-metal from Rosthorn's factory in Lower Austria.—Copper 55.33 parts, zinc 41.80, iron 4.66.

English sterro-metal (Gedge's alloy for ship-sheathing).—Copper 60 parts, zinc 38.125, iron 1.5.

The principal value of this alloy is its great strength, in which it is not surpassed by the best steel. While a wroughtiron pipe broke with a pressure of 267 atmospheres, a similar pipe of sterro-metal stood the enormous pressure of 763 atmospheres without cracking. Beside its strength it also possesses a high degree of elasticity, and on account of these properties is especially adapted for cylinders of hydraulic presses. As is well known, these cylinders begin to sweat at a certain pressure, *i. e.*, the pressure in the interior is so great that the water permeates through the pores of the steel. With a cylinder of sterro-metal the pressure can be considerably increased without the exterior of the cylinder showing any moisture.

According to the purpose for which it is to be used, the sterro-metal can be made especially hard and dense, but this change in its properties is less effected by altering the chemical composition than by mechanical manipulation.

If cast sterro-metal be rolled or hammered in the heat, it acquires, besides strength, an exceedingly high degree of toughness. In hammering the metal special care must be had not to overheat it, as otherwise it easily becomes brittle, and cracks under the hammer.

A sterro-metal containing copper 55.04, zinc 42.36, tin 0.83, and iron 1.77 was tested by Baron de Rosthorn, of Vienna, and gave the following results:\*

|                   | Ten   | nacity.   |
|-------------------|---|---|
| Material.         | Lbs. per square<br>inch.  | Kilogrammes per<br>sq. centimetre.                          |
| Sterro-metal cast | $\begin{array}{r} 60,480\\ 76,160\\ 85,120\\ 40,320\end{array}$ | $\begin{array}{r} 4252 \\ 5354 \\ 5984 \\ 2834 \end{array}$ |

The specific gravity of this metal was 8.37 to 8.40 when forged or wire-drawn; it has great elasticity, stretching 0.0017 without set, and costs 30 to 40 per cent. less than gunbronze. It has been forged into guns, cold from the casting.

*Delta metal.* On account of its strength this alloy is frequently used for parts of machinery as well as for art purposes. It closely resembles sterro-metal. It is essentially a brass hardened by an addition of iron. Besides the latter some manufacturers add small quantities of tin and lead; in some samples the presence of nickel has also been established. The following analyses of delta metals give an illustration of the composition of these alloys :

\*Holley: "Ordnance and Armor."

|              | Ι.        | II.                        | III.      | IV.   | V.                         |
|--------------|-----------|----------------------------|-----------|---|----------------------------|
|              | per cent. | $\operatorname{per}$ cent. | per cent. | $\operatorname{per}\operatorname{cent}\nolimits.$ | $\operatorname{per}$ cent. |
| Copper       | .55.94    | 55.80                      | 55.82     | 54.22   | 58.65                      |
| Zine         | . 41.61   | 40.07                      | 41.41     | 42.25   | 38.95                      |
| Lead         | . 0.72    | 1.82                       | 0.76      | 1.10  | 0.67                       |
| Iron         | . 0.87    | 1.28                       | 0.86      | 0.99  | 1.62                       |
| Manganese    | . 0.81    | 0.96                       | 1.38      | 1.09  |                            |
| Nickel       | . trace   | trace                      | 0.06      | 0.16  | 0.11                       |
| Phosphorus . | . 0.013   | 0.011                      | trace     | 0.02  | -                          |

No. I. is cast delta metal, No. II. wrought, No. III. rolled, and No. IV. hot stamped.

In making delta metal zinc is strongly heated (to above 1652° F.) in crucibles, and enough spiegeleisen or ferromanganese introduced to form an alloy of 95 parts zinc and 5 parts iron. Copper or brass and a very small quantity of phosphor-copper are then added.

The advantages claimed for delta metal are great strength and toughness. It produces sound castings of close grain. It can be rolled and forged hot, and can stand a certain amount of drawing and hammering when cold. It takes a high polish, and when exposed to the atmosphere tarnishes less than brass.

When cast in sand delta metal has a tensile strength of about 45,000 pounds per square inch, and about 10 per cent. elongation; when rolled, tensile strength of 60,000 to 75,000 pounds per square inch, elongation from 9 to 17 per cent. on bars 1.128 inch in diameter and 1 inch area.\*

Wallace<sup>†</sup> gives the ultimate tensile strength 33,600 to 51,520 pounds per square inch, with from 10 to 20 per cent. elongation.

\* Iron (London) Vol. 21, p. 159.

† Trans. of the Institution of Naval Architects, 1888, p. 374.

#### COPPER ALLOYS.

Tobin bronze.—As regards composition and properties this alloy closely resembles delta metal. Analyses of various samples showed the following results:

|            | I.        | II.       | III.      | IV.       |
|------------|-----------|-----------|-----------|-----------|
|            | per cent. | per cent. | per cent. | per cent. |
| Copper     | . 61.203  | 59.00     | 61.20     | 82.67     |
| Zine       | . 27.440  | 38.40     | 37.14     | 3.23      |
| Tin        | . 0.906   | 2.16      | 0.90      | 12.40     |
| Iron       | . 0.180   | 0.11      | 0.18      | 0.10      |
| Lead       | . 0.359   | 0.31      | 0.35      | 2.14      |
| Silver     | . —       | _         | _         | 0.07      |
| Phosphorus | . —       | _         | —         | 0.005     |

The Ansonia Brass and Copper Company are, according to F. Lynwood Garrison,\* the sole manufacturers of Tobin bronze. They claim to obtain 79,600 pounds per square inch tensile strength, an elastic limit of 54,257 pounds per square inch, and from 12 to 17 per cent. elongation with best rolled one-inch bars.

Tobin bronze, according to the inventor's claim, can be forged and stamped at a red heat as readily as steel. Bolts and nuts can be forged from it by hand or machinery, when cold drawn. Its increased density and high elastic limit, and the facility with which it can be upset, while hot, make it well adapted for special purposes. In forging Tobin bronze it is stated that particular care must be taken to work it only at a cherry-red heat, and that it should not be worked at a black heat.

Alloy No. IV., given in the above table, is brought into commerce under the name of

Deoxidized bronze. It seems probable some deoxidizing flux

\*New Alloys and their Engineering Applications. Jour. of the Franklin Institute, June and September, 1891.

containing phosphorus, similar to that used in the manufacture of phosphor-bronze, is made use of in the manufacture of this alloy. Deoxidized bronze is largely used for wood-pulp digesters, as it is found to resist the action of sodium hyposulphite and sulphurous acid remarkably well. Deoxidized bronze wire has a tensile strength in the neighborhood of 150,000 pounds per square inch.\*

Of the mixtures of metals termed brass, the alloys given in the preceding are the most important used in the industries with the exception of aluminium brasses, which will be discussed under "Aluminium Alloys," Chapter XI. It will, of course, be understood that they by no means exhaust the number of alloys which can be included in the generic term, brass, that number being so large that they can scarcely be enumerated. In examining a variety of brass, small variations in its quantitative composition can always be observed. No matter how small these variations may be, they nevertheless exert a great influence upon the physical properties of the respective alloys, so that an alloy differing but little in its chemical composition from another one, may nevertheless vary very much from it in regard to its physical qualities. Many manufacturers are of the opinion that the physical properties of the alloys are also largely influenced by the mode of manufacture, and those whose products are especially distinguished by great uniformity always work according to a determined method. Hence the manufacture of brass is of equal importance with the composition of the alloys.

## Manufacture of Brass.

Before zinc was known in the metallic form, brass, as pre-

\*F. Lynwood Garrison, New Alloys and their Engineering Application. Jour. of the Franklin Inst., June and Sept., 1891.

viously mentioned, was prepared by fusing copper together with zinciferous ores, as calamine or carbonate of zinc, as well as with cadmia, the zinc reduced by this process combining with the copper to an alloy. As is well known, the chemical composition of even the purest ores from the same locality always varies somewhat, and it is not possible with the use of zinc ores to obtain a mixture of metals of determined properties and general uniformity. Manufacturers working according to this old method must, therefore, on the one hand, use very uniform zinc ore, and on the other possess a thorough knowledge of the properties of brass, so as to be able to tell, from the color and fracture of a sample of the fused mass, whether the alloy possesses the requisite qualities or whether it requires the addition of a further quantity of zinc ore or of Though the manufacture of brass with the use of copper. zinc ores is less expensive than the fusion of the pure metals, it is at present carried on in very few places, because the more modern process is connected with less difficulty, and an entirely uniform product is obtained with greater ease. For the sake of completeness we will briefly describe this antiquated process of manufacturing brass.

A. Manufacture of brass according to the old method with the use of zinciferous ores.—Before the ores can be melted they have to be subjected to a preparatory treatment, in order to remove, as much as possible, admixtures of foreign metals (lead, arsenic, antimony,) which would have an injurious effect upon the quality of the brass. The native calamine, after being calcined, in order to expel the sulphur, is ground in a mill, the galena contained in it removed by washing, and it is then mixed at the same time with about one-fourth its volume of charcoal. This mixture is put into large cylindrical cruci-

bles, with alternate layers of granulated copper. Powdered charcoal is then thrown over the whole, and the crucibles are covered and luted up. The old form of furnace was a cone with the base downwards and the apex cut off horizontally. The crucibles were placed upon a circular grate or perforated iron plate upon the bottom, with a sufficient quantity of fuel thrown around them, and a perforated cover made of bricks or clay was fitted to the mouth, which served as a register to regulate the heat. After the alloy is supposed to be formed (the time varying from 10 to 20 hours, according to the nature of the calamine and the size of the crucibles), the heat is increased, so as to fuse the whole down into one mass. The till is then thrown up, and a workman, standing over the opening, grasps the crucible between the jaws of a pair of tongs and lifts it out of the furnace. The refuse is skimmed off, and another workman then seizes the crucible with a pair of tongs and pours the contents into iron moulds, guiding the stream with an iron rod. During this process there is a considerable combustion of zinc, the metal burning with its characteristic blue flame. When the material is good a single fusion is sufficient, but the finer sorts undergo a second fusion with fresh calamine and charcoal.

The crude brass may show several defects in regard to its composition. It may either contain too much zinc or copper, or the reduction of the zinc may not have proceeded in a complete manner. In such cases it is possible to improve the alloy by a corresponding addition of copper, zinc ore, or charcoal, and by again fusing it. Sometimes pieces of brass or metallic zinc are also added.

B. Manufacture of brass by fusing the metals together.—At the first glance this would appear to be a very simple operation;

#### COPPER ALLOYS.


it is, however, connected with many difficulties, and considerable skill is required to produce brass answering determined demands in regard to fusibility, tenacity, etc. In most factories the fusion of the metals is still effected in crucibles heated in reverberatory furnaces. For many years experiments have been made to do away with the crucibles and effect the fusion of the metals directly in special furnaces. It is evident that such a process of production would be considerably cheaper, as there would be no expense for crucibles and the consumption of fuel be considerably less. The use of a furnace in which the metals could be melted down in large quantities would have the further advantage of obtaining at one operation a large quantity of brass of the same quality.

The results of experiments made in this direction have, however, been so unsatisfactory as to force a return to the older and more expensive method of fusion in crucibles. The general introduction of furnaces for melting down the brass cannot, however, be considered as entirely abandoned, as the technical difficulties in the way will, no doubt, be overcome before long. More recently experiments on a large scale have again been instituted by well-known manufacturers, which hold out a hope of final success. For the present we must, however, confine ourselves to a description of the best constructions of furnaces for crucibles.

The manner of constructing these furnaces depends chiefly on the fuel to be used (coal, coke) and on the number of crucibles to be placed in the furnace at one time. Generally speaking, the furnaces for a certain kind of fuel agree in most respects, the variations being chiefly in the arrangement of the crucibles in the furnace, and the manner of distributing the flame around them.

We first give a description of a furnace especially adapted for the use of coke.

The furnace, Figs. 1 and 2, consists of a vault of refractory material and is about  $3\frac{1}{4}$  feet high. On the narrowest place of the vault is an aperture through which the furnace communicates with a well-drawing chimney. The plate upon which the crucibles for melting the brass stand has seven

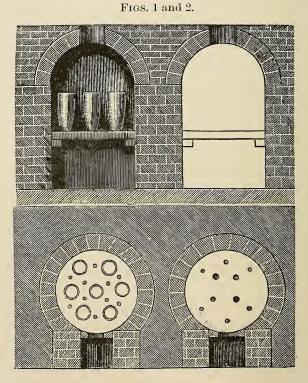

apertures so arranged that six of them are in the periphery of a circle, while the seventh forms the centre of the circle. Between these larger apertures serving for the reception of the crucibles are smaller ones, which admit the air from below into the furnace. The bottom plate consists of a thick cast-

iron plate coated with a layer of fire-clay. The six crucibles standing on the periphery of the circle have a height of 1.18 feet, with an upper diameter of 0.65 foot, which corresponds to a bottom diameter of 0.55 foot.

The crucible sitting in the centre hole is called the king crucible, and being more exposed to the heat is generally somewhat larger; it is, as a rule, 1.18 feet high with an upper diameter of 0.75 foot. The smaller crucibles hold about 92 to 97 pounds of metal and the king crucible about 132 pounds.


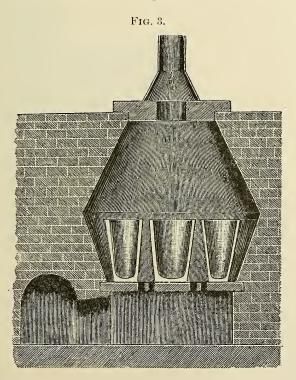


Fig. 3 shows another construction of a brass furnace. As will be seen from the illustration, the space in which the crucibles are placed has the form of two truncated cones

touching each other with the basis, a shaft being thus formed in which less fuel is consumed than in a furnace having the form of a cylinder. In place of coke charcoal may be used in this furnace, if the local conditions are such as to allow of its employment without increasing the cost of the brass.

In the preparation of plate-brass the fused metal has to be cast in special moulds to solidify. It is, however, of import-

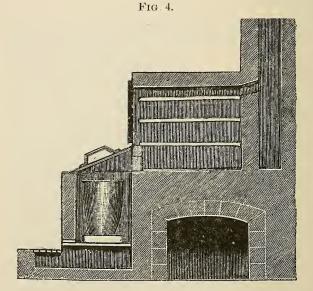

ance that this solidification should not take place too rapidly, as otherwise the properties of the brass might be injured. To prevent too rapid cooling the moulds serving for the reception of the fused mass are strongly heated, special furnaces having been constructed for the purpose, in which the gases escaping from the actual melting space are utilized for heating the moulds. Fig. 4 shows the construction of such a furnace in cross-section.

The crucibles in which the charge is to be melted stand

upon a grate; the fuel is introduced from above, and the gases of combustion pass through a flue into a space divided into several low stories in which the moulds are placed. With the use of coke or charcoal the work is very convenient, since no smoke is developed which could possibly contain combustible combinations. As will be seen from the above descriptions of furnaces for the use of coke or charcoal, no special provisions are required to insure a complete combustion of the fuel, it being sufficient to connect the furnace with a chimney producing a moderately strong draught. With the use of coal care must, however, be had to arrange the furnace in such a manner as to insure the complete combustion of all gaseous products evolved from the coal, as otherwise there would be a considerable loss of heat.

The arrangement of furnaces for the use of coal is modified in various ways. In one form of construction the coal is burned upon an ordinary grate, the gases of combustion passing through apertures in a vault of refractory material into a space in which the crucibles are placed. In other constructions, the fire-box is entirely separated from the melting-space, being only connected with it by flues led off at the sides through which the flame passes around the cruibles. Other constructions might be advantageously used for melting down brass. By, for instance, arranging the furnace so as to heat the crucibles by gas, the flame could be suitably regulated by a slide, and with the use of a generating furnace a number of melting furnaces could be kept going at one time. The generating furnace would, of course, have to be placed so as to form the centre of a circle on the periphery of which the separate melting furnaces are located and connected with the generating furnace by suitable flues. With, suppose, six

such melting furnaces, three could be supplied with heat, while the others, after the removal of the crucibles, would be charged with fresh material.

In conclusion we will say a few words in regard to the construction of furnaces in which the fusion of the brass is effected directly upon the hearth. Generally speaking, they must be so arranged that the copper can be quickly melted down upon a flat hearth, care being had that the gases passing over the copper contain a small excess of unburnt bodies, as the presence of free oxygen in the gases might produce an oxidation of the copper, and the resulting admixture of cuprous oxide injure the quality of the brass. After the fusion of the copper it is to be strongly heated, and the zinc, together with any brass waste both previously heated, introduced as quickly as possible. It is advisable to connect the furnace with two preparatory heating spaces, showing different temperatures. In the space showing the lowest temperature the zinc is heated as nearly as possible to its melting point, and in the hotter space the brass waste to be added to the fused mass.

By introducing, as rapidly as possible, the materials thus heated into the heated copper, a too rapid cooling off of the latter by yielding heat to the zinc need not be feared. By this precautionary measure of preparatory heating the metal will remain thinly fluid, even after the introduction of the zinc and the waste brass, and the resulting alloy will be perfectly uniform as regards fracture, hardness, and color.

The manner in which fusion is effected varies somewhat in the different works. In furnaces in which the king-crucible stands in the centre of a circle and the rest on the periphery, the work is generally carried on as follows :—

One of the crucibles is lifted from the furnace, and being placed alongside of it is first charged with a small quantity of brass-waste mixed with a certain quantity of pulverized char-Upon this base the mixture of copper and zinc in suitcoal. able proportions, previously weighed off for each crucible, is placed, and the whole covered with a layer of a mixture of brass-waste and pulverized charcoal. It is also advisable to cover the surface of the contents of the crucible with as high a layer of pulverized charcoal as possible, this preventing at least to some extent a too strong volatilization of the zinc. In brass foundries the waste resulting from casting and otherwise is always melted down with a new charge of the crucibles. The centre crucible, the so-called king-crucible, is generally charged last. In some foundries it is even customary to leave it entirely uncharged, it forming then, so to say, the inner casing of the furnace. This practice, however, cannot be recommended.

The period of the complete fusion of the charge depends on the size of the crucibles, the fuel used, and on the construction of the furnace itself, but should not be longer than from two to five hours. After placing the crucibles in the furnace the fuel (if coke or charcoal be used) is heaped around them, or the coal placed upon the grate and ignited. In working with furnaces provided with a movable plate the latter is from time to time lifted off, in order to see that the surface of the melted metal remains covered with charcoal. When by dipping a rod into the crucibles it is observed that the contents are thoroughly liquefied, the casting can be either at once proceeded with, or samples may first be taken to test the quality of the brass, and, if necessary, change its properties by additions to the fused mass.

While in the course of fusion care must be had to keep the apertures through which the air is admitted to the fuel free, towards the end of the operation they are covered as much as possible in order to save fuel. It is also of importance not to force the heating of the finished alloy further than is absolutely necessary, since by strong overheating a considerable portion of the zinc volatilizes, and the alloy may acquire properties entirely different from those desired.

## Casting Brass.

THE casting of brass requires certain precautionary measures in order to obtain homogeneous pieces as free from flaws as possible. As regards the mode of casting we especially distinguish two different methods, viz.: ingot-casting and plate-casting, the former serving for casting brick-shaped pieces, which are to be remelted for further working or at once brought into the required shape, and the latter for casting plates to be rolled out into sheets.

A. Casting of ingots.—If the brass is to be cast in the shape of bricks, or cubes, or is directly to be used for casting various articles, the operation is carried on as follows: The kingcrucible is generally left empty, and after the brass in the other crucibles is thoroughly melted down, is lifted from the furnace and placed in a depression in front of it filled with glowing coals. One crucible after the other is then taken from the furnace and its contents emptied into the king-crucible. As soon as it is filled the surface of the fused metal contained in it is covered with charcoal and the whole allowed to stand quietly about 15 minutes in order to bring about a uniform mixing of the masses emptied from the different crucibles. After this period, the charcoal is removed from the

surface, and, after vigorously stirring the contents of the crucible several times with an iron rod, the fused metal is poured into the moulds.

As will be seen from the preceding description, the kingcrucible answers here the purpose of a sump, and may be suitably replaced by one. For this purpose another furnace, in which the sump stands free and can be heated to a bright red heat, has to be erected in front of the furnace containing the crucibles. This sump then serves for the reception of the fused brass, and by charging the king-crucible also with metal, the space occupied by it in the centre of the furnace can be advantageously utilized. By arranging several melting furnaces around the sump-furnace and with a proper division of the work, only one sump is required, it being charged in rotation with the contents of the crucibles from the separate furnaces.

The moulds for casting ingots of brass are similar to those used for casting pig-iron. The patterns for the moulds are of wood, and have generally the form of bricks with oblique sides. The patterns are pressed alongside each other in wet moulding sand, a small gutter being left between each two moulds through which the metal after one mould is filled runs into the other.

The object being not so much to give the ingots a beautiful appearance as to obtain them in a handy form, the sand for making the moulds need not be especially fine. The cold ingots of brass have quite a rough surface, and must be freed from adhering grains of sand by rubbing.

For casting articles to be subsequently turned or worked with the file, special care is required in making the mould. As a rule the ingots are remelted in a wind furnace, a certain

quantity of brass or of zinc in pieces, according to the quality the article to be cast is to have, being added to the fused metal. For remelting brass graphite crucibles are generally used, less dross adhering to their walls than to those of the rougher clay crucibles.

The moulds used for casting articles of brass are sometimes made of loam, and must be sharply dried before use to prevent cracking. Suitable moulding sand is, however, generally preferred. The condition of the sand is of great importance for the surface of the cast article; if it be too meagre the surface is rough, and requires much after-work in turning or filing. Meagre sand is improved by adding a small quantity of ordinary flour paste or some sugar syrup. If the sand is too fat, this property is decreased by the addition of some finely pulverized charcoal.

In order to obtain perfect castings great attention must be paid to the temperature of the fused brass. Overheated metal gives, as a rule, porous castings, and if it be too cool the mould is incompletely filled out, which with delicate articles may spoil the entire casting. The metal must be poured in an uninterrupted stream into the mould, otherwise flaws will, as a rule, be formed and the casting be useless. In conclusion it may be remarked that in making the mould vents must be provided for the escape of the aqueous vapor evolved.

B. Casting of plate-brass.—For the preparation of sheet-brass or wire-brass the metal has to be cast in the form of plates of corresponding thickness. It being absolutely necessary for the metal to retain the property of ductility, special precautions must be taken in executing the casting.

Many attempts have been made to use iron moulds, but in most cases the castings turned out failures, on account of the

brass cooling off too rapidly. This evil might, however, be overcome by heating the moulds in a special furnace previously to casting and returning them to the furnace after casting, where by a suitable regulation of the temperature the castings could be cooled off as slowly as desired. Such furnace could be built on the same principle as the cooling furnace used in glass houses.

Loam moulds give good castings, but have the disadvantage of breaking readily, which, to be sure, might be overcome by edging the loam plates with band-iron. At present small moulds of sand are frequently used in many foundries, which must, of course, be thoroughly dried in special furnaces previously to casting. With the use of small moulds and careful work, faultless plates can be readily cast, while with large moulds it frequently happens that some places of the plate are defective and have to be cut out.

In many places granite moulds are still in use, and yield, according to the statements of many manufacturers, the best results. The preparation of these moulds requires great care, the following points deserving special attention: The granite plates have to be provided with a uniform coating of clay, which must always be kept in such a condition as to insure the utmost uniformity in the surface of the plates. To prevent the cracking of the coating of clay, it is covered, after thorough smoothing, with a thin layer of cow-dung.

The granite plates thus prepared are arranged in the following manner: The upper plate is suspended over the lower one, the space or mould between the two being limited by iron bars laid on the lower stone, which is a little longer than the upper one, and projects to the front so as to form a lip or mouth-piece for receiving the metal. The plates are bound

together with iron, and raised on one side so that they stand at an angle of 45°. As soon as the casting is finished and the metal is supposed to be solidified, the sheet of brass is carefully taken from the mould. With sufficient precautions such granite moulds can be used for a long time without the coating of clay becoming damaged, and the sheets turn out very uniform after the mould has once been heated by several castings. One and the same mould is frequently used continually, in order to keep it warm, and if it has to stand empty for some time it is enveloped in a bad conductor, as a coarse carpet, to prevent its cooling. If the mould is damaged it must be carefully mended, and the mended places sharply dried to prevent cracking.

The sheets of brass taken from the mould are subjected to a mechanical cleansing, and at the same time carefully inspected, being defective sheets remelted.


At the present time the plate-brass obtained by casting is generally worked into sheet-brass, which was formerly prepared by hammering, but now by rolling. In some cases rolling is succeeded by hammering, as, for instance, in the case of the very thin sheet-brass known as Dutch metal, which is distinguished by the peculiar clear sound it emits on being pressed together. Thicker plates are occasionally prepared for rolling by hammering. After each passage through the rolls the sheets are heated in a heating furnace, quenched to obtain greater ductility, and then rolled cold until reduced to the desired thickness. In working brass which is only ductile in the heat, the sheets must of course pass in a hot state through the rolls until reduced to the proper size. Before rolling, the sheets, and sometimes the rolls also, are coated with oil. After passing through the rolls the sheet-

brass is finally subjected to a treatment which decides whether it is to be soft and flexible, or hard and elastic. For soft sheet the rolled sheet-brass is again heated and quenched, while for hard and elastic sheet the heating is omitted, and the sheet several times more rolled cold.


The sheets are generally heated in a reverberatory furnace heated by wood or gas. Siemens has constructed regenerative gas reverberatory furnaces for heating. Coal, if used in such furnaces, yields, on account of the sulphur contained in the gases of the fire, a product which after cleansing does not show a beautiful yellow, but a red color, which is due to the copper having entered into combination with the sulphur contained in the gases of the fire. If coal is to be used as fuel, either furnaces with iron or clay muffles washed by the flame are used, or the coal is converted into gases, which before combustion are sucked by means of an exhauster through milk of lime to remove their content of sulphurous acid. Regenerative gas firing is advisable especially for large heating furnaces, since by directing the flame now to one side and then to the other a more uniform heat can be obtained and the temperature more readily regulated.

Figs. 5 and 6 show a reverberatory furnace for wood firing. It is furnished with a grate a, 4 feet long and 2 feet wide; the fire-bridge b projects about  $1\frac{3}{4}$  feet above the hearth c, which is on a level with the grate; the hearth is about 9 feet long and 4 feet wide. The arch behind the fire-bridge is about 3 feet high, and the flue d opens about 1 foot above the hearth. The sheets rest upon rails e so that they are also played upon from below by the flame.

The sheets to be heated are frequently placed upon a carriage running upon wheels and rails, which when the charge is heated is withdrawn and replaced by another loaded carriage. This plan has the disadvantage that through the intermediate space required for the movement of the carriage

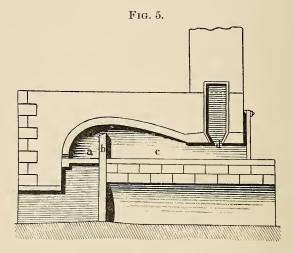

and the expansion of the bottom, much cold air passes between the bottom of the hearth and the furnace into the heat-

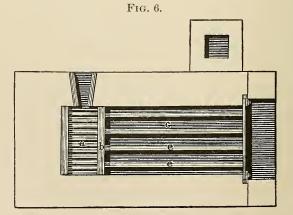

ing space and cools off the furnace, whereby more time, and consequently more fuel, is required for heating. In some brass factories this evil has been overcome as follows: On both sides, the entire length of the furnace, run, below the bottom of the hearth, hearth-plates with their angles turned downward. Corresponding to this, angle-irons turned upward are placed with sufficient play on both sides of the carriage so that on the carriage wheels a sort of gutter is formed which is filled with fine sand. On pushing the carriage into the furnace the angle-irons of the furnace sink into the sand and thus prevent the access of air. This arrangement is said to decrease the consumption of fuel one-third.

# Cleansing or Pickling of Brass.

The finished sheets have a black color, which is partially due to the formation of cupric oxide on the surface and partially to sulphur combinations formed, as previously mentioned, by heating with coal in annealing. As a rule brass is brought into commerce in a bright state, the only exception being the thicker sheets, which retain their black coating. In order to impart to the sheet its characteristic beautiful yellow color, it is subjected to a final operation termed pickling or dipping. This operation simply consists in treating the sheet with acid, which removes the layer of oxide to which the black color is due. The pickling is commenced by placing the sheets in a fluid consisting of 10 parts of water and 1 of sulphuric acid. The layer of oxide quickly dissolves in the fluid and the sheets show the pure yellow brass color. After this operation the sheets may be at once washed and dried and brought into commerce.

In most cases the sheets are, however, subjected to a second treatment with acids in order to impart to them a beautiful color; hence the treatment with sulphuric acid is generally

termed preparatory pickling. As the actual pickle, either nitric acid by itself is used or a mixture of two parts of nitric acid and one part of sulphuric acid. Pickles containing nitric acid possess the property of dissolving zinc from the brass quicker than copper, the surface of the sheet acquiring in consequence of it a warmer tone, shading more or less into reddish. By exercising great care dilute nitric acid by itself may be used as a pickle, but the sheets must be immediately washed, since if only the sligtest trace of the acid remains, they acquire after some time a greenish color due to the formation of a basic cupric nitrate.

It has been observed that nitric acid containing a certain quantity of nitrous acid yields especially beautiful shades of color. To obtain them a small quantity of organic substance is added to the nitric acid or to the mixture of nitric and sulphuric acids. The most curious substances are used for the purpose, snuff, for instance, being highly recommended as especially efficacious in producing beautiful colors. The use of such substances is, however, entirely superfluous, there being a number of cheaper organic substances which, when brought together with concentrated nitric acid, evolve nitrous acid. The cheapest of these materials is dry saw-dust, the nitric acid acquiring a short time after its introduction an orange-yellow color, which is due to the products of decomposition of the nitric acid, prominent among which is nitrous After taking the sheets from the pickle they are acid. washed, best in running water, in order to remove the last traces of acid.

By quick pickling the articles are obtained bright by the removal of the layer of oxide from the smooth surface of the metal. But sometimes a dull lustreless surface is to be im-

COPPER ALLOYS.

parted to the brass, which is effected by treating the articles with a boiling pickling fluid composed also of nitric and sulphuric acids. In many factories this pickle is prepared by dissolving 1 part of zinc in 3 of nitric acid and mixing the solution with 8 parts each of nitric and sulphuric acids. The solution is heated in a porcelain dish, and the articles to be pickled dipped in it 30 to 40 seconds. In dipping the brass articles large masses of red-brown vapors originating from the products of decomposition of the nitric acid are evolved which strongly attack the lungs. The operation should therefore be executed under a well-drawing chimney, or, still better, in an open space.

The pickled articles have a gray-yellow color, and in order to bring out the pure yellow color are immersed for a few seconds in pure nitric acid. They are then drawn through a weak solution of soda or potash and finally washed. The bright metal losing its beautiful color on exposure to the air in consequence of oxidation, the articles after drying must be coated with good varnish.

# Red Brass.

With an increase in the content of copper the color of brass changes, and its properties as regards ductility, strength, and toughness approach more closely those of copper. On account of their color, which facilitates gilding so that only a comparatively small quantity of gold is required for the production of articles presenting a fine appearance, the compounds belonging to this group are chiefly used for articles to be gilded.

The color of red brass being more agreeable to the eye than that of ordinary brass, it is also frequently used for articles not requiring special hardness and strength, as door-knobs, 12 escutcheons, curtain-rings, etc. It has, however, the disadvantage of turning black quicker than ordinary brass.

The content of copper in red brass amounts up to 80 per cent. and over, and to modify the properties of the alloy according to the purposes they are to serve, tin or lead, or sometimes both, are frequently added to the mixture. Red brass being frequently used for articles made by "striking up" in a die under a press or a drop-hammer, it must possess a high degree of ductility and toughness to prevent the cracking of the articles. Red brass comes into commerce under a great many names, such as tombac, talmi-gold, etc. But all these alloys, no matter under what name they may be known, agree in containing a high percentage of copper. The manner of preparing castings and sheet being exactly the same as that described for brass, we proceed at once to give the composition of the most important alloys belonging to this group.

*Tombac.* The name of this alloy is said to have been derived from the Malayan word *tambaga* (actually copper), while according to other statements it has been formed by reversing the syllables of the Chinese packfong or packtong (white copper).

Tombac contains generally 84 to 85 parts of copper and 15 to 16 parts of zinc. The proportions vary, however, very much, as seen from the following table:

|                        | Parts.  |       |       |  |  |  |  |
|------------------------|---------|-------|-------|--|--|--|--|
|                        | Copper. | Zinc. | Lead. |  |  |  |  |
| Cast-tombac, German    | 87.00   | 13.00 |       |  |  |  |  |
| " English              | 86.38   | 13.62 | -     |  |  |  |  |
| Tombac, German (Oker)  | 85.00   | 15.00 |       |  |  |  |  |
| " " (Hegermühl)        | 85.30   | 14.70 |       |  |  |  |  |
| " Paris (red)          | 92.00   | 8.00  |       |  |  |  |  |
| " for gilding, German  | 97.80   | 2.20  |       |  |  |  |  |
| " French               | 86.00   | 14.00 |       |  |  |  |  |
| " German (Lüdenscheid) | 82.30   | 17.70 |       |  |  |  |  |
| " French (yellow)      | 80.00   | 17.00 | 3.00  |  |  |  |  |
| " golden-vellow        | 89.97   | 9.98  | 0.05  |  |  |  |  |
|                        | 82.00   | 17.50 | 0.50  |  |  |  |  |

The best Berlin alloys (so-called bronzes) for lamps and chandeliers contain, as a rule, 80 per cent. copper and 20 per cent. zinc. For ordinary work an alloy with 33 per cent. zinc is used. Castings to be worked with a lathe contain 40 per cent. zinc. The so-called *Lyons gold* is tombac.

The color of tombac varies from pure copper red to orangeyellow, according to the content of copper, though a red color is by no means a criterion as regards the content of copper, since an alloy of 49.3 parts of copper and 50.7 of zinc is redder than one of 4 parts of copper and 1 of zinc. The more copper the alloy contains the more fine-grained and ductile it generally is.

Many small articles, as candle-sticks, inkstands, etc., which are sometimes gilt, are made from a compound designated in commerce as bronze, which is, however, not bronze, but only resembles it in color. Such alloys are also frequently used for casting small statues, for which they are well adapted, since they fill the moulds very uniformly. The composition of these alloys varies very much, though zinc and copper are, as a rule, the actual constituents, an admixture of tin occur-

ring only occasionally. We give a few compositions of this (imitation) bronze:

|        |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |      | Parts | s.        |
|--------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|------|-------|-----------|
|        |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |      |       |           |
|        |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | I.   | II.   | III.      |
| Copper | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • |   | • | . 80 | 67    | <b>76</b> |
| Zine   | • | • | • | • | • | • | • | • | • | • | • | • | • |   | • | • | • | • | . 20 | 33    | 24        |

Mannheim gold or similar.—This alloy has a beautiful golden yellow color. Its composition varies considerably.

|        | Par    | ts.  |
|--------|--------|------|
|        |        |      |
|        | Ι.     | II.  |
| Copper | . 83.7 | 89.8 |
| Zinc   | . 9.3  | 9.6  |
| Tin    | . 7.0  | 0.6  |

The alloy may also be obtained by melting together 69.6 parts of copper, 29.8 of brass, and 0.6 of finest tin.

Mannheim gold was formerly much used in the manufacture of buttons and pressed articles of a gold-like appearance, but it has recently been superseded by alloys which surpass it as regards beautiful color.

*Chrysochalk (gold-copper).*—This term is applied to several alloys resembling gold, which may consist of copper 90.5 parts, zinc 7.9, lead 1.6, or of copper 58.68, zinc 39.42, lead 1.90.

The beautiful color of this alloy soon disappears on exposure to the air, but can be preserved for some time by coating articles manufactured from it with a colorless varnish. Chrysochalk is generally used for ordinary gold imitations, as watch-chains, articles of jewelry, etc.

Chrysorin.—This alloy, prepared by Rauschenberger, consists of 100 parts of copper and 51 of zinc. Its color resem-

bles that of 18 to 20 carat gold, and does not tarnish in the air.

*Pinchbeck.*—The alloy known under this name was first manufactured in England, and is distinguished by its dark gold color which comes nearest to that of gold alloyed with copper. Pinchbeck being very ductile can be rolled out into very thin plates, which can be brought into any desired shape by stamping. The alloy does not readily oxidize in the air, and is, therefore, well adapted for cheap articles of jewelry, for which it is principally used. Pinchbeck answering all demands is composed—

|        |         |     |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | Pa   | arts. |
|--------|---------|-----|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|------|-------|
|        |         |     |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |      | ·     |
|        |         |     |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | 1.   | II.   |
|        | Copper  |     | • | • | • |   |   |   |   |   |   |   | • |   |   |   |   |   | 88.8 | 93.6  |
|        | Zine .  |     | • | • | • | • | • | • |   | • | • | • |   | • | • | • | • | • | 11.2 | 6.4   |
| $\cap$ |         |     |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |      |       |
| Or,    |         |     |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |      |       |
|        | Brass . |     | • | • |   |   |   |   |   |   |   |   |   |   |   |   |   |   | 1.0  | 0.7   |
|        | Copper  |     | • |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | 2.0  | 1.28  |
|        | Zinc.   | • • | • | • |   | • | • |   | • | • | • |   | • | • |   |   |   |   | _    | 0.7   |

Orëide or oroide (French gold).—This alloy is distinguished by its beautiful color, which resembles that of gold so closely that scarcely any difference can be detected on comparing the two metals. Besides its beautiful color it has other valuable properties, it being very ductile and tough so that it can be readily stamped into any desired shape; it also takes a high polish. It is frequently used for the manufacture of spoons, forks, etc., but being injurious to health on account of its large content of copper, is not suitable for the purpose. The directions for preparing this alloy vary very much, some masses from Paris factories showing the following compositions:

| Copper                        | • |   |   | • | • | • |   | • |   |   |   |   | . 90 | 80.5 | 68.21 |               |
|-------------------------------|---|---|---|---|---|---|---|---|---|---|---|---|------|------|-------|---------------|
| Copper<br>Zinc<br>Tin<br>Iron |   |   | • | • |   |   |   |   |   |   |   |   | . 10 | 14.5 | 13.52 | $\mathbf{Pa}$ |
| Tin                           |   | • |   |   |   |   |   |   |   |   |   |   |      |      | 0.48  | rts.          |
| Iron                          | • | • | • | • |   | • | • | • | • | • | • | • |      |      | 0.24  |               |

According to a special receipt, orëide is prepared in the following manner: Melt 100 parts of copper and add with constant stirring 6 parts of magnesia, 3.6 of sal ammoniac, 1.8 of lime, and 9 of crude tartar. Stir again thoroughly and then add 17 parts of granulated zinc, and after mixing it with the copper by vigorous stirring, keep the alloy liquid for one hour. Then remove the cover of froth and pour out the alloy.

Talmi or talmi-gold.—Cheap articles of jewelry, chains, earrings, bracelets, etc., were first brought into commerce from Paris under the name of talmi-gold, which were distinguished by beautiful workmanship, a low price, and great durability. Later on, when this alloy had required considerable reputation, other alloys, or rather metals, were brought into commerce under the same name, which retained their beautiful gold color, however, only as long as the articles manufactured from them were not used.

The finer quality of talmi-gold retains its pure gold color for some time and consists actually of brass or copper or tombac covered with a thin plate of gold combined with the base by rolling. The plates thus formed are then rolled out by passing through rolls, whereby the coating of gold not only acquires considerable density, but adheres so firmly to the base that articles manufactured from the metal can be used for years without losing their beautiful appearance.

In modern times articles of talmi-gold are brought into market which are simply electro-plated, the coating of gold being in many cases so thin that by strong rubbing with a rough cloth the color of the base shows through. Such articles, of course, lose their gold-like appearance in a short time.

In the following table we give the composition of a few alloys used in the manufacture of articles of talmi-gold; it will be seen that the content of gold varies very much, the durability of the articles manufactured from the respective alloys being, of course, a corresponding one. The alloys I., II., and III. are genuine Paris talmi-gold; IV., V., and VI. are imitations which are electro-plated, and VII. is an alloy of a wrong composition to which the gold does not adhere.

|                                       | Ι.   | II.                       | 111.                     | IV.  | V.   | VI.   | VII.                           |
|---------------------------------------|--|---------------------------|--------------------------|--|--|---|--------------------------------|
| Copper<br>Zinc<br>Tin<br>Iron<br>Gold | $   \begin{array}{c}     89.88 \\     9.32 \\                                    $ | 90.79<br>8.33<br><br>0.97 | 90.00<br>8.9<br><br>0.91 | $\begin{cases} 90.69 \\ 88.16 \\ 8.97 \\ 11.42 \\ \\ \\ 0.05 \\ \end{cases}$ | $ \begin{cases} 87.48 \\ 83.13 \\ 12.44 \\ 16.97 \\ \\ 0.03 \\ \end{cases} $ | $\begin{cases} 93.46 \\ 84.55 \\ 6.60 \\ 15.79 \\ \\ \\ \end{bmatrix} \\ \begin{cases} 0.05 \\ \end{cases}$ | 86.4<br>12.2<br>1.1<br>0.3<br> |

*Tissier's metal.*—This alloy is distinguished by great hardness, and differs from the previously described compounds in containing arsenic. It has a beautiful tombac red color. Its composition is not always the same, the quantities of the component metals varying within wide limits. The alloy actually deserving the name is composed of copper 97 parts, zinc 2, arsenic 1 to 2.

According to this composition Tissier's metal may be considered a brass containing a very high percentage of copper and hardened by an addition of arsenic. It is sometimes used for axle-bearings, but can be very suitably replaced by other alloys, to be mentioned further on, which are preferable to it on account of lacking the dangerous arsenic.

Tournay's metal.—This alloy is much used by the Paris manufacturers of bronze articles, and on account of its great ductility can be advantageously employed for the manufacture of cheap jewelry to be made from very thin sheet. It is also well adapted for the manufacture of buttons. It is composed of copper 82.54 parts, zinc 17.46.

*Platina*, a white alloy, especially suitable for buttons, contains 80 parts brass and 20 copper.

Manilla gold consists of copper and zinc, or lead.

Dutch leaf or Dutch gold. Copper 77.75 to 84.5 per cent., zinc 15.5 to 22.25 per cent.

The alloy is pale to dark yellow according to the proportions of copper and zinc used. Being very ductile, it is employed in the manufacture of Dutch leaf or Dutch gold.

The alloy is melted in graphite crucibles and cast in iron moulds to semi-circular bars about 24 inches long and  $\frac{1}{2}$  or  $\frac{3}{4}$ inch wide. The bars are then rolled cold and each resulting ribbon is made into a pile about 2 feet long and beaten under the hammer to a ribbon about  $1\frac{1}{2}$  inches wide. It is then annealed and beaten into a ribbon  $2\frac{1}{4}$  inches wide, and, after further annealing, into one  $3\frac{1}{2}$  to 4 inches wide. This last ribbon is pickled in dilute sulphuric acid, washed, boiled bright in argol solution, washed, brushed and quickly dried. The ribbons are then cut up and 1000 to 2000 pieces made into a pile and beaten under the hammer. The material is then again cut up, the leaves are placed between parchment and reduced by beating to about  $5\frac{3}{4}$  inches square. Each leaf is then cut up into 4 pieces, which are placed between gold beaters' skin and beaten by hand to about four times the size

of the original leaf. The hammer used weighs  $5\frac{1}{2}$  to 11 pounds, and the work is performed upon an anvil of dolomite by alternately beating with the right and left hand, and turning the package with the free hand. The package is made up of from 800 to 1000 gold beaters' skins, between which the metal-leaves are placed; on top and bottom come six parchment leaves, and the whole is then tied up in parchment. After the above-mentioned hammer has been used for about one hour, beating is continued for about 2 hours with a ham. mer weighing from 12 to  $16\frac{1}{2}$  lbs. To prevent the leaves from adhering to the skins in consequence of the development of heat, they are coated with gypsum. The leaves when taken from the skins are trimmed and placed in small books between tissue paper rubbed with colcothar. Each book contains 21 to 25 leaves.

Dutch leaf is used for gilding all sorts of articles, and its beautiful color may be preserved for some time by applying a coat of thin colorless or slightly yellow varnish. By adding to the latter a small quantity of a pure color—aniline colors being well adapted for the purpose—the color of the leaf can be readily changed to red, green, violet, etc.

Bronze powders. The bronze powders used for coating metallic and non-metallic articles (wood, plaster of paris, oilcloth, wall paper, etc.), consist of tombac-like alloys. For colors shading strongly into white, metallic mixtures with a high percentage of zinc are used, and for those approaching more closely to a pure red, alloys with a large content of copper.

The many shades of color found in commerce are, however, not produced by the employment of different compounds, but by heating the alloys converted into an impal-

pable powder until the desired shade is obtained by the formation of a thin layer of oxide upon the surface of each particle. In modern times bronze powders are brought into commerce showing beautiful green, blue, and violet colors, which are, however, not obtained by the formation of a layer of oxide, but by coloring the metallic powder with aniline color. The manner of preparing bronze powders has been recently much improved by the use of suitable machines for the conversion of the alloys into powder.

In metal-leaf factories the waste resulting in rolling out and hammering is used for the preparation of bronze powder. According to the old method the waste was rubbed with a honey-or gum-solution upon a stone until a mass consisting of fine powder combined to a dough by the honey-or gumsolution was formed. This dough was thrown into water, and after the solution of the agglutinant the metallic powder was dried, and subjected to oxidation by mixing it with a little fat and heating it in a pan over an open fire until the desired shade of color was obtained. At the present time this laborious and time-consuming method has been much shortened by the use of suitable machines, and of alloys prepared by melting together the metals in suitable proportions for powders which do not require to be colored by oxidation. These alloys are beaten out into thin leaves by hammers driven by steam. The leaves are then converted into powder by forcing them through the meshes of a fine iron-wire sieve with the assistance of a scratch-brush. This rubbing through is effected with a simultaneous admission of oil, and the mass running off from the sieve is brought into a grinding machine of peculiar construction-a steel-plate covered with fine blunt-pointed needles revolving over another steel-plate. In

this machine the mass is reduced to a very fine powder, mixed, however, with oil. The powder is first brought into water where the greater portion of the oil separates on the surface. The metallic mass lying on the bottom of the vessel is then subjected to a strong pressure, which removes nearly all the oil, the small quantity remaining exerting no injurious influence, but being rather beneficial, as it causes the powder to adhere with greater tenacity to the articles to which it is applied.

|   | <br> |     |     |    |             | <br> |             |   |   | <br> |   |   |   |
|---|------|-----|-----|----|-------------|------|-------------|---|---|------|---|---|---|
|   | C    | Col | loı | r. |             |      |             |   |   |      | Parts.<br>Copper.   | Parts.<br>Zinc.   | Parts.<br>Iron.   |
| Yellow<br>Pale green<br>Lemon<br>Copper-red<br>Orange .<br>Pale yellow .<br>Crimson |      |     |     |    | •<br>•<br>• |      | ·<br>·<br>· | • | • |      | 82.33<br>84.32<br>84.50<br>99.90<br>98.93<br>90.00<br>98.22 | $ \begin{array}{r} 16.69\\ 15.02\\ 15.30\\\\ 0.73\\ 9.60\\ 0.50\\ \end{array} $ | $\begin{array}{c} 0.16 \\ 0.63 \\ 0.07 \\ \\ \\ 0.56 \end{array}$ |

In the following table we give the compositions of the alloys for some colors :---

The better qualities of English bronze powders consist of copper 83 parts, silver 4.5, tin 8, oil 4.5, and the poorer qualities, of copper 64.8 parts, silver 4.3, tin 8.7, zinc 12.9, and oil 3.

The variety of bronze powder known under the name of "*brocade*," consists of coarser pieces prepared from the waste of metal-leaf factories by comminuting it by means of a stamping-mill, and separating the pieces of unequal size formed, first by passing through a sieve, and finally by a current of air. A certain kind of brocade, however, does not consist of a metallic alloy, but simply of mica rubbed

to a fine powder. Some kinds of bronze powder, as previously mentioned, are colored with aniline colors. This is effected by simply pouring a dilute solution of the aniline color in strong alcohol over the powder and intimate mixing.

Bronze powders from alloys of copper with 5 to 10 per cent. aluminium and 0.04 to 0.1 per cent. bismuth are, according to Lehmann, prepared directly from the block of metal by a cutting-machine, heating and boiling the powder, again heating several times, rubbing, washing, drying, sifting, and polishing between rolls. As a polishing agent for bronze powders Rosenhaupt uses mercurous nitrate.

### White Metal.

The alloys known under this name contain, besides a certain proportion of copper, a large quantity of zinc, and thus have the qualitative composition of brass without, however, sharing its other properties. In consequence of the large content of zinc, the color of these alloys is not yellow, but either pure white (silver-white) or a pale, but pleasant yellow. Their ductility decreasing considerably with the increase in the content of zinc, they can only be used for cast articles, which are to be finished by the lathe or file. Their comparatively low melting point is also due to the large content of zinc. Being quite cheap, they are well adapted for casting statuettes and other small articles not exposed to the influence of the weather. In the air these alloys do not acquire the beautiful color of bronze, called patina, but a dirty brown-green.

On account of their white color these alloys are much used in the manufacture of buttons, and can be partially worked with a fly-press without, however, subjecting them to too strong a pressure.

Birmingham platinum.—This alloy is of a pure, nearly silver-white color, which remains constant in the air for some time. The alloy is, however, so brittle as to be only suitable for casting. Buttons are made of it by casting it in moulds giving sharp impressions, the letter, escutcheon, etc., upon the button being subsequently brought out more by careful pressing. The alloy, which is also known as platinum-lead, is composed of—

|        |   |   |   |   |   |   |   |  |  |    | Parts. |            |
|--------|---|---|---|---|---|---|---|--|--|----|--------|------------|
|        |   |   |   |   |   |   |   |  |  |    |        |            |
|        |   |   |   |   |   |   |   |  |  | I. | II.    | III.       |
| Copper |   | • |   | • | • |   |   |  |  | 43 | 46.5   | 4          |
| Zinc   | • |   | • | • |   | • | • |  |  | 57 | 53.5   | <b>1</b> 6 |

Other alloys for white buttons consist of-

|              | Parts. |     |  |
|--------------|--------|-----|--|
|              |        |     |  |
|              | I.     | II. |  |
| Yellow brass | . 32   | 32  |  |
| Zine         | . 3    | 4   |  |
| Tin          | . 1    | 2   |  |

Sorel's alloy.—This important and valuable alloy possesses properties rendering it especially suitable for many purposes. It is chiefly remarkable for its considerable hardness, it being in this respect at least equal to good wrought-iron. Its toughness surpasses that of the best cast-iron. In casting it shows the valuable property of being readily detached from the mould, and it can be mechanically worked with great ease, but is too brittle to be rolled out into sheets or drawn into wire. It is much used for casting small statues, which after careful bronzing are brought into commerce under the name of cast-bronze. It may also be employed in the manufacture of articles exposed to the influence of the weather, as it rusts with difficulty and finally becomes coated with a thin, firmlyadhering layer of oxide which prevents further oxidation. The following mixtures have nearly the same properties, though they vary very much as regards their composition :---

|        |    |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | Parts. |    |  |  |
|--------|----|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|--------|----|--|--|
|        |    |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | _      |    |  |  |
|        |    |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | 1.     | II |  |  |
| Copper | ۰. | • |   | • |   |   | • |   |   |   | , | • |   | • |   | • |   |   |   | 1      | 10 |  |  |
| Zinc . | •  | • | • | • | • | • | • | • | • |   |   |   | , | • | • | • | • | • |   | 98     | 80 |  |  |
| Iron   |    |   |   |   | • |   |   |   |   | • | • |   | • | • |   | • |   | • | • | 1      | 10 |  |  |

The iron is used in the shape of cast-iron shavings, which are added to the zinc. The copper is then added and the alloy kept for some time fluid under a cover of glowing coals, in order to insure an intimate combination of the metals without a combustion of the zinc. The alloy being difficult to prepare in the above manner on account of the combustibility of the zinc, it is recommended in preparing large quantities not directly to mix the metals, but to use brass of known composition. This is melted down under a cover of charcoal and slightly overheated; the zinc is then added, and finally the iron.

Bath-metal.—This alloy is used, especially in England, for the manufacture of candle-sticks, tea-pots, buttons, etc., and is much liked on account of its beautiful yellowish-white to almost white color. It takes a high degree of polish, and articles manufactured from it acquire in the course of time a lasting silver lustre by simply rubbing them with a soft cloth. Bath-metal is composed of :

Brass 32 parts and zinc 9 = copper 55 parts and zinc 45.

#### COPPER ALLOYS.

Guettier's button metals :---

 1. Brass 372 (copper 297, zinc 93) zinc 62, tin 31.

 2.
 ·· 372 ( ·· 297, ·· 93) ·· 47, ·· 47.

 3.
 ·· 372 ( ·· 297, ·· 93) ·· 140, -

These alloys possess a silver color, No. 1 being the finest quality, No. 2, medium, and No. 3 inferior.

Ordinary English white metal.—Brass (copper 360, zinc 120) 480 parts, zinc 45, tin 15.

The preceding alloys are those which, strictly speaking, belong to the brasses, the composition of the mixtures as regards their principal constituents—copper and zinc—varying only within certain limits, and the addition of tin, lead, and iron being only made in order to change the properties of the alloys for certain purposes. Besides these alloys there are, however, some which find special application, and for that reason will be discussed separately; the alloys known as white metal, etc., and the metallic mixtures known as bronzepowders, belonging to this group.

In the following table, originally collated for the Committee on Alloys of the U. S. Board,\* the properties of the alloys of copper and zinc as described by the best authorities are exhibited in a concise manner :—

\* Report, Vol. II., 1881.

1.

|  | Remarks.  | Sheet copper.<br>Mean of 9 samples.<br>Tonbac for buttons.<br>Red tombac of Vienna.<br>Raltway axles, porous.<br>Pinchbeck.<br>Pinchbeck.<br>Bearings, Austria.<br>Bearings, Austria.<br>Bearings, Austria.<br>Bearings, Austria.<br>Bearings, Austria.<br>Bearings, Austria.<br>French oreide.<br>Specific gravity of ingol,<br>french oreide.<br>French oreide.<br>Specific gravity of pow-<br>Paris jeweiry. [acr, 8.584.<br>Tombae of Oker.  |
|--|---|--|
| rities.  | uthority.   | U.S.B. Mar. C.J.S. B. Mar. C. Mar. Mar. Mar. Mar. Mar. Mar. Mar. Mar   |
| autho  | onductivity for<br>electricity, sil-<br>ver=100   | 93:16<br>93:16<br>1<br>1<br>1<br>1<br>1<br>1<br>1<br>1<br>1<br>1<br>1<br>1<br>1  |
| eral s   | 100.<br>100.<br>100.                              | 81.1<br>29.9<br>29.9<br>29.9   |
| fsev   | vider of fusibility<br>(Mallet).                  |  |
| o uo   | lardness (Mallet,<br>and Calvert<br>and Johnson). | I I I I I I I I I I I I I I I I I I I  |
| aris   | rder of mallea-<br>bility (Mallet).               |  |
| Juno   | elative ductility.<br>(Thurston).                 | <b>1</b> 18.9<br>337.9<br>16.0.1<br>16.0.1   |
| Ĩ  | rder of ductility<br>(Mallet).                    |  |
| l Zinc   | enacity, pounds.<br>Per square inch.              |  |
| Properties of the Alloys of Copper and ZineComparison of several authorities | Fracture.   | Red<br>Tile-red     Fibrous<br>Earthy       Yellow-red     Vesicular       Yellow-red     Finely crystalline  |
| of the Allo  | Color.  | Red<br>Tile-red     Fibrous       Tile-red     Earthy       Tile-red     Earthy       Yellow-red     Vesicular       Yellow-red     Vesicular       Red-yellow     Coarsely c       Yellow-red     Vesicular       Red-yellow     Finely cry       Stellow-red     Vesicular       Yellow-red     Vesicular       Yellow-red     Vesicular       Red-yellow     Finely cry       Yellow-red     Finely cry       Yellow-red     Finely cry       Red-yellow     Finely cry       Yellow-red     Finely cry       Red-yellow     Finely cry       Yellow-red     Finely cry       Finely cry     Finely cry       Yellow-red     Finely cry       Yellow-red     Finely cry       Yellow-red     Finely cry   |
| rties c  | pecific gravity.                                  | 8.874<br>8.877<br>8.8674<br>8.8771<br>8.8771<br>8.8771<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8773<br>8.8774<br>8.8774<br>8.8774<br>8.8774<br>8.8774<br>8.8774<br>8.8774<br>8.8774<br>8.8774<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.8777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.7777<br>8.77777<br>8.77777<br>8.77777<br>8.777777<br>8.77777777  |
| rope   | È py analysis.                                    | 10.06  |
| F  | noitisoquo) Ş                                     | 92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>92.32<br>93.32<br>94.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.55<br>95.555 |
|  | of original<br>mixture.                           | 0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0<br>0  |
|  | Composition                                       | 100<br>1100<br>1100<br>1100<br>1100<br>1100<br>1100<br>1100  |
|  | tomic formula.                                    |  |

| Remarks.   | Gold leaf.<br>Tombac for buttoms.<br>Bronze powder.<br>Bronze powder.<br>Bath metal.<br>Alloy for jewelry.<br>Ornaments.<br>Dutch brass.<br>Specific gravity of pow-<br>Vienna gold leaf.<br>Bristol metal.<br>Bristol metal.<br>Chrysorin.<br>Chrysorin.<br>Suitable for forging or<br>Suitable for forging.<br>Bristol metal.   |
|--|---|
| uthority.  |   |
| onductivity for<br>electricity, sil-<br>ver=100. |   |
| onductivity for<br>heat, silver =<br>100.        | 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0   |
| rder of fusibility<br>(Mallet).                  | 0     \$\oldsymbol{\circ}   0   0   0   0   0   0   0   0   0   |
| ardness (Mallet,<br>and Calvert<br>and Johnson). | H 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1  |
| rder of mallea-<br>bility (Mallet).              | 0       01         01   01   01   01  |
| elative ductility<br>(Thurston).                 |   |
| rder of ductility<br>(Mallet).                   | 472.92.92   |
| enacity, pounds<br>per square inch.              | T<br>30.688<br>32.600<br>32.600<br>35.630<br>35.630<br>35.630<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.520<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.500<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.5000<br>30.50000<br>30.50000<br>30.50000<br>30.50000<br>30.50000<br>30.50000<br>30.50000000000  |
| Fracture.  | Red-yellow     Finely crystalline       Red-yellow     Earthy   |
| Color.   | Red-yellow Finely<br>Red-yellow Farthy<br>Yellow-red Finely<br>Yellow Barthy<br>Yellow Barthy<br>Yellow Finely<br>Yellow Finely<br>Yellow Farthy<br>Yellow Barthy<br>Yellow Finely<br>Yellow Funely   |
| .viivsig ohio9q                                  | 8.8.8.8.8.8.8.8.8.8.8.8.8.8.8.8.8.8.8.  |
| S anarysis.                                      |   |
| Composition<br>by analysis.                      | 81.91<br>77.339<br>71.20<br>73.20<br>69.74  |
| Finitziane.                                      | 11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11173<br>11  |
| C Composition                                    | 88888888888888888888888888888888888888  |
| 13<br>.stumot simot.                             | CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22<br>CG-22 |

COPPER ALLOYS.

Properties of the Alloys of Copper and Zinc.-Continued.

|  | Remarks.                                 |                       | Specific gravity of powder,<br>Good brass wire. [8.390.<br>Mosaic gold. | Suitable for forging. | Strong solder for brass.<br>Bristol metal.<br>Suitable for forging.               | Muntz metal.<br>Ship sheathing. | Specific gravity of pow-<br>Suitable for forging. | Bath metal.                 | Very ductile brass( 'torer). | German brass.           | Specific gravity of ingot,<br>[8.263. |  | Specific gravity of ingot,<br>[8.039. |                                  |
|--|--|-----------------------|---|-----------------------|---|---------------------------------|---|-----------------------------|------------------------------|-------------------------|---------------------------------------|--|---------------------------------------|----------------------------------|
|  |  | ողութ                 | Bo.<br>Bo.<br>Bo.<br>Ro.<br>Ro.   | Bo.<br>Bo.            | o g<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng<br>ng | U.S. B.<br>                     | Bo.   | U.S. B.<br>U.S. B.          | Bo.<br>Bo.<br>R              | U.S. B.                 | U.S. B.<br>U.S. B.                    | Bo.<br>U.S.B.<br>II S. B.  | U.S. B.                               | U.S. B.                          |
|  | metivity for<br>stricity, sil-<br>= 100. | ibrioD<br>elec<br>197 | 1111  |                       | 111   | 111                             |   |                             | 111                          | 11                      |                                       | 11   |                                       | 11                               |
| ned.   | t, silvet =                              | .001<br>buoD<br>DuoD  | 1111  | 1                     | 111   | 11                              | İ I I   |                             | 111                          | 🤅                       | 8<br>8<br>1                           |  | 11                                    | 11                               |
| ntin   | of fusibility<br>liet).                  | 19b1O<br>6M)          |   |                       | 111   | 1                               |   | 111                         |                              | 9                       |                                       |  |                                       | 11                               |
| -Co  | ness (Mallet,<br>l Calvert<br>Johnson).  | ibrsH<br>bus<br>bus   | 1111  | !                     | 111   |                                 | 111   |                             |                              | 12                      |                                       | 11   | 11                                    | 11                               |
| inc.   | - sellam to .<br>ty (Mallet).            | ilid<br>ilid          | 111   | 111                   | 111   |                                 |   |                             | 111                          | 5                       | 1111                                  | 11   |                                       | 11                               |
| Z pu   | ive ductility.<br>urston).               | чL)                   | 19.8  | 60.6                  | 111   | 0.67                            | 111   | 19.5                        | <mark>-</mark>               | 3.1                     | $0.36 \\ 0.26 \\ 0.26$                | 0.02   | 0.02                                  | 0.006                            |
| ar a   | of ductility.                            | 19b10<br>BM)          | 1111  | 111                   |   | 111                             |   | 111                         | 111                          | 12                      |                                       |  |                                       | 11                               |
| Coppe  | sbruod, yjis<br>square inch.             | per                   | 1   | 18.300                | 111   | 11.065                          |   | au.4au<br>                  | 46.400                       | 30.990                  | $\frac{-}{26.050}$                    | 9.710  | 3.087                                 | 2.656                            |
| Properties of the Alloys of Copper and ZincContinued | Fracture.                                |                       | Tarthy  | Earthy                |   | Earthy                          |   | Earthy                      | Coarselv orannlar            | Coarsely crystalline    | Pinkish-gray Coarsely granular        | Pinkish-gray Finely granular<br>Silver-white Vitreous conchoided | Vitreous conchoidal                   | Silver-white Vitreous conchoidal |
| Properties   | Color.                                   |                       | Red-vellow  | Red-vellow            |   | Red-yellow                      |   | Red-yellow                  | Red-vellow                   | Full yellow             |                                       | Pinkish-gray   | Silver-white                          | Silver-white                     |
|  | дітага оп                                | $^{i_{0}}$            | 8.410<br>   | 8.411                 | 111   | 8.405                           | 8.412<br>   | 8.283 -<br>8.283 -<br>8.283 | 1   8                        | 8.291<br>8.230<br>7.500 | 8.216<br>8.216                        | 8.034  | 8.171                                 | 7.939<br>7.974                   |
|  | by analysis.                             | Zn.                   | 34.50<br>34.50<br>33.50   | 36.36                 | 111   | 38.65                           | 40.10   | 41.10<br><br>44.44          | 44 78                        | 50.14                   | 50.30<br>50.82<br>52.28               | 56.22  | 60.35                                 | 62.78                            |
|  | nottisoqmoD                              | Cu.                   |   | 63.44                 |   | 60.94                           |   | 00.49<br><br>55.15          | 54.86                        | 49.66                   | 48.95                                 | 43.36  | 38.36                                 | 36.62                            |
|  | of original<br>mixture.                  | Zn.                   | 34.02     34.7     34.7     34.7     34.7     34.7     35               | 34.76<br>36.5<br>37.5 | $   \begin{array}{c}     38.75 \\     39.2 \\     39.71 \\   \end{array} $        | 40<br>40<br>5.5                 | 40.74<br>40.74<br>41.77                           | 45<br>45                    | 45.1<br>46<br>47.5           | 50.53                   | 50.76<br>52.5<br>55.5                 | 57<br>57.5<br>60   | 60.73<br>62.5                         | 63.12<br>65                      |
|  | Composition<br>F                         |                       | 65.98<br>65.4<br>65.3<br>65   | 65<br>63.5<br>62.5    | 61.25<br>60.8<br>60.16  | 60<br>60<br>59.5                | 59.26<br>59.26<br>58.33                           | 52 S                        | 54.9<br>54<br>59.5           | 50<br>49.47             | 49.23<br>47.5<br>45                   | 43<br>40.5   | 39.27<br>37.5                         | 35.88                            |
|  | Atomic formula.                          |                       |   |                       |   |                                 | Cu <sub>3</sub> Zn <sub>2</sub>                   |                             |                              | CuZn<br>CnZn            |                                       |  |                                       | Cu <sub>3</sub> Zn <sub>5</sub>  |

194

| Remarks,  |                     | Strong solder for brass.<br>Watchmaker's brass.<br>Specific gravity of ingot,<br>Very brittle.<br>Very brittle.<br>Brittle.<br>Brittle.<br>Brittle.<br>Protect from from rust.<br>Barely malleable.<br>Brittle.<br>Mateal for brittons.<br>White button metal.<br>Specific gravity of ingot,<br>Brittle.  |
|---|---------------------|---|
| ority.  | qıny                | Weither Strategy Constraints of the strategy o  |
| = 100.<br>= 100.  | Verd<br>Verd<br>Ver | 27.39   |
| t, silver =   | Cond.               | 42.8<br>42.8<br>53.1<br>53.9<br>58.9<br>58.9<br>58.9<br>58.1  |
| t of fusibility (1) (1) (1) (1) (1) (1) (1) (1) (1) (1) | nus<br>19b1O<br>3M) | و و و و   |
| i Johnson).<br>Calvert<br>Johnson).                     | bisH<br>bas         | H 1 1 2 4 1 1 1 2 4 1 1 1 2 4 1 1 1 1   |
| t of mallea-<br>ty (Mallet).                            |                     |   |
| ive ductility.<br>urston).                              | tsləA<br>dT)        | 0.111<br>0.111<br>0.1009<br>0.0009<br>0.0004<br>0.0003<br>0.0004<br>0.0003<br>0.0004<br>0.0003<br>0.0004<br>0.0003<br>0.0004<br>0.0003<br>0.0004<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.0003<br>0.00000000  |
| t of ductility.   | n9b1O<br>8M)        | - ! eo oo oo o  o   o          m  |
| sity, pounds<br>square inch.                            | Rena<br>Toq         | $\begin{array}{c} 43.232\\ 2.337\\ 2.337\\ 1.779\\ 1.779\\ 1.779\\ 1.779\\ 1.779\\ 1.779\\ 1.779\\ 1.779\\ 1.792\\ 1$   |
| Fracture.   |                     | Coarsely crystalline<br>Vitreous conchoidal<br>Vitreous conchoidal<br>Conchoidal<br>Vitreous conchoidal<br>Vitreous<br>Conchoidal<br>Finely crystalline<br>Finely crystalline<br>Finely granular<br>Finely granular  |
| Color.  | -                   | Deep-yellow<br>Bilver-white<br>""<br>Silver-gray<br>Ash-gray<br>Silver-gray<br>Silver-gray<br>Bluish-gray<br>Ash-gray<br>Ash-gray<br>Bluish-gray<br>Verydark gray<br>Bluish-gray<br>Verydark gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray<br>Bluish-gray  |
| пе втатіту.   | iəəqZ               | 8.288<br>8.8088<br>8.8098<br>8.8098<br>8.8008<br>8.8008<br>8.8008<br>8.8008<br>8.8008<br>8.8008<br>8.8008<br>8.8008<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7318<br>7.7319<br>7.7319<br>7.7319<br>7.7319<br>7.7319<br>7.7319<br>7.7319<br>7.7  |
| .sizylsns yd  | Zn.                 | 66.23<br>66.23<br>66.23<br>85.10<br>77.43<br>85.10<br>96.43<br>85.66<br>96.43<br>85.66<br>96.43<br>85.66<br>10<br>10<br>10<br>10<br>10<br>10<br>10<br>10<br>10<br>10<br>10<br>10<br>10  |
| Composition   | Cu.                 | 35.68<br>35.68<br>32.94<br>17.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.49<br>117.4   |
| of original<br>mixture,                                 | Zn.                 | 64.66<br>67.15<br>67.15<br>67.15<br>67.15<br>67.15<br>67.15<br>77.25<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55<br>88.55 |
| noitizoquio)<br>Ingining to                             | cu.                 | 882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85<br>882.85  |
| ie formula.   | motA                | CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CusZna<br>CusZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>CuZna<br>Cuz<br>CuZna<br>Cuz<br>Cuz<br>Cuz<br>Cuz<br>Cuz<br>Cuz<br>Cuz<br>Cuz<br>Cuz<br>Cuz   |

1

,

, |.

4

COPPER ALLOYS.

#### LIST OF AUTHORITIES.

Bo.—Bolley. Essais et Recherches Chimiques, Paris, 1869.

Cr.-Croockewit. Erdmann's Journal, XLV. 1848, pp. 87 to 93.

- C. J.—Calvert and Johnson. *Phil. Mag.*, 18, 1850, pp. 354 to 359; *ibid.*, 17, 1859, pp. 114 to 121; *ibid.*, 16, 1858, pp. 381 to 383.
- Ma.—Matthiessen. Phil. Trans., 1860, pp. 161 to 184; ibid., 1864, pp. 167 to 200.

Ml.-Mallet. Phil. Mag., Vol. 21, 1842, pp. 66 to 68.

Ri.-Riche. Annales de Chimie, 30, 1873, pp. 351 to 410.

U. S. B.--Report of Committee on Metallic Alloys of United States Board appointed to test iron, steel, etc. (Thurston's Investigations.)

We.-Weidemann. Pogg. Annalen, 108, 1859, pp. 393 to 407.

Prof. Robert H. Thurston, who conducted the investigations of the United States Board, makes the following note on the preceding table :—

"Alloys having the name of Bolley appended are taken from Bolley's 'Essais et Recherches Chimiques,' which gives compositions and commercial names, and mentions valuable properties, such as are given in the columns of remarks, but does not give results in figures as recorded by other authori-The same properties and the same name are accorded ties. by Bolley to alloys of different compositions, such as those which in the column of remarks are said to be 'suitable for forging.' It might be supposed that such properties belonged to those mixtures and not to other mixtures of similar composition. It seems probable, however, that when two alloys of different mixtures of copper and zinc are found to have the same strength, color, fracture, and malleability, it will also be found that all alloys between these compositions will possess the same properties, and hence that instead of the particular alloys mentioned only suitable for forging, all the alloys between the extreme compositions mentioned also possess that quality.

"In the figures given from Mallet under the heads of order of ductility," order of malleability," hardness," and order of fusibility," the maximum of each of these properties is represented by 1.

"The figures given by Mallet for tenacity are confirmed by experiments of the author with a few very marked exceptions. These exceptions are chiefly the figures for copper, for zinc, and for  $\text{CuZn}_2$  (32.85 copper, 67.15 zinc). The figures for  $\text{CuZn}_2$ , as given by Mallet, can, in the opinion of the author, only be explained on the supposition that the alloy tested was not  $\text{CuZn}_2$  (32.85 copper, 67.15 zinc), but another containing a percentage of copper probably as high as 55. The figure for the specific gravity (8.283) given by Mallet indicates this to be the case as does the color. The figure for ductility would indicate even a higher percentage of copper. The name 'watchmaker's brass ' in the column of remarks must be an error, as that alloy is a brittle, silver-white, and extremely weak metal.

"The figures of Calvert and Johnson and Riche, as well as those of the author, give a more regular curve than can be constructed from the figures of Mallet.

"The specific gravities in Riche's experiments were obtained both from the ingot and from powder. In some cases one, and in some cases the other, gave highest results. In the table under the head of 'specific gravity,' Riche's highest average figures are given, whether these are from the ingot or from fine powder, as probably the most nearly correct. The figures by the other method, in each case, are given in the column of remarks. The figures of Riche and Calvert and Johnson are scarcely sufficient in number to show definitely the law regulating specific gravity to composition, and the curves from their figures vary considerably. The figures of the author being much more numerous than those of earlier experimenters, a much more regular curve is obtained, especially in that part of the series which includes the yellow or useful metals. The iregularity in that part of the curve which includes the bluish-gray metals is, no doubt, due to blow-holes, as the specific gravities were in all cases determined from pieces of considerable size. If they were determined from powder, it is probable that a more regular set of observations could be obtained, and that these would show a higher figure than 7.143, that obtained for cast-zinc. Matthiessen's figure for pure zinc (7.148) agrees very closely with that obtained by the author for the cast-zinc, which contained about 1 per cent. of lead.

"The figures for hardness given by Calvert and Johnson were obtained by means of an indenting tool. The figures are on a scale in which the figure for cast-iron is taken as 1000. The alloys, opposite which the word "broke" appears, were much harder than cast-iron, and the indenting tool broke them instead of making an indentation. The figures of alloys containing 17.05, 20.44, 25.52, and 33.94 per cent. of zinc have nearly the same figures for hardness, varying only from 427.08 to 472.92. This corresponds with what has been stated in regard to the similarity in strength, color, and other properties of alloys between these compositions."

# CHAPTER VII.

### COPPER-TIN ALLOYS.

# Bronze in General.

THE alloys produced by the union of copper and tin are termed "bronze" in the actual sense of the word, if the copper is present in predominating quantity, while those in which the content of tin predominates are called "white metal." In order to modify the properties of the alloys in a certain sense, both bronze and white metal are sometimes compounded with small quantities of other metals.

In this section of our work we have to deal with bronzes in the strict sense of the word. It has been previously mentioned that the term bronze is frequently erroneously applied to mixtures of metals belonging really to the brasses, so that there is actually such a confusion of terms that many whose interest it is to have an accurate knowledge of alloys do not know what bronze actually is.

The principal constituent of bronze in all cases is copper, the addition of tin only serving to modify its properties. Tin, though a very soft metal by itself, possesses the characteristic property of imparting great hardness to copper, so that genuine bronze takes a fine polish, and castings of it can be worked very clean with the file. On account of these qualities it is especially adapted for a casting material, and its properties can be so changed that it will flow freely, or

(199)

give a beautiful sound, or acquire the utmost degree of hardness.

The ductility of bronze being but slight, only that containing very little tin can be converted into sheet by rolling, the operation succeeding satisfactorily at a red heat if the content of tin does not exceed 4 to 6 per cent. Bronze, as previously mentioned, being chiefly intended for casting, finds, on account of its hardness, much application in the machine industry for articles which cannot be made of iron or steel.

Bronzes consisting of absolutely pure copper and tin show definite properties according to the quantity of the metals contained in them. However, in making a chemical analysis of commercial bronze, it will almost invariably be found to contain a small quantity of other metals. A sharp distinction should, however, be made as to whether these admixtures are accidental or intentional. Besides iron, manganese, nickel, lead, and zinc, very small quantities of phosphorus, arsenic, sulphur, or antimony are sometimes found, and a small quantity of these bodies sufficing to considerably change the properties of the alloy, it is important to pay some attention to their influence. Before entering on a discussion of these properties, it may, however, be remarked that the difficulties many manufacturers find in obtaining alloys of determined qualities is due to the fact that they do not use as pure metals as possible by themselves, but melt down with them certain quantities of old bronze, which, as a rule, contains zinc, iron, or other foreign metals.

A content of zinc acts upon the properties of bronze in various ways. Added to it in a very small quantity it has even a beneficial influence, the moulds being filled out sharper and

the castings obtained freer from blow-holes. If, however, the addition of zinc be exceeded above a certain limit, the alloy loses the characteristic properties of bronze, and especially the warm color, which passes into a more or less dull brass vellow. Besides, bronze with too large a content of zinc does not acquire on exposure to the air the beautiful green coloration termed genuine patina, but one shading into black. The addition of zinc must always be kept within very narrow limits, less than one-half per cent. of it contributing so essentially to the strength of the bronze that such an addition should be made in all cases where this property is especially desired. With an addition of up to 2 per cent. of zinc the properties of the alloy remain about the same, its elasticity being also increased to a considerable extent. With a slight increase of over 2 per cent. of zinc, the hardness as well as the tenacity of the bronze decreases to a considerable extent, and the brass-like character of the alloy soon becomes apparent.

An admixture of lead has in all cases an injurious effect upon the properties of bronze. With a content of one-half per cent. the lead begins to liquate from the bronze, which makes the castings turn out unequal and increases the oxidability of the alloy. A content of lead makes the bronze somewhat denser and more malleable, these properties being, however, of little value as the alloy is exclusively intended for casting. The peculiar patina of a velvety-black color found upon old Chinese bronzes is said to be the product of a content of lead; and it is actually a fact that all Chinese bronzes contain a certain quantity of lead.

Iron affects the properties of bronze in a similar manner to zinc, imparting great hardness to it, and for this reason is frequently added to bronzes for axle-bearings and wherever they are to show great power of resistance. A content of iron has also considerable influence upon the color and gives a peculiar white tone to the bronze. It further makes it more difficult of fusion, though the castings are faultless.

An admixture of nickel increases the hardness of bronze to a considerable extent and decreases its toughness. On account of its costliness many declared the use of this metal as an addition to bronze impracticable. It must, however, not be forgotten that at the utmost only 1 to  $1\frac{1}{2}$  per cent. of it are required to impart the desired qualities. Moreover it is not by any means the most expensive metal used as an addition to bronze, tungsten and titanium being also frequently employed for the purpose. These last-mentioned metals seem, however, to possess no special properties exerting a favorable influence upon bronze, and, though the alloys have been fre quently mentioned and recommended in various periodicals, they have not gained a foothold in practice, which cannot be ascribed to their costliness, because manufacturers requiring alloys completely answering certain purposes, are always willing to pay a good price for them.

An admixture of very small quantities of arsenic, antimony, and sulphur renders the bronze brittle,  $\frac{1}{10}$  per cent. of either of these bodies sufficing for the purpose. Phosphorus exerting, as is well known, an injurious influence upon most metals and alloys, acts differently in this respect as regards bronze, and, for this reason, the so-called phosphor-bronze will be discussed later on.

The physical properties of bronze are also materially affected by other conditions than the chemical composition, chief among which is the rapid or slow cooling off of the fused material, which exerts so powerful an influence that the

product with an equal chemical composition may acquire an entirely different appearance. According to the content of tin the color of bronze varies between red and white, and with a considerable content of tin passes into steel-gray. Generally speaking, tin exerts a greater influence upon the color than zinc, the alloy with a comparatively small content of tin exhibiting no longer a red but a white color.

Alloys containing 90 to 99 per cent. of copper retain a pure red color; with 88 per cent. of copper it rapidly changes to orange-yellow; and with 85 per cent. becomes pure yellow. With a decrease of the content of copper to 50 per cent, the respective alloys show a slightly yellowishwhite color. It is a remarkable fact that alloys with a content of copper of between 50 and 35 per cent., are distinguished by a pure white color, while those containing up to 65 per cent. of tin show a steel-gray color. With a still greater percentage of tin the color of the alloys again becomes pure white. Bronze of various compositions being extensively used in the construction of machinery and the manufacture of ordnance, many physicists have occupied themselves with the determination of the proportions of ductility and hardness of the various alloys. But, notwithstanding the many full researches, it cannot yet be said with absolute certainty when a bronze is hardest, toughest, most ductile, etc., and we have only approximate numbers for these proportions, which we briefly sum up as follows:

Alloys with 1 to 2 per cent. of tin show nearly the same ductility as pure copper; they can be worked in the cold under the hammer, but crack more readily than pure copper, this cracking showing itself especially in attempting to stretch a plate of the alloy under the hammer. The duc-

tility decreases rapidly with an increase in the content of tin; an alloy containing 5 per cent. of tin can only be worked with the hammer at a red heat, but soon cracks when it is attempted to hammer it in the cold; alloys containing up to 15 per cent. of tin can no longer be hammered even in a warm state. The figures above given show that tin reduces the ductility of the copper. Its solidity is, however, considerably increased. Alloys with about 9 per cent. of tin show, according to most statements, the greatest strength of all bronzes, and in accordance with this, gunmetal has generally a content of tin approaching that limit. According to other statements alloys with about 15 per cent. possess the greatest hardness and strength. The maximum for hardness and brittleness lies between a content of 28 and 35 per cent. of tin.

From the results of more modern researches in regard to the strength and hardness of bronzes, the following may be deduced: The hardness increases constantly until the composition of the alloy has reached 72.8 parts of copper and 27.2 of tin. With an increase in the content of tin the hardness decreases, it being, in a mixture of 33.33 parts of copper and 66.66 parts of tin, nearly exactly the same as that of pure copper. Above this proportion of tin the hardness decreases considerably, and with a compound of 90 parts of tin and 10 of copper is but little more than that of tin.

Alloys rich in copper undergo a peculiar molecular change by forging. By subjecting alloys containing somewhat less than 94 per cent. of copper to continued forging they become as hard as steel, but unfortunately acquire at the same time such a degree of brittleness that they can only be used for purposes where they are not exposed to heavy shocks.

Though the hardening of bronzes by forging is remarkable, there is another phenomenon yielding still more remarkable results. By quickly cooling off red-hot bronze in cold water it almost completely loses its brittleness, and can then be used for many purposes, an alloy containing 84 parts of copper and 16 of tin being most suitable for the purpose. Even a quite thick article acquires a certain flexibility through its entire thickness, which it retains after forging. If it is desired to restore an article after tempering to its original hardness, it need only be brought to a red heat and slowly cooled. According to the above the behavior of bronze in this respect is just the reverse of steel, the latter by quick cooling becoming very hard and brittle, and by slow cooling soft and malleable. The density and hardness of bronze decrease with quick cooling and increase with slow cooling, and, hence, bronze articles quickly cooled have a deeper sound, a fact well to be considered by bell-founders.

The density and hardness, as well as the power of resistance against cracking, depend on the composition of the alloy as much as on the manner of cooling the cast articles.

According to practical experience the greatest strength is secured by endeavoring to obtain the crystals of the alloy as small as possible, even the material of the mould in which the casting is effected exerting a great influence upon the grain, and through this upon the strength. Articles must be cast at a higher temperature in iron moulds than in sand moulds, one of 2912° F. (1600° C.) being required with the use of iron moulds, while one of 2552° F. (1400° C.) suffices with the use of sand moulds, especially for larger castings.

Alloys suddenly subjected to a high pressure, as is the case with gun-metal, must have an especially high degree of den-

sity, the density being, however, not directly proportional to the composition, as will be seen from the following table:—

| Compos  | Composition. |      |  |  |  |  |  |
|---------|--------------|------|--|--|--|--|--|
| Copper. | Tin.         |      |  |  |  |  |  |
| 96.2    | 3.8          | 8.74 |  |  |  |  |  |
| 94.4    | 5.6          | 8.71 |  |  |  |  |  |
| 92.6    | 7.4          | 8.68 |  |  |  |  |  |
| 91.0    | 9.0          | 8.66 |  |  |  |  |  |
| 89.3    | 10.7         | 8.63 |  |  |  |  |  |
| 87.7    | 12.3         | 8.61 |  |  |  |  |  |
| 86.2    | 13.8         | 8.60 |  |  |  |  |  |
| 75.0    | 25.0         | 8.43 |  |  |  |  |  |
| 50.0    | 50.0         | 8.05 |  |  |  |  |  |

Bronze being exclusively used for casting, it is important to say a few words in regard to the temperatures at which the various alloys become fluid. According to Künzel, to whose researches we are indebted for much information regarding the properties of bronze, the various alloys show the following melting points :—

| Compo   | sition.      | Melting point, | Melting point |
|---------|--------------|----------------|---------------|
| Copper. | Tin.         | degrees F.     | degrees C.    |
| 95      | 5            | 2520           | 1360          |
| 92      | 8            | 2354           | 1290          |
| 90      | 10           | 2282           | 1250          |
| 89      | 11           | 2228           | 1220          |
| 86      | 14           | 2100           | 1150          |
| 84      | 16           | 2012           | 1100          |
| 80      | $\tilde{20}$ | 1868           | 1020          |

Articles cast of bronze contract in solidifying, as is the case with other mixtures of metals, the degree of contraction depending on the temperature of the alloy and its composi-

tion, and amounts to  $\frac{1}{130}$  to  $\frac{1}{77}$  of the bulk of the various mixtures.

The difficulty of obtaining perfect castings is, however, more increased by the chemical behavior of the alloys towards the oxygen of the atmosphere than by contraction. In subjecting the bronze to fusion, the tin shows greater affinity for oxygen than the copper, and hence by remelting the bronze several times, it becomes sensibly richer in copper by a portion of the tin being lost by oxidation. To prevent a change in the qualities of the alloy, a larger quantity of tin than the finished product is to contain is generally added, the volatilization of tin being equal to the excess added, so that the alloy obtained shows exactly the desired composition.

Another effect of the oxygen of the atmosphere consists in the oxides of the constituent metals of the bronze—stannic oxide and cuprous oxide—dissolving in the alloy, whereby its strength and toughness are considerably decreased. In the manufacture of ordnance a portion of the metal required is generally obtained by melting down old cannon. The mixture of metals thus obtained containing frequently large quantities of the metallic oxides in solution, the toughness and strength of the new alloys are considerably impaired.

The melted bronze shows another property frequently observed in other metals, especially in gold and silver: it can absorb a considerable quantity of oxygen, but allows it to escape in a gaseous state on cooling. If now, as is done in most cases, the castings are rapidly cooled off, the bronze becomes so thickly fluid that the absorbed oxygen cannot escape, and the resulting castings are full of innumerable, though microscopically small, hollow spaces, which injure the density and strength of the alloy.

The absorption of oxygen, as will be seen from the above, being very injurious to the qualities of the bronze, precautions have to be taken to protect the metal from the effect of oxygen in fusing as well as in casting. The best preventative against the absorption of oxygen is to protect the alloy by a layer of glowing charcoal, and to effect a reduction of any oxides formed by vigorous stirring of the fused alloy with a stick of green wood. Though oxidation is counteracted by these means, it is not possible to remove by them the oxygen reaching the alloy from oxygenous material. Phosphorus has, however, been found an excellent agent for the deoxidation of the oxides dissolved in the metal, but it has to be added very carefully, since a small quantity of it in excess exerts great influence upon the properties of the alloy itself. In most cases an addition of  $\frac{8}{1000}$  to  $\frac{10}{1000}$  suffices for the reduction of the oxides in solution.

The tin oxidizing more readily, it is, as a rule, advisable to fuse the copper first and then quickly introduce the tin, whereby the heat should be increased so as to keep the alloy very thinly-fluid, the union of the two metals being accelerated by these means. The melted mass should at the same time be vigorously stirred with wooden rods, which not only accelerates the mixing but also counteracts the oxidation of the tin. Even with the use of all the above-mentioned precautions, the loss in fusing and casting always amounts to several per cent. of the weight of the metals used. Work where the loss is only one to two per cent. may be called excellent, as in many cases it amounts to ten per cent.

The loss of metal as well as the qualities of the castings are also considerably affected by the construction of the melting furnace. The quicker the furnace can be heated to the

#### COPPER-TIN ALLOYS.

209

temperature required for reducing the alloy to a fluid state the better it is for the purpose, for even with perfect protection against the action of oxygen, changes injurious to the homogeneity of the castings take place with long-continued fusion. If a bronze be intentionally kept in a fluid state for a long time, a white alloy very rich in tin is formed in it which is clearly perceptible in the castings. The alloy is no longer homogeneous, but actually consists of a mixture of several alloys differing very much in density, power of resistance, and strength, which seriously impairs the properties of the entire mixture. This separation or liquation of the alloy into two or more compounds occurs especially in mixtures most frequently used, *i. e.*, such as contain between 5 and 20 per cent. of tin ; from alloys containing a lower or higher percentage of tin, homogeneous castings are more readily obtained.

Since the liquation of an alloy rich in tin is promoted by slow cooling, the melted mass, which has a temperature of about 2552° F. must be cooled down as quickly as possible to 932° F., at which, according to experience, the alloy richest in tin solidifies. This is, however, connected with many difficulties, especially in casting large pieces, such as cannon and bells, for which perfect homogeneousness of the metal is an absolute necessity.

The behavior of the solidified alloys towards the atmosphere varies according to their chemical composition, *i. e.*, they oxidize, on exposure to the air, in a shorter or longer time, acquiring thereby a color ranging from a beautiful green to black. This layer of oxide which, contributes much to the æsthetic effect produced by an article of bronze, is an important factor, especially to those occupied with casting statues, etc., and will be referred to later on.

# Melting and Casting of Bronze.

The quantity of bronze to be prepared at one time varies according to the article to be cast, and may amount to a few ounces or hundreds or thousands of pounds. Though the mode of preparing the bronze is the same in all cases, in the practice certain difficulties occur in casting small articles as well as large ones, which deserve attention.

For easting small articles a finished alloy of the desired proportions of metals is generally used, it being very difficult to hit the exact composition required in preparing small quantities of bronze. The fusion, in this case, is always effected in crueibles, special care being required to prevent as much as possible oxidation of the tin. The crueibles are placed in a wind-furnace and the surface of the bronze is kept carefully covered with pulverized coal, anthracite being best for the purpose on account of its great density.

Attention has already been drawn to the fact that the temperature of the fused metal exerts a considerable influence upon the quality of the casting. Experience has shown that for small articles the bronze must not be heated too strongly, as otherwise the resulting casting is blown, and one blow-hole suffices to spoil it entirely. Articles to be subjected to hammering or stretching after casting must also not be cast too hot, in order to prevent them from acquiring a too coarsely crystalline structure.

Small castings cool off rapidly, but the effect of this, especially if not uniform, is to make portions of the mass considerably harder in some parts than in others, which renders mechanical manipulation difficult. It is therefore advisable to thoroughly heat the moulds before use, and to surround them with a bad conductor, for instance ashes, and also cover

#### COPPER-TIN ALLOYS.

them with a layer of the same material after finishing the casting. Moulds of cast-iron or brass are generally used for small castings, which, in order to protect them, are coated with a mass consisting of lamp-black and oil of turpentine.

The preparation of large quantities of bronze as required for casting bells, cannon, or statues, is effected in reverbera-


D

tory furnaces capable of holding up to 10,000 pounds of bronze or more. The copper is first melted, and, when fluid, any old bronze to be used is added. When all is converted into a uniform mass, the tin, previously heated as much as possible, is introduced in small portions. Immediately before the in-

FIGS. 7 AND 8.

troduction of the tin, the fire must be increased in order to compensate for the consequent reduction of the temperature, and to keep the metal in a thinly-fluid state. Figs. 7 and 8 show the arrangement of a reverberatory furnace especially adapted for melting not too large a quantity of bronze. F is

FIGS. 9 AND 10.

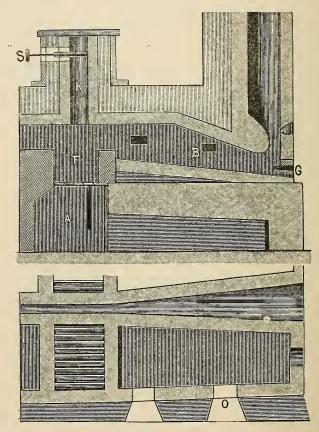

the fire-box, and G the ash-pit. The metals to be melted are placed upon the trough-shaped hearth H, while the aperture D serves for the introduction of the charge and for taking samples.


COPPER-TIN ALLOYS.

The finished bronze is run off through the aperture D. For large articles loam moulds are almost exclusively used, sand moulds being but seldom employed. While, as previously stated, it is advisable in casting small articles not to have the bronze too hot, for casting large works it should be very hot in order to render the production of uniform castings possible by keeping the mass in a fluid state for some time, and thus giving the gases evolved as well as the oxides a chance to rise to the surface.

Figs. 9 and 10 show the construction of a furnace especially adapted for melting a large quantity of bronze, which is to be as uniform as possible. The furnace, shown in Fig. 9 in section, and in Fig. 10 in ground-plan, has a capacity of about 16,200 pounds of bronze. Its total length is 13 feet, and it is heated with wood. F is the fire-box, and A the ashpit, while the metals are melted in the space B, between Fand G. K is the stoking-channel, which can be closed by the slide S. The aperture O serves for the introduction of the large pieces of metal, and the openings on the side for adding smaller pieces. G is the tap-hole closed during melting by a plug of clay.

The base of the hearth in these furnaces is, as will be seen from the illustrations, trapeziform, though there are other constructions in which it is elliptical or oval or even circular, the latter form being frequently used, for instance, in casting statuary bronze. Figs. 11 and 12 show the construction of such a furnace, S being the hearth, A the fire-box, and D the foundry-pit in which the mould is placed. The aperture above S serves for the introduction of the metals, and that above D, which is closed during the melting with a plug of clay, for running off the fused metal.

In a furnace of this kind up to 26,500 pounds of bronze can be melted for one casting. It is possible to construct furnaces of larger dimensions, but, on account of more uniform heat-

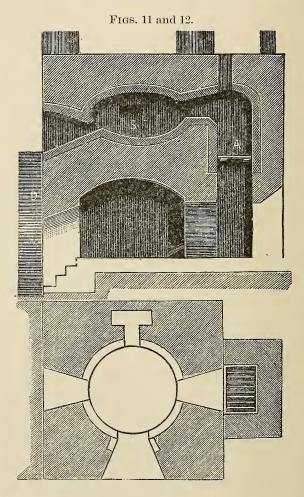

ing, it is recommended to use in this case several fire-places arranged on the circumference of the melting hearth.

The different kinds of bronze.—It will, of course, be readily understood that the composition of bronze must vary very

much according to the purpose for which it is to be used. In practice a large number of alloys are distinguished, which, according to their application, are known by various names. To retain this division would lead to the enumeration of a large number of names, and we must therefore restrict ourselves to those most frequently used, such as gun-metal, statuary bronze, speculum metal, etc.

Before proceeding with the description of the preparation of the alloys serving for these purposes, it will be convenient to briefly refer to the bronzes of pre-historic times. It is well known that bronze was extensively used by the ancients for coins, weapons, tools, and ornaments. It might be supposed, at first sight, from the castings of the ancients, that they possessed some very expeditious and simple means of making their enormous and numerous productions in this department; but upon closer inspection this conclusion appears untenable, for many analyses of their alloys have demonstrated the fact that their bronzes were not a constant composition of copper and tin, but contained frequently foreign metals, which cannot be considered as intentional additions, but only as accidental contaminations. Hence the success of a bronze of good composition was, no doubt, at that time, more a matter of accident than is possible with our present knowledge in regard to alloys, and the analyses of old bronzes can only give us hints about the behavior of the metals in the presence of substances to be considered as contaminations, without, however, contributing to the advancement of information in regard to the alloys. The researches made in modern times, especially as regards gun-metal, are so exhaustive in respect to the influence of the chemical composition of the alloy upon its physical qualities as to enable us to prepare alloys with any desired properties.

While the older bronzes, especially those of Greek origin, consisted almost only of copper and tin, in the older Roman coins considerable quantities of lead are frequently found, which must be considered as an intentional addition. Zinc seems to have first been intentionally added to bronze in the beginning of the present era. The exact composition of bronze has only been determined in modern times with the assistance of chemistry, the effect produced by the different elements upon the properties of the bronze, as well as the influence upon its physical qualities by rapid or slow cooling off, being now quite well understood. But that we have not yet arrived at a full knowledge of these properties is well seen from phenomena which in modern times have excited the interest of all technologists, it being only necessary to refer in this respect to phosphor-bronze and Uchatius's so-called steelbronze.

|                      | Ι.    | II.   | III.  | IV.   | $\mathbf{V}_{\bullet}$ | VI.   | VII.  | VIII. | IX.  |
|----------------------|-------|-------|-------|-------|------------------------|-------|-------|-------|------|
| Copper               | 86.38 | 80.91 | 88.70 | 92.07 | 68.42                  | 81.76 | 83.65 | 88.06 | 95.0 |
| Tin                  | 1.94  | 7.55  | 2.58  | 1.04  | 0.94                   | 10.90 | 15.99 | 11.76 | 4.5  |
| Zinc                 | 3.36  | 3.08  | 3.71  | 2.65  | —                      |       | —     | —     | —    |
| Lead                 | 5.68  | 5.33  | 3.54  |       | 22.76                  | 5.25  |       | —     | 0.2  |
| Antimony .           | 1.61  | 0.44  | 0.10  |       | 0.67                   | —     | —     | _     | —    |
| Iron                 | 0.67  | 1.34  | 1.07  | 3.64  | 4.69                   | 0.15  | trace | trace | 0.3  |
| Nickel               |       |       | —     |       | 0.78                   | trace | 0.63  | trace |      |
| Cobalt               | _     | _     |       | —     | —                      | 1.22  |       |       |      |
| Sulphur              | _     | 0.31  |       | —     | —                      | —     |       | —     |      |
| Arsenic              |       | _     | —     | —     | 1.48                   | _     | —     | -     |      |
| Phosphorus           | —     |       |       | —     | —                      |       | 0.05  | 0.03  |      |
| Silica               | 0.10  | 0.16  | 0.09  | 0.04  | _                      | _     | —     | _     | _    |
| $Loss \ldots \ldots$ | 0.26  | 0.79  | 0.21  | 0.56  | 0.26                   | 0.72  |       | 0.15  | -    |

#### Composition of some ancient bronzes :

Nos. 1 to 4 are examples from Japanese temples, according to Maumené; No. 5, an Egyptian figure, according to Flight; No. 6, from Cyprus at the time of Alexander the Great, according to Reyer; No. 7, an axe from Limburg with a thick coat of green patina, according to Reyer; No. 8, a chisel of a dark yellow color from Peschiera, according to Reyer; No. 9, old German chisel, according to Boussingault.

A Japanese bronze statue of Buddha weighing 450 tons is composed of copper 98.06, tin 1.68, mercury 0.21, gold 0.05.

# Ordnance or Gun-metal.

The use of bronze for casting cannon is said to have been known by the Arabs as early as the commencement of the twelfth century; in Germany the first bronze cannon were manufactured towards the end of the fourteenth century. Prior to that, after the invention of gunpowder, cannon of wrought-iron bars put together in the shape of a barrel and hooped with iron were used. While wrought-iron guns soon burst in consequence of the crystalline texture formed, castiron cannon of mottled iron are much more durable. Modern cannon of cast-steel are lighter, cheaper and generally more durable than bronze.

More money and labor have been spent on the study of gun-metal than on any other alloy, the governments of several of the larger countries having expended millions of dollars in experiments to find out the best alloys for the manufacture of ordnance. But that, notwithstanding all this, a final result has not yet been arrived at is best proved by the many different opinions, some diametrically opposed to each other, in regard to the value of, for instance, the previously mentioned steel-bronze.

The properties demanded from a good gun-metal follow from the use of the cannon themselves. In firing a cannon

an immense pressure, amounting to over 2000 atmospheres, is suddenly developed. To resist this pressure the material must possess great toughness, and cannon manufactured from bronze lacking this toughness burst generally with the trial-shots, for which especially large charges of powder are used. Gun-metal must further possess a high degree of hardness, as in firing the projectile strikes once or several times against the walls of the piece, it being impossible to give the same size mathematically accurate to the calibre of the piece and that of the projectile. If the bronze be not sufficiently hard, the interior of the piece loses after a few shots its cylindrical form, which is detrimental to the accuracy of the shot. Finally it must be considered that the gases evolved by the combustion of the powder attack the substance of the piece itself, and hence the composition of the bronze must be such that this chemical action is reduced to a minimum.

Briefly stated, good gun-metal must be very tough, capable of resistance, hard, and indifferent towards chemical influences, conditions which vary much from each other and are difficult to combine.


In order to obtain these properties all possible additions have been made to the actual bronze (consisting of tin and copper), and analyses of ordnance metal of different centuries and various countries plainly show the efforts made to arrive at a correct composition of gun-metal by certain admixtures. In modern times the addition of foreign metals, with the exception of a small quantity of zinc or, in special cases, of phosphorus, seems to have been abandoned, the quality of the bronze being adapted to the desired purposes by suitable treatment in melting and casting. In older pieces a series of foreign metals is found, some of which, as for instance nickel


and cobalt, must be considered as accidental contaminations, since the preparation of these metals in a metallic form has only been known during more recent times. Iron, if present in a considerable quantity, is, no doubt, an intentional addition, and a content of bismuth can be explained by the fact that in connection with arsenic it was formerly used as a flux in the bronze mixture.

The content of tin in bronze suitable for ordnance varies between 9 and 12 parts of it to 100 parts of copper, ordnance bronze containing more tin, showing, as a rule, greater fusibility and hardness, but less elasticity, and the resulting castings are not nearly so homogeneous. For smaller pieces alloys containing 8 parts of tin to 100 of copper are generally used, while those for larger pieces have the above composition.

So many details essential for the success of the operation are connected with the melting and casting of alloys for the manufacture of pieces of ordnance, that a special volume would be required for a complete description of the various processes. We can, therefore, only give the merest outline, and must refer those especially interested to the treatises published on this subject. The principal requisite of an alloy answering all the demands of a good ordnance-bronze is the production of entirely homogeneous casting, which it is endeavored to attain by solidifying the alloy under conditions allowing of its uniform cooling off. The moulds are always placed in a vertical position, and the evil of the upper portions of the casting showing frequently a different composition from the lower, is counteracted by using an excess of bronze, so that the finished casting has a long piece on top, the so-called "dead-head" or "sullage-piece," which is later on sawed off and remelted with a new charge. This deadhead contains the greater portion of the alloys of dissimilar composition, and also the so-called "waste," consisting of oxidized metal.

Figs. 13 and 14 show a double furnace in use in the gun-

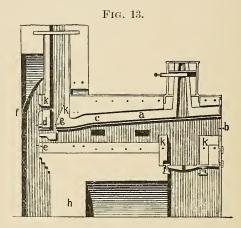


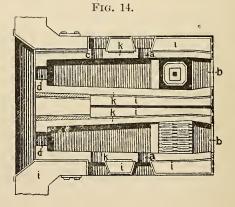

foundry at Spandau, in which 16,000 lbs. of gun-metal can be melted at one time. b is an opening through which larger masses may be brought upon the hearth, after which it is bricked up; a and c serve for the introduction of smaller

masses of metal and for stirring; e is the tap-hole; d and f, looking holes; g, flue. The portions indicated by k are constructed of refractory material. In this furnace the fusion of 16,000 lbs. of metal is effected in  $3\frac{1}{2}$  hours.

In several French foundries a shaft-furnace after the prin-

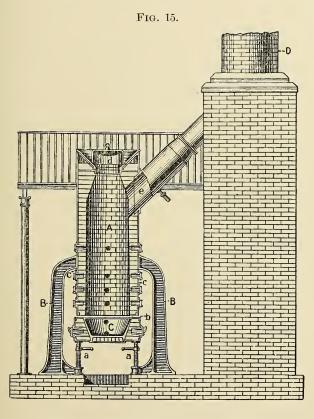

ciple of Herbetz's steam-injector furnace is used, but the furnace works without steam, the natural draught of a sheet-iron chimney 82 feet high being only used. The furnace shaft A(Fig. 15),  $12\frac{1}{2}$  feet high and  $2\frac{3}{4}$  to 3 feet in diameter, contains the furnace and is supported in a frame by four cast iron col-

umns B, to which is also secured the movable hearth C, so that it can be raised or lowered at will by means of screws a, and the operator has it in his power to regulate, according to the quality of the coke used, the width of the slit b between the edges of the shaft and the hearth which serves for the admission of air. c are looking holes; d, a Langen apparatus for closing the mouth of the shaft; e, a pipe conducting the gas into the chimney D. This furnace has the following advantages over a crucible furnace: Omission of crucible and blast, production of a beautiful fine-grained bronze on account of the evaporation of zinc appearing as contamination, consumption of only about 12 per cent. coke against 40 per cent. with crucible furnaces, more rapid fusion, and production of castings of any desired size with but one tapping.

In casting ordnance old cannon are frequently melted in, the practice in the opinion of many experts producing a favorable influence upon the homogeneousness of the resulting new material. The loss of tin by oxidation is also smaller, since tin once united with copper does not oxidize as readily as in the preparation of new alloys. But in order to obtain a homogeneous product great experience is required, and after the metals are melted, samples must be taken and examined as to their qualities, so that if the composition be not correct it can be improved by a suitable addition of copper or tin or old bronze, as may be found necessary. A considerable time being, however, required for the newly added metals to form a homogeneous combination with the material already melted, great precaution is necessary to prevent the oxidation of the metals as much as possible. Strictly taken, it would be best to use gas only for melting bronze mixtures, since with the practice of this mode of firing not only the heat

can be regulated at will, but a flame containing no free oxygen and consequently capable of completely preventing the formation of waste can be passed over the fusing mixture of metals.

The temperature at which ordnance-bronze is cast also exerts considerable influence upon its physical properties, one of about 2822° F. appearing to be the most suitable. Cannon cast at this temperature are distinguished by great homogenousness throughout the entire mass, and besides there need to be no fear of the separation of the so-called tin-spots, one of which, if located in a place especially subjected to strong pressure in firing, suffices to render the entire piece useless in a short time.

Ordnance-bronze should be cooled off rapidly, this also decreasing the danger of the formation of tin-spots. Iron moulds are frequently used, but they must not be too cold, as otherwise the layers of bronze coming in immediate contact with the iron solidify so quickly as to prevent the mobility of the still fluid mass in the interior, which would produce an unequal tension of the molecules, in consequence of which the piece might burst with the first shot. In many ordnance-foundries sand moulds are used, there being a great diversity of opinions as to which method of casting is the most suitable. Cannon are now generally cast solid, and the cylindrical cavity is formed by boring out this solid mass. Some, however, consider it preferable to cast the piece over an iron mandrel, which is sometimes so arranged that water can circulate in it in order that the parts nearest to it may quickly solidify and become as hard as possible.

*Steel-bronze.*—The ordnance-bronze known under this name is prepared in the Austrian arsenals, the method of melting

and subsequent treatment in casting being kept secret. It is only known that the bronze contains 8 per cent. of tin, and that the casting is effected in cold iron moulds. The peculiarity of the process of manufacturing ordnance from steelbronze (also called Uchatius-bronze, after its inventor) consists in the piece after being finished to a certain extent being subjected to a peculiar mechanical treatment. The calibre of the piece is made smaller than it is finally to be, and is then gradually enlarged to the required diameter by steel-cylinders with conical points being forced through the cavity with the assistance of hydraulic presses. In consequence of this peculiar treatment the cavity is, so to say, rolled or forged, the bronze acquiring the greatest power of resistance in those places which in firing are subjected to the greatest pressure.

The following table shows the composition of ordnancebronze of various times and different countries :—

|  | Parts.   |  |       |                        |       |        |  |  |  |  |  |
|--|--|--|-------|------------------------|-------|--------|--|--|--|--|--|
|  | Copper.  | Tin.   | Lead. | Zinc.                  | Iron. | Brass. |  |  |  |  |  |
| United StatesFrance (modern)PrussiaEnglandFrance (1780)Savoy (Turin, 1771)Russia (1819)Lucerne (Switzerland)Cochin ChinaChinaTurkey (1464) | $\begin{array}{c} 90\\ 90.09\\ 90.09\\ 90.90\\ 89.30\\ 100\\ 100\\ 88.61\\ 88.929\\ 77.18\\ 93.19\\ 77.18\\ 93.19\\ 71.16\\ 89.58\\ 95.20\\ \end{array}$ | $\begin{array}{c} 10\\ 9.9\\ 9.1\\ 10.7\\ -\\ 12.0\\ 10.7\\ 10.375\\ 3.42\\ 5.43\\ -\\ 10.15\\ 4.71 \end{array}$ |       | 0.419<br>5.02<br>27.36 |       |        |  |  |  |  |  |

# Bell-Metal.

It was known in ancient times that certain alloys which,

by reason of their composition, have to be classed with the bronzes, are distinguished by a specially pure tone on being struck. The ancient Hebrews, Babylonians and Egyptians made use of small hand-bells and cymbals, especially at festivals and dances. The Romans had small bells at their house-doors and in the baths. In the temple of Proserpina at Athens bells announced the hour of the sacrifice; they sounded as a martial signal, and were secured to the triumphal car of the conqueror. The actual church bells were first introduced by Paulinus, Bishop of Nola in Campania.\* In France bells were introduced about the middle of the sixth century, somewhat later in England, but in Germany only in the 11th century. The largest bells were cast in the middle ages, bell-founding flourishing especially from near the end of the 15th to the commencement of the 16th century. The weight of some of such large bells is as follows : Ivan Weliki at Moscow, Russia, cast in 1653, 528,000 lbs.; this bell, as well as another weighing 316,800 lbs., at the same place, fell Two other bells at the same place weigh 176,000 and down. 156,200 lbs. respectively. A bell in Toulouse, France, weighs 60,500 lbs., one in the Stephan's tower, Vienna, 56,540 lbs., in St. Peter's church at Rome, 41,800 lbs., at Olmütz, 39,-600 lbs., at Notre Dame, Paris, 35,640 lbs., at Milan, 33,000 lbs., and one, at Erfurt, cast in 1497, 30,250 lbs. Older bells in the cathedral at Cologne weigh 24,200 lbs. and 13,200 lbs. respectively, while the new Kaiser bell weighs 59,730 lbs.; it is 10 feet 8 inches high and 11 feet 4 inches wide.

The principal requisite of good bell-metal is a pure, full sound, which is, however, only obtained with an alloy showing besides great homogenousness and hardness, a consider-

\* Hence the world campanile.

able degree of strength. Experience has shown that these qualities are obtained with a composition containing from 20 to 22 per cent. of tin. The color of good bell-metal is a peculiar gray-white, differing materially from that of ordnancebronze and statuary-bronze. The bell-founder uses the appearance of the fracture as a sign of the correct composition of the bell-metal; if the fracture be too fine the alloy is too rich in tin; if too coarse-grained it contains too little tin.

Bell-metal is brittle and cracks under the hammer, cold as well as heated. If it be repeatedly brought to a dark red heat and quickly cooled by immersion in water, its brittleness is so far reduced that it can be hammered and stamped. It has been attempted to change the sound of bell-metal and improve it, especially in regard to its purity. The opinion was formerly held that an addition of silver adds to the beauty of the sound, though at present it is thoroughly understood that such is not the case.

Independent of the quality of the material used the tone of a bell depends materially on its size and form, the thickness of the walls and the proportion of height to diameter being also of importance for a beautiful and pure tone. The skill of the bell-founder lies not so much in finding the right composition of the alloy, this being thoroughly understood at the present time, as in giving the bell a shape corresponding to a certain tone, which is of special importance for chimes.

The melting and casting of bell-metal is not as difficult as that of ordnance-bronze, though great analogy exists between them. The copper is first melted down, and after heating the fused mass as much as possible, the tin is introduced and an intimate mixture promoted by vigorous stirring. Many bellfounders do not add all the tin at once, but at first about two-

thirds of it, and when this has formed a union with the copper, the other third.

It rarely happens that new materials are entirely used in preparing the bell-metal, old bells and ordnance-bronze being; worked in large quantities. The composition of these should, however, be known so that the mean of the alloy be such as: will yield a bell of the required quality. For this purpose *it* is best to melt small portions of the respective metals together in the same proportions in which they are to be fused on a large scale. From the quality of these test-pieces it will then be seen whether a change in the composition of the alloy is necessary.

It is still more preferable to ascertain by a chemical analysis the centesimal composition of the metals, since the appearance of the fracture, color, and degree of brittleness gives rise to error.

It has been frequently observed that bells repeatedly remelted acquire a disagreeable tone. The principal rerson for this change is found in the solution of oxide in the alloy. This evil can be overcome by deoxidizing the mixture of metals, to which we will refer later on. While the composition of bell-metal for large bells is always within the abovementioned limits, the material used for the manufacture of small tower-bells, table-bells, etc., varies very much, mixtures being often used which can actually not be classed as bellmetal, they being frequently only tin alloyed with a small quantity of copper and a little antimony.

Chinese tam-tams or gongs are distinguished by a strong, far-reaching sound. The alloy of which they are made is nearly of the same composition as the ordinary bell-metal, the difference in sound being due to mechanical treatment. As

soon as the plates intended for the manufacture of tam-tams are well solidified they are withdrawn from the mould and introduced into a furnace where they are raised to a cherry-red heat. They are then inserted between iron disks and plunged into water and allowed to cool, after which they are withdrawn, and are so tough that they may be worked under the hammer.

The following table shows the composition of some bellmetals :—

|  | Parts.  |   |   |   |                     |                  |  |  |  |  |  |
|--|---|---|---|---|---------------------|------------------|--|--|--|--|--|
|  | Copper.   | Tin.  | Zinc.   | Lead.   | Silver.             | Iron.            |  |  |  |  |  |
| Normal composition {<br>Alarm bell at Rouen<br>Alarm bell at Ziegenhain.<br>Alarm bell at Darmstadt<br>Alarm bell at Reichenhall<br>(13th century)<br>Tam-tam<br>Bells of Japanese origin. | $\begin{array}{c} 80\\78\\76.1\\71.48\\73.94\\80\\78.51\\10\\10\\10\\10\\10\end{array}$ | $\begin{array}{c} 20\\ 22\\ 22.3\\ 33.59\\ 21.67\\ 20\\ 10.27\\ 4\\ 2.5\\ 3\\ -\end{array}$ | $ \begin{array}{c} - \\ - \\ - \\ - \\ - \\ - \\ - \\ - \\ - \\ - \\$ | $\begin{array}{c} - \\ - \\ - \\ - \\ - \\ - \\ - \\ 0.52 \\ - \\ 1.33 \\ 2 \\ - \end{array}$ | $ \begin{array}{c}$ | <br>0.12<br><br> |  |  |  |  |  |

For the fabrication of small clock-bells, table-bells, sleighbells, etc., an alloy giving a clear and pure tone has to be used. Experience has shown that bell-metal with about 22 per cent. of tin gives the finest tone, and can therefore be suitably used for small bells. However, it is an object to use as cheap an alloy as possible for these purposes by a reduction of the content of the expensive copper. The following table will suffice to show the composition of such alloys :

-228

#### COPPER-TIN ALLOYS.

|                       |         |       | Parts. |       |         |                |               |  |  |  |  |  |  |
|-----------------------|---------|-------|--------|-------|---------|----------------|---------------|--|--|--|--|--|--|
|                       | Copper. | Tin.  | Zinc.  | Lead. | Silver. | Anti-<br>mony. | Bis-<br>muth. |  |  |  |  |  |  |
| House-bells.          | 80      | 20    |        |       |         |                |               |  |  |  |  |  |  |
| House-bells, smaller. |         | 25    | -      |       |         |                | _             |  |  |  |  |  |  |
| Clock-bells, German.  |         | 24.3  | 2.7    |       |         |                |               |  |  |  |  |  |  |
| Clock-bells, Swiss.   | 74.5    | 25    |        | 0.5   |         | -              |               |  |  |  |  |  |  |
| Clock-bells, Paris.   | 72.0    | 26.56 |        | —     | 1.44    | - 1            | —             |  |  |  |  |  |  |
| Sleigh-bells          | 84.5    | 15.42 | . —    |       | —       | 0.1            | $\frac{-}{5}$ |  |  |  |  |  |  |
| White table bells.    | 17      | 800   | _      |       | —       |                | 5             |  |  |  |  |  |  |
| White table bells     |         | 7     | _      | _     |         | 1              | -             |  |  |  |  |  |  |
|                       |         |       | 1      |       |         |                |               |  |  |  |  |  |  |

Algiers metal (metal d' Alger).—This metal has a nearly pure white color and takes a beautiful polish. It can scarcely be classed with bell-metal, its composition having nothing in common with it. It is composed of copper 5 parts, tin 94.5, and antimony 0.5. The antimony is very likely added to give greater hardness.

Large bells are east in loam moulds. The figures or designs with which the bell is to be ornamented are placed in the mould, the portions which have been left imperfect in casting being mended after the cast bell is cold. Small bells are generally cast in sand moulds, though recently iron moulds are frequently used.

Silver bell-metal.—This alloy suitable for small bells is distinguished by a beautiful silver-clear tone, and a nearly white color. It is composed of:

|        |  |   |   |  |   |   |  |  |  |   |    | Parts. |      |
|--------|--|---|---|--|---|---|--|--|--|---|----|--------|------|
|        |  |   |   |  |   |   |  |  |  |   |    |        |      |
|        |  |   |   |  |   |   |  |  |  |   | 1. | 11.    | III. |
| Copper |  | • | • |  | • | • |  |  |  | • | 40 | 41.5   | 41.6 |
| Tin    |  | • |   |  |   |   |  |  |  |   | 60 | 58.5   | 58.4 |

# Bronzes for Various Purposes.

As previously stated the properties of bronze may be

varied within very wide limits according to the purpose for which it is to be used. A few of the most important bronzes used in the various branches of industry are here given. To enter on a detailed description of all these alloys is scarcely practicable, since many manufacturers preparing bronzes for their special purposes use alloys which, as regards their centesimal composition (in respect to copper and tin), show considerable variations, and sometimes contain other metals as additions, which, according to the assertions of the manufacturers, impart to them exactly the properties desired.

According to the purposes for which the bronzes are to be used they may be designated, besides those already mentioned, as machine bronze (for bearings and pieces subject to severe friction), coin and medal bronze, and ormolu. The last alloy is chiefly used for small articles of art, and is by many classed among statuary bronze, but incorrectly so, because the latter, as will be explained later on, cannot be termed a bronze in the actual sense of the word. Besides the above-mentioned varieties of bronze, there remains to be mentioned the speculum metal, which was formerly much used for mirrors of optical instruments, but at the present its application is limited, these mirrors being now made by a cheaper process and at the same time of greater power.

Medal and coin-bronze.—A bronze suitable for these purposes must have a certain degree of ductility, be able to receive a true impression, and wear well. In many countries the baser coin is now made of a bronze-like alloy instead of pure copper as formerly, it being better calculated to resist the injuries it is likely to receive in circulation. The bronze used in casting medals contains a variable proportion of tin, ranging generally from 4 to 10 per cent., according to the depth of the

#### COPPER-TIN ALLOYS.

impression. Bronzes containing about 8 per cent. of tin are distinguished by great hardness, but can be rendered sufficiently soft for stamping by heating to a red heat and tempering. This variety of bronze is chiefly used for medals which, besides being distinguished by artistic execution, are to have considerable durability. If the impression is to be quite deep, or if the medals are to be stamped several times, they must be repeatedly annealed.

An addition of a very small quantity of lead and zinc has a favorable effect upon the metal to be used for medals. It renders it softer, so that it can be worked with greater ease, and its color and fusibility are also improved.

The baser coin of many countries (France, Switzerland, Belgium, Italy, etc.) consists of a bronze of varying composition. The copper coin manufactured in France since 1852 consists, for instance, of copper 95 parts, tin 4, and zinc 1. This alloy has stood the test of time, coins stamped in 1852 still showing the impression in all its details, which is sufficient proof of its durability. Coin-bronze as made by the Greeks and Romans contained from 96 parts of copper and 4 of tin, to 98 parts of copper and 2 of tin. Chaudet has shown that the first of these alloys can be used for fine work, medals of this composition taking very perfect polish while sufficiently hard to wear well.

Many medals, as is well known, do not show the color of bronze, but a pleasant brown, subsequently produced by oxidation. A bronze which, on account of its pale-red color, is especially adapted for medals with figures in high relief, consists of a mixture rich in copper. It is at the same time is very flexible, so that the medals can be stamped without an expense of great power. This bronze consists of copper 97 parts, tin 2, and lead 1.

Medals whose size does not exceed a certain limit are at present stamped from sheet rolled out to the required thickness, and the blanks thus obtained stamped with the impression, this method being also used in making coins. For large medals with impressions in very high relief plates are prepared by casting, the model of the medal being used in order to obtain plates already somewhat raised or depressed on the respective places. As soon as the pieces cast in sand are solidified, they are thrown into cold water to give them the required degree of softness. After subjecting them to one or two pressures in the stamping-press, they must be again annealed in order to prevent cracking of the edges.

Ormolu (Or moulu).—This alloy is much used for small statues, candlesticks, inkstands, etc., but serves also for purely artistic purposes. It also finds a very interesting application in the manufacture of articles coated with enamel. The enamel is placed in shallow cavities chiseled in the surface of the bronze and fused by heating the latter. Enamel of various colors can be used, each color being terminated by the edges of the cavities, and the articles after heating appear coated with the tightly-adhering enamel. Such work is termed *email cloisonné*. It became known in Europe through Chinese articles, but at present the European product by far surpasses the Chinese.

Below we give the composition of a few bronzes which can be classed with ormolu. They are much used in the manufacture of small articles of art, this industry being carried on to an enormous extent in Paris and Vienna.

Actual ormolu.—This bronze is distinguished by a pure golden-yellow color, and requires but little gold for gilding. It is much used for the finest bronze articles of luxury. It is composed of copper 58.3 parts, tin 16.7, zinc 25.3.

#### COPPER-TIN ALLOYS.

Bronze for small castings.—For articles to be prepared in large quantities, it is desirable to have a bronze which becomes very thinly fluid in the heat and fills out the moulds. Cast-iron moulds are generally used, and the articles, as a rule, turning out very clean, can be at once brought into commerce after mending imperfect parts. A bronze of excellent quality for this purpose is composed of copper 94.12 parts, tin 5.88.

Gold-bronze.—For many articles which are to present a beautiful appearance without being too expensive, it is scarcely practicable to provide them with a coating of genuine gold. An effort must, therefore, be made to impart to the alloy to be used a color resembling as closely as possible that of gold. A mixture possessing these properties in a high degree is composed of copper 90.5 parts, tin 6.5, and zinc 3.0. This alloy retains its beautiful gold color on exposure to the air, but loses it rapidly if exposed to both air and water. Articles manufactured from it, if kept in a room, retain their color, and in the course of time act like all genuine bronzes, *i. e.*, they become covered with the characteristic green coating known as genuine patina, which is so highly valued on account of bringing out the beauty of the contours.

According to Maréchal and Saunier, a beautiful gold bronze is obtained if the tin be first purified by fusing with nitrate of soda, and the copper by fusing with saltpetre and potassium cyanide, and adding to the fused copper argol and potassium cyanide. The metals thus prepared are fused together with the addition of a mixture of sal ammoniac, potassium cyanide, phosphor-copper and Marseilles (castile) soap; before pouring out, a small quantity of sodium is added to make the alloy non-oxidizable.

Bronze to be gilded.—Every kind of bronze can be gilded, the gold adhering with great tenacity. An example of this is furnished in the equestrian statue of the Emperor Marcus Aurelius, standing in front of the capitol at Rome, which still shows traces of the gold with which it was at one time entirely coated. In making castings to be subsequently gilded, it is advisable to use an alloy which is distinguished by a beautiful gold color, such alloy, as previously mentioned, requiring the smallest possible quantity of gold. An alloy answering the purpose is composed of copper 58.3 parts, tin 16.7, zinc 25.3.

In many places, especially in Paris, much jewelry is made of bronze. The articles being generally turned out by stamping and finally gilded, the bronze used must have a certain degree of ductility and allow of being readily gilded. A mixture answering these demands, and of which the greater portion of the Paris bronze jewelry is made, consists of copper 8 parts, tin 7.

Bronze for ship-sheathing.—A bronze containing 4.5 to 7 parts of tin to 100 of copper can be readily rolled to sheets at a red heat, and in rolled plates with a content of 4.5 to 5.5 per cent. tin, resists the action of sea-water much longer than pure copper. With less than 3 per cent. tin its durability decreases essentially. It has been sought to replace a small portion of the tin by zinc or lead (0.5 to 1.3 per cent), it being claimed that the zinc makes the bronze more uniform. French bronze-sheet contains, according to Pufahl, copper, 91.57 per cent.; tin, 8.17; lead, 0.11; nickel, 0.08; and iron, 0.04.

Machine-bronze.—In this collective term are included a great number of alloys with very variable properties, and

#### COPPER-TIN ALLOYS.

which have actually nothing in common except that they are used for certain parts of machinery. Many of these mixtures of metals—for some of them can scarcely be called bronzes must be as hard as possible in order to resist wear, others must possess great strength so as not to yield under shocks or pressure, while still others must have the property of showing, even under a heavy load, but little frictional resistance when in contact with other metals.

Bronzes of ordinary composition differ but little as regards their properties from other cheaper metals and mixtures of metals, and, on account of their higher price, are but little used in the manufacture of parts of machinery, red brass being more frequently employed. The so-called white metal, which is distinguished by great hardness and comparative cheapness, finds, however, much application for bearings. The white metals most frequently used in the manufacture of machines consist of alloys very rich in tin, containing besides this metal, antimony and a small quantity of copper.

Alloys for bearings.—The alloys for bearings of heavy axles, especially such as revolve rapidly, for instance, bearings of railroad wheels, are, as a rule, very rich in copper (between 80 and 90 per cent.), and must, therefore, be classed among the bronzes. The alloys richest in copper can be forged in the heat, while those with a smaller content of copper lack this valuable property. In the annexed table the composition of a few important alloys belonging to this group, and the purposes for which they are generally used, are given. We would, however, remark that nearly every large machine-shop uses alloys of varying composition for the same purposes. This variation can only be explained by the difference in the quality of the metals worked, for it is evident from what has

already been said in regard to the influence of small quanties of foreign metals upon the quality of the alloys, that a machine-shop having only copper containing a small quantity of iron at its disposal will use a different composition from one working copper free from iron.

The same holds good as regards all other contaminations, and it would be a great achievement if the metals serving for the preparation of the alloys could be procured chemically pure at a low price. The result would be a considerable decrease in the number of alloys used for certain purposes, and the same mixtures would be employed for the same purposes in all factories.

|   |                          |               |  | Parts.   |  |         |  |  |
|---|--------------------------|---------------|--|--|--|---------|--|--|
|   |                          |               |  | Copper.  | Zinc.  | Tin.    |  |  |
|   | railroad<br>"<br>various | l car<br>axl€ | axles  | $     \begin{array}{r}             86 \\             82 \\             82 \\           $ | $     \begin{array}{r}       14 \\       8 \\       18 \\       16 \\       2 \\       2.1 \\       5.88     \end{array} $ |         |  |  |
| " | 6 C<br>6 C               | "             | $(hard) \qquad (very hard) \qquad \dots \qquad \dots \qquad \dots$ | 82<br>88.8   | $\frac{2}{11.2}$   | 16<br>— |  |  |

# Metals for Bearings.

|   | Parts.   |   |  |                 |  |  |  |  |
|---|--|---|--|-----------------|--|--|--|--|
|   | Copper.  | Zinc.   | Tin.   | Lead.           |  |  |  |  |
| For cog-wheels  | $\begin{array}{c} 91.3\\ 83.3\\ 80\\ 81\\ 88\\ 87.7\\ 86.2\\ 81.2\\ 64.4\\ 615\\ 90\\ 79.1\\ 77.2\\ 50\\ 3\end{array}$ | $\begin{array}{c} 8.7 \\ 16.7 \\ 2 \\ 2.6 \\ 3.6 \\ 5.1 \\ 10 \\ 7.7 \\ 2 \\ 7.8 \\ 7 \\ 16.4 \\ 2 \end{array}$ | $\begin{array}{c} \\ \\ 17 \\ 16 \\ 10 \\ 9.7 \\ 10.2 \\ 12.8 \\ 17.6 \\ 30.8 \\ 8 \\ 13.1 \\ 15.8 \\ 33.6 \\ 1 \end{array}$ | 8.6<br>         |  |  |  |  |
| <ul> <li>buttons (white).</li> <li>sheet for pressed articles</li> <li>small castings</li></ul> | 57.9<br>63.88<br>94.12<br>90<br>84<br>88<br>90   | $36.8 \\ 30.55 \\ \\ 10 \\ 8.3 \\ 2 \\ 2 \\ 2$  | $ \begin{array}{r}     1 \\     5.3 \\     5.55 \\     5.88 \\     \hline     2.9 \\     10 \\     8 \\   \end{array} $      | <br><br>4.3<br> |  |  |  |  |

Machine Metals for Various Purposes.

Bronze for articles exposed to shocks and very great friction.— Copper, 83 parts; tin, 15; zinc, 1.5; lead, 0.5.

Bronze for valve-balls and other constituent parts to which other parts are to be soldered with hard solder.—Copper, S7 parts; tin, 12; antimony, 1. This alloy is flexible, and of a red, granular fracture.

Bronze resisting the action of the air.—For this purpose Bath recommends a mixture of 576 parts of copper, 48 of brass, and 59 of tin.

A bronze for the same purpose can, however, also be obtained by mixing together 26 parts of copper and 2 of tin.

A beautiful bronze, which can be used for most purposes as a substitute for brass, and also as hard solder for copper, is obtained, according to Eisler, by mixing together 16 parts of copper and 1 of tin. It is golden-yellow, can be hammered and stretched, is harder and more plastic than brass and copper, nearly as hard as wrought-iron, and runs more easily and thinner than brass.

Chinese bronzes.—Some bronzes exhibited at the Paris Exhibition attracted special attention, not only on account of their artistic beauty, but also on account of the unusually deep bronze color, which, in many specimens, presented a beautiful dead-black appearance. The color, which was doubtless intended to contrast with the silver of the filigree work, was proved to belong to the substance proper of the bronze, and not to have been artificially produced by an application upon its surface. Analyses of the different specimens of the bronze gave the following results :—

|  | rans.            |
|--|------------------|
| ~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~ |                  |
| I                                      | . II. III.       |
| Tin 4.8                                | 36 5.52 7.27     |
| Copper                                 | 72 72.09 72.32   |
| Lead 9.9                               | 20.31 14.59      |
| Iron 0.8                               | 55 1.73 0.28     |
| Zinc 1.8                               | <b>6.00 6.00</b> |
| Arsenic                                | - trace trace    |

Doute

These alloys contain a much larger proportion of lead than is found in ordinary bronze; and it is noticeable that the quantity of lead increases precisely with the intensity of the bronze color, proving, as before stated, that the latter is due to the special composition of the bronze.

Some of the specimens contain a considerable proportion of zinc, but the presence of this metal, instead of improving the appearance, seemed rather to counter-balance the effect of the lead.

### COPPER-TIN ALLOYS.

In imitation of the Chinese bronze some alloys were made of the following composition :—

|        |   |   |   |   |   |   |   |   |   |   |   | I     |       |      | II.    |
|--------|---|---|---|---|---|---|---|---|---|---|---|-------|-------|------|--------|
| Tin    |   | • | • | • | • |   | • |   |   |   | • | 5.5 p | arts. | 5.0  | parts. |
| Copper | • | • |   |   | • | • | • |   |   |   |   | 72.5  | "     | 83.0 | " "    |
| Lead   |   | • | • | • |   |   |   |   | • | • |   | 20.0  | "     | 10.0 | 44     |
| Iron   | • |   | • |   |   | , |   | • | • | • | • | 1.5   | • •   | _    | "      |
| Zinc   | • | • | • | • | • |   |   | • | • | • | • | 0.5   | "     | 2.0  | "      |

No. I. produced an alloy exceedingly difficult to work, and, without giving any superior results as regards color, furnished castings which were extremely brittle.

No. II., on the contrary, gave an alloy exactly resembling the Chinese bronze. Its fracture and polish were identical, and when heated in a muffle it quickly assumed the peculiar dead-black appearance so greatly admired in the Chinese specimens.

Hitherto it has been found difficult, if not impossible, to obtain this depth of color with bronzes of modern art, since the surface scales off when heated under similar conditions as No. II.

Japanese bronzes.—An analysis of Japanese bronzes made by M. E. J. Maumené gave the following results :—

| Copper       | 86.38 | 80.91 | 88.70 | 92.07 |
|--------------|-------|-------|-------|-------|
| Tin          | 1.94  | 7.55  | 2.58  | 1.04  |
| Antimony     | 1.61  | 0.44  | 0.10  | 1.04  |
| Lead         | 5.68  | 5,33  | 3.54  | 1.04  |
| Zinc         | 3.36  | 3.08  | 3.71  | 2.65  |
| Iron         | 0.67  | 1.43  | 1.07  | 3.64  |
| Manganese    | 0.67  | trace | 1.07  | 3.64  |
| Silicic acid | 0.10  | 0.16  | 0.09  | 0.04  |
| Sulphur      | 0.10  | 0.31  | 0.09  | 0.04  |
| Waste        | 0.26  | 0.79  | 0.21  | 0.56  |

All these alloys show a granulated texture, are blistered in

the interior, and sound on the exterior surface. In the presence of an abundance of antimony their color is sensibly violet, and red in the presence of iron. The specimens were cast thin, from 0.195 to 0.468 inch, and the mould was well filled.

Old Peruvian bronze.—An old chisel, weighing about 7 ounces, found in Quito, and which had evidently been used for working trachyte,\* showed according to Boussingault the following composition: Copper 95.0 parts, tin 4.5, lead 0.2, iron 0.3, silver traces.

A chisel brought by Humboldt to Europe from a silver mine worked by the Incas consists of copper 94 per cent., tin 6 per cent. Charlon ascribes the hardness of the tools used by the Peruvians in mining, which consisted of copper 94 per cent. and tin 6 per cent., to the presence of a small quantity of silicon.

A Turkish bronze basin examined by Fleck was composed of copper 78.54 parts, tin 20.27, lead 0.54, iron 0.19.

An antique bronze weapon in the form of a chisel, which was found near Bremen, was composed of copper 85.412 parts, tin 6.846, iron 0.346.

# Speculum Metal.

Alloys, composed of two-thirds copper and one-third tin, take a beautiful polish and can be used as mirrors. At the present time such alloys are only used in the construction of mirrors for optical instruments, especially for large telescopes, though they are being gradually displaced by glass mirrors.

Good speculum metal should be perfectly white, without a

\* A nearly compact, feldspathic, volcanic rock, breaking with a rough surface, and often containing crystals of glassy feldspar, with sometimes hornblende and mica.

COPPER-TIN ALLOYS.

tinge of yellow, having a fine-grained fracture, and be sound and uniform, and sufficiently tough to bear the grinding and polishing without danger of disintegration. A composition answering all purposes must contain at least 65 to 66 per cent. of copper. The specula made by Mudge contained from 32 parts of copper and 16 of tin to 32 of copper and 14.5 of tin. A little tin is lost in fusion. It has been frequently attempted to increase the hardness of speculum metal by additions of arsenic, antimony, and nickel. With the exception of nickel these additions have, however, an injurious effect, the specula readily losing their high lustre, this being especially the case with a larger quantity of arsenic. According to Bischoff a mirror composed of 66.3 per cent. copper, 32.1 tin and 1.6 arsenic, which possessed a white color and excellent lustre, after some time suddenly tarnished and became coated with a green patina. Sollitt claims that an addition of arsenic during fusion prevents oxidation of the tin.

It would seem that the actual speculum metal is a combination of the formula  $Cu_4Sn$ , and has the following centesimal composition :—

| Copper |   | • | • |   | • | • | • | • | • |  | • | • | • | • |   | • | • | • | • | • | • | 66.6  |
|--------|---|---|---|---|---|---|---|---|---|--|---|---|---|---|---|---|---|---|---|---|---|-------|
| Tin    | • | • |   | • | • |   | • | • | • |  | • | • | • | • | • |   |   | • | • | • | • | 33.4  |
|        |   |   |   |   |   |   |   |   |   |  |   |   |   |   |   |   |   |   |   |   |   | 100.0 |

According to David Ross the best proportions are: Copper 126.4, tin 58.9, *i. e.*, atomic proportions. He adds the molten tin to the fused copper at the lowest safe temperature, stirring carefully, and securing a uniform alloy by remelting.

The so-called tin-spots which sometimes separate when ordnance-bronze is incorrectly treated form an alloy similar in composition to speculum metal; it has, however, not a pure 16

white color, such as is found in those containing 31.5 of tin. By increasing the content of copper, the color shades gradually into yellow, and with a large content of tin into blue. It is dangerous to increase the content of tin too much, as besides the change in color the alloy becomes brittle and cannot be further worked. The following table shows the composition of some alloys used for speculum-metal. It may, however, be remarked that the standard alloy is undoubtedly the best for the purpose :—

|                         | Parts.  |       |       |          |               |  |  |  |  |  |  |
|-------------------------|---------|-------|-------|----------|---------------|--|--|--|--|--|--|
|                         | Copper. | Tin.  | Zinc. | Arsenic. | Other metals. |  |  |  |  |  |  |
| Standard alloy          | 68.21   | 31.79 |       |          |               |  |  |  |  |  |  |
| Otto's                  |         | 31.5  | —     |          |               |  |  |  |  |  |  |
| Richardson's            | 65.3    | -30   | 0.7   | 2        | 2 silver.     |  |  |  |  |  |  |
| Little's                | 65      | 30.8  | 2.3   | 1.9      |               |  |  |  |  |  |  |
| Sollit's                | 64.6    | 31.3  |       |          | 4.1 nickel.   |  |  |  |  |  |  |
| Chinese speculum metal. | 80.83   |       | —     |          | 8.5 antimony. |  |  |  |  |  |  |
| Old Roman               | 63.9    | 19.05 |       |          | 17.29 lead.   |  |  |  |  |  |  |

Other compositions: Copper 32, brass 4, tin  $16\frac{1}{2}$ , arsenic  $1\frac{1}{4}$ . Copper 32, tin 15 to 16, arsenic 2. Copper 32, tin  $15\frac{1}{2}$ , nickel 2.

According to Boedicker, the mirror of the celebrated Ross telescope, which has a diameter of 6 feet and weighs 11,000 lbs., is composed of copper 70.24, tin 29.11, zinc 0.38, iron 0.10, lead 0.01, and nickel 0.01.

For the manufacture of concave mirrors an alloy of copper 18, tin 18, zinc 18, nickel 36, and iron 10, has been recommended.

# Phosphor-Bronze.

In the actual sense of the word, phosphor-bronze cannot be considered an alloy containing a certain quantity of copper,

#### COPPER-TIN ALLOYS.

but it is rather a bronze subjected to a peculiar treatment with the use of certain phosphorus combinations. Many excellent phosphor-bronzes contain but a very small quantity of phosphorus, which exerts no essential influence upon the qualities of the alloy, the phosphorus having exerted its influence during the preparation of the alloy.

It has previously been mentioned that bronze frequently contains a considerable quantity of cuprous oxide in solution, which is formed by direct oxidation of the copper during fusion, and that the admixture of this oxide injures to a great extent the strength of the alloy. If now the melted bronze be treated with a substance exerting a powerful reducing action, as, for instance, phosphorus, a complete reduction of the cuprous oxide takes place, the pure bronze acquiring thereby a surprisingly high degree of strength and power of resistance. If exactly the quantity of phosphorus required for the complete reduction of the oxide has been used, no phosphorus will be found in the alloy, but the latter must nevertheless be called phosphor-bronze. Hence it will readily be seen that phosphor-bronze is not a special alloy, but that every kind of bronze can be converted into it. With the use of combinations of phosphorus, phosphor-bronze is therefore deoxidized bronze.

Phosphor-bronze has long been known to chemists, but its valuable qualities as a material to be used in construction were first made known by Montefiori-Levi and Künzel, who discovered the alloy in 1871. Besides reducing any oxides dissolved in the alloy, the phosphorus exerts another very material influence upon its properties. The ordinary bronzes consist of mixtures in which the copper actually forms the only crystallized constituent, the tin crystallizing with great

difficulty, and the alloy in consequence of this dissimilar condition of the two metals is not as solid as it would be if both constituents were crystallized. The presence of phosphorus is useful in giving the tin a crystalline character, which enables it to alloy itself more completely and strongly with the copper, the result being a more homogeneous mixture.

If so large a content of phosphorus be added that it can be authenticated in the finished phosphor-bronze, the latter must be considered as an alloy of crystallized phosphor-tin with copper. By increasing the content of phosphorus still more, a portion of the copper also combines with the phosphorus, and the bronze then contains, besides copper and tin, combinations of crystallized copper phosphide with phosphide of tin. The strength and toughness of the bronze do not suffer by a greater addition of phosphorus, but its hardness is considerably increased, so that many phosphor-bronzes are equal in this respect to the best steel, and some even surpass it in general properties.

Perhaps about the best method of making phosphor-bronze is to line the crucible with a mixture of 18 parts bone ash, 14 parts sand and 4 parts charcoal; the whole ground up with gum water and the inner surface of the crucible spread with it. Granulated copper is then introduced, covered with a layer of the mixture and subjected to fusion.

At a temperature sufficient to melt the copper, the silica decomposes the bone ash  $[Ca_3(PO_4)_2]$ , the base of which (calcium) is removed, thus liberating the phosphorus which reacts on the cupreous oxide in the fused copper, deoxidizing and purifying it. The products of the reaction rise to the surface and form a slag which can be tapped off.

Another, and perhaps the most general, method of making

phosphor-bronze is the addition of phosphor-copper or of phosphor-tin, both of these phosphor-metals being sometimes used at the same time. They must be especially prepared, the best processes being briefly as follows :—

*Phosphor-copper* is prepared by heating a mixture of 4 parts of super-phosphate of lime, 2 parts of granulated copper, and 1 part of finely-pulverized coal in a crucible at not too high a temperature. The melted phosphor-copper, which contains 14 per cent. of phosphorus, separates on the bottom of the crucible.

According to another method phosphor-copper is prepared by adding phosphorus to copper-sulphide solution and boiling, adding sulphur as the sulphide is precipitated. The precipitate is carefully dried, melted, and cast into ingots. When of good quality and in proper condition, it is quite black.

*Phosphor-tin* is prepared as follows: Place a bar of zinc in an aqueous solution of chloride of tin, collect the sponge-like tin separated and bring it moist into a crucible, upon the bottom of which sticks of phosphorus have been placed. Press the tin tightly into the crucible and expose it to a gentle heat. Continue the heating until flames of burning phosphorus are no longer observed on the crucible. After the operation is finished, a coarsely crystalline mass of a tin-white color, consisting of pure phosphor-tin, is found upon the bottom of the crucible.

Phosphor-tin may also be made by heating 3 parts of anhydrous phosphoric acid with 1 part carbon and 6 parts tin. The resulting alloy has a silver-white crystalline appearance, and dissolves in hydrochloric acid with the evolution of sulphuretted hydrogen. According to Pelletier, this alloy appears to possess the composition of  $\mathrm{Sn}_{3}\mathrm{P}_{2}$ ; it melts at 698° F.

Phosphor-bronze is prepared by melting the alloy to be converted into it in the usual manner, and adding small pieces of phosphor-copper or phosphor-tin. For 220 lbs. of bronze 21 to 24 ozs. of phosphor-copper with 15 per cent. phosphorus are used.

Whiting prepares *phosphor-bronze wire* by immersing the alloy in a solution of 0.125 to 5 per cent. phosphorus in ether, carbon disulphide or olive oil, 5 to 10 per cent. sulphuric acid and 85 to 95 per cent. water, and drawing into wire.

The properties of correctly prepared phosphor-bronze are as follows: Its melting point is nearly the same as that of ordinary bronze. In cooling it shows, however, the phenomenon of passing directly from the liquid into the solid state without first becoming thickly fluid. In a melted state it retains a perfectly bright surface, while that of ordinary bronze is always covered with a thin film of oxide.

If phosphor-bronze be subjected to continued melting no loss of tin takes place, but the content of phosphorus decreases slightly.

The chief properties of phosphor-bronze are its extraordinary toughness and strength. In a cold state it can be rolled, stretched and hammered.

According to Kirkaldy phosphor-bronze produced the following results by physical tests :—

| Elastic Limits. | Tensile Strength. |             |
|-----------------|-------------------|-------------|
| Pounds per      | Pounds per        | Elongation. |
| Square Inch.    | Square Inch.      | Per Cent.   |
| Cast            | 52,625            | 8.40        |
| Cast            | 46.100            | 1.50        |
| Cast            | 44.448            | 33.40       |

| Tensile St  | rength.   | Twists in  |           |   |  |  |
|---|---|--|-----------|---|--|--|
| Wire as Drawn.<br>Pounds per<br>Square Inch.  | Annealed.<br>Pounds per<br>Square Inch.   | Wire as<br>Drawn.  | Annealed. | Elongation.<br>Per cent.  |  |  |
| $\begin{array}{r} 102,759\\ 120,957\\ 120,950\\ 139,141\\ 159,515\\ 151,119\end{array}$ | $\begin{array}{r} 49,350\\ 47.787\\ 53,381\\ 54,111\\ 58,853\\ 64,569\end{array}$ | $\begin{array}{r} 6.7 \\ 22.3 \\ 13.0 \\ 17.3 \\ 13.3 \\ 15.8 \end{array}$ |           | $\begin{array}{c} 37.5 \\ 34.1 \\ 42.4 \\ 44.9 \\ 46.6 \\ 42.8 \end{array}$ |  |  |

DRAWN METAL (Phosphor Bronze).

Besides, as a bearing metal phosphor-bronze is useful for a large number of purposes, such as pump-cylinders, hydraulic presses, piston rings, eccentric rings, etc.; also for propeller blades, bells, wire, screws, gunpowder machinery, tools, etc. Blast furnaces are sometimes provided with phosphor-bronze tuyeres, which are said to give most satisfactory results.

The content of phosphorus varies according to the purpose for which the bronze is to be used, an alloy with 8 to 9 per cent. tin containing, as a rule, not over a few tenths per cent. Pufahl found in a bronze of 91 per cent. copper and 8.5 tin not over 0.1 per cent. phosphorus, the remainder being nickel, lead and iron. According to Priwoznick the content of phosphorus ranges from 0.17 to 0.76 per cent., but, according to Künkel, it may rise to  $2\frac{1}{2}$  per cent., according to the purpose for which the bronze is intended. Ledebur found in a phosphor-bronze with 0.004 per cent. phosphorus 0.038 per cent. oxygen.

According to Thurston five sorts of phosphor-bronze are considered to answer all requirements.

0. Ordinary phosphor-bronze of 2 per cent. of phosphorus.

1. Good phosphor-bronze of  $2\frac{1}{2}$  per cent. of phosphorus.

These two numbers are in all cases superior to ordinary bronze and steel.

- 2. Superior phosphor-bronze of 3 per cent. of phosphorus.
- 3. Extra phosphor-bronze of  $3\frac{1}{2}$  per cent. of phosphorus.
- 4. Maximum phosphor-bronze of 4 per cent. of phosphorus.

These three, according to Delalot, are superior to any other bronzes. Above No. 4 phosphor-bronze is useless, below No. 0 it is inferior to common bronze and steel. Nos. 3 and 4 are comparatively unoxidizable.

In the following a few analyses of different kinds of phosphor-bronzes are given :

| Copper          |          |          | . 90.34 |       | 90.86 | 94.'  | 71    |
|-----------------|----------|----------|---------|-------|-------|-------|-------|
| · Tin           |          |          | . 8.90  |       | 8.56  | 4.    | 39    |
| Phosphorus      | • • • •  |          | . 0.76  |       | 0.196 | 0.    | 053   |
| I.              | II.      | III.     | IV.     | v.    | VI.   | VII.  | VIII. |
| Copper          | -        | _        | 77.85   | 72.50 | 73.50 | 74.50 | 83.50 |
| Tin 9.85        | 4 - 15   | 4-15     | 11.00   | 8.00  | 6.00  | 11.00 | 8.00  |
| Zinc 3.77       | —        | 8-20     | 7.65    | 17.00 | 19.00 | 11.00 | 3.00  |
| Lead 0.62       | 4 - 15   | 4-15     | —       |       |       | —     |       |
| Iron , trace    |          | —        | —       |       |       |       | -     |
| Phosphorus 0.05 | 0.5 to 3 | 0.25 - 2 |         | —     | —     |       |       |

No. 1 for axle bearings; Nos. II. and III. for softer and harder axle bearings; Nos. IV. to VIII. for railroad purposes, viz.: No. IV. for distributing slide valves for locomotives; Nos. V. and VI. for axle bearings for cars; No. VII. for connecting rods; No. VIII. for piston rods for hydraulic presses. The alloys IV. to VIII. are richer in zinc than ordinary bronze, and hence more homogeneous.

On account of its toughness, density, elasticity and strength, phosphor-bronze may in many cases serve as a substitute for

wrought iron and steel, especially in the construction of articles of complicated form, which require much labor, as well as in the manufacture of wire, for instance, for non-rusting mine ropes and telegraph wire. It is also suitable for shipsheathing, for torpedoes instead of welded steel, for cartridge shells, etc. According to Pufahl, Höper's phosphor-bronze wire is composed of copper, 95.59 per cent.; tin, 3.60; lead, 0.50; iron, 0.07; nickel, 0.24; and phosphorus, 0.37; an alloy from Iserlohn was found to contain copper, 92.12; tin, 4; zinc, 3.69; lead, a trace; iron, 0.05; nickel, 0.16; and phosphorus, 0.06. The absolute strength of Höper's cable rope is 212,500 lbs. per square inch, and sheet, for instance for flap valves, is said to surpass even caoutchouc as regards elasticity.

Bender, Stöckmann and Stölzel give the following analyses of Höper's phosphor-bronze :

| Copper          |   |   | .90.34 | 90.86 | 94.70 | 93.68 | 94.11 |
|-----------------|---|---|--------|-------|-------|-------|-------|
| $Tin\ldots \ .$ | • |   | . 8.90 | 8.56  | 4.39  | 5.83  | 5.15  |
| Zinc            |   |   | . —    |       |       | 0.34  | 0.28  |
| Phosphorus      | • | • | . 0.76 | 0.196 | 0.053 | 0.17  | 0.21  |

No. II is especially suitable for blast furnace tuyeres; and No. III for bearings.

*Phosphor-lead bronzes* have also been prepared, Lavroff'sbronze containing copper 70 to 90 per cent., tin 4 to 13, lead 5.5 to 16 and phosphorus 0.5 to 1. Kühne's phosphor-lead bronze contains, according to Pufahl, copper 78.01 per cent., tin 10.63, lead 10.45, iron 0.09, nickel 0.26, and phosphorus 0.57.

*Phosphor-aluminium bronze.*—Thos. Shaw, of Newark, N. J.,\* patents a phosphor-aluminium bronze, making the following claims: First, an alloy of copper, aluminium and

\* U. S. patent 303,236, Aug. 1884.

phosphorus, containing 0.33 to 5 per cent. of aluminium, 0.05 to 1 per cent. of phosphorus, and the remainder copper. Second, its manufacture by melting a bath of copper, adding to it aluminium in the proportions stated, the bath being covered with a layer of palm oil to prevent oxidation, and then adding a small proportion of aluminium.

# Silicon Bronze.

Copper and silicon, with or without tin, may be alloyed to form silicon bronze. Weiller's alloy is made by the introduction of sodium to reduce silica in the crucible. The inventor recommends the following proportions : Fluo-silicate of potash 450 parts by weight, glass in powder 600, chloride of sodium 250, carbonate of soda 75, carbonate of lime 60, and dried chloride of calcium 500. The mixture of these substances is heated in a plumbago retort to a temperature a little below the point when they begin to react on one another, and it is then placed in a copper or bronze bath, when the combination of silicon takes place.

Silicon acts upon copper in almost exactly the same manner that phosphorus does, except that it appears to be a more natural alloy, and a flux or reducing agent to the oxide of copper that is produced when copper is in a melted condition, and it is thereby more active in clarifying, refining, hardening, and strengthening copper and its alloys. In this respect it is more vigorous and pronounced than phosphorus.

The qualities that particularly recommend silicon-bronze are great strength and toughness, high electrical conductivity, and resistance to corrosion. It is, therefore, logically the best metal extant for electric-light, telephone and telegraph wire. It can be made stronger than steel, and yet may possess two or three times its conductivity.

The early specimens of silicon-bronze wire for telegraph purposes had a conductivity of 97 per cent., and a resistance to rupture of about  $28\frac{1}{2}$  tons to the square inch; that for telephone purposes having a conductivity of 32 per cent., and a resistance to rupture of  $47\frac{1}{2}$  tons to the square inch.

Quite recently there has been developed a new type of telegraph wire, possessing less conductivity than the former, but having considerably higher tensile strength, which allows the wire to be more tightly stretched, while the posts may be placed at a greater distance apart. This wire has a conductivity of 80 per cent. and a tensile strength varying from 35 to 37 tons to the square inch. At the same time the character of the telephone wire has also been changed, raising its conductivity to 42 per cent. and its tensile strength to 52 These wires are almost exclusively used for telephone tons. lines at Prague, Trieste, Lemberg, and other European cities. The line at Trieste, in particular, has stood the test of violent storms completely, which is due to the small diameter of the conductor. A similar experience has been made at Rheims, where, in one case, a line having a span of more than a thousand feet was exposed to the action of the wind blowing directly across it.

Its power of resisting snow has been equally well established. Thus, on an Austrian railway the engineer at the head of the telegraph department personally examined the wires during a violent storm of damp snow, followed by a sharp frost, at a point where the line crosses hilly ground at a height of about 2,000 feet above the sea. The wires were well covered with snow and sagged considerably more than usual. In several instances by shaking the wire the snow was detached, when the conductors immediately assumed their

normal deflections after the snow had melted. The Austrian railway company above mentioned has numerous lines on which the distance between posts varies from 328 to 720 feet across flat country; in hilly districts the distance ranges from 160 to 500 feet.

During the last few years the "Italian General Telephone Company" has employed these silicon-bronze wires with spans as large as one thousand feet without any accident having occurred. In Vienna telephone posts are frequently placed at the same distance apart, and carry as many as 78 parallel wires.

Silicon-bronze telegraph wire (I) and silicon-bronze telephone wire (II) of Weiller's patent silicon-bronze contain, according to Hampe:

|         |   |   |   |   |   |   |   |   |   |   |  |   |   |   |   | 1.    | 11.   |
|---------|---|---|---|---|---|---|---|---|---|---|--|---|---|---|---|-------|-------|
| Copper  | • |   |   | • |   | • | , |   |   |   |  | • | • |   |   | 99.94 | 97.12 |
| Tin     |   | • | • |   |   |   |   |   | • |   |  |   | • |   |   | 0.03  | 1.14  |
| Iron    |   |   | • |   |   |   |   |   | • |   |  |   |   |   | • | trace | trace |
| Zine    |   | • | • | • |   |   |   | • | • |   |  |   |   | • | • |       | 1.62  |
| Silicon |   | • | • | • | • | • | • | • | • | • |  | • | • | • | • | 0.02  | 0.05  |

The following compositions of silicon-bronze may be recommended :

|         |  |   |   |   |   |   |  |   |   |   |   | Ι.    | II.   |
|---------|--|---|---|---|---|---|--|---|---|---|---|-------|-------|
| Copper  |  |   | • | • |   | • |  | • | , |   | • | 97.12 | 97,37 |
| Tin     |  | • |   |   | • |   |  | , |   |   |   | 1.14  | 1.32  |
| Zinc .  |  |   | • |   |   |   |  |   |   | • |   | 1.10  | 1.27  |
| Silicon |  |   |   |   |   |   |  |   |   |   |   | 0.05  | 0.07  |

Strength of the above alloys, 600 lbs. per 0.001 square inch, extension 46 per cent., contraction 86 per cent. Cast pins 3 inches thick could be readily reduced by rolling to 1 inch thick.

Bronze for telephone lines.—E. Van der Ven\* has instituted \*Musée Teyler, and Electrotech. Zeitsch., 1883.

a careful investigation on wires of phosphor-bronze and silicon-bronze. The wires experimented with contained, according to chemical analysis made for him by M. Van Eyndhoven, in the case of the phosphor-bronze : Copper 95.5 per cent., phosphorus 2.6 per cent., with small quantities of tin, manganese, and silicic acid; in the silicon bronze : Copper 92.2 per cent., silicium 0.91 per cent., together with small quantities of tin, manganese, and antimony.

The practical results of Dr. Van der Ven's researches are that phosphor-bronze has about 30 per cent. of the conducting power of copper, silicon-bronze about 70, while steel as used in wires has only about 10.5 per cent. Comparing their tenacity, as also very carefully determined by him, with that of steel, he finds that a wire of the latter material, of 2 millimetres diameter, with quadruple security and the conventional sag of 0.7 millimetre, can have a stretch from pole to pole of 130 metres, while the stretch, under the same conditions, of a wire 1 millimetre in diameter would for phosphorbronze be 106 metres, for silicon-bronze 91 metres. These alloys, with a diameter of 1.18, and of 0.77 millimetres respectively, have the same electrical resistance as the steel wire of 2 millimetres resistance. The relatively short stretch which in general increases the expense of construction and maintenance, is less costly in cities, where at short distances the roofs of buildings offer points of suspension for telephone wires. It is thus self-evident that the bronze wires are preferable to those of steel, whose resistance demands a much larger section; the more, since the net-work of lines suspended in the air cannot be counted among the ornaments of a large city. To this result may be added the statements made by M. Bede, at the Paris Electrical Congress, concerning the

practicability of the use of phosphor-bronze wire. A phosphor-bronze wire of 0.8 millimetre (costing, too, the same as steel of 0.2 mm.) would, on account of its high elasticity, coil up, before it has fallen 4 metres from its original position, so rapidly that on breaking it would ordinarily not strike the ground, and hence would be less dangerous. On account of non-oxidation there is no loss of diameter.

# Statue-Bronze.

For casting statues the actual bronze may be advantageously used, and many antique statues are composed of this material. But in modern times a mixture of metals is used, which besides copper and tin—the constituents of actual bronze—contains a quantity of zinc, the alloy thus formed being actually an intermediary between genuine bronze and brass. The reason for the use of such mixtures must partially be sought in their cheapness as compared with genuine bronze, and partially in the purpose for which the metal is to be used. A statuary bronze which thoroughly answers the purpose must become thinly fluid in fusing, fill the moulds out sharply, allow of being readily worked with the file, and must acquire a beautiful green color—the patina—on exposure to the air for a short time.

But the actual bronze, even if highly heated, does not become sufficiently fluid to accurately fill out the moulds, and has the further disadvantage of yielding homogeneous castings with difficulty. Brass by itself is also too thickly-fluid, and lacks the requisite hardness to allow the fine mending of those parts which have been left imperfect in casting.

Alloys containing zinc and tin, besides copper, can, however, be so prepared that they become very thinly-fluid, and yield fine castings which can be readily worked with the file

## COPPER-TIN ALLOYS.

and chisel. The most suitable proportions seem to be a content of zinc of from 10 to 18 per cent. and one of tin of from 2 to 4 per cent. In regard to hardness, statuary bronze is a mean between genuine bronze and brass, it being harder and tougher than the latter, but is surpassed in these properties by the former.

Statuary bronze being chiefly used for artistic purposes, its color is of great importance. By small variations in the content of tin or zinc, which must, however, be always kept between the indicated limits, the color may be shaded from orange-yellow to pale yellow. With an excessive content of tin the alloy becomes brittle and difficult to chisel, and by increasing the content of zinc the warm tone of color is lost, and the bronze does not acquire, on exposure to the air, a fine patina.

Though the alloys best adapted for statues are definitely known at the present time, it happens sometimes that many large castings do not exhibit the right qualities. Their color is either defective, or they do not acquire a beautiful patina, or are difficult to chisel. These evils may be due either to the use of impure metals or to the treatment of the alloy in melting. On account of the large content of zinc there is a considerable loss in melting, amounting even with the most careful work to at least 3 per cent., and sometimes reaching 10 per cent., and it is evident that in consequence of this loss the alloy will show an entirely different composition from what it should have according to the quantity of metal used in its preparation.

The color of the alloys, as mentioned above, quickly changes by variations in their compositions. The following table gives a series of alloys of different colors suitable for statuary bronze :—

| Copper. | Zinc. | Tin. | Color.        |
|---------|-------|------|---------------|
| 84.42   | 11.28 | 4.30 | red-yellow.   |
| 84.00   | 11.00 | 5.00 | orange-red.   |
| 83.05   | 13.03 | 3.92 | ~··           |
| 83.00   | 12.00 | 5.00 |               |
| 81.05   | 15.32 | 3.63 | orange-yellow |
| 81.00   | 15.00 | 4.00 |               |
| 78.09   | 18.47 | 3.44 | 6 .           |
| 73.58   | 23.27 | 3.15 | "             |
| 73.00   | 23.00 | 4.00 | pale orange.  |
| 70.36   | 26.88 | 2.76 | pale yellow.  |
| 70.00   | 27.00 | 3.00 | "             |
| 65.95   | 31.56 | 2.49 | "             |


According to d'Arcet the best bronze for statues consists of copper, 78.5 parts; zinc, 17.2; tin, 2.9; and lead, 1.4, or ot copper, 164 parts; zinc, 36; tin, 6; and lead, 3.

In the following table will be found the composition of a few celebrated statues :—

|   | Copper. | Zinc.       | Tin. | Lead. | Iron. | Nickel. | Anti-<br>mony. |
|---|---------|-------------|------|-------|-------|---------|----------------|
| Equestrian statue of Louis XIV,         |         |             |      |       |       |         |                |
| cast 1699, by Keller                    | 91.40   | 5.35        | 1.70 | 1.37  | _     | _       | _              |
| Statue of Henry IV, Paris               | 89.62   | 4.20        | 5.70 | 0.48  | _     | -       | _              |
| Equestrian statue of Louis XV           | 82.45   | 10.30       | 4.10 | 3.15  | _     | _       | _              |
| Minerva statue, Paris                   | 83      | 14          | 2    | 1     | _     |         | -              |
| Statue of Napoleon, Paris               | 75      | 20          | 2    | 2     |       | _       | -              |
| Old Vendome column, Paris, from         |         |             |      |       |       |         |                |
| captured cannon                         |         | 0.5         | 10.2 | 0.1   | -     |         | —              |
| Alloys of Stiglmayr, Munich, for        |         |             |      |       |       |         |                |
| instance, statue of Bavaria             | 91.5    | 5.5         | 1.7  | 1.3   | -     | -       | -              |
| Statue of Lessing, Brunswick            | 84.2    | 11.5        | 3.55 | 0.75  | -     | -       | -              |
| Statue of Melanchthon, Witten-          |         |             |      |       |       |         |                |
| berg, and of Frederick William          |         | = 10        | 0.00 |       |       |         |                |
| IV, Cologue, by Gladenbeck              |         | 7.46        | 2.99 |       | -     | _       |                |
| Statue of Count Brandenburg, of         |         |             |      |       |       |         |                |
| Thaer, and of the lion fighter in       |         |             |      |       |       |         |                |
| front of the Museum, Berlin, by         | 88.88   | 9.72        | 1.40 |       |       |         |                |
| Giadenbeck<br>Statue of Blücher, Berlin | 90.1    | 9.72<br>5.3 | 4.6  | _     |       | _       | _              |
| Statue of Frederick the Great,          | 90.1    | 0.0         | 4.0  | _     | _     | _       | _              |
| Berlin                                  | 88.3    | 9.5         | 1.4  | 0.7   |       |         |                |
| Shepherd, Potsdam Palace                | 88.66   | 1.28        | 9.20 | 0.77  |       |         | _              |
| Bacchus, """"                           | \$9.34  | 1.63        | 7.50 | 1.21  | 0.18  |         |                |
| Germanicus, Potsdam                     | 89.78   | 2.35        | 6.16 | 1.33  | 0.10  | 0.27    | _              |
| Statue of the Great Elector, Ber-       | 05.10   | 2.00        | 0.10 | 1.00  |       | 0.27    |                |
| lin, erected 1703.                      | 89.09   | 1.64        | 5.82 | 2.62  | 0.13  | 0.11    | 0.60           |
| Statue of Frederick William, Ber-       | 00.00   | 1101        | 0.02 | 2.02  | 0.10  | 0.11    | 0.00           |
| lin                                     | 87.44   | 8.89        | 3.20 | 0.65  | _     |         | -              |
| Horse-tamer, Berlin                     | 84.55   | 15.63       | 0.14 | 0.16  |       | _       | -              |
| Statue of the Elector John Wil-         |         |             |      |       |       |         |                |
| liam, Düsseldorf                        | 71.74   | 25.58       | 2.37 | 0.91  | _     | _       |                |
| Statue of Albrecht Dürer, Nürn-         |         |             |      |       |       |         |                |
| berg                                    | 88.6    | 0.1         | 5.2  | 4.5   | -     | -       | -              |
| 1                                       |         |             |      |       |       |         |                |
|   |         |             |      |       |       |         |                |

Melting and casting statuary bronze.—On account of the oxidability of the bronze used for statues, certain precautions have to be observed in melting in order to reduce the loss to a minimum. Crucibles are used for melting small quantities, but reverberatory furnaces for casting large statues.

Figs. 16 and 17 exhibit a furnace used in the Royal foundry at Munich. The charge is 27,500 lbs. Fig. 16 shows the section in the direction of x x, and Fig. 17 in the direction of y y. A is the grate, b the hearth, c the tap hole,

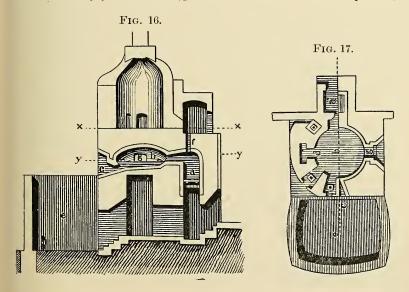

d are air channels in the external wall for carrying off the products of combustion, e is the foundry-pit, f stoke channel, g charging holes.

The operation is commenced by heating the furnace to a red heat, and then quickly introducing the copper. The latter being melted, it is covered with a layer of coal and the previously-heated zinc added. Immediately after the introduction of the latter the tin is added, and the fused mass 17

frequently stirred with wooden poles in order to prevent, by the products of distillation evolved from the wood, the oxidation of the metals, and to promote the homogeneity of the alloy.

Before using the metal for casting, many founders draw it in a very thinly fluid state into a pan or kettle standing in front of the tap-hole, and allow it to stand for some time in order to separate on the surface any oxide still contained in the alloy, which otherwise would injure the purity of the casting. After the layer of oxide is removed, the clay-plug closing the discharge-aperture in the bottom of the pan is removed, and the metal allowed to run into the mould placed in the pit directly in front of the turnace.

Loam-moulds can only be used for large castings, and it being impossible to previously heat them, the fused metal is introduced from below and gradually rises to the top. When it runs from the apertures in the top of the mould and from the vent-holes, the mould has been successfully filled.

The following table\* is a list of about 140 different alloys of copper and tin, giving some of their mechanical and physical properties :—

\*Prepared originally for United States Board; Committee on Metallic Alloys. Report, Vol. I. 1879, p. 390.

| Remarks.   | ]                         | a. Specific gravity of bar. | ings from ingot. |        | Cast copper.               | Sheet copper. | Mean of 9 samples. | Defective her | Can be forged like copper. | Ramrods for guns.<br>Defective bar. | Resists actic | chiorie aciu.      | Annealed and compressed.<br>Hard, malleable. | Pieces of machines. | Specific gravity after re-<br>finated feminering | Surrol managell            |                    |           | Bronze for medals.<br>Shows separation of met- | als when examined with | English ordnance.<br>Ordnange metal. |               |
|--|---------------------------|-----------------------------|------------------|--------|----------------------------|---------------|--------------------|---------------|----------------------------|-------------------------------------|---------------|--------------------|--|---------------------|--|----------------------------|--------------------|-----------|--|------------------------|--------------------------------------|---------------|
|  | oqmy                      | U.S. B.                     | Ma.              | C. J.  | Cr.<br>Mar.                | Mar.          | Ne.                | Ma.           | Bo.                        | 11 S B.                             | M.            | U.S.B.             | Ri.<br>W.                                    | B0.                 | KI.  | C. J.                      | U.S.B.             | U.S.B.    | Bo.  |                        | Bo.                                  |               |
| netivity for<br>stricity, sil-<br>= 100.         |                           | 1                           | <br>03 16        |        |                            |               | 6.97               | 62.46         |                            |                                     | 1             | I                  | 11   | I                   | 10.68  | 12.00                      |                    | I         |  |                        |                                      |               |
| t, silvet <del>—</del><br>t, silvet <del>—</del> | Dond<br>bea<br>100.       |                             |                  | 81.1   |                            |               | 130                | I             |                            |                                     | ł             | ļ                  |  | Ι                   | 1  |                            | I                  | I         | 11   |                        | 11                                   |               |
| of fusibility<br>Ilet).                          | 19b1O <sup>-</sup><br>BM) | i                           | 16               | ]      |                            | 1             | ]                  |               |                            |                                     |               | 1                  |  | 1                   |  |                            | ]                  | 1         |  |                        |                                      |               |
| of mallea.                                       | Order                     |                             | c,               |        |                            |               | )                  | 1             | }                          |                                     |               |                    | 11   | 1                   |  |                            | 1                  |           |  |                        |                                      |               |
| Calvert<br>Calvert<br>Johnson).                  | tbrsH<br>bits<br>bits     | 1                           | 10               | 301    |                            | I             |                    | I             |                            |                                     | Ι             | [                  |  | 1                   | Ι  | 602.8                      | ]                  | 1         |  |                        | 11                                   |               |
| ive ductility<br>urston).                        | твіэЯ<br>dT)              | 30.8                        | H                |        |                            | I             |                    | 100.1         |                            |                                     |               | 70.3               |  | I                   | J  | 11                         | 21.9               | 43.2      |  |                        |                                      |               |
| of ductility.                                    | 19b1O<br>sM)              | 1                           | 1                | 1      |                            | l             |                    | I             |                            | 11                                  | I             | I                  |  | I                   | 1  | II                         | I                  | I         | .  |                        |                                      |               |
| sbruot, pounds<br>square inch.                   | per                       | 27,800                      | 55,104           |        |                            | I             | 24,252             | • ]           |                            |                                     | 000 000       | 32,000             |  | I                   | I  | 11                         | 28,540             | 27,900    |  |                        |                                      |               |
| Fracture.  |                           | Fibrous                     | Earthy           |        |                            | ļ             | -                  | Votionlen     | TRENDERA A                 | Vesicular                           |               | Vesteular          |  |                     |  |                            | Vesicular          | Vesicular |  |                        |                                      |               |
| Color.   | :                         | Copper-red                  | Tile-red         |        |                            |               |                    | Dod           |                            | Red                                 | 0.1111        | Keddisn-           | Golden                                       | Mollak              | 1  |                            | Reddish-           | Reddish-  | MOTTA  |                        |                                      |               |
| fic gravity.                                     | i9942                     | 8.791 <i>a</i><br>8.87.15   | 8.667<br>8.991   |        | 8.79 <del>1</del><br>8.921 | 8.952         | 8.672              | o sea         | HAD O                      | 15.8                                |               | 8 049              | 8.947  |                     | 8.939  | 8.820                      | 8.694              | 8.684     |  |                        |                                      |               |
| .siaylana yd                                     | Sn.                       |                             |                  |        |                            | 1             | }                  | 1             | 1.30                       |                                     |               | 97.2               | 11   | I                   | )  |                            | I                  | I         |  |                        | L I                                  |               |
| Composition                                      | Cu.                       | I                           |                  | I      | I I                        | ]             | 11                 | 1 20          | eo.1e                      | []                                  | 1 00          | 90.06              | 11   | I                   | I  | ]                          | 1                  | 1         |  |                        | 11                                   |               |
| mixture.   | Sn.                       | 0                           | 0.00             | 0.00   | 0.00                       | 0.00          | 0.00               | 1.41          | 1.96                       | 00.10<br>02.00                      | 8.8           | <u>67.6</u>        | $4.00 \\ 5.00$                               | 5.90                | 6.00   | 6.83                       | 7.20               | 7.50      | 8.00   | }                      | $8.26\\8.30$                         |               |
| notizeomoO<br>fanigito 10                        | Cu.                       | 100                         | 100.00           | 100.00 | 100.00                     | 100.00        | 100.00             | 98 59         | 98.04                      | 92.50                               | 96.97         | 90.27              | 96.00<br>95.00                               | 94.10               | 94.00<br>02.02                                   | 93.17                      | 92.80              | 92.50     | $92.00 \\ 91.75$                               |                        | 91.74<br>91.70                       | NUMB - 8 8-16 |
| ic formula.                                      | motA                      | 1                           |                  | 1      | 11                         | I             |                    | - "Uut        | 960010                     |                                     | 18            | SnCu <sub>48</sub> | 1  | 1                   |  | $\operatorname{SnCu}_{25}$ | SnCu <sub>24</sub> |           |  |                        |                                      |               |

## COPPER-TIN ALLOYS.

| Remarks.   |                        | 8-pounder guns. | Toothed wheels | Prussian ordnance. | Ordnance metal. | rienen orunanee. | Compressed ordnance | After repeated compres- | Railroad car bearings. | Small bar east in iron | monid<br>Small bar cast in clay | Mean of 12 gun-heads. | Ordnance metal. |        | Mean of 83 gun-heads. | Currented] | CHUIL ITTELENT. |       |          | gravity<br>gravity         | Densest of all allove (?) | Avlettee hed Seraing |        |       |
|--|------------------------|-----------------|----------------|--------------------|-----------------|------------------|---------------------|-------------------------|------------------------|------------------------|---------------------------------|-----------------------|-----------------|--------|-----------------------|------------|-----------------|-------|----------|----------------------------|---------------------------|----------------------|--------|-------|
| ity.   | todtaA                 | Bo.             | ເງິ            | Mus.               | Bo.             | é é              | U.S. B.             | De.                     | Ri.                    | ю.<br>Во               | Wa.                             | Wa.                   | Wa.             | ю.     | C. J.                 | Wa.        | Ma.<br>La       | Ma.   | U.S. B.  | U.S. B.                    | W                         | ····                 | Mus.   | Ma.   |
| etivity for<br>ricity, sil-<br>= 100.  | vbroð<br>tondu<br>Ver= |                 |                |                    |                 |                  | Ι                   | I                       | Ι                      |                        | I                               | ·                     | Ι               |        | 1                     | 10101      | 12.10           | 10.15 | I        |                            | I                         |                      | I      | 8.82  |
| silver =   | npuon                  | 1               | 11             | I                  | 1               | 1                | 1                   | I                       | 1                      | 1                      |                                 | I                     | 1               |        | 1                     | I          | !               | 1     | 1        | 11                         |                           |                      | 1      | 1     |
| of fusibility<br>let).   | Order<br>[Mal]         |                 |                |                    |                 |                  | Ι                   | 1                       | 1                      |                        | 1                               |                       | 1               | 1      | 1                     | 1          | 1               |       |          |                            | 1                         |                      | 1      | 1     |
| v (Mallea-   | bility<br>order o      |                 |                |                    | Ι               |                  | 1                   |                         | i                      |                        |                                 | 1                     |                 |        | 1                     | 1          |                 | 1     | T        | 11                         |                           |                      |        |       |
| ess (Mallet,   | ubrsH<br>bns<br>bns    |                 | 039.98         | 1                  | 1               | 1                | ſ                   | ļ                       | I                      | 11                     |                                 | 1                     | I               |        | 772.92                | 1          | 1               | i     | Ι        | 11                         | ļ                         |                      |        |       |
| ve ductility [26]  | ritsl9A<br>udT)        | 1               | [              |                    | I               |                  | 18.0                | 1                       | I                      | 11                     | I                               | Ι                     | I               |        | Ι                     | I          | 1               | 1     | 7.3      |                            |                           |                      | 1      | 1     |
| of ductility [ef.  | order<br>(Mal)         |                 |                | Ι                  | ł               |                  |                     | I                       | 1                      | 11                     | I                               | Ι                     | Ι               |        |                       | 1          |                 | 1     | 1        | 11                         | 1                         |                      | I      | 1     |
| z, pounds   2<br>2   2<br>2 | iəsnəT<br>2 19q        |                 | 11             | 32,093             |                 |                  | 26,860              | I                       | Ι                      | i I                    | 37,688                          | 25,783                | 26,011          |        | I                     | I          |                 | 1     | 31,100   | $^{-}_{29,430}$            | I                         |                      | 44,071 | 1     |
| Colopse inc. $Colopse = 231Vet = 231Ve$   |                        |                 |                |                    | 1               |                  | Earthy              | ļ                       | ]                      |                        |                                 |                       |                 |        | -                     | 1          |                 |       | Earthy   | Finely vesicular           |                           |                      |        |       |
| L'roperue<br>Color.  |                        |                 |                |                    |                 |                  | Grayish-            |                         |                        |                        |                                 |                       |                 |        | ]                     |            |                 |       | Grayish- | Mot                        | yellow                    |                      |        |       |
| C gravity.   | ñiəəq2                 |                 | 0.793          | I                  | I               |                  | 8.669               | 8.875                   | 8.930                  | 1                      | 8.953                           | 8.313                 | 8.353           | 8.84   | 8.825                 | 8.523      |                 | I     | 8.648    | $\frac{-}{8.681a}$         | 8.87                      |                      | I      |       |
| .sizylsus yd   | Sn.                    |                 |                | Ι                  | [               | I                | 9.58                | 1                       | I                      |                        | I                               | I                     | 1               |        |                       | 1          |                 | I     | I        | $\frac{-}{12.73}$          | I                         | I                    | Ι      |       |
| noitisoquo   | Ca.                    |                 | !              | I                  | 1               |                  | 90.27               | I                       | 1                      |                        | Ι                               | Ι                     |                 |        | 1                     | !          |                 | I     | Ι        |                            | 1                         | I                    |        | 1     |
| of original<br>mixture.  | sn.                    | 8.33            | 8.70           | 60.6               | 9.10            | 06.6             | 10.00               | 10.00                   | 10.00                  | 10.70                  | 10.71                           | 10.71                 | 10.71           | 11.00  | 11.03                 | 11.11      | 10.01           | 12.35 | 12.50    | 12.40<br>13 43             | 13 70                     | 14 00                | 14.29  | 14.91 |
| noitisoqmot<br>Isniviro to   | Cu.                    | 91.66           | 60.18          | 16.06              | 90.90           | 90.10            | 90.00               | 00.00                   | 00.00                  | 89.30                  | 89.29                           | 89.29                 | 89.29           | 89.00  | 88.97                 | 88.89      | 88.00           | 87.65 | 87.50    | 86.80<br>86.57             | 86.91                     | 86.00                | 85.71  | 85.09 |
| .slumua.   | imotA                  | 10              | DUCU20         | I                  | 1               | 1                | I                   | ł                       | ł                      |                        | i                               | Ι                     |                 | SnCurs | SnCu <sub>15</sub>    |            |                 |       |          | $\operatorname{SnCn}_{12}$ | 1                         | 1                    | 1      |       |

Properties of the Alloys of Copper and Tin.-Continued.

260

# THE METALLIC ALLOYS.

| Remarks.                                  |                    |   | Carriage wheel boxes.<br>Jeweler's punches. | Strongest of series. | Annealed and tempered.   | Chinese gong.<br>Bells of Reichenhall, 300<br>visions old | Annealed and tempered.<br>After repeated compres-<br>[sion. | Annealed and tempered.  |   | Bwiss clock-bells, brittle. |
|---|--------------------|---|---|----------------------|--|---|---|---|---|-----------------------------|
| ority.                                    | diuA               | RI.<br>C. J.<br>MI.   | Bo.<br>MI.                                  | U.S. B.              | Ri.<br>MI.   | Th.<br>Bo.  | Mus.<br>Ri.<br>U.S. B.                                      | Ri.<br>MI.  | B0.<br>U.S. B.<br>Ri.<br>B0.  | Bo.<br>W.                   |
| uctivity, for<br>etricity, sil-<br>= 100. | Cond               | 111   | 111   | I                    | 111  | 11  |   | 111   |   | 11                          |
| uetivity for<br>tt, silver =              | puon               | 111   | 1   | 1                    |  | 11  | 1111  | 111   | 11111   | 11                          |
| r of fusibility.                          | Orde:<br>(M        | 1   2   | 14  | 1                    | 112  | 1   |   | 12  |   | 11                          |
| r of mallea-<br>ty (Mallea).              | bili<br>Drde       | °   | 1 1 1                                       | 1                    | 1   9  | 11  |   | 11=   | 11121   | 11                          |
| ness (Mallet,<br>i Calvert<br>i Johnson). | brsH<br>ans<br>ous | 916.66<br>8   | 0   | 1                    | 4  |   |   | 00  | ei  | 11                          |
| ive ductility<br>urston).                 | Relat              | 111   |   | 0.32                 | 111  | 11  | 0.40  | 111   | 1000000000000000000000000000000000000   | 11                          |
| r of ductility.                           | ebrO<br>M)         | 01  | «   | I                    | +  | ]   |   | 110   | 0]  | 11                          |
| eity, pounds<br>square inch.              | snэT<br>тэq        | 36,064  | 34,048                                      | 36,200               | 39,648   | 11  | 35,739 — — — 32,980   |   | 24,650<br>22,010<br>21,728  | 11                          |
| Fracture.                                 |                    | Finely crystalline  | Finely crystalline                          | Finely crystalline   | Finely crystalline   |   |   | Vitreous conchoidal   | Finely granular<br>Smooth.<br>Vitreous  |                             |
| Color.                                    |                    | Reddish-  | Reddish-                                    | Reddish-             | Yelløwish-   | 7 (nat  | Reddish-  | Yellowish-  | Pinkish-gray  |                             |
| пе втатіту.                               | iəəqB              | 8.87<br>8.832<br>8.561  | - 8.462                                     | 8.792                |  | 8.953<br>8.7  |   |   | $\begin{array}{c} - \\ 8.917 \\ 8.565 \\ 8.91 \\ 8.750 \\ 9.1(7) \\ 9.1(7) \end{array}$   |                             |
| .sisylsns yd                              | Sn.                | 111.  | 111   | I                    | 111  | 19.57   | 18.84   |   | 23.24   | 1                           |
| Composition                               | Cu.                | 111   | 111   | I                    | 111  | 80.43   | 80.95   | 111   | 76.64   | 11                          |
| mixture.                                  | Sn.                | $     \begin{array}{r}       15.67 \\       15.68 \\       15.71 \\       15.71     \end{array} $ | $16.00 \\ 16.70 \\ 17.19 \\ 17.19$          | 17.50                | $     \begin{array}{c}       18.00 \\       18.85 \\       18.90 \\       18.90 \\     \end{array} $ | 20.00   | 20.00<br>20.00<br>20.00                                     | $20.80 \\ 20.98 \\ 21.03 \\ 21.0$ | $\begin{array}{c} 22.00\\ 23.69\\ 23.69\\ 23.81\\ 23$ | 24.80<br>25.00              |
| nottisoqmoD<br>Isnigiro lo                | Cu.                | 84.33<br>84.30<br>84.29   | 84.00<br>83.30<br>82.81                     | 82.50                | 82.00<br>81.15<br>81.10  | - 80.00   | 80.00<br>80.00<br>80.00<br>80.00                            | 79.20<br>79.02<br>78.97   | $\begin{array}{c} 78.00\\ 77.50\\ 76.32\\ 76.29\\ 76.29\\ 76.29\end{array}$   | 75.20<br>75.00              |
| ic formula.                               | motA               | SnCu <sub>10</sub>  | SnCu <sub>9</sub>                           |                      | SnCu <sub>e</sub><br>SnCu <sub>e</sub>   | ]   | ]   | $\operatorname{SnCu}_{\tau}$  | SnCue<br>SnCue<br>SuCue   |                             |

# COPPER-TIN ALLOYS.

|  | Remarks.                                  |                    |          |   | Mirror of telescope. |                |  | Mirror metal.    | Hard, Uniform. |                      |                   | Greatest density, weakest.          | White bell-metal. | Weakest under transverse                            | [stress.          | Remarkable for liquation.                                   |       | Very slightly malleable. |
|--|---|--------------------|----------|---|----------------------|----------------|--|------------------|----------------|----------------------|-------------------|-------------------------------------|-------------------|---|-------------------|---|-------|--------------------------|
|  | .vity.                                    | զդութ              | Ri.      | C. J.<br>Ml.<br>U.S. B.                             | U.S.B.<br>Bo.        | С. J.          | U.S. B.<br>Ml.                         | Bo.<br>U.S. B.   | Wus.           | U.S.B.<br>U.S.B.     | C.J.              | U.S.B.                              | Bo.               |   | E.                | C. J.<br>M. B.  | Mus.  | W.                       |
|  | uctivity for<br>ctricity, sil-<br>= 100.  | puo) +             | 1        | 1   | 11                   | 11             | 11                                     | 11               | }              |                      | I                 |                                     |                   |   |                   |   | 1     | 1                        |
| aed.   | ut, silver —                              | 100<br>Pea<br>Cond | I        | 15<br>1.1   |                      | 11             | 15.5                                   |                  |                |                      | 49.4              |                                     | Ι                 |   |                   | 42.8  |       | 1                        |
| tinı   | r of fusibility                           | (Ma<br>M)          | 1        | 151   |                      |                | ۱ <u>۰</u>                             |                  |                |                      |                   | ∞                                   | 1                 |   |                   | ^   |       | 1                        |
| Con  | r of mallea-<br>ity (Mallet).             | orde:              |          | 131   | 11                   | 11             | 14                                     |                  | 11             |                      | 1                 | 19                                  |                   |   | []                | 113   | 1     | 1                        |
| in.—(  | ness (Mallet,<br>i Calvert<br>i Johnson). | basH<br>and<br>and | 1        | Broke<br>1<br>—                                     | 11                   | -<br>Broke     | 19                                     | 11               | t I            |                      | Broke             |                                     | • 1               |   | 11                | Broke<br>   | 1     | 1                        |
| $nd \ T$   | tive ductility.<br>urston).               |                    | I        | - 0.003   | 0.008                | LI             | 11                                     | 0.009            | []             | $0.002 \\ 0.001$     | 1                 | 0.003                               |                   | 0.003   | 1 I               | 0.003   | 1     | 1                        |
| r a  | r of ductility<br>allet).                 | (Ms)               | I        | 1°  | 11                   | 11             | 10                                     | 11               | 11             | 11                   | T                 | -                                   | <b>)</b>          | 1   |                   | 110   | I     | 1                        |
| Joppe  | sbruoq, yiis<br>aquare inch.              |                    | 1        | $10,976 \\ 6,493$                                   | 5,585                | 11             | 1,620<br>1,568                         | -2,536           | 1 017          | 2,201                |                   | 688                                 |                   | 1,455   |                   | 2,555<br>3,808  | 795   | 3                        |
| Properties of the Alloys of Copper and Tim-Continued | Fracture.                                 |                    |          | Conchoidal  |                      |                | Conchoidal                             | Conchoidal       |                | Radiated ervstalline |                   | Rough, stony<br>Tabular ervstalline |                   | Stony<br>"  |                   | Vitreous conchoidal   |       |                          |
| Properties   | Color.                                    |                    | Reddish- | Bluish-red<br>Reddish-                              | White                |                | White<br>Ash-gray                      | White            | Steel-gray     | Bluish-gray          |                   | Dark gray                           |                   | Light gray  |                   | Light gray<br>Gravish-                                      | white | Bluish-<br>white         |
|  | .viivers of                               | iəəqZ              | 8.87     | 8.965<br>8.575<br>8.925<br>8.925                    | 8.932                | 8.80           | 8.938                                  | -002             | 1              | 8.947                | 8.954             | 8.970<br>8.970                      | 100               | 8.781<br>8.682<br>8.642                             | 8.57<br>8.57      | 8.533<br>8.560<br>8.416                                     |       | 8.79                     |
|  | .sizylsns yd                              | Sn.                |          | 111   | 29.89                | l I            | 31.26                                  | 11               | 1              | 34.47                | 1                 | 11                                  | 1                 | $\frac{-}{43.17}$                                   |                   | 48.09   |       |                          |
|  | noitizoqmoD                               | Cu.                | 1        | 111   | 69.84                | 11             | 68.58                                  | 14               | 1              | 65.34                | I                 | 11                                  |                   | 56.70   | I                 | 51.62   |       | 1                        |
|  | mixture.                                  | Sn.                | 27.09    | $\begin{array}{c} 27.10\\ 27.20\\ 27.50\end{array}$ | 30.00                | 31.72          | 31.75                                  | $31.79 \\ 32.50$ | 33.33          | 35.00<br>35.00       | 38.21             | 38.29<br>38.29<br>38.29             | 40.00             | 42.50<br>43.68<br>47.50                             | 48.16             | $\frac{48.17}{48.20}$                                       | 50.00 | 50.00                    |
|  | noitizoqmoD<br>Isnigiro io                | Cu.                | 72.91    | $72.90 \\ 72.80 \\ 72.50 \\ 72.50 \\$               | 70.00                | 68.28          | 68.25<br>68.21                         | 68.21<br>67.50   | 66.67          | 65.00<br>65.00       | 61.79             | 6/.19<br>12.19                      | 00.09             | 57.50<br>56.32<br>59.50                             | 51.84             | 51.83<br>51.80<br>51.75                                     | 50 00 | 50.00                    |
|  | ic formula.                               | motA               | SnCus    | SnCu <sub>5</sub><br>SnCu <sub>5</sub><br>—         | 11                   | SnCu₄<br>SnCu₄ | SnCu <sub>4</sub><br>SnCu <sub>4</sub> | ,<br>            | 1              |                      | SnCu <sub>3</sub> | SnCu <sub>3</sub>                   |                   | $\mathrm{Sn}_{\mathrm{s}}\mathrm{Cu}_{\mathrm{12}}$ | SnCu <sub>2</sub> | SnCu <sub>2</sub><br>SnCu <sub>2</sub><br>SnCu <sub>2</sub> | a     |                          |

262

## THE METALLIC ALLOYS.

|              | Remarks.                         |                   |                       |                                 |                                 | White bell-metal. |        |         |                                | Brittle; uniform. |                        |              |                                 | Yellow, greenish-white,<br>febining |                    |                   | -              |                    |  |                                 |        |
|--------------|----------------------------------|-------------------|-----------------------|---------------------------------|---------------------------------|-------------------|--------|---------|--------------------------------|-------------------|------------------------|--------------|---------------------------------|-------------------------------------|--------------------|-------------------|----------------|--------------------|--|---------------------------------|--------|
|              | ority.                           | գյուծ             | U.S. B.<br>U.S. B.    | RI.<br>U.S. B.                  | U.S. B.                         | U.S. B.           | E.     | C.      | U.S. B.<br>MI.                 | W.<br>W.          | á<br>ĢĒ                | ΞÅ           | E- E-                           | A.                                  |                    | ΞΨ.               | j≓;            | Ma.<br>Ri.         |  | ΤKΗ C                           |        |
| 101          | = 100.<br>trielty, si<br>= 100.  | puon              | 11                    |                                 |                                 | 111               |        | []      | ! 1                            | 1                 |                        | 11           | 11                              | ]                                   |                    |                   |                | 12.76              |  |                                 |        |
| 101          | t, silver =                      | puoj              | 11                    | 11                              | []                              |                   | 1      | 1.<br>1 | 11                             | 1                 |                        | 11           | }                               | 15                                  |                    | 11                | 11             | 11                 | 42.3   | 1   9 07                        | 0.01 I |
| <u>viili</u> | idizuî îusibi<br>11et).          | eM)               |                       |                                 | 11                              |                   | 1      | 11      | 9                              |                   |                        | 11           |                                 | 1                                   |                    | 0                 |                |                    | 11   | 4                               |        |
| -189         | r of malle                       | orde              |                       |                                 |                                 |                   | 1      |         | ۍ                              | 1                 |                        |              | 11                              |                                     |                    | ×                 |                | 1                  |  | <u>-</u>                        | !      |
| Jlet,        | all ohnson<br>Valvert<br>nosndol | bus<br>bus<br>bus |                       |                                 | 11                              |                   | Dvolea |         |                                | 1                 | 1                      |              | 11                              | - 135 49                            |                    | 12                |                | 11                 | 104.17   | 8   13<br>8   13                | 10.00  |
|              | tive ducti<br>urston).           |                   | $0.003 \\ 0.003$      | 0.003                           | 0.000                           | 0.005             | 51     | 11      | 0.005                          | 100               | 0.011                  | 0.018        | 0.03                            |                                     | 100                | 8. I              | 0.20           | ]                  | 0.92   | 4.71                            |        |
| ΛiΠi         | r of ducti<br>Met).              | 9b10<br>вМ)       | 11                    | 11                              |                                 |                   |        |         | 0                              |                   |                        | 11           | 11                              |                                     | 1                  | 0                 | []             |                    | •  | >                               |        |
| чол.<br>spu  | uoq , yiis<br>na guare in        | sn9T<br>19q       | 1,525<br>2,407        | 3,010                           | 2,000<br>3,910                  | 2,820             |        |         | 3,371 $3,136$                  | 0.800             | 1,648                  | 4,380        | 6,775<br>5.000                  | 11                                  | 100 1              | 8,736             | 2.816          | 11                 | 6,520  | 0,944<br>3,798                  |        |
|              | Fracture.                        |                   | Fine grain<br>Crystal | Crystal                         |                                 | Crystal           |        |         | Crystal<br>Tabular crystalline | Crustal           | Utystut<br>u           | : 3          | Finely crystalline              | }                                   |                    | Coarse crystal    | Crystal        | ]]                 | Crystal  | Coarsely crystalline<br>Crystal |        |
|              | Color.                           | ·                 | Grayish-white         | Grayish-white                   | . 3                             | Grayish-white     |        |         | Grayish-white                  | White /           | 20111 M - Her Corto    | Bluish-white | Grayish-white                   | Whitish                             | Cuentalshitto      | ann winst for the | Grayish-white  |                    | Grayish-white  | 3                               |        |
| ۲.           | tivers of                        | io9q8             | 8.442                 | 8.30                            | 8.302                           | 8.182             | 8.12   | 8.072   | 8.013<br>8.056                 | 7 031             | 7.918                  | 7.813        | 7.774                           | 7.53                                | 1.74               | 7.387             | 2.690          | 7.53               | 7.657  | 7.558                           |        |
| 'SISÁI       | ទ្រពន ឬថ                         | Sn.               | 52.14 —               | 55.28                           | 57.30                           | 61.32             | 11     |         | 65.80                          |                   | 73.80                  | 11           | 76.29                           | 77.63                               | 10.00              |                   | 11             | 11                 | 84.62  |                                 |        |
| nom          | Composi                          | Cu.               | 47.61                 | -44.52                          | 42.38                           | 38.37             |        | 1       | 34.22                          | 11                | 25.85                  | 11           | 23.35                           | 21.38                               | 1 00               | 07.07             | 11             |                    | 15.08  |                                 |        |
| re.          | giro io<br>utxim                 | Sn.               | 52.05<br>52.50        | 55.37<br>55.37                  | 58.26                           | 60.80             | 65.01  |         | 65.05<br>65.08                 | 66.67             | 71.28                  | 75.00        | 75.62<br>77.50                  | 78.26<br>78.79                      | 78.79              | 78.85             | 82.50<br>82.50 | 84.79              | 84.79<br>84.81   | 87.50<br>88.14                  |        |
| ùoți         | isoq moD                         | Cu.               | 47.95                 | 44.63                           | 41 74                           | 39.20<br>37.50    | 34.99  |         | 34.95                          | 32.50             | 28.72                  | 25.00        | 24.38                           | 21.74<br>21.21                      | 21.21              | 21.15             | 17.50          | 15.21              | 15.21<br>15.19   | 12.50                           |        |
| .al          | lumrof si                        | motA              | ShrCu2                | Sn <sub>3</sub> Cu <sub>3</sub> | Sn <sub>3</sub> Cu <sub>4</sub> | Sn 6Cue           | SuCu   | SnCu    | sncu                           |                   | ${\rm Sn}_4{\rm Cu}_3$ |              | Sn <sub>5</sub> Cu <sub>3</sub> | Sn.Cu                               | Su <sup>2</sup> Cu | Sn2Cu             | ки50u2<br>—    | Sn <sub>3</sub> Cu | sn <sub>3</sub> Cu<br>Sn <sub>3</sub> Cu<br>Sn <sub>3</sub> Cu | Sn.Cu                           | -      |

COPPER-TIN ALLOYS.

|   | Remarks.                                 |                         | Slightly mallcable.   |
|---|--|-------------------------|---|
|   | .vitro                                   | զգութ                   | We C. J. C. S. B. B. B. B. C. S. J. J. C. S. J. J. C. S. J. J. C. S. J.   |
|   | uctivity for<br>stricity, sil-<br>= 100. | Ver<br>elec<br>Cond     | 12.03<br>12.03<br>11.45   |
| ed.   | t, silvet =                              | 100 <sup>.</sup><br>Пея | 39.6<br>15.2  |
| pnl   | vof fusibility.                          | вM)                     | [ ]   ]   |
| one   | ty (Mallea-                              |                         | - +   ]   - 0   -             -   |
| n.—C  | l Johnson).<br>Calvert<br>Lanson).       | and<br>and<br>bas       | 88.33<br>15<br>16<br>16   |
| dT  | ive ductility.                           |                         | $\begin{array}{c} 7.08 \\$  |
| $r \alpha r$  | of ductility_                            | r9brO<br>8M)            |   |
| Joppe   | sbruoq ,yjis<br>square inch.             | DGI                     | $\begin{array}{c} 6,380\\ -2,380\\ -2,380\\ -2,380\\ -2,380\\ -2,122\\ -1\\ -1\\ -1\\ -1\\ -1\\ -1\\ -1\\ -1\\ -1\\ -1$   |
| Properties of the Alloys of Copper and TimConcluded | Fracture.                                |                         | Crystal<br>Coarsely crystalline<br>Granular<br>Granular<br>Fibrous<br>  |
| Properties (  | Color.                                   |                         | Grayish-white<br>Grayish-white<br>Grayish-white<br>Grayish-white<br>Grayish-white<br>" " "<br>White   |
|   | . үлітата эй                             | iəəqZ                   | $\begin{array}{c} 7.552 \\ 7.517 \\ 7.517 \\ 7.517 \\ 7.517 \\ 7.517 \\ 7.517 \\ 7.529 \\ 7.442 \\ 7.442 \\ 7.442 \\ 7.429 \\ 7.305 \\ 7.291 \\$ |
|   | .sisylsus yd                             | Sn.                     | 88.47<br>   |
|   | Composition                              | Cu.                     | $\begin{array}{c c} 11.49 \\ \hline \\ 8.57 \\ \hline \\ 0.74 \\ 0.32 \\ \hline \\ 0.32 \\ \hline \\ \end{array}$   |
|   | of ôriginal<br>mixture.                  | sn.                     | 88.16<br>88.18<br>90.27<br>90.27<br>90.30<br>90.30<br>90.30<br>95.77<br>95.77<br>95.77<br>95.77<br>95.77<br>95.57<br>100.00<br>100.00<br>100.00<br>100.00<br>100.00<br>100.00   |
|   | noitisoquio)                             | Cu.                     | 111.81<br>11.81<br>11.82<br>11.82<br>1.82<br>1.82<br>1.82   |
|   | ic formula.                              | motA                    |   |

#### COPPER-TIN ALLOYS.

## LIST OF AUTHORITIES.

Bo.—Bolley. Essais et Recherches Chimiques, Paris, 1869, pp. 345, 348. Cr.—Croockewit. Erdmann's Journal, XLV. 1848, pp. 87 to 93.

C. J.—Calvert and Johnson. Specific Gravities, Phil. Mag., 1859, Vol. 18, pp. 354 to 359; Hardness, Phil. Mag., 1859, Vol. 17, pp. 114 to 121; Heat Conductivity, Phil. Trans., 1858, pp. 349 to 368.

De.-S. B. Dean. Ordnance Notes, No. XL., Washington, 1875.

La.-Lafond. Dingler's Jour., 1855, Vol. 135, p. 269.

Ml.-Mallet. Phil. Mag., 1842, Vol. 21, pp. 66 to 68.

Ma.-Matthiessen. Phil. Trans., 1860, p. 161; ibid., 1864, pp. 167 to200.

Mar.—Marchaud and Scheerer. Journal fuer Praktische Chemie, Vol. 27, p. 193 (Clark's "*Constants of Nature*").

Mus.-Muschenbroek. Ure's Dictionary, article "Alloy."

Ri.-Riche. Annales de Chimie, 1873, Vol. 20, pp. 351 to 419.

U. S. B.—Report of Committee on Metallic Alloys of United States Board appointed to Test Iron, Steel, etc.

T.—Thomas Tomson. Annales de Chimie, 1814, Vol. 89, pp. 46 to 58.W.—Watt's Dictionary of Chemistry.

Wa.—Major Wade, United States Army. Report on Experiments on Metals for Cannon, Phil., 1856.

We.-Weidemann. Phil. Mag., 1860, Vol. 19, pp. 243, 244.

Note on the table.—In the preceding table the figures of order of ductility, hardness, and fusibility are taken from Mallet's experiments on a series of 16 alloys, the figure 1 representing the maximum and 16 the minimum of the property. The ductility of the brittle metals is represented by Mallet as 0.

The relative ductility given in the table of the alloys experimented on by the U. S. Board is the proportionate extension of the exterior fibres of the pieces tested by torsion as determined by the autograph strain diagrams. It will be seen that the order of ductility differs widely from that given by Mallet.

The figures of relative hardness, on the authority of Calvert

266

and Johnson, are those obtained by them by means of an indenting tool. The figures are on a scale in which cast-iron is rated at 1000. The word "broke" in this column indicates the fact that the alloy opposite which it occurs broke under the indenting tool, showing that the relative hardness could not be measured, but was considerably greater than that of cast-iron.

The figures of specific gravity show a fair agreement among the several authorities in the alloys containing more than 35 per cent. of tin, except those given by Mallet, which are in general very much lower than those by all other authorities. In the alloys containing less than 35 per cent. of tin there is a wide variation among all the different authorities, Mallet's figures, however, being generally lower than the others. Several of the figures of specific gravity have been selected from Riche's results of experiments on the effects of annealing, tempering, and compression, which show that the latter especially tends to increase the specific gravity of all the alloys containing less than 20 per cent. tin to about 8.95. This result is due merely to the closing up of the blow-holes, thus diminishing the porosity. The specific gravity of 8.953 was obtained by Major Wade by casting a small bar in a cold iron mould from the same metal, which gave a specific gravity of only 8.313 when cast in the form of a small bar in a clay mould. The former result is exceptionally high, and indicates the probability that every circumstance of the melting, pouring, casting, and cooling was favorable to the exclusion of the gas which forms blow-holes and to the formation of perfectly compact metal.

The figures of tenacity given by Mallet, Muschenbroek, and Wade agree with those found in the experiments as closely as could be expected from the very variable strengths of alloys of the same composition which have been found by all experimenters.

Mallet's figure for copper, 24.6 tons or 55,104 pounds, is certainly much too high for cast copper; the piece which he tested was probably rolled or perhaps drawn into wire. Haswell's Pocket Book gives the following as the tensile strength of copper; the names of the authorities are not given :—

|                         | Pounds per   |
|-------------------------|--------------|
|                         | square inch. |
| Copper, wrought         | 34,000       |
| Copper, rolled          | 36,000       |
| Copper, cast (American) | 24,250       |
| Copper, wire            | 61,200       |
| Copper, bolt            | 36,800       |

The strength of gun-bronze, as found in the guns, is not given in the table, which is designed to compare the various authorities on the tenacities of the alloys only as cast under ordinary conditions, and not when compressed, rolled, or cast under pressure.

# CHAPTER VIII.

## NICKEL ALLOYS.

ALTHOUGH nickel in a pure state and as a distinct metal has been known only for a comparatively short time, in many localities it has for many years been indirectly used in the preparation of alloys. As far back as the seventeenth century, alloys were brought to Europe from China which were distinguished by quite a white color and considerable hardness, and were known by various names. The actual Chinese name—packfong or packtong—of this alloy means white copper. Engström, in 1776, found it to consist of copper 40.5, zinc 44.3, and nickel 15.2, while the analysis of a specimen by Fyfe, in 1822, gave copper 41.0, zinc 26.5, nickel 8, and iron 2.7. The alloy is probably prepared by the Chinese in a manner similar to that in which brass was made in Europe, before zinc in a metallic state was known, namely, by fusing copper with nickeliferous minerals.

As far back as 1770, a similar white alloy, known as Suhl white copper, was prepared in Europe from white metallic grains obtained by crushing and washing old slag. According to Brandes (1823) these grains consisted of copper 88, nickel 8.75, iron, silica and alumina 1.75, and antimony and sulphur 0.75. By adding zinc and tin an alloy was obtained which was used for spurs and gun-mountings, and contained, according to Keferstein, copper 40.4, zinc 25.4, nickel 31.6, and tin 2.6. According to Frick, the alloy, whose content of

(268)

nickel and the white color dependent thereon was established in 1823, contained copper 11 parts, zinc  $7\frac{3}{4}$ , and nickel 1. In 1823, the society for promoting industry in Prussia offered a prize for the invention of an alloy which, while similar in appearance to silver, should cost no more than  $\frac{1}{6}$  the price of the latter, and be suitable for culinary and table purposes. In 1824, such an alloy was prepared almost simultaneously by Henniger Bros. of Berlin, and Dr. Geitner, of Schneeberg. The latter called his alloy argentan, and prepared it at first from cobalt speiss (on an average with 49 nickel, 37 arsenic, 7 sulphur, besides iron and other metals), the result being that the composition of the alloy was not always constant. Henniger Bros. called their alloy "Neusilber" (new silver). Later on the alloy was prepared only from copper, zinc and metallic nickel, and it was soon introduced in France under the names of Maillechort (called thus after the first manufacturers, Maillet and Chorier), argent d' Allemagne, argent allemand, argent neuf, and in England under the name German silver.

In Vienna the alloy has been prepared since 1824 and was called *alpaka*, in Paris, *alfenide*, while the Chinese name packfong has been retained for inferior qualities poorer in nickel and containing other metals. Articles quite heavily silver-plated were introduced in 1840, and are known as *China silver* or *Christophle metal*.

According to other statements the above mentioned alloy, known as Maillechort, contains at the utmost 15 per cent. nickel, and alloys which besides copper, zinc and nickel, contain other metals (tin, bismuth, antimony) to obtain greater fusibility and a more beautiful color, are known as *silverine*, *argentan*, *packfong*, etc.

Nickel-copper alloys.-Nickel and copper unite in a wide range of proportions, the color of the alloys varying from copper-red to the blue-white of the nickel, according to the proportions of the respective metals. With a content of 0.10 per cent. nickel the alloy is very ductile, of a light copper-red color, and moderate strength; with 0.15 per cent., the ductility is still considerable, while the color changes to a very pale red; a content of 0.25 per cent. of nickel gives a nearly white alloy, and 0.30 per cent., a silver-white metal. The beautiful white color and considerable hardness acquired by copper by an addition of nickel make the alloy especially suitable for coinage, and it is used for this purpose in Switzerland, Belgium, and the United States. Both the Belgian and the United States coins now contain copper 75, nickel 25. The modern small coins of Switzerland, France, Sweden, Denmark, England and Belgium, contain a small addition of tin and zinc, and those of Italy only of tin. Chilian coins are composed, since 1872, of copper 70, nickel 20, zinc 10.

The use of alloys consisting of copper and nickel alone is limited, those consisting of copper, nickel, and zinc being more frequently employed. C. Morfit prepares a beautiful alloy of nickel and copper by mixing 33 parts of nickel and 34 parts of copper with some borax, and fusing in a graphite crucible. To the melted mass he adds with constant stirring 33 parts more of copper, and casts the resulting alloy in small sticks.

*Berthier's alloy* consists of copper 0.682 parts, nickel 0.318. It is fusible, ductile, strong, bluish-white, slightly magnetic, and somewhat crystalline near the surface.

Ingot-iron sheet, plated on both sides with an alloy of copper 80 and nickel 20, serves for the manufacture of cartridge shells. According to Vivian, copper sheet with 1 to 3 per cent. nickel can be rolled hot and is stronger and tougher than sheet of copper or brass. An alloy with 50 to 60 per cent. nickel is used in watch factories, but otherwise serves only as a raw material for other alloys.

Künzel and Montefiore-Levy endeavored in vain to produce a nickel-copper alloy not subject to liquation, and which, with the same or greater degree of hardness would possess greater elasticity, more absolute strength and toughness than ordinary gun-metal. With a content of up to 10 per cent. nickel and 90 per cent. copper, these alloys did not possess the required hardness, while with over 10 per cent. nickel the castings obtained were porous, because such combinations richer in nickel absorb in fusing large quantities of oxygen which becomes free in cooling. This is also the reason for the difficulty encountered in making nickel coins of copper 75, nickel 25, the alloy adopted by Belgium, Germany, and the United States. By an addition of aluminium or phosphor-copper, dense castings may be obtained in iron moulds. While large cavities formed in consequence of too high a temperature in casting or incorrect cooling generally yield useless castings, smaller cavities distributed throughout the entire mass disappear by rolling and stamping, and are of no disadvantage.

*Nickel-copper-zinc alloys.*—These alloys form the mixtures of metals known as German silver, packfong, *argent neuf*, etc. They may in a measure be considered as a brass, which, by an addition of nickel, has acquired a white color and considerable hardness.

Generally speaking, German silver is superior to brass as regards hardness, strength, and power of resisting chemical influences, the latter property making it especially valuable for certain purposes. In respect to its preparation it is, however, a very subtle mixture, and exceedingly small quantities of foreign metals exert a considerable influence upon the physical properties of the alloy.

A content of arsenic is most injurious in this respect. Even a very small percentage of it renders the alloy so brittle that it can scarcely be worked, and in a short time changes its color to brownish.

A considerable portion of nickel is obtained from an ore known as copper-nickel or arsenical nickel and from certain cobalt ores. Both ores, however, always contain considerable quantities of arsenic, which it is impossible to remove entirely by the ordinary mode of smelting. This content of arsenic prevented for a long time the general introduction of nickel alloys in practice, and it became necessary entirely to abandon the method of preparing nickel by the dry method. It is now prepared by the wet method, in order to obtain protoxide of nickel entirely free from arsenic. This protoxide is then made into small cubes with starch-paste and heated at a very high temperature. By this treatment it is reduced to metal, the pure nickel remaining behind in the form of a quite dense metallic sponge, which is, however, not fused, but simply slagged, nickel belonging to the metals very difficult to fuse. It may here be mentioned that for making alloys, it is really better to have the nickel, not as a compact fused mass, but in the form of a sponge, the latter combining with greater ease with the other metals.

Nickel ores are also reduced by fluxing with chalk and fluorspar if arseniated, or by roasting, and then reducing with charcoal and sulphur to the state of sulphide, and then by

double decomposition with carbonate of soda obtaining the carbonate, which is finally reduced with charcoal.

Nickel and cobalt are closely allied as regards their chemical properties and frequently occur together, so that the nickel found in commerce often contains a considerable quantity of cobalt, which passes into the alloy without, however, exerting an injurious influence. The same may be said of iron, also chemically closely allied to nickel, a content of it even increasing the tenacity and hardness of the nickel alloys and imparting to them a whiter color. But, on the other hand, it makes them more difficult to work, and renders them somewhat brittle. The genuine packfong, the original nickel alloy introduced from China, contains sometimes as much as three per cent. of iron. European manufacturers also frequently add a small quantity of iron to German silver, if a high degree of hardness is required for certain purposes.

Some skill is, however, required to effect an actual combination of the alloy with the iron. By adding the iron directly to the fused alloy it does not combine with it, and forms upon the surface of the fused mass a layer consisting of copper, nickel, and the added iron. An alloy of iron and copper dissolves, however, readily in the German silver, and an intimate union of all the metals can be easily effected by melting together equal portions of copper and steel, and adding pieces of this alloy to the fused German silver.

An addition of silver to German silver does not affect its properties injuriously, nor an addition of a few per cent. of lead, which makes the alloy more fusible, somewhat cheaper, and improves its color. It is, however, remarkable that only a very small addition of lead renders the alloy quite brittle.

By an addition of tin, German silver acquires considerable hardness and a beautiful sound. An alloy of this kind containing a suitable quantity of tin could be used as speculummetal and bell-metal. But the previously given compositions for these purposes being very suitable and much cheaper, tin alloys containing nickel are not used in practice.

As regards the properties of nickel alloys they may be summed up as follows: The color of the mixture is always white, the degree of whiteness depending on the quantity of the separate metals used in the respective composition. The most beautiful color is shown by an alloy of 4 parts of copper and 3 of nickel, but unfortunately this alloy is scarcely available for practical purposes, it being extremely difficult to fuse, and so hard that it can scarcely be worked. An alloy containing 75 parts of copper and 25 of nickel does no longer show a pure white color, but one with a yellowish tinge, which is clearly perceptible by holding a polished piece of such an alloy alongside a piece of silver. Hence the better qualities of German silver must in all cases contain more than one-fourth of nickel. In using a small quantity of nickel it has been attempted to remove the yellowish color by an addition of silver; but without success. The Swiss coins are made of such an alloy, and, as is well known, show a decidedly yellowish cast.

In most factories the articles made of German silver are plated with silver by the electric current and exhibit the color of chemically pure silver, which they retain for a shorter or longer time according to the thickness of the deposit.

The mechanical manipulation of German silver is attended with some difficulties, the plates, which for the purpose of

preparing sheet must be obtained by casting, being strongly crystalline and readily cracking under the hammer.

Generally small plates about  $7\frac{3}{4}$  to 12 inches long,  $4\frac{3}{4}$  to  $7\frac{3}{4}$ inches wide, and  $\frac{1}{3}$  inch thick are prepared by casting. These plates are slightly rolled and hammered, being annealed after each mechanical manipulation. By this treatment they gradually lose the crystalline structure, and when this has entirely disappeared can be further worked with ease, and rolled and stamped into any desired form, most articles (spoons, forks, ets.) being prepared by the latter method. Like alloys of the precious metals, German silver has the property of retaining its metallic color and lustre on being brought in contact with air and water, and it is not affected even by dilute acids such as are frequently found in food (lactic acid, acetic acid, etc.).

Nickel alloys possessing strong electric properties are used in the manufacture of positive elements for thermo-electric piles, they being especially adapted for the purpose on account of their high melting point. A thermo-electric pile, one portion of which consists of a nickel alloy, can be heated to a strong red heat without fear of the alloy melting.

# German Silver or Argentan.

Alloys of nickel, copper and zinc are recognized in commerce under all sorts of names, but in order to avoid confusion we will retain the term German silver or argentan, which is most in use. Factories which produce this alloy are found in almost all large cities, though Germany and England are the chief seats of the industry. The composition of the alloys used by the various factories differs considerably, as may be seen from the following figures :—

| Copper | • | • | • | • |   | • |   | • |   | • |   | • |   | • | • |   |   |   | 50 | to | 66 | parts. |
|--------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|----|----|----|--------|
| Zine   |   | • | • | • | • | • |   | • | • | • | • | • | • |   | • | • | • | • | 19 | "  | 31 | "      |
| Nickel | • | • | • | • |   | , | • | • | • | • | • | • | • | • | • | • | • | • | 13 | "  | 18 | "      |

For the fabrication of spoons, forks, cups, candle-sticks, etc., alloys consisting of copper 50 parts, nickel 25 and zinc 25 are most suitable, as they show a beautiful white blue color which does not tarnish.

German silver is sometimes so brittle that a spoon allowed to fall upon the floor will break, this fragility being due, of course, to an incorrect composition. It is impossible to give a definite composition for German silver, inasmuch as it varies according to the manipulation the article manufactured from the alloy is to undergo. The following table of analyses of different kinds of German silver shows how the qualities of the alloys change with the percentage of metals contained in them. Immaterial admixtures of foreign metals have been omitted in the compilation, only those belonging to the composition of the alloy being given :—

| German silver.                         |            | Parts.          |               | Quality.                                    |
|--|------------|-----------------|---------------|---|
|  | Copper.    | Zinc.           | Nickel.       |   |
| $\operatorname{English}_{\mathcal{U}}$ | 88         | 3.5<br>3.5      | $\frac{4}{6}$ | finest quality.<br>very beautiful, but very |
|  |            | 6.5             | 3             | refractory.<br>ordinary, readily fusible.   |
| German                                 | $52 \\ 59$ | $\frac{26}{30}$ | 22<br>11      | prime quality.                              |
| "                                      | 63         | 31              | 6             | third "                                     |

The following analyses give interesting particulars concerning various kinds of alloys for German silver :---

| German silver.             |          |  | Parts.  |          |       |
|----------------------------|----------|--|---|----------|-------|
|                            | Copper.  | Zinc.  | Nickel.                                       | Lead.    | Iron. |
| (                          | 50       | 31.3   | 18.7  |          |       |
| French for sheet {         | 50       | 30   | 20  | <u> </u> |       |
| (                          | 58.3     | 25   | 16.7  |          |       |
| (                          | 50       | 25   | 25  |          | —     |
| Vienna                     | 55.6     | 22   | 22  | -        |       |
| (                          | 60       | 20   | 20  |          |       |
| Berliu                     | 54       | 28   | 18  |          | —     |
| Derman                     | 55.5     | 29.1   | 17.5  |          | —     |
| ſ                          | 63.34    | 17.01  | 19.13   |          |       |
| English                    | 62.40    | 22.15  | 15.05   | -        |       |
| Dignon                     | 62.63    | 26.05  | 10.85   |          |       |
| Ļ                          | 57.40    | 25   | 13  |          | 3.00  |
|                            | 26.3     | 36.8   | 36.8  |          | —     |
| Chinese                    | 43.8     | 40.6   | 15.6  |          |       |
|                            | 45.7     | 36.9   | 17.9  |          |       |
| Ļ                          | 40.4     | 25.4   | 31.6  |          | 2.60  |
|                            | 48.5     | 24.3   | 24.3  | 2.9      |       |
| T ('                       | 54.5     | 21.8   | 21.8  | 1.9      | 1     |
| For casting $\ldots$       | 58.3     | 19.4   | 19.4  | 2.9      |       |
|                            | 57.8     | 27.1   | 14.3  | 0.8      |       |
|                            | 57.0     | 20.0   | 20.0  | 3.0      |       |
| Sheffield-                 | 50.00    | 07 00  | 11.00   |          |       |
| Common (yellow)            | 59.30    | 25.90  | 14.80   |          | _     |
| Silver-white.              | 55.20    | 24.10  | 20.70   | _        |       |
| Electrum (bluish)          | 51.60    | 22.60  | 25.80   |          |       |
| Hard (can be worked cold). | 45.70    | 20.00  | 31.30   |          |       |
| Fricke's-                  | 55 50    | 20.00  | 5 50  |          |       |
| Bluish-yellow (hard)       | 55.50    | 39.00  | 5.50  |          | _     |
| Pale yellow (ductile)      | 62.50    | $\begin{array}{c} 31.20\\ 18.80 \end{array}$ | $\begin{vmatrix} 6.30 \\ 31.20 \end{vmatrix}$ |          |       |
| Silvery (hard)             | -50.00 v |  | 10.00   |          |       |
| ( (harder)                 | 59.00    | 30.00  |   | _        | -     |
| Common formula             | 55.00    | 25.00  | 20.00   |          |       |

Many varieties of German silver contain different quantities of iron, manganese, tin, or very frequently lead to change the qualities of the alloy or to cheapen it. All these additions, however, exert rather an injurious than beneficial influence, and especially lessen the power of resistance against the action of dilute acids, which is one of the most valuable properties of this alloy.

An addition of lead makes German silver more fusible; one of tin acts in a certain sense as in bronze, making the alloy

denser and more sonorous, and causing it to take a better polish. An addition of iron or manganese increases the white color of the alloy, but it becomes at the same time more refractory and inclines towards brittleness.

Substitutes for German Silver.—There are a number of directions for the preparation of alloys to be used as substitutes for German silver, but none of them has succeeded in entirely replacing the latter, a proof that it possesses advantages not belonging to the others.

*Nickel-bronze.*—This alloy is prepared by fusing highly purified (99.5 per cent.) nickel with copper, tin and zinc, so that the resulting bronze contains 20 per cent. nickel. It is of a light color and possesses great strength.

According to Garnier, nickel containing phosphorus alloyed with copper, zinc and iron gave better results than such alloys without copper.

Bismuth-bronze.—-Webster's bismuth-bronze is made of various proportions. According to the statement of its discoverer its composition and qualities are as follows: For a hard alloy take 1 part of bismuth and 16 of tin, both by weight, and, having melted them, mix them thoroughly. For a hard bismuth-bronze take 69 parts of copper, 21 of spelter, 9 of nickel, and 1 of the above hard alloy of bismuth and tin. This bismuth-bronze is a hard, tough, sonorous, metallic alloy, which is proposed for use in the manufacture of screw propeller blades, shafts, tubes, and other appliances employed partially or constantly in sea-water. In consequence of its toughness it is thought to be well suited for telegraph wires and similar purposes where much stress is borne by the wires. From its sonorous quality it is well adapted for piano wires. For domestic utensils and articles exposed to atmospheric in-

fluences use bismuth 1 part, aluminium 1, and tin 15, melted together to form the separate or preliminary alloy, which is added in the proportion of 1 per cent. to the abovedescribed alloy of copper, spelter, and nickel. This bronze forms a bright and hard alloy suited for the manufacture of utensils or articles exposed to oxidation.

Manganese-German Silver.—As a substitute for German silver, Boucelin and Ponsard recommend an alloy of copper 60, zinc 15 and ferro-manganese with 70 to 80 per cent. manganese 40. For bearings, cocks and valves: Copper 60, zinc 10 and ferro-manganese with 60 per cent. manganese 40. According to Ledebur, the collection of the Freiberg School of Mines contains a moderately ductile sheet of a pale yellow color composed of copper 60.95, manganese 7.95, zinc 29.93 and iron 1.13, and another sheet of a paler, but still perceptible yellow color, composed of copper 63,16, manganese 4.48, zinc 26.11, iron 0.74, and nickel 3.67.

The following composition is recommended as being readily cast, and hence very suitable for articles of art :

| Copper            |      |   |    |   |    | • | •  | •  |    |    | •             | • |     |               | • | • | • | • | • |   | • |   | 52.1     | to  | 50 |
|-------------------|------|---|----|---|----|---|----|----|----|----|---------------|---|-----|---------------|---|---|---|---|---|---|---|---|----------|-----|----|
| Nickel            |      | • | •  | • |    |   |    |    |    |    |               |   | •   | •             | • |   | • |   | • |   |   | • | 17       | "   | 15 |
| Zinc .            |      |   |    | • |    | • |    |    |    |    | •             |   | •   | •             |   |   |   |   | • | • | • | • | <b>5</b> | "   | 10 |
| Mangar            | iese | • | •  |   |    | • | •  |    |    | •  | •             | • |     | •             |   |   | • |   | • | • |   | • | 1        | " ( | 5  |
| $\mathbf{Phosph}$ | oru  | 3 |    | • | •  |   |    | •  |    |    | •             | • | •   | •             |   | • | • | • | • | • |   | • | —        |     |    |
| Copper            | wit  | h | 15 | p | er | c | en | t. | pl | ho | $\mathbf{sp}$ | h | ori | $\mathbf{1S}$ | • | • | • | • | • |   |   |   | 3        | "   | 5  |

*Aphtit.*—The alloy known by this name is composed of: Iron 66, nickel 23, tungsten 4, copper 5.

Arguzoid.—Copper 55.78, zinc 23.198, nickel 13.046, tin 4.035, lead 3.544. This alloy is silver-white, almost ductile, and suitable for articles of art.

Ferro-German silver prepared by the Société anonyme Le

. *Ferro-Nickel* of Paris consists of iron, nickel and copper with or without zinc.

A silver-like alloy, which can be worked like German silver, is composed of copper, 70; nickel, 20; zinc,  $5\frac{1}{2}$ ; cadmium,  $4\frac{1}{2}$ .

Platinoid.—This alloy, invented by H. Martino, is a kind of German silver with an addition of 1 to 2 per cent. of tungsten. The latter, in the form of phosphor-tungsten, is first melted together with a certain quantity of copper, the nickel is next added, then the zinc, and finally the remainder of copper. In order to remove the phosphorus and a portion of the tungsten, both of which separate as dross, the resulting compound is several times remelted. Finally an alloy of a beautiful white color is obtained, which, when polished, closely resembles silver, and retains its lustre for a long time. Platinoid has the properties of German silver in a pre-eminent degree. It shows great resistance, which changes but little with the temperature, and is about 11 times greater than that of German silver. To determine the dependence of the resistance on the temperature, platinoid wire was wound upon a bobbin provided with a thread, and uniformly heated in an oil-bath. The experiments gave the following table, in which the resistance at  $0^{\circ}$  C. is placed = 1.

| Temperature.  | Resistance.  | Temperature.   | Resistance.  |
|---|--|--|--|
| $\begin{array}{c ccccccccccccccccccccccccccccccccccc$ | $\begin{array}{c} 1.0000\\ 1.0024\\ 1.0044\\ 1.0066\\ 1.0075\\ 1.0097 \end{array}$ | $\begin{array}{cccccccccccccccccccccccccccccccccccc$ | $\begin{array}{c} 1.0126\\ 1.0134\\ 1.0166\\ 1.0188\\ 1.0209\end{array}$ |

This shows an average increase of resistance of 0.0209 for 1° C. between 0° and 100° C.; another experiment with wire gave an average of 0.022 for 1° C. According to experiments

by Matthiessen and the more recent ones by Erno, the increase in the resistance of copper is 0.38 per cent., and of German silver 0.044 per cent. Hence platinoid is in this respect far superior to other wire in use.

Manganin. Copper, 83; nickel, 4; manganese, 13.

*Dienett's German silver*. This alloy is said to possess a beautiful white color and the density and toughness of tombac. It is composed of copper, 4, zinc, 2.5, lead, 0.75, nickel, 0.5 and tin, 0.125.

Pirsch's patented German silver is composed of

|         |         |         |       | Anti- | Alumin- |       |
|---------|---------|---------|-------|-------|---------|-------|
| Copper. | Nickel. | Cobalt. | Zinc. | mony. | ium.    | Iron. |
| 79.50   | 16.00   | 1.00    | 1.00  | 1.00  | 0.50    | 1.00  |
| 75.00   | 16.00   | 2.00    | 2.25  | 2.75  | 0.50    | 1.50  |
| 71.00   | 16.50   | 1.25    | 7.50  | 2.50  |         | 1.25  |

Alfénide, Argiroide, and allied alloys.—The alloys brought into commerce under these and many other names consist in most cases of a mixture of metals closely resembling German silver, but they are always electro-plated with pure silver, the thickness of the plating depending on the price of the respective articles. In many cases the composition used in the manufacture of these articles is a very ordinary quality or German silver, which by itself would present a mean appearance, but is hid from the buyer by the silver plating.

In recent times alloys have been frequently recommended which differ from the actual nickel alloys as represented by German silver in containing tin and aluminium, which makes them more fusible and more easily worked than German silver. Thus far these alloys have not been generally introduced in practice, and besides they are dearer than German silver.

According to Rochet, alfénide is composed of 59.1 parts of copper, 30.2 of zinc, 9.7 of nickel, and 1.0 of iron. According to this, it is actually nothing but an ordinary quality of Ger-

man silver. It is said to be well adapted for electro-silvering plating spoons, forks, and other articles with a smooth surface, but it does not succeed so well for decorated pieces.

*Toucas's alloy* is composed of copper 5 parts, nickel 4, antimony, tin, lead, zinc, and iron, of each 1. The metals are melted together in a crucible. This alloy has the advantage of being complex, if it does not possess other qualities than similar compounds. According to the inventor, it has nearly the color of silver, may be worked like it, and is laminated by the ordinary processes. It is resisting, malleable, susceptible of a fine polish, with a lustre of platinum, and can be perfectly silvered. For objects which are to be spun, hammered, or chased, the above alloy is very convenient, but for cast and adjusted pieces it is preferable to increase the proportion of zinc in order to increase the fluidity of the metal. This compound is employed for ornaments, jewelry, etc.

According to Trabuk, of Nimes, a beautiful white alloy, which resists the action of vegetable acids, and may serve as a substitute for German silver, is obtained by melting together 875 parts of tin, 55 of nickel, 50 of antimony, and 20 of bismuth. Into a crucible of suitable size introduce first  $\frac{1}{3}$  of the tin and all the nickel, antimony and bismuth, and after covering these metals with the sccond third of tin, cover the whole with a layer of charcoal powder to prevent oxidation. The lid is then placed upon the crucible and the latter heated to a bright red heat. After ascertaining by stirring with a red hot iron rod that all the nickel is fused, the last third of tin is added, without, however, removing the layer of charcoal. The mass is then stirred until it is perfectly homogeneous, and cast into ingots.

The annexed table gives a number of nickel alloys arranged according to their compositions.

| the second  |         |       |               |       |       |      |         | and the second |
|--|---------|-------|---------------|-------|-------|------|---------|----------------|
|  | Copper. | Zine. | Nickel. Lead. | Lead. | Iron. | Tin. | Silver. | Cobalt.        |
| I. Copper, zine and nickel.  |         |       |               |       |       |      |         |                |
| French Maillechort, according to Levoir.   | 65      | 50    | <u>د</u>      | 1     |       |      |         |                |
| French Maillechort, according to Levoir.   | 38      | 200   | 00            | !     |       | !    |         | 1              |
| French Maillechort, according to Levoir.   | 89      | 12    | 16            |       |       |      |         |                |
| French Maillechort, according to Levoir.   | 55      | 15    | 80            | ]     | l     | I    |         | 1              |
| French German silver, according to<br>d'Arcet  | 50      | 30    | 20            |       | l     | I    | 1       |                |
| French German silver, according to<br>Chaval   | 58.3    | 25    | 16.7          |       | i     |      | I       |                |
| iam German s   |         | ì     |               |       |       |      |         |                |
| Ware   | 62.40   | 22.15 | 15.05         |       |       |      | ł       |                |
| Sheffield German silver, very elastic  | 57.40   | 25.00 | 13.00         | l     | 00    | ]    | I       |                |
| Vienna German suver:<br>Copper 2, zine 1, nickel 1, for forks  |         |       |               |       |       |      |         |                |
| hard and does not very write, but<br>hard and does not tarnish   | 50      | 25    | 25            | I     | I     | ł    | ]       | I              |
| Copplet 9, zine 2, meter 2, 107 tories and<br>Ruives 7, resembles silver 0.750 fine .<br>Cooner 3, zine 1, meted 1, meanillas  | 55.6    | 22.2  | 22.2          | 1     |       | 1    | ]       | 1              |
| silver 0.750 fine; readily rolled and  |         |       |               |       |       |      |         |                |
| worked   | 09      | 20    | 60<br>00      | 1     |       |      |         | I              |
| Spoon metal, according to Schubarth  | 50.00   | 31.25 | 18.75         | ]     |       | ]    |         |                |
| packroug   | 40.6    | 43.7  | 15.6          |       | I     | ļ    | I       |                |
| Bolley.  | 54.0    | 28.0  | 18.0          | I     | ]     |      | 1       |                |
| Frick. Friek according to  | 55.5    | 29.1  | 17.5          |       | ]     | I    | I       |                |
| A MULTING AND A MU |         |       |               |       |       |      |         | 1              |

Analyses of Nickel Alloys.

|                                    | Cobalt. | 1  | I                                      | ] ]   |            | 1  | 1    |   |  |  |            | I  | -        |
|------------------------------------|---------|--|--|---|------------|--|------|---|--|--|------------|--|----------|
|                                    | Silver. | I  | [                                      | 1 ]   |            | ł  | I    |   | 111  |  | ľ I        | I  |          |
|                                    | Tin.    | I  | 1                                      | ] ]   |            | ł  |      |   |  |  | ] [        | I  | 1        |
|                                    | Iron.   | 1  | I                                      | Ē   |            | ł  | I    |   |  | 0  | 9.4<br>9.4 | 1.0  | 2.6      |
| ntinued.                           | Lead.   |  | I                                      | ] ]   |            | 2.9  | 1.9  | 2.9<br>0.8  |  |  |            |  | 1        |
| Analyses of Nickel-AlloysContinued | Nickel. | 10   | 36.8                                   | $\frac{17.4}{6}$  |            | 24.3   | 21.8 | 19.4<br>14.3  | $   \begin{array}{c}     20 \\     19.8 \\     13.05   \end{array} $ | 0.61   | 16.8       | 9.7  | 31.6     |
| Nickel-A                           | Zine.   | 30 ,   | 36.8                                   | 36.9<br>6   |            | 24.3   | 21.8 | $19.4 \\ 27.1$  | $20_{5.5}^{20}$  | 02.0   | 13.4       | 30.2   | 25.1     |
| alyses of                          | Copper. | 59   | 26.3                                   | $\frac{45.7}{10}$   |            | 48.5   | 54.5 | 58.3<br>57.8  | 57<br>69.8<br>79.7   | t<br>t   | 65.4       | 59.1   | 40.4     |
| uF                                 |         | Alfénide, according to Bolley.<br>Chinese German silver very ductile and | Chinese tutenag for casting, very fus- | ible, of a beautiful white color, but<br>hard and difficult to roll | ver, zinc, | For castings, copper 2, zinc 1, nickel 1,<br>lead 0.12 |      | 20, lead 3. Coppet vo, 201, 10, 20, 110, 20, 110, 20, 120, 200, 120, 12 | Gensdorff  | 111. Copper, zinc, nickel, iron.<br>English German silver, very elastic, ac- |            | Allende for tableware, according to<br>Rochet. | to Fyfe. |

284

•

THE METALLIC ALLOYS.

| Cobalt.       | 0.42   |  | ŝĩ                        | I  |  | I   | I             | 11                  |   | 1                                 |              | I            | 1                                 | 1            |
|---------------|--|--|---------------------------|--|--|---|---------------|---------------------|---|-----------------------------------|--------------|--------------|-----------------------------------|--------------|
| Silver.       | 0.02 Sb  |  | 0.50 Al                   | I  |  | I   | Ι             |                     |   | 38                                | 40           | 50<br>50     | 60<br>90<br>90                    | 40           |
| Tin.          | 0.12   |  | 2.75                      | 28.8   |  | 25  | 31.3          | 25<br>2.6<br>3.6    |   | 1                                 | ]            |              |                                   |              |
| Iron.         | $2 \\ 0.28$  |  | 1.50                      | I  |  |   | 1             |                     |   | ł                                 | I            | 1            | I                                 | 1            |
| Lead.         | 0.28   |  | 1                         | I  |  | 1   | I             |                     |   | 1                                 | I            | 1            | 1                                 |              |
| Nickel. Lead. | 22<br>16.27  |  | 16                        | 17.7   |  | 25  | 4.1           | $\frac{25}{31.6}$   |   | 25 to 30                          | 20 to 30     | 25 to 35     | 8.6                               | 4.6          |
| Zine.         | 23<br>23.31  |  | 2.25                      | I  |  | 1   | 1             | $\frac{-}{25.4}$    |   | I                                 | I            |              | 16.3                              | 10.8         |
| Copper.       | 53<br>59.23  |  | 75                        | 52.5   |  | 50  | 64.6          | $50 \\ 40.4$        |   | 37 to 42                          | 30 to 40     | 45 to 55     | 41.8                              | 44.6         |
|               | For articles to be soldered, white, hard,<br>brittle | IV. Copper, tin, nickel, with or wthout<br>zine. | Keene's silver-like alloy | Very surance for cascungs, copper 50, the<br>17, nickel 10<br>For bells and bearings, according to Fils- | ner; steel-like with a reddish tinge,<br>capable of taking a high polish, very<br>hard, slightly ductile, of a beautiful | sound, not attacked by sulphurgtted<br>hydrogen | 151, nickel 2 | cording to Winekler | V. Copper, nickel, silver (Ruolz alloys). | For rolling, pressing and drawing | For jewelry. | For casting. | For rolling, pressing and drawing | For jewelry. |

Analyses of Nickel-Alloys.-Continued.

NICKEL ALLOYS.

|  | Analyses of Nickel-Alloys.—Concluded. | Nickel-A                        | lloysCor                   | ncluded.          |                      |   |  |   |
|--|---------------------------------------|---------------------------------|----------------------------|-------------------|----------------------|---|--|---|
|  | Copper.                               | Zine.                           | Niekel. Lead. Iron.        | Lead.             | Iron.                | Tin.  | Silver.  | Cobalt.   |
| Silver-like alloy, according to Pirsch-<br>Baudoin<br>Luteein or Paris metal of Le Mat.  | 71<br>80                              | 1-10                            | 16.5<br>16                 | 1                 | $\frac{1.25}{5}$     | រភ្<br>តាំទា  |  | $\frac{1.75}{1}$                                      |
| German silver from Sheffield, copper 60,<br>nickel 20, zinc 20, iron 2, lead 3, very<br>white and brittle.                                     | 57.1                                  | 19.0                            | 19.0                       | 1.9               | ب<br>مى              |   | 1  | I   |
| yellow than German suver, somewhat more<br>yellow than German  | 60                                    | 17.8                            | 18.8                       | I                 | Ĩ                    | I   | I  | 3.4   |
| Silver's manganese 2   | $\frac{58}{71 	ext{ to } 79.5}$       | $\frac{21.7}{1 	ext{ to } 7.5}$ | 14.5<br>16 to 16.5         | $2.4 \mathrm{Mm}$ |                      | $\begin{array}{c c c} 0.6 & 1.2 \\ 1 \text{ to } 1.5 & 1 \text{ to } 2.75 \\ \end{array}$ | $\underset{\mathrm{Al0 to } 0.5}{\overset{1.2}{}}$ | $\begin{array}{c} 0.6 \\ 1 \text{ to } 2 \end{array}$ |
| Tarker's curonum auoy<br>Toucas's German silver.<br>China silver, according to Meurer<br>Chinese white copper, according to Levol<br>Minargent | 35.7<br>55.24<br>79.40<br>100         | $\frac{7.1}{19.52}$             | 28.6<br>13.0<br>16.2<br>70 | 7.1<br>7.1<br>    | 7.2<br>trace<br>4.58 | As 2  | Sb 7.1   |   |

## Manufacture of German Silver on a Large Scale.

In the manufacture of German silver, the purity of the metal used is of greater importance than in the preparation of any of the alloys previously described. The nickel found at present in commerce is generally sufficiently pure to be used without further preparation, the chief contamination being cobalt, which, as previously mentioned, exerts little influence upon the properties of the alloy. Copper is frequently contaminated with iron, lead, arsenic, and antimony, and, in such case, is only fit for the preparation of German silver of second or third quality. Zinc also contains certain contaminations injurious to the qualities of the alloy.

The manufacture of German silver is generally carried on according to two methods which, from the countries where they have been perfected, are termed respectively the *English* and the *German* process. Both yield German silver of excellent quality, and, as will be seen from the descriptions of the two methods, differ chiefly in the manner in which the various operations in melting down the alloys are executed.

German process.—The alloy is prepared as follows: The zinc and nickel to be used for a certain quantity of copper are divided into three equal portions. Now place upon the bottom of a graphite crucible, capable of holding at the utmost 22 pounds of the alloy, a layer of copper, upon this a layer of zinc and nickel, upon this again a layer of copper, and continue in this manner until all the copper is in the crucible, retaining, however, one-third each of the nickel and zinc.

The crucible is now covered with a layer of charcoal powder to prevent volatilization and oxidation of zinc, and the contents are melted down as quickly as possible in a wind-

furnace connected with a high chimney, quite a high temperature being required for the fusion of the alloy.

When the contents of the crucible are supposed to be liquefied, they are examined by dipping in an iron rod, and, if the whole is found to be thoroughly melted, an intimate mixture of the metals is effected by vigorous stirring with the rod.

The zinc and nickel retained are now added in portions to the melted contents of the crucible, the mass being vigorously stirred after each addition, and a sharp fire kept up to prevent the alloy from cooling off too much by the newly-introduced metals. After the introduction of the last portion, an additional piece of zinc is generally thrown into the crucible to compensate for the loss of zinc by volatilization, and besides experience has shown that a small excess of zinc renders the alloy more thinly-fluid, which materially facilitates the work in the subsequent casting. If the alloy is to be rolled out into thin sheets, it is recommended to keep the finished alloy liquid for some time longer before proceeding to casting. In doing this, however, it is necessary constantly to keep the surface of the melted metal covered with charcoal to prevent volatilization of zinc.

The casting of the alloy is effected in various ways. It is either at once cast into plates, which are subsequently rolled out into sheets, or into very thin sticks, which after cooling are remelted and finally cast into plates. On account of the greater consumption of fuel and labor, the last method is somewhat more expensive than direct casting, but it has the advantage of the alloy becoming more homogeneous by remelting, and besides it can be worked with greater ease. Only with the use of very pure metals is it advisable to cast the alloy at once into plates.

289

Considerable skill is required for casting the alloy, it being necessary to run it into the moulds at as high a temperature as possible and in an uninterrupted stream. An interruption of the stream can be at once detected by the fact that the plate is not uniform.

The moulds used in casting plates consist of two iron plates, one plain and the other with a ledge corresponding to the thickness of the plate to be cast, which varies from 0.50 to 0.59 inch. On account of the great contraction of the alloy in solidifying, the distance between the two plates must be somewhat greater. In order to obtain castings of greater homogeneousness, it is recommended to run the melted metals from below into the moulds. This is effected by providing the lower plate with a lip or mouth-piece, in which is placed a clay-funnel connected with a pipe rising somewhat above the mould. After the plates are tightly screwed together, the mould is highly heated and the casting proceeded with. The metal is heated as intensely as possible, and after being freed from all contaminations floating on the surface, is allowed to run in a steady, thin stream into the mould. When the metal appears on the upper end of the mould and the funnel remains filled, the casting is finished. After allowing the filled mould to stand quietly for about half an hour, the solidified plate is removed. To prevent the alloy from adhering to the sides of the mould, these are previously to casting coated with a layer of fine lamp-black. The principal difficulty in casting plates of German silver is to obtain them perfectly homogeneous and free from blow-holes, which is best effected by bringing the melted metal as hot as possible into the mould. On account of the difficulty of executing the casting so quickly that the contents of the crucible do not cool

off, it is recommended to fill only one mould at a time, and replace the crucible in the furnace in order to keep the contents at the highest temperature possible.

The plates of German silver thus obtained have to be carefully examined as to whether they are perfectly homogeneous. Imperfect plates must be thrown out and remelted. The perfect plates are rolled out into sheets from which the articles to be manufactured are punched out and then further worked.

English process.—The English method of preparing the alloy differs somewhat from the German, especially in the manner in which the metals are melted together, no portion of the zinc or nickel being retained, but the entire quantity of metal is melted at one time. Good graphite crucibles are used, which are placed in a furnace capable of producing a high temperature. The metals are used in the form of small pieces. The charge of each crucible generally consists of  $8\frac{1}{4}$ pounds of tin, 1 pound of zinc, and, according to the quality of the alloy to be produced, 2 to 3 pounds of nickel. The metals are intimately mixed and quickly introduced into the red-hot crucibles. Their surface is immediately covered with a thick layer of coal-dust and the mixture fused as quickly as possible. After ascertaining by stirring with an iron rod that the mass is liquefied, a previously prepared alloy of 1 part by weight of zinc and  $\frac{1}{2}$  part of copper is added, the quantity for the above charge ranging from  $1\frac{3}{5}$  and 2 pounds. When this alloy is melted and the entire contents of the crucible form a homogeneous whole, 2 pounds of zinc are finally added. The mass, being kept constantly covered with coal-dust, is now heated as strongly as possible, and when thinly fluid a sample is taken to test its qualities.

The alloy always contains a certain amount of oxide, and,

#### NICKEL ALLOYS.

if a large quantity of it is present, the casting will be badly blown. To ascertain how the alloy will act in casting, a test casting is made, and, if the fracture of this shows blow-holes, the oxides will have to be reduced. This is effected by throwing pitch into a stoneware pipe pushed through the contents of the crucible to the bottom. The products of dry distillation evolved from the pitch effect a reduction of the oxides, which is accelerated by stirring coal dust into the melted metal. When the reduction of oxides is supposed to be finished, a strong heat is given, and, after the coal mechanically mixed with the alloy has collected upon the surface, the purified metal is cast in a manner similar to that described under the German process. Instead of coating the moulds with lamp-black alone, many manufacturers use a mixture of lamp-black and oil of turpentine. Moulds thus treated must, however, be sharply dried to volatilize the oil of turpentine, as otherwise the vapors evolved from the oil of turpentine in casting might readily cause the formation of blow-holes.


The casting of the plates finishes the chemical portion of the process, and the perfect plates are mechanically worked in the same manner as indicated under the German process. Articles of German silver have to be soldered with a solder whose color approaches as nearly as possible that of the alloy. An excellent composition for this purpose is prepared by melting 5 to 6 parts of German silver together with 4 parts of zinc. It is, however, better directly to prepare the alloy which is to serve as solder by melting together copper 35 parts, zinc 57, and nickel 8.

The alloy is prepared in the same manner as German silver, and after being cast in thin plates pulverized while hot. If

#### THE METALLIC ALLOYS.

the alloy is too tough and can only be pulverized with difficulty, it contains too little zinc, while too great brittleness indicates too small a quantity of nickel. In both cases the alloy must be improved by remelting and adding the necessary quantity of the respective metals.

The alloys of German silver are principally used for the manufacture of tableware, as cups, dishes, forks, spoons, etc., but on account of their beautiful color and solidity, they are also used for articles of art, and are more and more substituted for genuine silver. For fine mechanical work German silver surpasses all other alloys, it having, besides considerable strength and power of resistance, the valuable property of not

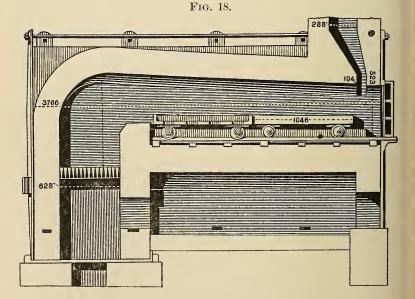


changing its appearance in contact with dry air, and of expanding but little on heating.

Manufacture of German silver sheet. The crystalline plates obtained by casting are very gradually reduced by rolling,

#### NICKEL ALLOYS.

they being between the rollings repeatedly heated to a cherrybrown heat in a heating furnace for direct firing, Figs. 18 and 19, or in a muffle furnace, Figs. 20 and 21, and allowed to cool completely, otherwise edge-cracks will be formed. After

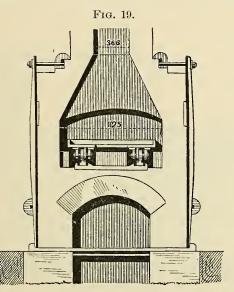


the destruction of the crystalline structure German silver can be worked like brass. Very thin sheet,  $\frac{1}{40}$  to  $\frac{1}{66}$  millimeter thick is called *German silver foil* or *packfong foil*.

The sheets resting upon a carriage with perforated bottom, running upon rails, are introduced into the heating furnace, Figs. 18 and 19, through an opening the entire width of the furnace which can be closed by a cast-iron door. When taken from the furnace the sheets are placed upon a carriage pushed close up to the furnace, the upper edge just level with the bottom of the hearth.

Muffle furnaces, Figs. 20 and 21, are a protection against the deposit of dust, and allow of slower heating, but their effect is less favorable on account of their yielding the heat with


greater difficulty. The cast iron muffle resting upon a firebrick arch is washed by the gases of combustion ascending from the grate through the flues a and b. The gases then pass into the chimney. The channels d serve for the introduction of air; c are the supports of the arch.

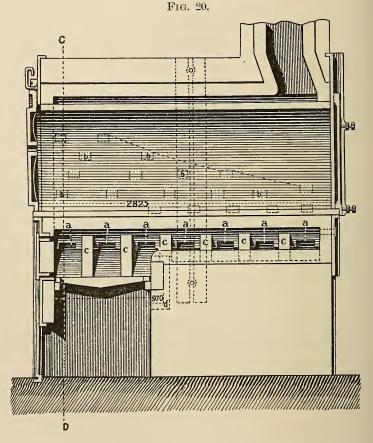

*Nickel-steel.* In 1889, M. Henry Schneider, of Creuzot, France, took out two patents for the manufacture of alloys of cast iron and nickel, and steel and nickel, respectively.\*

\* U. S. Patents 415,657 and 415,655, Nov. 19, 1889.

In the specifications of the first patent it is stated that it is very difficult to incorporate nickel with iron and steel, particularly when it is attempted to produce these alloys on a commercial scale. "To overcome this difficulty, a prelimi-

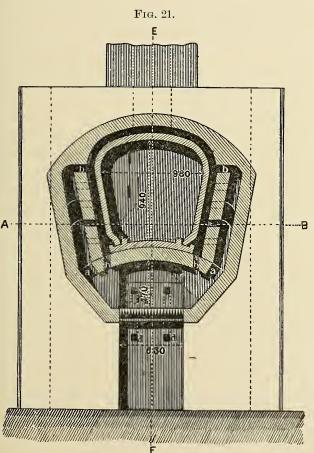

nary product is made of cast iron and nickel in a crucible, cupola, or open-hearth furnace. This product or alloy, while especially useful for the manufacture of iron and nickel and steel and nickel alloys, may be used as castings for a variety of purposes.

### THE METALLIC ALLOYS.

"In the manufacture of this alloy of cast-iron and nickel, a suitable furnace is charged with nickel scrap and ordinary cast or pig-iron, with carbonaceous matter; or the nickel may be in the form of nickelized compounds or coke. The operation is best carried on in a reverberatory furnace under a layer of anthracite, to avoid oxidation.

"The resulting alloy contains from five to thirty per cent. nickel, and is remarkable for its great elasticity and strength —properties which may be still further developed by chilling or tempering in the usual manner.

"This alloy of cast iron and nickel, containing (say) thirty per cent. of nickel, sixty-three per cent. of iron, three per cent. of carbon, and two of manganese and silicon, is then charged on the bed of an open-hearth furnace, with the iron or scrap used in the ordinary methods of making open-hearth steel, care being taken to protect the bath from oxidation by means of a layer of slag or cinder. A steel, containing about five per cent. of nickel, is thereby obtained. Precautions, however, must always be taken to prevent red-shortness in the metal before the final introduction of the recarbonizing and manganiferous silico-spiegel iron or ferro-manganese.

"Nickel steel of this kind, containing five per cent. of nickel, is especially adapted or suitable for use in the construction of ordnance, armor plate, gun-barrels, projectiles and other articles employed for military or other like purposes, or the manufacture of commercial sheets, bars, etc.

"The percentages of carbon, silicon and manganese can be regulated according to the degree of hardness required, but in all cases, in order to obtain the best results possible, the product must invariably be tempered in an oil or other bath."\*

\* U. S. Patent 415,655, Nov. 19, 1889.

#### NICKEL ALLOYS.

*Marbeau's nickelo-spiegel* is made by a patented process, which consists in the reduction of the ores of nickel, iron and manganese at the same time and in one operation. The following proportions are stated as affording good results.\*

An alloy of nickel and iron having thus been obtained, there appears to be but little difficulty in working this nickel iron into a nickel steel by means of an open-hearth furnace.

Riley states the alloy (nickel steel) can be made in any good open-hearth furnace, working at a fairly good heat.<sup>†</sup> No special arrangements are required for casting, the ordinary ladles and moulds being sufficient. If the charge is properly worked, nearly all the nickel will be found in the steel almost none is lost in the slag.

No extraordinary care is required when reheating the ingots for hammering or rolling. If the steel has been properly made, and is of correct composition, it will hammer and roll well, whether it contains little or much nickel. Riley ‡ appears to have obtained the best results with steel containing five per cent. nickel. With this grade rolled, but not annealed, he obtained elastic limit 69,664 pounds per square inch, tensile strength 116,480 pounds per square inch, with fourteen per cent. elongation in eight inches. When rolled and annealed, elastic limit 72,800 pounds per square inch,

\* Engineering and Mining Jour., Jan. 31, 1891.

† Journal of the Iron and Steel Institute, No. 1, 1889, p. 45. Journal of the Franklin Institute, May, 1890, p. 367.

‡ Ibid., p. 48.

tensile strength 104,832 pounds per square inch with thirteen and one-half per cent. elongation in eight inches.

Riley states that the whole series of nickel steels up to fifty per cent. nickel takes a good polish and finish. Steels rich in nickel are practically non-corrodible, and those poor in nickel are much better than other steels in this respect.

The alloys up to five per cent. of nickel can be machined with moderate ease, beyond that they are more difficult to machine.

The one per cent. nickel steel welds fairly well, but this quality deteriorates with each addition of nickel.

The tests of some of the nickel steel made by Carnegie, Phipps & Co., Pittsburg, for the U. S. Navy Department, gave the following results: Elastic limit (two specimens) 59,000 and 60,000 lbs. per square inch, ultimate tensile strength, 100,000 and 102,000 lbs. per square inch; elongation,  $15\frac{1}{2}$  per cent., and reduction of area at fracture,  $29\frac{1}{2}$  and  $26\frac{1}{2}$  per cent. The test pieces were cut  $\frac{3}{4}$  inch plate. The chemical analysis gave a content of  $\frac{3}{16}$  per cent. nickel.\*

The conductivity of nickel steel is extremely poor and low, but the resistance very high. According to Hopkinson, nickel steel containing less than 5 per cent. nickel is decidedly more magnetizable than wrought iron, particularly for high inductions. On the other hand, when containing 25 per cent. nickel, it is non-magnetic. But if cooled to  $-4^{\circ}$  F. it becomes very decidedly magnetic and remains so when it again returns to its normal condition. If, finally, it is heated until it reaches its critical temperature, 1076° F., it becomes again non-magnetic and remains so until cooled to  $-4^{\circ}$  F.<sup>†</sup>

\* Engineering and Mining Journal, Dec. 13, 1890.

† F. Lynwood Garrison, Journal Franklin Inst., September, 1891.

# CHAPTER IX.

# ALLOYS OF TIN, WITH LITTLE COPPER AND ADDITIONS OF ANTIMONY, ETC.

TIN by itself is a very soft metal, and in a pure state finds but little application in the industries, but in the form of alloys its use is constantly increasing. These alloys show different properties according to the metals with which the tin is combined, and form one of the most important and valuable groups, as they include metal for bearings, type-metal, Britannia metal, etc.

The tin alloys most frequently used contain copper, zinc, or antimony; others less frequently employed contain iron or lead, and some for special purposes, bismuth.

The effect produced by the different metals upon the properties of the tin varies very much, but, generally speaking, it may be said, that the melting point is raised, while the great ductility of the tin is decreased, but its hardness and resisting power are very much increased.

An addition of copper makes the tin considerably harder, the properties of the alloys thus formed approaching those of genuine bronze. Alloys containing, besides tin and copper, certain quantities of zinc, possess the same constituents as brass, and it depends on the quantity of the metals whether the properties of the alloy actually approach those of brass, or whether they have a more bronze-like character.

Antimony possessing the special property of hardening soft metals, the tin and antimony alloys always show a certain de-(299)

### THE METALLIC ALLOYS.

gree of hardness, but unfortunately become also so brittle that they can only be used for castings, as stretching them under the hammer or by rolling is very difficult and frequently impossible.

Alloys of tin and lead were formerly much used in the manufacture of pots, dishes, plates, etc., but at the present time their application is limited. Alloys of tin with bismuth and other metals are distinguished by a very low melting point, frequently below the boiling point of water; such alloys are only used for special purposes.

The most important alloys of tin are those known as white metal and Britannia metal. In a certain sense a few other alloys might be classed among the tin alloys, but as the other metals are present in a preponderating quantity, it seems more suitable to discuss them under the name of the metal present in largest quantity, or which at least imparts to the alloy its characteristic properties.

# White Metals. Bearing Metals.

The so-called white metals contain varying quantities of tin, copper and antimony. Sometimes the latter is replaced by zinc, the composition in this case approaching more or less that of statuary bronze. A simultaneous use of zinc and antimony occurs but seldom; there are further some alloys which contain iron or lead besides the mentioned metals. A combination of many metals to one and the same alloy does not seem especially practicable, since our knowledge of the alloys has scarcely reached such a point as to enable us to determine with absolute certainty how three metals in various proportions of mixture behave towards each other, and we are still less able to state with accuracy the behavior of alloys in

the preparation of which four, five, or even six metals are used. Besides practical experience has shown such alloys to be frequently of no value, and are simply recommended by some persons in order to make a market for a new product.

The so-called white metals serve almost exclusively for bearings, some compositions used for the same purpose having been already given on page 235 *et seq.* In mechanics a very exact line is drawn between the various kinds of bearings, and they can be chiefly divided into two large groups : redbrass bearings and white-metal bearings. The red-brass bearings are distinguished by great hardness and power of resistance, and are principally used for bearings of heavily-loaded and rapidly-revolving axles. For bearings of axles of large, heavy fly-wheels revolving at great speed bearings of red brass are also preferable to white metal, though they are more expensive.

White metals are cheaper than red-brass alloys, and have a lower melting point, so that a worn-out bearing can be readily remelted and replaced by a new one, while with red brass these operations are connected with much more trouble and expense. White-metal bearings possess still another property which makes them almost indispensable for certain purposes. If, for instance, the shaft resting in the bearing does not run perfectly quiet, the consequence of the use of a red-brass bearing will be that either the axle or the bearing, according to whether the one is harder than the other, is subjected to great wear, and this will in a short time increase to such an extent that the axle in revolving will swerve considerably. By using, however, for these purposes white-metal bearings of a sufficient degree of softness, the harder axle by pressing into the softer bearing runs more quietly for a longer time than if the latter consists of red-brass. The bearing, of course, wears out as quickly, but this is of little importance, since the expense of replacing it is comparatively small.

White-metal bearings contain a preponderating quantity of tin; the degree of hardness of such alloys depends chiefly on the content of copper, those containing certain quantities of it being, as a rule, the strongest and most capable of resistance. The tin can, however, be also considerably hardened by the use of antimony, and such bearings are frequently used at the present time, they being much cheaper than those containing copper, though they are not so strong and generally quite brittle, so that they frequently break.

In the annexed table will be found the compositions of the more frequently used compounds for bearings. From the many receipts given, those have been selected which differ in regard to hardness and wear. As will be seen, iron is only used in rare cases, and the compositions containing lead find but little application, experience having shown that the strength of the alloy is considerably decreased by an addition of lead,

In modern times bearings of soft metal are frequently replaced by such as consist of a metal whose hardness is almost equal to that of which the axle is made, phosphor-bronze being often used for this purpose, as it can be readily obtained so hard as to equal in that respect an axle of wrought or caststeel. The metal is then used in a very thin layer, and serves, so to say, to fill out the small interspaces formed by wear on the axle and bearing, the latter consisting simply of an alloy of tin and lead. Such bearings, though very durable, are rather expensive, and can only be used for large machines. For small machines bearings of white metal are

generally preferred, and, if the axles are not too heavily loaded, do excellent service.

|   | Parts.  |   |                     |       |  |   |
|---|---|---|---------------------|-------|--|---|
|   | Tin.  | Anti-<br>mony.  | Zinc.               | Iron. | Lead.                                    | Copper.                                 |
| German, for light loads,<br>""""""""""""""""""""""""""""""""""""                  | $\begin{array}{c} 85\\ 82\\ 80\\ 76\\ 3\\ 90\\ 86.81\\ 17.47\\ 76.7\\ 72.0\\ 15\\\\ 72.7\\ 38\end{array}$ | $\begin{array}{c} 10\\11\\12\\17\\1\\8\\7.62\\\hline \\15.5\\26.0\\\hline \\1\\1\\18.2\\6\\\end{array}$ | $ \begin{array}{c}$ |       | $ \begin{array}{c}    $                  | 5787125.575.627.82.08-9.11              |
| For rapidly revolving<br>axles.   | 17  | 77  | -                   | _     | -  | 6                                       |
| Bearings of great hard-<br>ness   | 5   |   | _                   | 70    | _  | 2.5                                     |
| Bearings of great hard-<br>ness   | $\begin{array}{c} 12\\ 2\\ 1.5 \end{array}$   | $\begin{array}{c} 82\\ 2\\ 1.5 \end{array}$   |                     | _     |  | $\begin{array}{c} 4\\ 8\\ 7\end{array}$ |
| For railroads—<br>Prussia   | 91<br>85<br>80  | $\begin{array}{c} 6\\ 10\\ 12 \end{array}$  | ~                   | -     |  | 3<br>5<br>8                             |
| under the heaviest pressure   | 86.81   | 7.62  | _                   |       |  | 5.57                                    |
| Bavaria, durable cold<br>running  | 90  | 8   | _                   |       |  | 2                                       |
| Austria government rail-<br>road<br>Distributing slide valves.                    | $\begin{array}{c} 90\\ 83.2 \end{array}$  | $7\\11.2$   | -                   | _     |  | $\frac{3}{5.6}$                         |
| Railroad cars and larger<br>machines<br>Railroad cars, harder {<br>and stronger { | 20  | $     \begin{array}{c}       16 \\       20 \\       12     \end{array} $                               |                     |       | $\begin{array}{c} 84\\60\\80\end{array}$ | -                                       |

White metals for bearings.

Babbitt's anti-attrition metal is made by melting separately

4 parts of copper, 12 of Banca tin, 8 of regulus of antimony, and adding 12 parts of tin after fusion. The antimony is added to the first portion of tin, and the copper is introduced after taking the melting pot away from the fire and before pouring into the mould. The charge is kept from oxidation by a surface coating of powdered charcoal. The "lining metal" consists of this "hardening" fused with twice its weight of tin, thus making 3.7 parts copper, 7.4 parts antimony, and 88.9 tin. The bearing to be lined is cast with a shallow recess to receive the Babbitt metal. The portion to be tinned is washed with alcohol and powdered with sal ammoniac, and those surfaces which are not to receive the lining metal are to be covered with a clay wash. It is then warmed sufficiently to volatilize a part of the sal ammoniac and tinned. The lining is next cast in between a former, which takes the place of the journal, and the bearing.

Founders often prefer to melt the copper first in a plumbago crucible, then to dry the zinc carefully, and immerse the whole in the barely fluid copper.

A small percentage of aluminium added to Babbitt metal gives very superior results over the ordinary Babbitt metal. It has been found that the influence of the aluminium upon the ordinary tin-antimony-copper Babbitt is to very considerably increase the durability and wearing properties of the alloy.

The following Babbitt metal (plus aluminium) has been patented by Alexander W. Cadman (U. S. patent 464,147, December 1, 1891): Antimony 7.3 parts, tin 89, copper 3.7, with from  $\frac{1}{4}$  to 2.5 parts aluminium.

*Kingston's metal*, formerly much used for bearings, is made by melting 9 parts of copper with 24 of tin, remelting, and adding 108 parts of tin, and finally 9 of mercury. Fenton's alloy for axle-boxes for locomotives and wagons consists of zinc 80 parts, copper  $5\frac{1}{2}$ , tin  $14\frac{1}{2}$ . This alloy may be recommended as regards cheapness and lightness. Experiments have shown that boxes of this alloy require but half as much oil for lubricating as others. The components can be melted in an ordinary iron pot, and the alloy is less difficult to work than brass.

Dewrance's patent bearing for locomotives consists of copper 4 parts, tin 6, antimony 8. A locomotive of the Liverpool-Manchester railroad ran over 4500 miles without the bearing requiring repair.

Alloy for anti-friction brasses.—Zinc 80 parts, tin 14, copper 5, nickel 1.

Alloy for metal stopcocks which deposits no verdigris.—Zinc 72 parts, tin 21, copper 7.

English white metal.—Tin 53 parts, lead 33, copper 2.4, zinc 1, antimony 10.6. The specific gravity of this alloy is 7.22 and it melts at 290° F.

A composition of white metal for machines recommended by Jacoby consists of copper 5 parts, tin 85, and antimony 10.

Hoyle's patent alloy for pivot bearings consists of tin 24 parts, lead 22, and antimony 6. It is claimed to stand friction without heating longer than any other composition.

In the factory of H. Roose, of Breslau, the following alloys are used for white metal bearings—

|          | Parts. |     |      |     |
|----------|--------|-----|------|-----|
|          | í.     | 11. | 111. | IV. |
| Tin      | 18     | 18  | -    | —   |
| Lead     | 3      | _   | 8    | 8   |
| Copper   | 1      | 1   | 1    | —   |
| Antimony |        | 3   | 1    | 1   |
| 20       |        |     |      |     |

C. B. Dudley, during his more than fifteen years' experience in the laboratory of the Pennsylvania Railroad Company, has analyzed many bearing metals under various names. Some of these analyses are given as follows :\*

Camelia metal.—Copper 70.20 per cent., tin 4.25, lead 14.75, zinc 10.20, iron 0.55.

Anti-friction metal.—Tin 98.13, copper 1.60, iron, trace.

White metal.—Lead 87.92, antimony, by difference, 12.08.

Metal for lining car brasses.—Lead 84.87, antimony 15.10, tin, trace.

Salgee anti-friction metal.—Zinc 85.57, tin 9.91, copper 4.01, lead 1.15.

Graphite bearing metal.—Lead 67.73, tin 14.38, antimony 16.73, iron not determined, graphite, none.

Carbon bronze.—Copper 75.47, tin 9.72, lead 14.57, carbon, possible trace.

Cornish bronze.—Copper 77.83, tin 9.60, lead 12.40, zinc, traces of iron, phosphorus.

Magnolia metal.—Lead 83.55, antimony, by difference, 16.45, traces of iron, copper, zinc, and possibly bismuth.

American anti-friction metal.—Lead 78.44, antimony 19.60, zinc 0.98, iron 0.65.

*Tobin bronze.*—Copper 59.00, zinc 38.40, tin 2.16, iron 0.11, lead 0.31.

Graney bronze.—Copper 75.80, lead 15.06, tin 9.20.

Damascus bronze.—Copper 76.41, tin 10.60, lead 12.52.

Manganese bronze.-Copper 90.52, tin 9.58, manganese, none.

Ajax metal.—Copper 81.24, tin 10.98, lead 7.27, phosphorus or arsenic 0.37.

Anti-friction metal.—Lead 88.32, antimony 11.93.

\* Jour. Franklin Institute, February, 1892.

*Harrington bronze.*—Copper 55.73, zinc 42.67, tin 0.97, iron 0.68.

Car-box metal.—Lead 84.33, antimony 14.38, iron 0.61, zinc, trace.

*Ex. B. metal.*—Copper 76.80, tin 8.00, lead 15.00, phosphorus 0.20.

Dudley's investigations finally resulted in finding an alloy which wears 13 per cent. more slowly than phosphor bronze. This alloy consists of copper 76.80, tin 8.00, lead 15. To obtain uniform castings 0.20 per cent. phosphorus is add^d, the alloy being prepared according to the following formula : Copper 105 lbs., phosphor bronze, new or broken, 60 lbs., tin  $9\frac{3}{4}$  lbs., lead  $25\frac{1}{4}$  lbs.

The resulting alloy is the above-mentioned Ex. B metal of the Pennsylvania Railroad Company.

## CHAPTER X.

### ALLOYS OF COPPER WITH OTHER METALS.

In the preceding chapters the alloys of copper have been described which on account of their easy preparation and the abundance of the metals which are combined with the copper are in general use. There are, however, a number of other copper-alloys which, though at present seldom employed, possess properties deserving attention.

Copper-arsenic alloys. Arsenic imparts to copper a very beautiful white color and great hardness and brittleness. Before German silver was known these alloys known as white copper, white tombac, argent haché, Chinese pétong, etc., were sometimes used for the manufacture of cast articles which were not to come in contact with iron. On exposure to the air these alloys, however, retain their white color for a short time only and acquire a brownish tinge. On account of this, as well as the poisonous character of arsenic and the difficulty of working them, these alloys are very little used at the present time.

A white, brittle, lustrous alloy capable of taking a high polish is obtained by pressing a mixture of 70 parts copper in the form of fine shavings and 30 of white arsenic into a crucible and melting the mixture under a surface coat of glass in a furnace of good draught. Or by melting copper with white arsenic and black flux, or by melting 16 parts copper and 1 part calcium arsenate under a cover of borax, coal dust and glass powder.

(308)

### ALLOYS OF COPPER WITH OTHER METALS.

Copper-lead alloys. An addition of lead to copper renders it softer and more ductile. Alloys of copper and lead are subject to separation or liquation, the lead separating out and leaving the copper in a porous mass, especially if the alloy is not quickly solidified. In preparing the alloys the copper is melted down under a cover of charcoal dust, the fire is then made as hot as possible and the lead quickly introduced into the overheated copper. As soon as all is melted, stir several times with an iron rod to make the alloy homogeneous and quickly pour the liquid mass into cold metallic moulds. On account of the above-mentioned liquation it is difficult to obtain faultless large castings of these alloys, and hence they are cast into thin plates, which are subsequently rolled out into The alloy forms a metal of gray color, brittle, and of sheets. feeble affinity. An alloy of copper 4 parts and lead 1 is sometimes used for large type.

For sheets and plates requiring no great durability, Guettier recommends an alloy of equal parts lead and copper. For hard solder Domingo recommends an alloy of copper 15.16 per cent. and lead 20.

Copper-iron alloys. In ancient times such alloys in the form of black copper appear to have\_been employed for castings. A statue of Buddha from Hindostan, about 3500 years old contains, according to Forbes, 91.502 copper, 7.591 iron, 0.021 silver, 0.005 gold, 0.079 arsenic, 0.510 sulphur, 0.292 insoluble matter, and traces of nickel and manganese. An alloy of copper 2 and iron 1 possesses great strength, which decreases with the increase in iron, while the hardness increases. An addition of 3 to 4 per cent. copper to malleable iron gave, according to Höltzer, with decreased strength an elongation of 22.5 per cent. and a decrease in the cross-section

of 51 per cent. According to Billings iron with 2 per cent. copper gives a very red-short, dark gray, granular alloy. However, according to the more recent investigations of Ball <sup>-</sup> and Wingham, copper in iron is not so dangerous as generally supposed, and the red-shortness ascribed to copper may be due to sulphur occurring in the ores. The authors named found cupriferous steel stronger, but harder, than steel free from copper.

Copper-steel.-A few years ago M. Henri Schneider, of Creuzot, France, took out patents for the manufacture of alloys of iron and copper and steel and copper. In the patent specifications it is stated the alloy of cast iron and copper can be made in a crucible, cupola or open-hearth furnace. "The furnace is charged with copper scrap and cast iron mixed between layers of coke, or if a cupreous coke be employed then the cast iron is laid in alternate layers with it, and a layer of anthracite is preferably laid over the whole. The alloy thus formed contains, generally, from five to twenty per cent. of copper, according to the purpose for which it is to be employed, and it is remarkable for its great strength, tenacity and malleability-properties which may be still further developed by chilling or tempering." \*

The alloy thus formed is charged into the bed of a furnace, with the ordinary ingredients used in the manufacture of steel, preferably under a layer of anthracite, to avoid oxidation. It is important that the copper be introduced at as early a stage in the process as possible. The said alloy may be introduced either while melted or in its hardened condition, or it may be prepared in the furnace itself, where the operation of manufacturing the steel is carried on. In the

\* U. S. Patent 415,656, Nov. 19, 1889.

## ALLOYS OF COPPER WITH OTHER METALS. 311

latter case, the bed of anthracite is first prepared and the copper placed thereon with a suitable quantity of cast or pig iron. The whole is then covered with anthracite, in order to protect the metal from contact with the air during fusion. When the charge is melted, the excess of anthracite is removed and successive charges of iron or scrap added, the operation being then continued in the ordinary way, care being taken to continually protect the bath from oxidation by means of a layer of slag or cinder, which may be renewed as required, and also to prevent red-shortness in the metal before the final introduction of the recarbonizing and manganiferous silico-spiegel iron or ferro-manganese.

The steel produced by this means contains from two to four per cent. of copper.

It is stated in the patent specifications that the steels alloyed with copper are especially useful in the manufacture of ordnance, armor-plate, gun-barrels, projectiles and for other military purposes, or in the manufacture of commercial bars, sheets, etc.\*

In view of the remarkable elastic limit of copper-steel while maintaining at the same time a very considerable elongation, Mr. F. Lynwood Garrison † is of the opinion that it would not be surprising if its use became very extensive in the arts. It has the advantage of aluminium, nickel and tungsten steels in being cheaper to manufacture.

Alloys of copper and much zinc. Pure zinc fouls the cut of files, and to decrease this evil it is mixed with small quantities (1 to 10 per cent.) of copper or iron, or of both metals.

\* U. S. Patent 415,654, Nov. 19, 1889. The British Patents Nos. 16,568 and 16,569, 1888, seem to have been abandoned in 1890.

† Jour. of the Franklin Inst., Sept., 1891.

For cheaper bearing metals better able to resist friction, which are harder and stronger than pure zinc and have but a slight coefficient of friction, zinc may be combined with tin, a little copper, and some antimony. The annexed table gives the composition of a few of such alloys:

|   | Zinc.           | Copper.                                    | Anti-<br>mony. | Tin.            | Lead.      | Iron. |
|---|-----------------|--|----------------|-----------------|------------|-------|
| English bearing metal, very<br>good, ½ brass<br>Same for rapidly revolving                        | 80              | 5.5  | _              | 14.5            |            | _     |
| shafts  | $76.14 \\ 78.3$ | $\begin{array}{c} 5.69 \\ 5.6 \end{array}$ | _              | $17.47 \\ 15.8$ | -          | _     |
| which does not deposit<br>verdegris   | $72 \\ 83.33$   | $\begin{array}{c} 7 \\ 2.27 \end{array}$   | 3.79           | 21<br>7.57      | 3.03       | =     |
| Kniess' bearing metal<br>Wagner's bearing metal for<br>steam engines<br>Dunlevie and Jones' bear- | 24              | 3<br>0.5                                   | <br>3          | 15<br>18        | 42<br>14.5 | 0.5   |
| ing metal   | 52              | 1.6  | 0.4            | 46              | _          | _     |

Dunlevie and Jones' bearing metal is prepared by melting the copper in a crucible, adding  $\frac{1}{7}$  of the tin and the antimony, and pouring into an ingot-mold. In another crucible the zinc is melted together with the rest of the tin, and, after adding the first alloy, the whole is again melted.

Alloys which can be filed are composed of zinc 90 to 99 and copper 1 to 10; or zinc 98 to 99.8 and iron 0.2 to 2; or zinc 97, copper 2.5, and iron 0.5; or zinc 68, copper 11, tin 21.

*Cupro-manganese.*—In 1840, Gersdorff prepared cupro-manganese with manganese 1 and copper 4, and shortly afterwards Schrötter prepared it with 10 to 19 per cent. manganese by reducing a mixture of copper scales, pyrolusite and coal. In 1876, Parson obtained ferriferous cupro-manganese by melting ferro-manganese in a crucible and adding copper, and, in 1878,

## ALLOYS OF COPPER WITH OTHER METALS. 313

Biermann produced cupro-manganese free from iron which contained 74.50 per cent. copper, 25 per cent. manganese, and 0.50 per cent. carbon. By its content of manganese the alloy exerts, in a manner similar to that of phosphorus and silicon, a reducing effect upon the oxides absorbed by melting bronze, etc., manganous oxide being formed and separated, so that with a moderate addition (3 to 6 per cent. of the weight of the charge) only small quantities of manganese remain in the alloy, the strength of the latter being thereby increased. For reducing purposes a quantity of manganese about four times larger than the cheaper phosphorus is required. By a larger addition of manganese, so that more of it remains in the alloy, hardness and strength are increased, but brittleness less rapidly than by phosphorus.

Cupro-manganese may be prepared as follows: Bring into a graphite crucible of about 35 to 60 lbs. capacity a mixture of powdered manganese ore, coal dust and granulated copper, give a cover of fluor-spar, common salt and charcoal dust, expose the crucible to a white heat for several hours, and pour out the liquid alloy; the result will be a hard, tough, strong, whitish-gray product. By reason of incomplete reduction up to 10 per cent. of manganese is scorified, and the furnace as well as the crucible is strongly attacked.

To partly overcome these evils, Allen melts in a reverberatory furnace with regenerative firing a mixture of cupric oxide, coal and manganic oxide, the latter obtained from the manganiferous liquid resulting as a by-product in the manufacture of chlorine or prepared from manganous carbonate, the result being a malleable, ductile alloy containing 5 to 30 per cent. manganese, which is claimed to possess greater toughness than copper. Valenciennes reduces pyrolusite in a magnesia crucible lined with pyrolusite, and melts the resulting metallic manganese with copper to alloys containing 3 to 8 per cent. manganese. Such alloys are soft and ductile, while with 12 to 15 per cent. manganese they acquire a gray color, are hard and brittle, and more readily fusible. By an addition of zinc, alloys resembling German silver are obtained, which are ductile cold as well as hot, while German silver has always to be worked hot.

Parkes heats  $\frac{1}{5}$  to 100 parts by weight of manganese ore with 50 parts of cupric oxide and 75 parts anthracite in a covered crucible to a red heat six to ten hours. After cooling a friable mass is obtained, in which the alloy is found in small globules. The latter are separated by sifting, and washed.

With a smaller content of manganese, for instance, 4 per cent., cupro-manganese has a copper red color, with a larger content (10 to 15 per cent.) a yellowish-gray color, and with still larger content, for instance, up to 30 per cent., a gray color. According to Weiller, an alloy with 8 per cent. manganese can be readily rolled, but with 12 to 15 per cent. becomes very brittle. An alloy of copper 75 and manganese 25 resists corrosion better than copper. According to Pufahl, two varieties of cupro-manganese contained :

| Copper. | Manganese. | Iron. | Nickel. | Lead. | Silicon. |
|---------|------------|-------|---------|-------|----------|
| 68.39   | 29.24      | 1.29  | 0.19    | 0.06  | 0.07     |
| 56.29   | 40.86      | 1.50  | 0.10    | trace | 1.08     |

Cupro-manganese, generally with 10 to 30 per cent. manganese, serves as an addition to copper or metallic alloys to impart to them by the withdrawal of oxygen greater density and strength, and, with a larger content of manganese, greater

## ALLOYS OF COPPER WITH OTHER METALS. 315

hardness. If in the oxidation of the manganese trimanganic tetroxide is formed, 1 part oxygen requires 2.585 parts manganese, but only 0.646 parts phosphorus. Among others cupro-manganese serves for the manufacture of

Manganese bronze.—To prepare manganese bronze add to ordinary bronze melted in a crucible under a cover of charcoal to which potash or soda may be added, small pieces of cupromanganese previously warmed, heat, stir several times with a rod of retort-graphite or of burnt wood, and pour out the alloy; or melt first the copper with the cupro-manganese in a crucible under a cover of coal dust, then add the required tin and stir thoroughly with the graphite-rod.

According to Cowles, an addition of up to 5 per cent. aluminium increases the strength and elasticity of manganese bronze, makes it more easy to cast, and gives it a silver-white appearance. An alloy of manganese 18, copper 67.5, aluminium 1.2, silicon 5 and zinc 13 is said to be superior to German silver for the manufacture of rheostats, and its electrical resistance is claimed to be 41 times greater than that of copper. By remelting, even under a cover of coal, manganese is oxidized.

Tough, malleable manganese bronze of almost a brassyellow color contained, according to Gintl, copper 75 to 76, manganese 16 to 17, zinc 5 to 6; or copper 15, manganese 4, zinc 1.

The statements regarding the properties of manganesebronze vary considerably. It is interesting to find in this connection that, about the year 1868, Messrs. Montefiore-Levi and Künzel made a number of experiments with copper and manganese alloys, and from their results concluded such alloys to be useless. They obtained great tensile strength and toughness with some of the compositions, but their ready oxidation at high temperatures made the qualities of the castings uncertain and impracticable.

More recent experiments are, however, more favorable. According to Biermann, the most advisable addition to bronze is  $\frac{2}{3}$  per cent. manganese =  $2\frac{2}{3}$  per cent. cupro-manganese with 25 per cent. manganese; in many cases an addition of 0.5 to 2 per cent. cupro-manganese suffices, the alloys then containing only a few  $\frac{1}{100}$  per cent. of manganese. While good qualities of ordinary bronze broke under a pressure of 39.6 lbs. per square millimeter, bronze with <sup>2</sup>/<sub>3</sub> per cent. manganese stood a pressure of 62.15 lbs. with an elongation of  $20\frac{1}{2}$ per cent. On account of its great homogeneity such manganese bronze possesses great resisting power against wear by friction; bearings of bronze with  $\frac{1}{2}$  to  $\frac{2}{3}$  per cent. mangauese being much more durable than other bearing metals without manganese. An alloy of copper 80, cupro-manganese 7 to 9, tin 6, and zinc 5 has proved especially suitable for bearing metal.

Manganese-brass. According to Parkes, copper 70, manganese 30 and zinc 20 to 30 give a silver-like alloy which can be forged and rolled at a red heat. If the alloy is not required to stand a high temperature the composition is: Copper 49, manganese 21, iron 5 to 10, and zinc 5 to 10. For soldering the alloy the following composition is suitable: Copper 7, manganese 3, silver 1 to 2.

For coins, copper 65, manganese 25 and zine 10 may be melted together, or copper 65, manganese 15 to 20, zine 10, and nickel 5 to 10.

*Copper-tungsten alloys.* Copper and tungsten unite, according to Biermann, to an alloy with 10 per cent. tungsten which

### ALLOYS OF COPPER WITH OTHER METALS. 317

combines hardness and elasticity with toughness, and is suitable for axle bearings and telegraph wires. Tungsten-copper combines also with other metals. Biermann prepared an alloy with iron 66, nickel 23, tungsten 4, and copper 5. According to Pufahl, Biermann's tungsten bronze contains copper 95.39, tin 3.04 and tungsten 1.57.

Copper-cobalt alloys. These alloys show a red color and a fracture resembling that of pure copper. They are distinguished by great ductility and tenacity, and can be forged and stretched in the heat, but cannot be hardened. They are prepared by melting together copper and cobalt in a crucible under a cover of boric acid and charcoal. An alloy cast in grains, which is attracted by a magnet, is composed of cobalt 48.20 per cent., nickel 1, copper 50.26, and iron 0.46. It is red, while an alloy containing equal proportions of nickel and copper shows a white color. Alloys with 1 to 6 per cent. of cobalt can be as readily forged, stretched, and rolled hot as copper, but are considerably tougher. An alloy with 5 per cent. cobalt shows especially valuable properties; it is nonoxidizable and ductile like copper, elastic and tough like iron, and will no doubt be applied to many purposes.

*Cobalt bronze* of Wiggin & Co., of Birmingham, is an alloy of copper, cobalt zinc, tin or lead, and is said to possess all the properties of pure cobalt.

*Copper-magnesium alloys.* According to Grätzel, an alloy or copper and magnesium is used as addition to tombac castings, and when of a pale red color and quite brittle contains, according to Pufahl, copper 89.31, magnesium 10.18, aluminium 0.05, nickel 0.21, lead 0.08 and iron 0.07.

According to Warren, alloys of copper with magnesium as regards general properties do not surpass the other usual cop-

### THE METALLIC ALLOYS.

per alloys, which can be more readily prepared. An alloy with 11 per cent. magnesium has a brass-like appearance, is very brittle, and when melted together with copper gives alloys which with an increase in the content of copper become less brittle. An alloy with 4 per cent. magnesium resembles an actual bronze in appearance and physical properties;  $1\frac{1}{2}$  per cent. magnesium makes the copper somewhat lighter in color, and harder. The French Société industrielle et commercial des metaux has introduced alloys of copper with iron, nickel and zinc-magnesium.

Copper-antimony alloys. According to Held, a malleable gold-like alloy is obtained by adding to 100 parts of melted copper 6 parts of antimony, and, when liquefaction is complete, some wood ashes, calcareous spar and magnesium to remove porosity. The alloy is said to be stronger than gold.

Melted together in equal parts copper and antimony give a hard combination of a beautiful violet color suitable for fancy articles.

*Mira metal.* The alloy known by this name is distinguished by great resistance towards acids and is, therefore, especially suitable for cocks, pipes, etc., which come in contact with acid liquids. Mira metal contains according to analysis: Copper 74.755, zinc 0.615, lead 16.350, tin 0.910, iron 0.430, nickel and cobalt 0.240, antimony 6.785.

# CHAPTER XI.

## ALUMINIUM ALLOYS.

As stated in the general review of the metals, aluminium is distinguished by a beautiful silvery color and great strength. It is, however, especially valuable on account of its low specific gravity, which is about that of glass.

Among the alloys of aluminium those with iron and copper are of special importance, but before entering on a description of them we will briefly mention the behavior of aluminium towards the other metals.

Aluminium unites easily with most of the metals, the combination being usually accompanied by a disengagement of heat, which is particularly active in the case of copper. Lead and antimony appear to be the only metals not alloying with The practical production of aluminium alloys is, it easily. generally speaking, not a difficult operation. The aluminium may be melted in a carbon or magnesia-lined crucible, without a flux, and the other metal simply thrown in; it falls to the bottom, melts, and is absorbed by the aluminium. In some few cases the alloying metal must be mixed in powder with finely-divided aluminium and heated together in a closed crucible, but this is only exceptionally the case. Again, a bar of aluminium may be taken in the tongs and held under the surface of another metal already melted. This is the best method of introducing small percentages of alu-

minium into other metals, unless we may accept the adding of a small quantity of rich alloy to pure metal, thus diluting the percentage of aluminium to the desired quantity. Most of the alloys thus produced are improved by careful remelting, the aluminium seeming to become more intimately combined. The alloy made in the first operation is often not entirely homogeneous, but becomes more uniform, and finally perfectly so, by repeated fusion. Very few of these alloys will liquate, the alloys in general acting as a single metal. However, in some cases where the alloy is not of a very definite or certain composition a liquation may take place, leaving as a residue an alloy with different proportions from the fluid metal running off. In the case of volatile metals they can usually be driven out of the aluminium by keeping the alloy melted and exposed to a heat sufficient to drive off the volatile metal.

The properties of the alloys of aluminium with the precious metals, gold and silver, approach nearest to those of the metal present in largest quantity. An alloy of aluminium 90 parts and gold 10 equals in hardness a corresponding alloy of gold and silver, and shows a beautiful yellow color. It can be readily worked under the hammer and rolled out to sheet. An alloy of aluminium with 5 parts of silver does not differ in its properties from pure aluminium, except that it is somewhat harder and takes a finer polish. It is used in making balances for chemists. With a content of iron of over 5 per cent., the aluminium becomes more refractory and at the same time brittle. The introduction of 0.1 per cent. of bismuth makes the metal so brittle that it can no longer be worked; it breaks even if worked directly after annealing. The presence of a small quantity of silicum gives to aluminALUMINIUM ALLOYS.

321

ium a strong crystalline structure, the crystallization being clearly perceptible on the surface by a peculiar net-like appearance of the metal.

Aluminium-iron alloys.—A small quantity of aluminium, by changing the structure of iron and steel, improves their strength, sensibly increases their resistance towards corroding substances and atmospheric influences, and lowers the fusing point, for instance of cast iron, making the castings more uniform and denser—for instance, Mitis castings.

Speaking generally of the application of aluminium to the manufacture of iron and steel, the usual amount stated to be requisite for producing good results is about 0.10 per cent., but in many cases this would be too little.

Aluminium steel.---A considerable percentage of the total production of aluminium, both in this country and in Europe, is used in the manufacture of iron and steel castings. The process consists in adding from 0.10 to 0.15 per cent. of aluminium to iron and steel just before casting, by which blowholes are prevented and sounder castings produced. The beneficial effect is due in part at least to the deoxidizing action of aluminium upon carbon monoxide at a high temperature, a reaction which has been demonstrated directly between the metal and the gas. A detail of manipulation in the method of applying aluminium, especially in castings for steam and pump cylinders, and other castings intended to resist high pressure, is reported in Dingler's Polytechnical Journal, Vol. 284, No. 11. The addition is made by first forming a mixture of aluminium and iron, which is effected by placing the proper quantity of heated aluminium in the bottom of a small ladle, running some iron into the ladle from the furnace, and waiting until the mixture begins to stiffen. Then the iron to

### THE METALLIC ALLOYS.

be operated on is run into a large ladle and the iron-aluminium mixture is poured into it, whereby an intimate mixture of the whole is effected. For 220 lbs. of iron to be operated on, about 7 ozs. of aluminium are used. The iron is not poured at once from the large ladle, but is allowed to stand until it is orange yellow and a thin film begins to form on the surface. As soon as this occurs the film is removed and the iron is poured. The mould should be kept full.

According to a paper read by Mr. J. W. Langley at the Glen Summit meeting of the American Institute of Mining Engineers, the practice in the United States in pouring ingots is as follows: The aluminium in small pieces of  $\frac{1}{4}$  or  $\frac{1}{2}$ pound weight is thrown into the ladle during the tapping, shortly after a small quantity of steel has already entered it. The aluminium melts almost instantaneously, and diffuses with great rapidity throughout the contents of the ladle. The diffusion seems to be complete. The quantity of aluminium to be employed will vary slightly, according to the kind of steel and the results to be attained. For open-hearth steel, containing less than 0.50 per cent. carbon, the amount will range from 5 to 10 ounces per ton of steel. For Bessemer steel the quantities should be slightly increased, viz., 7 to 16 ounces. For steel containing over 0.50 per cent. carbon, aluminium should be used cautiously; in general between 4 and 8 ounces to the ton

Aluminium-copper alloys.—These two metals unite readily in any proportions, the union being attended with evolution of heat, which in some cases is very large in amount. The alloys of aluminium with copper show very different properties according to the quantities of aluminium they contain. Alloys containing but little copper cannot be used for indus-

#### ALUMINIUM ALLOYS.

trial purposes. With 60 to 70 per cent. of aluminium they are very brittle, glass-hard, and beautifully crystalline. With 50 per cent. the alloy is quite soft, but under 30 per cent. of aluminium the hardness returns.

The usual alloys are those of 1, 2, 5 and 10 per cent. of aluminium, such alloys being known as aluminium bronze. The 5 per cent. bronze is golden in color, polishes well, casts beautifully, is very malleable cold or hot, and has great strength, especially after hammering. The 7.5 per cent. bronze is to be recommended as superior to the 5 per cent. bronze. It has a peculiar greenish-gold color, which makes it very suitable for decoration. All these good qualities are possessed by the 10 per cent. bronze. It is bright golden, keeps its polish in the air, may be easily engraved, shows an elasticity much greater than steel, and can be soldered with hard solder. When it is made by a simple mixing of ingredients, it is brittle and does not acquire its best qualities until after having been cast several times. After three or four meltings it reaches a maximum, at which point it may be melted several times without sensible change. It gives good castings of all sizes and runs in sand-moulds very uniformly. Thin castings come out very sharp, but if a casting is thin and suddenly thickens, small off-shoots must be made at the thick place, into which the metal can run and then soak back into the casting as it cools and shrinks, thus avoiding cavities by shrinkage at the thick part. Its specific gravity is 7.68, about that of soft iron. Its strength when hammered is equal to the best steel. It may be forged at about the same heat as cast steel and then hammered until it is almost cold without breaking or ripping. Tempering makes it soft and malleable. It does not foul a file and may be drawn into wire. Any

#### THE METALLIC ALLOYS.

part of a machine which is usually made of steel can be replaced by this bronze.

The melting-point of aluminium-bronze varies slightly with the content of aluminium, the higher grades melting at a somewhat lower temperature than the lower. The 10 per cent. bronze melts at about 1700° F., a little higher than ordinary bronze or brass.

In making aluminium bronze great attention must be paid to the quality of the copper used. Ordinary commercial copper may contain small amounts of antimony, arsenic or iron, which the aluminium can in no way remove, and which affect very injuriously the quality of the bronze. The aluminium bronzes seem to be extremely sensible to the above metals, particularly to iron. This necessitates the employment of the very purest copper; electrolytic copper is sometimes used when not too high priced, but Lake Superior is generally found satisfactory enough. Even the purest copper may contain dissolved cuprous oxide or occluded gases, and it is one of the functions of the aluminium to reduce these oxides and gases, forming slag which rises to the surface and leaving the bronze free from their influences. If tin occurs in the copper, it lowers very greatly the ductility and strength of the bronzes, but zinc is not so harmful.

Care should also be taken as to the purity of the aluminium used, though its impurities are not so harmful as they would be if occurring in similar percentage in the copper, since so much more copper than aluminium is used in these alloys. Yet the bronzes are so sensitive to the presence of iron that an aluminium with as small a percentage of this metal as possible should be used. The silicon in commercial aluminium is not so harmful as the iron, but it does harden the bronze

#### ALUMINIUM ALLOYS.

considerably and increases its tensile strength. The "Magnesium und Aluminium Fabrik" of Hemelingen gives the following directions for preparing the bronzes: Melt the copper in a plumbago crucible and heat it somewhat hotter than its melting point. When quite fluid and the surface clean, sticks of aluminium of a suitable size are taken in tongs and pushed down under the surface, thus protecting the aluminium from oxidizing. The first effect is necessarily to chill the copper more or less in contact with the aluminium; but if the copper was at a good heat to start with, the chilled part is speedily dissolved and the aluminium attacked. The chemical action of the aluminium is then shown by a rise in temperature which may even reach a white heat; considerable commotion may take place at first, but this gradually subsides. When the required amount of aluminium has been introduced, the bronze is let alone for a few moments, and then well stirred, taking care not to rub or scrape the sides of the crucible. By the stirring, the slag, which commenced to rise even during the alloying, is brought almost entirely to the surface. The crucible is then taken out of the furnace, the slag removed from the surface with a skimmer, the melt again stirred to bring up what slag may still remain in it, and it is then ready for casting. It is very injurious to leave it longer in the fire than is absolutely necessary; also any flux is unnecessary, the bronze needing only to be covered with charcoal powder. The particular point to be attended to in melting these bronzes is to handle as quickly as possible when once melted.

As with ordinary brass or bronze, two or three remeltings are needed before the combination of the metals appears to be perfect, and the bronze takes on its best qualities. When the

### THE METALLIC ALLOYS.

alloy is thus made perfect, the bronze is not altered by remelting, and the aluminium, which in the first instance removed the dissolved oxides and occluded gases from the copper, now prevents the copper from taking them up again, and so keeps the bronze up to quality. If, however, the bronze is kept melted a long time, and subject to oxidizing influences, the tendency of the copper to absorb oxygen will cause some loss of aluminium by the action of the latter in removing the oxygen taken up, and a slag consisting principally of alumina will result; but if the remelting of the bronze is done quickly and the surface covered with charcoal or coke, the loss from this cause will be very trifling, and the percentage of aluminium will remain practically constant.

Dilution of a high per cent. bronze to a lower one is practised on a large scale by the companies which produce aluminium bronze directly in their reduction furnaces. The operation is said to consist simply in melting the high per cent. bronze in a crucible, and stirring into it pure copper in the required proportions, or else melting the two down together on the hearth of a reverberatory furnace. The combined aluminium thus cleanses the added copper and produces a lower per cent. bronze of right quality if the high per cent. bronze is pure and the copper added of the proper quality. It is, of course, quite certain that no difficulty can occur in adding aluminium to a low per cent. bronze to increase its percentage other than that of imperfect combination, which may be overcome by one or two remeltings.

Aluminium bronze is not an easy metal to cast perfectly until the moulder is familiar with its peculiarities. Aluminium bronze shrinks about twice as much as brass, and this shrinkage in setting and this contraction in cooling are the ob-

ALUMINIUM ALLOYS.

stacles which cause the most trouble. A plumbago crucible, or one lined with magnesite,\* is the best to use for melting the bronze, the melt being kept covered with powdered char-Dr. Joseph W. Richards suggests that the stirrers and coal. skimmers used be coated with a wash made of plumbago and a little fire-clay, as the contact of bronze with bare iron tools cannot but injure its quality. The crucible should not be kept in the fire any longer than is absolutely required to bring the bronze to proper heat for casting. In casting it is of considerable advantage to use a casting ladle, into which the bronze is poured, which is arranged so as to tap from the bottom. This effectually keeps any slag or scum from being entangled in the casting. The same result is also obtained by arranging a large basin on top of the pouring gate, which is temporarily closed by an iron or clay stopper. Enough bronze is then poured into this basin to fill the mould, and after the dirt is all well up to the surface, the plug is withdrawn and the mould fills with clean metal. For very small work the ordinary skim-gate will answer the above purpose; for larger castings the tapping ladle is preferred. Plain castings, such as pump-rods, shafting, etc., and especially billets for rolling and drawing, are cast advantageously in iron moulds, which should be provided with a large sinking head on top to feed the casting as it cools. Rubbing with a mixture of plumbago, kaolin and oil is said to protect the iron moulds from sticking.

\* It is best to use the white Grecian mineral, fully shrunk by calcining at the highest heat of a fire-brick or porcelain kiln, and then ground fine and made into a stiff paste with sugar syrup or molasses. The crucible is carefully lined, and then heated slowly to redness. On cooling any cracks are carefully filled with more paste, and the crucible is baked again; when properly prepared, however, one baking is sufficient, and the linings do not shrink from the walls of the crucible. The chilling makes the bronze soft, and the slabs and cylinders thus cast for rolling and drawing are in good condition to be worked at once. For ordinary foundry castings, sand moulds are used. The slower cooling makes the castings more or less hard; if soft castings are wanted they can be subsequently annealed.\*

Thomas D. West, the author of "American Foundry Practice," in a paper on "Casting Aluminium Bronze and other Strong Metals," read before the American Society of Mechanical Engineers, November, 1886, says :

"The difficulties which beset the casting of aluminium bronze are in some respects similar to those which were encountered in perfecting methods for casting steel. There is much small work which can be successfully cast by methods used in the ordinary moulding of cast iron, but in peculiarly proportioned and in large bronze castings other means and extra display of skill and judgment will generally be required. In strong metals there appears to be a 'red shortness' or degree of temperature after it becomes solidified, at which it may be torn apart if it meets a very little resistance to its contraction, and the separation may be such as cannot be detected by the eye, but will be made known only when pressure is put upon the casting. To overcome this evil and to make allowance for sufficient freedom in contraction, much judgment will often be required and different modes must be adopted to suit varying conditions. One factor often met with is that of the incompressibility of cores or parts forming

\*ALUMINIUM: Its History, Occurrence, Properties, Metallurgy and Applications, Including Its Alloys. By Joseph W. Richards. Third edition, Revised and Enlarged. 1896. Philadelphia, Henry Carey Baird & Co.

### ALUMINIUM ALLOYS.

the interior portion of castings, while another is the resistance which flanges, etc., upon an exterior surface oppose to freedom of contraction of the mass. The core must generally be 'rotten' and of a yielding character. This is obtained by using rosin in coarse sand, and filling the core as full of cinders and large vent-holes as possible, and by not using any core-rods of iron. The rosin would cause the core when heated to become soft, and would make it very nearly as compressible as a 'green-sand' core when the pressure of the contraction of the metal would come upon it.

"By means of dried rosin or green sand cores we were able to meet almost any difficulties which might arise in ordinary work from the evils of contraction, so far as cores were con-For large cylinders or castings, which might require cerned. large round cores which could be 'swept,' a hay-rope wound around a core barrel would often prove an excellent yielding backing, and allow freedom for contraction sufficient to insure no rents or invisible strain in the body of the casting. To provide means of freedom in the contraction of exterior portions of castings, which may be supposed to offer resistance sufficient to cause an injury, different methods will have to be employed in almost every new form of such patterns. It may be that conditions will permit the mould to be of a sufficiently yielding character, and again it may be necessary to dig away portions of the mould or loosen bolts, etc., as soon as the liquid metal is thought to have solidified. In any metal there may be invisible rents or strains left in a casting through tension when cooling, sufficient to make it fragile or crack of its own accord, and it is an element which, from its very deceptive nature, should command the closest attention of all interested in the manufacture of castings.

"Like contraction, the element of shrinkage is often found seriously to impede the attaining of perfect castings from strong metals. In steel castings much labor has to be expended in providing risers sufficient to 'feed solid' or prevent 'draw-holes' from being formed, and in casting aluminiumbronze a similar necessity is found. The only way to insure against the evils of shrinkage in this metal was to have the 'risers' larger than the body or part of the castings which they were intended to 'feed.' The feeder or riser being the largest body, it will, of course, remain fluid longer than the casting, and, as in cast-iron, that part which solidifies first will draw from the nearest uppermost fluid body, and thus leave holes in the part which remains longest fluid. The above principle will be seen to be effective in obtaining the end sought. It is to be remembered that it is not practicable to 'churn' this bronze, as is done with cast iron. A long cast-iron roll, 1 foot in diameter, can by means of a feeder 5 inches in diameter and a 1 inch wrought-iron rod be made perfectly sound for its full length. To cast such a solid in bronze, the feeding head should be at least as large as the diameter of the roll, and the casting moulded about onequarter longer than the length of roll desired. The extra length would contain the shrinkage hole, and when cut off a solid casting would be left. This is a plan often practised in the making of guns, etc., in cast iron, and is done partly to insure against the inability of many moulders to feed solid and to save that labor. A method which the writer found to work well in assisting to avoid shrinkage in ordinary castings in aluminium bronze was to 'gate' a mould so that it could be filled or poured as quickly as possible, and to have the metal as dull as it would flow to warrant a full run of casting.

### ALUMINIUM ALLOYS.

By this plan very disproportionate castings were made without feeders on the heavier parts, and upon which draw or shrinkage holes would surely have appeared had the metal been poured hot.

"The metal works well in our ordinary moulding sands and 'peels' extra well. As a general thing, disproportionate castings weighing over 100 pounds are best made in 'dry' instead of 'green' sand moulds, as such will permit of cleaner work and a duller pouring of the metal, for in this method there is not that dampness which is given off from a greensand mould and which is so liable to cause 'cold shots.' When the position of the casting work will permit, many forms which are proportionate in thickness can be well made in green-sand by coating the surface of the moulds and gates with 'silver lead' or plumbago.

"From 'blow-holes,' which are another characteristic element likely to exist in strong metals, it can be said that aluminium-bronze is free. Should any exist, it is the fault of the moulder or his mould, as the metal itself runs in iron moulds as sound and close as gold. Sand moulds to procure good work must be well vented, and, if of 'dry-sand,' thoroughly open sand mixture should be used and well dried. The sand for 'green-sand' work is best fine, similar to what will work well for brass castings. For 'dry-sand' work the mixture should be as open in nature as possible, and, for blacking the mould, use the same mixtures as are found to work well with cast iron."

Aluminium bronze forges similarly to the best Swedish iron, but at a much lower temperature. It works best at a cherry red; if this is much exceeded, the metal becomes hot, short, and is easily crushed. The temperature for rolling is a

bright red heat, and it is a curious fact that if the metal were forged at the temperature at which it is rolled, it would be crushed to pieces. If the temperature in the ordinary muffle in which it is heated be allowed to rise too high, the bronze will frequently fall apart by its own weight. When in the rolls it acts very much like yellow Muntz metal. As it loses its heat much more rapidly than copper or iron, it has to be annealed frequently between rollings.

The following examples of rolling are given by the "Cowles Electric Smelting and Aluminium Company:" A billet of 10 per cent. bronze about  $18^{\prime\prime} \ge 1\frac{1}{2}^{\prime\prime} \ge 1\frac{1}{2}^{\prime\prime}$  was rolled in a Belgian train to quarter-inch rod, at one annealing. The 5 per cent. bronze is harder to roll hot than the 10 per cent., but in cold rolling just the reverse is true; a piece of 5 per cent. sheeting, 8 inches wide, has been reduced 8 gauge numbers when rolled cold at one annealing; while a 10 per cent. sheet could not be reduced more than half that number. The billets for rolling can be best prepared by casting in iron moulds previously rubbed with a mixture of plumbago, pipeclay, and lard oil. The metal chills very quickly and very smooth castings can be produced, the smoothness depending considerably on the speed of pouring. With care the 5 and 10 per cent. bronzes can be easily drawn into wire. It is preferable, however, to roll the 5 per cent. to quarter inch rods and the 10 per cent. to a less diameter, and anneal them. The metal thus prepared is much tougher and less liable to break in drawing. The dies must be very hard, or the ordinary wire, and especially the higher grades, are apt to cut The speed of the draw blocks must be less than for them. iron, brass, copper, German silver, or soft steel, and the reduction must be more gradually effected.

Aluminium bronze is, in every respect, considered the best bronze yet known. Its high cost has thus far prevented its extensive use in the arts, but since the perfection of electrolytic processes for the production of aluminium, the cost or manufacture has been greatly reduced.

The following results were obtained at the South Boston Iron Works, with pieces of the Cowles Company alloys, February, 1886:—

| Aluminiu  | ım bronze. | Tensile strength,<br>pounds per<br>square inch.                                      | Elastic limit.                 | Elongation,<br>per cent.  |
|---|------------|--|--------------------------------|---|
| $ \begin{array}{c} 10 \text{ per cent.} \\ 10 & {}^{\prime\prime} \\ 10 & {}^{\prime\prime} \\ 9 & {}^{\prime\prime} \\ 9 & {}^{\prime\prime} \\ 8\frac{1}{2} & {}^{\prime\prime} \\ 7\frac{1}{2} & {}^{\prime\prime} \end{array} $ | bronze<br> | $\begin{array}{c} 91,463\\92,441\\96,434\\77,062\\71,698\\72,019\\60,716\end{array}$ | 59,81585,03451,77444,02545,537 | $ \begin{array}{c} 1^{\frac{1}{2}}\\ 2^{\frac{1}{2}}\\ 1\\ 9\\ -\\ 8\\ -\\ 8\\ -\\ 6\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\ -\\$ |

The following tests were made at the Washington Navy Yard of pieces very nearly half an inch in diameter and two inches between shoulders :—

| Aluminium bronze.                     | Tensile strength,<br>pounds per<br>square inch. | -Elastic limit.    | Elongation,<br>per cent. |
|---------------------------------------|---|--------------------|--------------------------|
| 10 per cent. bronze<br>10 " "<br>10 " | $114.514 \\95.366 \\109.823$                    | $69.749 \\ 79,894$ | $0.45 \\ 0.05 \\ 0.05$   |

According to Thurston, the alloys of aluminium and copper may be made by fusing together the oxides with metallic copper and enough carbon and flux to reduce them. The oxides as well as the other materials should be as finely divided as possible, and the carbon introduced in excess.

Aluminium brass. An addition of aluminium (1.5 to 5.8 per cent.) to brass increases its strength, toughness and elasticity. An alloy of copper 60 parts, zinc 30, and aluminium 2, made by the aluminium factory at Hemlingen near Bremen, can be rolled, forged, stamped, drawn into tubes and wire, is suitable for bells, strings, etc., and especially for cartridge shells, they being not attacked by the gases of the powder. With an addition of 8 per cent. aluminium the brass becomes more ductile, acquires a more beautiful color, and becomes stronger and more resistant towards caustic fluids. With over 13 per cent. aluminium it becomes hard and red-short, and acquires a reddish color. With a still greater content of aluminium it becomes very brittle and gray-black, but at 25 per cent. the strength, according to Langhove, increases again.

According to Kiliani the action of aluminium upon brass is much more powerful than upon bronze; 1 to 3 per cent. of it producing nearly the same effect in the former as 5 to 10 per cent. in the latter, so that aluminium-brass is the cheaper metal. Compared with aluminium-bronze, aluminium-brass has the disadvantage of greater weight and of being more readily oxidized, it being, however, less oxidizable than many other metals used at the present time. For soft brass-alloys 1/2 to 2 per cent. aluminium is usually taken; for hard alloys 2 to 3.5 per cent. While in casting ordinary brass a dirtygreen coat of oxide is obtained, with an addition of only  $\frac{1}{2}$  per cent. aluminium the surface remains bright and lustrous and the metal itself becomes more liquid. By the addition of 1 per cent. aluminium the tensile strength of brass with 33 per cent. zinc is greater than that of cast delta metal. The content of zinc exerts an essential influence upon the alloy; the

### ALUMINIUM ALLOYS.

greater it is the smaller the addition of aluminium must be, otherwise the alloy will be too hard and brittle. To brass with 33 per cent. zinc up to 3.5 per cent. aluminium is generally added, and to brass with 40 per cent. zinc not over 2 per cent. While alloys with 40 per cent. zinc can, without regard to their content of aluminium, be forged at a dark red heat, those with 33 per cent. zinc must contain at least 2 to  $3\frac{1}{2}$  per cent. aluminium to be malleable at a dark red to brown heat. With the decrease in the content of aluminium the forging temperature also decreases, so that brass containing 1 per cent. should be forged only hand-warm, and brass with  $\frac{1}{2}$  per cent. aluminium can be forged at a dark cherry-red heat, while at this temperature ordinary brass breaks up under the hammer.

The aluminium may be added to the fusing brass either as such, or in the form of a 20 to 25 per cent. aluminium bronze. In remelting aluminium-brass an enrichment of aluminium takes place in consequence of the volatilization of zinc. Casting requires experience, on account of the great shrinkage and the formation of froth which readily passes into the alloy. A warm alloy when suddenly cooled becomes brittle and the fracture exhibits a deep golden lustrous color.

Messrs. Cowles recommended aluminium brass for the following purposes :

"Valve and valve-seats for mining pumps, or pumps working under great pressure. worms and worm-wheels, slide-faces, mining machinery, pinions, screws, hydraulic machinery, dredging machinery, gates for turbine wheels working under a high head, propeller wheels, and as a metal to resist the action of salt water in marine architecture. While aluminium brass is not quite as strong or as tough as the A grade bronze, yet it will answer nearly as well for many purposes that the bronze is used for."

The ordinary grades of aluminium brass have about 85,000 pounds per square inch in tensile strength, with nine per cent. elongation.

Cowles Bros. report the following series of tests made, at their works in Lockport, their alloys all being made by adding zinc to aluminium-bronze:

| Co         | omposition. |       | Tensile strength              |                          |
|------------|-------------|-------|-------------------------------|--------------------------|
| Aluminium. | Copper.     | Zinc. | per quare inch<br>(castings). | Elongation,<br>per cent. |
| 5.8        | 67.4        | 26.8  | 95,712                        | 1.0                      |
| 3.3        | 63,3        | 33.3  | 85,867                        | 7.6                      |
| 3.0        | 67.0        | 30.0  | 67.341                        | 12.5                     |
| 1.5        | 77.5        | 21.0  | 32,356                        | 41.7                     |
| 1.5        | 71.0        | 27.5  | $41,\!952$                    | 27.0                     |
| 1.25       | 70.0        | 28.0  | 35,059                        | 25.0                     |
| 2.5        | 70.0        | 27.5  | 40,982                        | 28.0                     |
| 1.0        | 57.0        | 42.0  | 68,218                        | 2.0                      |
| 1.15       | 55.8        | 43.0  | $69,\!520$                    | 4.0                      |

Richards' bronze.—The alloy known under this name is the invention of Mr. Joseph Richards, of Philadelphia. It is a very strong and at the same time cheap alloy. It contains copper 55 parts, zinc 42 or 43, iron 1, aluminium 1 to 2. This alloy is of a golden-yellow color, is exceedingly finegrained, and has a tensile strength in castings of 50,000 lbs. per square inch with 15 per cent. elongation. Like all the strong brasses, however, it requires some experience in handling before the ordinary metal-worker can turn out uniformly castings with these maximum properties. The worked metal averages 50 per cent. stronger.

Aluminium-nickel-copper alloys.—A number of remarkable and useful alloys are made by mixing aluminium bronzes

with nickel in various proportions. These compositions are said to be very ductile and to have a tenacity of from 75,000 to over 100,000 lbs. per square inch, with about 30 per cent. elongation. Tests made by Kirkaldy on alloys of a similar nature made by the "Webster Crown Metal Company," England, give results ranging from 82,000 to over 100,000 lbs. per square inch with 20 to 30 per cent. elongation.

The alloys are prepared as follows:

a. Copper is melted and aluminium added to it until a 10 per cent. bronze is made. There is then added to it 1 to 6 per cent. of an alloy, ready prepared, containing :

| Copper    | • | • | • | • | • | • | • | • | • |   | • |   | • | • | • | • | • | • | • | 20 1 | parts. |
|-----------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|------|--------|
| Nickel    | • |   | • |   |   |   |   |   | - | : |   | • |   |   |   |   | • | • | • | 20   | ۰.     |
| Tin       |   |   |   |   | • | • |   |   |   |   |   |   |   |   |   |   |   | • |   | 30   | "      |
| Aluminium |   |   |   |   |   |   |   | • | • | • |   |   |   |   | • |   |   |   | • | 7    | - 44   |

The alloy thus prepared would contain, as represented by the two extremes :

|           | I.     | II.  |
|-----------|--------|------|
| Copper    | . 89.3 | 86.4 |
| Nickel    | . 0.3  | 1.4  |
| Tin       | . 0.4  | 2.0  |
| Aluminium | . 10.0 | 10.2 |

*b*. The two following alloys are prepared in the usual way, under a flux consisting of equal parts of potassium and sodium chlorides, and are cast into bars:

| Ι.                 | II.             |
|--------------------|-----------------|
| Aluminium 15 parts | Nickel 17 parts |
| Tin                | Copper 17 ''    |
|                    | Tin             |
| 100 parts          |                 |
|                    | 100 parts       |

To make the bronzes, equal parts of these two alloys are 22

melted with copper; the more of the alloys used the harder and better the bronze. The best mixture is of

|           |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | 100 - | parts   |
|-----------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|-------|---------|
| Alloy II. | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | 8     |         |
| Alloy I   | • | • |   | • | • | • | • |   |   |   | • | • | • | • | • | • | • | • | • |   |   | 8     | "       |
| Copper .  | • | • | • | • | • | • | • | • | • |   | • |   | • | • | • | • |   | • | • | • |   | 84    | parts . |

The copper is first melted, then the alloys put in together and stirred well. As iron is harmful to this bronze, the stirrer should be of wood or clay. This alloy is suitable for art castings, kitchen utensils, etc., or anywhere where durability, hardness, malleability, polish and very slight oxidability are required. A cheaper and more common alloy may be made of

| Copper   | • |   |   |   | • | · | • | • | • | • | • |   | • |   | • | • |   | • | • |   | 91 | parts |
|----------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|----|-------|
| Alloy I  |   |   | • | • | • |   | • | • | • | • | • | • | • | • | • | • |   | • |   |   | 4  | 66    |
| Alloy II | • | • | • |   |   | • | • | • | • | • | • | • | • | • | • | • | • | ı | ı | • | 5  | • •   |

These two bronzes would contain centesimally:

|           | Rich alloy. Poorer alloy. |
|-----------|---------------------------|
| Copper    | . 85.36 94.58             |
| Tin       | . 12.08 6.70              |
| Nickel    | . 1.36 3.85               |
| Aluminium | . 1.20 0.60               |

c. The following alloy is said to withstand oxidation well, to possess great tenacity, durability, capability to bear vibrations, and to take a high polish. A preliminary alloy is made of:

| Copper    |   | • | • | • | • | • | • | • | • | • | • | • | • |   | • | • | • | • | • | • | • | 200 | parts |
|-----------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|-----|-------|
| Tin       |   | • |   | • | • |   |   | • | • | • | • |   | • | • |   | • | • | • | • | • | • | 80  | "     |
| Bismuth . |   |   |   | • |   | • |   |   | • |   |   | • |   |   | • | • | • | • | • | • | • | 10  | "     |
| Aluminiu  | n | • | • |   |   |   |   |   | • | • | _ | • | • | • | • |   |   | • | • | • | • | 10  | "     |

# ALUMINIUM ALLOYS.

The alloy proper is made by melting together :

| Preliminary al | loy | • | • | • | • | • | • | • | • | • | • | • | • | • | • | $4\frac{1}{2}$  | parts |
|----------------|-----|---|---|---|---|---|---|---|---|---|---|---|---|---|---|-----------------|-------|
| Copper         |     | • | • | • | • | • | • |   | • |   |   |   |   |   | • | 164             | 66.   |
| Nickel         |     |   |   | • |   | - | • | • | • | • | • | • |   |   |   | 70              | "     |
| Zinc           | • • | • |   |   | • | • |   |   |   | • | • | • | • |   |   | $61\frac{1}{2}$ | • •   |

The final composition would be by calculation:

| Copper . | • | • | • | • | • | • | • | • | • | • | • | • |   | • |   | • |   | • |   | • |   |   | 55.67  |
|----------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|--------|
| Nickel   |   | • |   | • |   | • |   |   |   | • |   |   | • |   |   |   |   |   |   | • |   |   | 23.33  |
| Zinc     | • | • | • |   | • | • |   |   | • |   | • |   | • | • | • | • |   |   |   |   |   |   | 20.50  |
| Tin      |   |   | • | • | • |   | • | • | • | • |   | • | • | • | • | • | • | • | • |   | - |   | 0.40   |
| Bismuth. |   | • |   |   | • | • | • | • | • | • | • |   | • |   |   | • |   | • |   |   | • | • | 0.05   |
| Aluminiu | m | • | • | • | • | • | • | • |   | • | • | • | • | • | • | • | • |   | • |   | • | • | 0.05   |
|          |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | 100.00 |

d. Another alloy patented by Mr. Webster contains:

| Copper . | • |   | • | • | • | • | • | • |  | • | 53       | parts | =  | 51.0  | per cent. |
|----------|---|---|---|---|---|---|---|---|--|---|----------|-------|----|-------|-----------|
| Nickel . |   |   |   | • | • |   |   |   |  |   | 221      | 1 66  | =  | 21.6  | "         |
| Zinc     |   |   |   |   |   |   |   |   |  |   | 2        | "     | =  | 21.2  | "         |
| Tin      |   |   |   |   |   |   |   |   |  |   | <b>5</b> | 6     | == | 4.8   | "         |
| Bismuth  |   | • |   |   |   |   |   |   |  |   |          | ٤     | =  | 0.7   | 66        |
| Aluminiu | m |   |   |   |   |   |   |   |  |   |          |       | =  | 0.7   | "         |
|          |   |   |   |   |   |   |   |   |  |   |          |       |    | 100.0 | ) "       |

Lechesne.—The alloy known under this name has been patented in England by the Société Anonyme La Ferro-Nickel, of Paris. The patent mentions two alloys containing :

| Ι.                              | II.       |
|---------------------------------|-----------|
| Copper                          | 600 parts |
| Nickel                          | 400 "'    |
| Aluminium 1 $\frac{3}{4}$ "     | 1 "       |
| Vhich would give in per cent. : | II.       |
| Copper                          | 59.97     |
| Nickel 9.98                     | 39.98     |
| Aluminium 0.18                  | 0.5       |
| 100.00                          | 100.00    |

The first of these alloys is the one to which the name "Lechesne" appears to be given. In a description of the manufacture of this alloy a French magazine states that the nickel is first put into a crucible and melted, the copper stirred in gradually, then the heat raised and the aluminium added. The alloy is heated almost to boiling and cast very hot. It is claimed that this alloy is equal to the finest German silver, being very malleable, homogeneous, strong and ductile, and stands hammering, chasing, punching, etc., perfectly.

The following alloys are recommended by G. F. Andrews as being all very hard, fine-grained and showing great strength.

|          | Aluminium.  | Nickel.          | Copper.         |
|----------|-------------|------------------|-----------------|
| No. I.   | $6^{1}_{4}$ | $21\frac{1}{4}$  | $72\frac{1}{2}$ |
| No. II.  | 10          | $\underline{24}$ | 66              |
| No. III. | 12          | 33               | 55              |

No. II has the color of ten carat gold and takes a fine polish; No. III has a beautiful golden-brown color; No. I is similar, but richer and deeper. These alloys may become very useful for decorative purposes.

Sun bronze.—An alloy known under this name is composed of cobalt 60 or 40, aluminium 10, copper 40 or 30.

*Metalline.*—This alloy contains cobalt 35, aluminium 25, iron 10, copper 30.

*Nickel-aluminium* is composed of nickel 20 parts, aluminium 8. It is used for decorative purposes.

Rosine.—Nickel 40 parts, silver 10, aluminium 30, tin 20. Used for jewelers' work.

Aluminium alloy for dentists' fillings patented by C. C. Caroll (U. S. Patent 475,382, May 24, 1892). Silver 42.3 per

cent., tin 52, copper 4.7, aluminium 1. It is reduced to powder and then forms an amalgam with mercury.

Alloy for type-metal patented by Mr. Thomas MacKellar (U. S. Patent 463,427, November 11, 1891). Lead 65 parts, antimony 20, and 10 parts of an alloy consisting of equal parts of tin, copper and aluminium. The tin-copper-aluminium alloy is first melted, the antimony added to it, and the mixture is then added to the melted lead.

Aluminium bronze alloy patented by John A. Jeancon (U. S. Patent 446,351, February 10, 1891). Aluminium 12 to 25 parts, manganese 2 to 5, copper 75 to 85.

*Hercules metal.*—The alloy known under this name consists of bronze 88 per cent., aluminium  $2\frac{1}{2}$ , tin 10 and zinc 2.

Alloy of aluminium and chromium.—With chromium, aluminium forms a beautiful alloy, which can be prepared by a tedious operation in the form of crystalline needles. It has no technical application, and is here simply mentioned for the sake of completeness.

Alloy of aluminium and tin.—An alloy, the use of which it is claimed overcomes the difficulties of working and welding aluminium, is formed by melting together 100 parts of aluminium with 10 of tin. The alloy is whiter than aluminium and but little heavier, its specific gravity being 2.85. By most substances it is less attacked than pure aluminium, and it can be welded and soldered like brass without any special preparation.

Brazing aluminiuu bronze.—Aluminium-bronze will braze as well as any other metal, using one-quarter brass solder (zinc 50 per cent., copper 50 per cent.) and three-quarters borax.

Soldering aluminium-bronze.—To solder aluminium-bronze with ordinary soft (pewter) solder : Cleanse well the parts to

be joined free from dirt and grease. Then place the parts to be soldered in a strong solution of sulphate of copper, and place in the bath a rod of soft iron touching the parts to be joined. After a while a copper-like surface will be seen on the metal. Remove from bath, rinse quite clean, and brighten the surfaces. These surfaces can then be tinned by using a fluid consisting of zinc dissolved in hydrochloric acid in the ordinary way with common soft solder.

Mierzinski recommends ordinary hard solder, and says that Hulot uses an alloy of the usual half-and-half lead-tin solder with 12.5, 25, or 50 per cent. of zinc amalgam.

Aluminium-bronze for jewelry may be soldered by using the following composition :—

Hard solder for 10 per cent. aluminium-bronze.—Gold 88.88 per cent., silver 4.68, copper 6.44.

Middling hard solder for 10 per cent. aluminium-bronze.— Gold 54.40 per cent., silver 27.60, copper 18.

Soft solder for aluminium-bronze.—Brass (copper 70 per cent., tin 30 per cent.) 14.30, gold 14.30, silver 57.10, copper 14.30.

Schlosser gives the following directions for preparing solder for aluminium-bronze: White solder is alloyed with zinc amalgam in the proportions of

| White solder | • |   | • | • | • | • |   |   | • | • |   | <b>2</b> | 4 | 8 |
|--------------|---|---|---|---|---|---|---|---|---|---|---|----------|---|---|
| Zinc amalgam | • | • |   | • | • | • | • | • | • | • | • | 1        | 1 | 1 |

The white solder may be composed as follows :---

| Brass. |   |  |   |  |   |   |   |   |   | ÷ |   |   | 40 | 22 | 18 |
|--------|---|--|---|--|---|---|---|---|---|---|---|---|----|----|----|
| Zine . |   |  |   |  | • | • | • | • | • |   | • | • | 2  | 2  | 12 |
| Tin    | • |  | • |  |   |   |   | • | • | • | • |   | 8  | 4  | 30 |

The zinc amalgam is made by melting 2 parts of zinc, adding 1 part of mercury, stirring briskly and cooling the

amalgam quickly. It forms a silver white, very brittle alloy. The white solder is first melted, the finely powdered zinc amalgam added, and the alloy stirred until uniform and poured into bars.

Soldering aluminium.—Although strictly speaking the subject of soldering aluminium-bronze and aluminium does not belong here, a special chapter being devoted to "Soldering," it is preferred to refer to it in this place.

From the articles which occasionally appear in the trade journals, both in Europe and in this country, and the patent list, it appears that the difficulties of soldering aluminium have not been entirely overcome. Some of the solders are here introduced without comment.

Mourey's aluminium solders are composed of :---

|           | 1. | 11. | ш. | IV. | v. |
|-----------|----|-----|----|-----|----|
| Zinc      | 80 | 85  | 88 | 90  | 94 |
| Copper    | 8  | 6   | 5  | 4   | 2  |
| Aluminium | 12 | 9   | 7  | 6   | 4  |

In making these solders the copper should be melted first, the aluminium then added, and the zinc last. Stearin is used as a flux to prevent the rapid oxidation of the zinc. When the last metal is fused, which takes place very quickly, the operation should be finished as rapidly as possible by stirring the mass, and the alloy should then be poured into an ingotmould of iron, previously rubbed with fat. The pieces to be soldered should first be cleaned thoroughly and roughened with a file and the solder placed on the parts in small fragments, the pieces being supported on a piece of charcoal. The place of juncture should then be heated with the blast lamp. The union is facilitated by the use of a soldering tool of aluminium. This last is said to be essential to the success of the operation.

Alloy I is recommended for small objects of jewelry; alloy IV is said to be best adapted for larger objects and for general work, and is that most generally used. The successful performance of the act of soldering appears to require skill and experience, but the results obtained are said to leave nothing to be desired. Soldering tools of copper or brass should be avoided, as they would form colored alloys with the aluminium and solder. The skillful use of the aluminium tool, however, requires some practice. At the instant of fusion the operator must apply some friction, and, as the solder melts very suddenly, the right moment for this manipulation may be lost unless the workman is experienced.

Bourbouze's aluminium solder. Tin 45, aluminium 10. If the soldered articles are not to be subjected to further working, a solder containing somewhat less aluminium may be used.

Frishmuth's aluminium solders.

| Ι.        | II.      |
|-----------|----------|
| Silver 10 |          |
| Copper    |          |
| Aluminium |          |
| Tin 60    | 95 to 99 |
| Zinc      | —        |
| Bismuth   | 5 to 8   |

Solder No. II. is to be applied with the soldering iron, but on account of its great fusibility it appears to us only suitable for small articles, which after soldering are not to be subjected to further heating.

M. H. Lancon has patented<sup>\*</sup> the following method of preparing aluminium solder: Pure aluminium is melted, the surface of the melted metal completely covered with a layer of

\* German patent, 66,398.

### ALUMINIUM ALLOYS.

phosphoric acid, acid sodium sulphate, fluorine combinations or other salts of an acid reaction, and finally a small quantity of copper and tin is added to the melted metal, or copper, bismuth, zinc and tin, or copper, antimony, bismuth and zinc, or copper, antimony, bismuth and tin. The composition of the solder varies according to the articles to be soldered.

For wire and thin articles the solder is composed of pure aluminium 95 parts, copper 1, tin 4. The 4 parts tin may be replaced by bismuth 2 parts, zinc 1, tin 1.

For large pieces of aluminium and aluminium sheets, the solder is composed of: Pure aluminium 95 parts, copper 2, antimony 1, bismuth 1, zinc 1; or: Pure aluminium 60, copper 13, bismuth 10, antimony 15, tin 2.

Schlosser recommends two solders containing aluminium as especially suitable for soldering dental work on account of their resistance to chemical action. Copper cannot be allowed in alloys intended for this use, or only in very insignificant quantity, since it is so easily attacked by acid food, etc. Since these two alloys can probably be used also for aluminium dental work, their composition is here given :

Platinum aluminium solder. Gold 30, platinum 1, silver 20, aluminium 100.

Gold aluminium solder. Gold 50, silver 10, copper 10, aluminium 20.

O. M. Thowless has patented the following solder for aluminium and the method of applying it.\* The alloy is composed of: Tin 55 parts, zinc 23, silver 5, aluminium 2.

The aluminium and silver are first melted together, the tin added, and lastly the zinc. The metallic surfaces to be united are immersed in dilute caustic alkali, or a cyanide so-

\* English patent, 10,237, Aug. 29, 1885.

lution, washed and dried. They are then heated over a spirit lamp, coated with the solder, and clamped together, small pieces of the alloy being placed around the joints. The whole is then heated to the melting point of the solder, and any excess of it removed. No flux is used.

C. Sauer of Berlin has patented the following : An alloy is made of : Aluminium 9 parts, silver 1, 2, 3, or 4, copper 2, 3, 4, or 5.

He also claims the above alloy, to which is added 1 or 2 parts of zinc, cadmium, or bismuth, or even a fusible metal such as Wood's alloy. A small proportion of gold may be added. In making, the copper and silver are first melted, melted aluminium added, and the solid zinc last dropped in. In using, the alloy is broken small, spread between the surfaces to be soldered, previously heated, and the joint then made with a soldering iron. No flux is required.

Chloride of silver has been recommended as a solder. It is to be finely powdered and spread along the junction to be soldered, and melted with the blow-pipe.

*Richards's solder.* Mr. Joseph Richards has patented\* in the United States and England a composition containing a small amount of phosphorus, and describes as preferable a solder composed of :—

| Tin          | • | • | • | • | 32 p | oarts | = | $78.34 \mathrm{per}$ | cent. | tin.        |
|--------------|---|---|---|---|------|-------|---|----------------------|-------|-------------|
| Zinc         |   | • |   |   | 8    | "     |   | 19.04                | "     | zinc.       |
| Aluminium.   | • | • | • | • | 1    | " "   | _ | 2.38                 | "     | aluminium.  |
| Phosphor tin |   | • | • |   | 1    | "     | = | 0.24                 | "     | phosphorus. |

On remelting some of this solder, a liquation was noticed, and it was inferred that the more fusible part was probably a \* United States patent, 478,238, July 5, 1892; English patent, 20,208, 1892.

better alloy for soldering, being less likely itself to liquate. It was therefore analyzed, and found to contain 71.65 per cent. of tin corresponding closely to the formula Sn<sub>4</sub>Zn<sub>3</sub>, which would call for 70.7 per cent. The solder as now made contains 1 part aluminium, 1 part phosphor tin, 11 parts zinc and 29 parts tin, giving it 71.2 per cent. of tin. The solder fuses easily at a heat attainable with a copper or nickel bolt, and possesses great ability to take hold on the metal. It is so tough that if a joint is well made the metal will break before the solder. It is very nearly the color of aluminium, but darkens slightly on standing some time; when the article is in constant wear, however, the solder retains its bright color, when discolored it becomes bright again by polishing. The edges to be joined are filed or scraped clean immediately before soldering, then, if the piece will allow, heated to a temperature at which the solder melts, and the edges are tinned by rubbing with a stick of solder. If the whole piece cannot be heated, the edges can be tinned by heating with a tinned bolt and rubbing in the melted solder briskly. Any surplus solder is removed from the edges by a small scraper, while still hot. The prepared edges are then soldered together in any way desired. For a lap-joint, the edges are overlapped, the soldering bolt passed along, and a little extra solder melted in the joint. For a joint at an angle, it is necessary that the bolt be shaped to fit, as the solder must be rubbed in well at the edges. No flux of any kind is to be used either on the bolt or on the joint. In making a lock seam, the edges of the aluminium should be coated with the solder as above described before being turned over, else the solder cannot soak into the joint. Common sheet-tin does not need such preparation, because the whole sheet is already tinned to start with. In brief, aluminium is similar to copper and blackiron, not like tinned iron, and the edges must be prepared for soldering.

# CHAPTER XII.

## TIN ALLOYS.

As seen from the alloys previously described, tin is much used in the preparation of mixtures of metals, and, although soft in itself, it has the property of hardening many other soft metals. Tin by itself is actually only used for tinning iron, etc.; for casting it is in most cases used in the form of an alloy.

Alloys of tin and lead.—Tin and lead alloy freely in all proportions, and the two metals are frequently found associated in nature. The alloys are easily made, and they generally impart more resistance to the lead without sensibly impairing the qualities of the tin. It would not be impossible to ascertain the proportion of lead in the alloy by the behavior of the latter under a chisel, a punch, and by the streak it leaves upon paper. Lead added to tin increases its malleability and ductility, but diminishes its toughness. Difficult to break even after successive bendings, tin becomes more brittle when alloyed with lead. The fracture is then more marked than that of lead, whatever may be the proportions in the alloy, the latter metal being more easily separated than tin, but requiring, however, to be torn asunder. The strongest alloy of tin and lead is produced by alloying tin 3 parts and lead 1, the density of this alloy being 8. According to Watson, the densities of alloys of tin and lead are as follows :---

| 0  | 1 |   | • | • | • | • | • | • | • |   | •  | • |   | • | • | • | • |   | 11.3 |
|----|---|---|---|---|---|---|---|---|---|---|----|---|---|---|---|---|---|---|------|
| 10 | 1 |   |   | • | • | • | • |   |   |   | •  |   | • |   |   |   |   | • | 7.2  |
| 32 | 1 | • |   |   |   |   |   |   |   | • | .• |   |   |   |   |   |   | • | 7.3  |
| 16 | 1 |   | • |   |   |   |   |   | • |   |    |   |   | • |   |   |   | • | 7.4  |
| 8  | 1 |   |   | • |   |   |   |   |   |   |    |   |   |   |   |   |   |   | 7.6  |
| 4  | 1 |   |   |   |   |   |   | • |   |   | •  |   |   |   |   |   |   |   | 7.8  |
| 2  | 1 |   |   |   |   |   |   |   |   |   |    |   |   |   |   |   | • | • | 8.2  |
| 1  | 1 |   |   |   |   |   |   |   |   |   |    |   |   |   |   |   |   |   | 8.8  |

Alloys of tin and lead were formerly much used in the manufacture of domestic utensils. They are, however, not suitable for this purpose, on account of the solubility and poisonous properties of the lead. Under no circumstances should an alloy of tin and lead used in the manufacture of domestic utensils contain more than 10 to 15 per cent. of lead. Such an alloy is not sensibly attacked by vinegar and fruit acids. But unfortunately there are cases in which the so-called tin contains as much as one-third of its weight of lead.

Alloys containing from 10 to 15 per cent. of lead have a beautiful white color, are considerably harder than pure tin and much cheaper. Many alloys of tin and lead have an especially lustrous appearance and are used for stage-jewelry and mirrors for reflecting the light of lamps, etc. An especially lustrous alloy is known under the name of *Fahlun brilliants*. It is used for stage-jewelry and consists of tin 29 parts, lead 19. The alloy is poured into moulds faceted in the same manner as diamonds. Seen in an artificial light, the pieces of metal thus cast are so brilliant as to produce the effect of diamonds. Other alloys of tin and lead of some importance are those used in the manufacture of toys (tin soldiers). They must fill the moulds well and be cheap, and, consequently, as much as 50 per cent. of lead is used. With the use of sharp iron or brass moulds such an alloy yields good castings. Toys can also be prepared from type-metal, which is even cheaper than alloys of tin and lead, but has the disadvantage of readily breaking on sharply bending the articles.

In the following table the melting points of alloys of tin and lead as determined by Messrs. Parkes and Martin are given :—

| Composition.                            |   | Melting<br>points. | Comp  | Melting<br>points. |            |  |  |
|---|---|--------------------|---|--------------------|------------|--|--|
| Tin.                                    | Lead.   | Degrees F.         | Tin.  | Lead.              | Degrees F. |  |  |
| 4                                       | 4   | , 372°             | 4   | 28                 | 527°       |  |  |
| $\begin{array}{c} 4\\ 6\\ 8\end{array}$ | 4   | 336                | 4   | 30                 | 530        |  |  |
|   | 4   | 340                | 4   | 32                 | 532        |  |  |
| 10                                      | $ \begin{array}{c} 4 \\ 4 \\ 4 \\ 4 \\ 4 \\ 4 \\ 4 \\ 4 \\ 4 \\ 6 \\ 8 \\ \end{array} $ | 348                | 4   | 34                 | 535        |  |  |
| 12                                      | 4   | 336                | 4   | 36                 | 538        |  |  |
| 14                                      | 4   | 362                | 4   | 38                 | 540        |  |  |
| 16                                      | 4   | 367                | 4   | 40                 | 542        |  |  |
| 18                                      | 4   | 372                | 4   | 42                 | 544        |  |  |
| 20 .                                    | 4   | 378                | 4   | 44                 | 546        |  |  |
| 22                                      | 4   | 380                | 4   | 46                 | 548        |  |  |
| 24                                      | 4   | 382                | 4   | 48                 | 550        |  |  |
| $\begin{array}{c} 4\\ 4\\ 4\end{array}$ | ) 4   | 392                | 4   | 50                 | 551        |  |  |
| 4                                       | ) 6   | 412                | 4   | 52                 | 552        |  |  |
| 4                                       |   | 442                | 4   | 54                 | 554        |  |  |
| 4                                       | 10  | 470                | 4   | 56                 | 555        |  |  |
| 4                                       | 12  | 482                | 4   | 58                 | 556        |  |  |
| 4                                       | 14  | 490                | 4   | 60                 | 557        |  |  |
| 4                                       | 16  | 498                | 4   | 62                 | 557        |  |  |
| 4                                       | 18  | 505                | 4   | 64                 | 557        |  |  |
| 4<br>4<br>4<br>• 4                      | 20  | 512                | 4 -   | 66                 | 557        |  |  |
|   | 22  | 517                | 4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4 | 68                 | 557        |  |  |
| 4                                       | 24  | 519                | 4   | 70                 | 558        |  |  |
| 4                                       | 26  | 523                |   |                    |            |  |  |

For baths used by cutlers and others in tempering and heating steel articles, Parkes and Martin propose the following alloys :—

| No. Use.   | Compo  | osition.   | Melting<br>points.  |
|--|--|--|---|
|  | Lead.  | Tin.   | Degrees F.  |
| 1       Lancets.         2       Other surgical instruments.         3       Razors         4       Pen-knives         5       Knives, scalpels, etc.         6       Chisels, garden knives.         7       Hatehets         8       Table knives         9       Swords, watch springs.         10       Large springs, small saws         11       Hand saws         12       Articles of low temper | $     \begin{array}{r}       7 \\       7_{\frac{1}{2}} \\       8 \\       8_{\frac{1}{2}} \\       10 \\       14 \\       19 \\       30 \\       48 \\       50 \\       Oil bo \\       1     \end{array} $ | 4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>4<br>1<br>1<br>1<br>1<br>1 | $\begin{array}{r} 420^{\circ} \\ 430 \\ 442 \\ 450 \\ 470 \\ 490 \\ 509 \\ 530 \\ 558 \\ 558 \\ 600 \\ 612 \end{array}$ |

# Britannia Metal.

The alloy known under this name consists principally of tin alloyed with antimony. Many varieties contain only these two metals and may be considered tin hardened by antimony. Other alloys, also called Britannia metal, contain, however, in addition, certain quantities of copper, sometimes lead, and occasionally, though rarely, bismuth.

The Pewterers' Company of England, which has been an incorporated society ever since the reign of Edward IV. (1474), in 1772 attempted to regulate the quality of pewter wares by permitting enough lead to bring the density of pewter from  $\frac{1835}{1820}$  to  $\frac{1985}{1820}$ , that of tin. Persons who depart from this regulation were liable to expulsion from the guild, but it has been so greatly disregarded as to have very little effect in keeping up the standard of pewter.

Britannia metal has always a silvery color with a bluish tinge, and, on account of its hardness, takes a fine polish, which it retains on exposure to the air. Though it is quite hard, in strength it only slightly surpasses tin. Good Britannia metal shows a fine-grained, jagged fracture ; if the fracture

353

be quite coarse and strongly crystalline the alloy contains too much antimony, and, as a rule, is too brittle to be worked to advantage.

Even with a correct composition, the brittleness of Britannia metal is such that in rolling it out to sheet the edges generally become full of cracks. A content of iron or zinc increases this brittleness to a considerable extent, and, in preparing an allow to be rolled out into sheet or to be used for stamped articles, great care must be had to have the metals to be used entirely free from iron or zinc. A content of copper increases the ductility of Britannia metal, but decreases its fusibility, which is one of its most valuable properties, and besides gives to the color a strong vellowish cast. An addition of lead is of advantage especially to metal to be principally used for castings it becoming more fusible thereby and filling out the moulds better, but its color acquires a strong brownish cast, and articles manufactured from it lose their lustre on exposure to the air much more quickly than those containing no lead.

A large content of antimony, to be sure, imparts great hardness and a permanent brilliant lustre to Britannia metal, but it also decreases its ductility. And, moreover, the antimony possessing poisonous properties, its use must be restricted, especially if the alloy is to be employed in the manufacture of domestic utensils, such as coffee and tea pots, etc. It need scarcely be said that for sanitary reasons the antimony must be free from arsenic, and besides, a very small content of it renders the alloy extremely brittle, and articles manufactured from it tarnish quickly, especially on exposure to moist air. Alloys consisting of tin and antimony alone would seem to deserve the preference, and a composition of tin 90 parts, antimony 10, can be especially recommended as regards resistance to chemical influences and facility of working.

For most purposes, not requiring a special degree of hardness, this alloy is the most suitable, it being readily fusible and filling the moulds out well. For articles subjected to constant wear a harder alloy is required.

The following table shows the composition of several varieties of Britannia metal :---

| Britannia metal.                       | Parts.          |           |         |       |       |          |  |  |  |  |  |  |  |  |
|--|-----------------|-----------|---------|-------|-------|----------|--|--|--|--|--|--|--|--|
|  | Tin.            | Antimony. | Copper. | Zinc. | Lead. | Bismuth. |  |  |  |  |  |  |  |  |
| English                                | 81.90           | 16.25     | 1.84    |       | _     |          |  |  |  |  |  |  |  |  |
| ···· · · · · · · · · · · · · · · · · · | 90.62           | 7.81      | 1.46    | ·     |       | _        |  |  |  |  |  |  |  |  |
| <u>د،</u>                              | 90.1            | 6.3       | 3.1     | 0.5   | _     |          |  |  |  |  |  |  |  |  |
|  | 85.4            | 9.66      | 0.81    | 3.06  |       |          |  |  |  |  |  |  |  |  |
| Pewter                                 | 81.2            | 5.7       | 1.60    | _     | 1.15  |          |  |  |  |  |  |  |  |  |
| "                                      | 89.3            | 7.6       | 1.8     | _     | 1.8   |          |  |  |  |  |  |  |  |  |
|  | 83.30           | 6.60      | 1.60    | 3.06  | -     | 1.60     |  |  |  |  |  |  |  |  |
| Tutania                                | 91.4            |           | 0.7     | 0.3   | 7.6   | _        |  |  |  |  |  |  |  |  |
| Queen's metal                          | 88.5            | 7.1       | 3.5     | 0.9   | _     |          |  |  |  |  |  |  |  |  |
| Ğerman                                 | 72              | 24        | 4       | _     |       |          |  |  |  |  |  |  |  |  |
|  | 84              | 9         | 2       | 5     |       |          |  |  |  |  |  |  |  |  |
| " (cast)                               | $\overline{20}$ | 64        | 10      | 6     |       |          |  |  |  |  |  |  |  |  |
| Malleable (cast)                       | 48              |           | 3       | 48    |       | 1        |  |  |  |  |  |  |  |  |
| Birmingham (sheet)                     | 90.60           | 7.80      | 1.50    |       | _     |          |  |  |  |  |  |  |  |  |
| · (cast).                              | 90.71           | 9.20      | 0.09    | _     |       |          |  |  |  |  |  |  |  |  |
| Karmasch's.                            | 85.0            | 5.0       | 3.60    | 1.40  | _     | 1.60     |  |  |  |  |  |  |  |  |
| Koeller's.                             | 85.70           | 10.40     | 1.00    |       |       | 1.80     |  |  |  |  |  |  |  |  |
| Wagner's (fine).                       | 85.64           | 9.66      | 0.81    | 3.06  |       | 0.83     |  |  |  |  |  |  |  |  |
|  |                 | 1         |         |       |       |          |  |  |  |  |  |  |  |  |

Britannia ware made in Sheffield is often composed of block tin  $3\frac{1}{2}$  parts, antimony 28, copper 8, brass 8.

Dr. Karl Karmarsch, who thoroughly studied the properties of Britannia metal, says that the specific gravity of the alloys is 7.339 for laminated sheets, and 7.361 for casting. He explains this anomaly by the fact that the molecules, under the action of the rolls, have a tendency to become sepa-

rated, their softness and malleability not being great enough to allow of a regular and uniform compression. This is not an isolated fact. M. LeBrun has also found a lower specific gravity for certain alloys of copper and zinc which had been laminated or hammered.

Britannia metal is prepared by first melting the copper by itself, then adding a portion of the tin and the entire quantity of the antimony. The fire can then be quickly moderated, because the new alloy has a much lower melting point than copper.

The last quantity of tin is finally added, and the alloy uninterruptedly stirred for some time to make it thoroughly homogeneous.

Britannia metal can be brought into determined shapes by pressing and rolling, which will be referred to later on, but it being always to some extent brittle, it is preferred to prepare many articles by direct casting. To obtain clean and beautiful castings, requiring but little after manipulation, it is best to use brass moulds. Before casting, the moulds have to be strongly heated and the interior lined with a special coating to prevent the alloy from adhering. This is effected by means of a mixture of lamp-black and oil of turpentine, or by lamp-black alone, and, though the first process is the more simple and convenient, the latter is preferable, especially for casting fine articles. The moulds can be so coated as to be beautiful and uniform by using an ordinary lamp, similar to a spirit lamp, filled with oil of turpentine. By holding the cold mould over the dull flame of such a lamp, it becomes coated with a delicate film of a velvety black soot, which, while it preserves all the fine lines of the mould, prevents the alloy from adhering.

Instead of lamp-black, some manufacturers use finely elutriated reddle or red chalk mixed to a uniform mass with water. With moulds having many small and at the same time deep turns, it is difficult perfectly to coat the inside with the protecting mass, and the coating with lamp-black is decidedly to be preferred.

With ordinary moulds it is, of course, impossible to cast an article which is to have a certain shape, in one piece. The different parts are consequently cast separately, and subsequently put together with a solder of a color as nearly like that of the metal as possible. Such articles can, however, be also cast in one piece. We will take, for example, an article frequently made of Britannia metal : a coffee-pot, whose shape is such that it must consist of several pieces. To cast it in one piece, the mould must be so constructed that it can be completely removed from the finished castings.

The separate parts of the mould having been coated with lamp-black, or reddle, are put together, and the whole heated nearly to the temperature of the melted Britannia metal. The latter is then poured into the mould until it seems entirely filled. After waiting until it may be supposed that a sufficiently thick layer of metal is solidified, the mould is quickly turned over to allow the still liquid portion of the metal to run out.

In order to obtain castings of the right condition, this mode of procedure requires considerable practical skill, it being necessary to hit the exact moment at which the layer of metal has acquired the required thickness, and before succeeding the operator may be prepared to meet with many failures. But by noting by means of a watch the time allowed to pass between pouring the metal into the mould, and pouring the

### TIN ALLOYS.

still liquid portion out, the exact time required for the formation of a sufficiently thick layer will soon be learned.

The inside of the articles obtained by the above mode of casting is something roughly crystalline. This is due to the metal beginning to crystallize, and the corners and edges of the small crystals being exposed by pouring out the liquid portion of the metal. Care must therefore be had to use for such casting an alloy giving a fine-grained mass. The interior of the articles, as far as accessible, can also be smoothed, while the article is still in the mould, with a burnishing stone or burnisher.

For articles to be made by stamping or other mechanical process, the alloy resulting from melting the metals together is ladled into cast-iron boxes, and the slabs thus made are subsequently rolled into sheet. Spherical vessels are usually "spun up" in halves, which are then united by soldering, and smaller articles are generally pressed in moulds by a stamping press of very simple construction.

Cast or stamped Britannia metal has always an unsightly gray white appearance, the innumerable small crystals of which the surface of the article is composed preventing a complete reflection of the light. The articles must, therefore, be polished, which is effected with a burnisher, or, if their shape permits, upon the lathe by means of wooden disks covered with leather rubbed with emery.

A great many articles of Britannia metal are at the present time electro-plated with silver, the same as objects of German silver, which are so well manufactured in England, Germany, and this country, that it is difficult to distinguish them from pure silver. In some cases the Britannia metal is electroplated with tombac.

Biddery metal.—The name of this alloy is derived from Biddery, a city of the East Indies. It may be classed among the alloys known under the collective term of Britannia metal, but differs from it in containing lead instead of antimony.

Genuine Indian Biddery metal, which is frequently imitated in England, consists of—

|        | Parts.        |  |  |
|--------|---------------|--|--|
|        | I. II.        |  |  |
| Copper | <br>3.5 11.4  |  |  |
| Zine   | <br>93.4 84.3 |  |  |
| Tin    | <br>— 1.4     |  |  |
| Lead   | <br>3.1 2.9   |  |  |

According to Dr. Hamilton, who had occasion to witness the operation, 123.6 parts of zinc, 4.6 of copper, and 4.14 of lead, together with a mixture of resin and wax to prevent oxidation, are melted together in a crucible. The fused metal is poured into clay moulds and the articles finished with the lathe. The Indian artists impart to the articles a beautiful velvety-black color by treatment with a solution of sulphate of copper, and decorate the surface in a very peculiar and original manner. By means of a graver, lines forming frequently very artistic designs are cut into the surface. The lines are then inlaid with fine gold and silver wire, pressed in by means of a burnishing tool, after which the articles are carefully polished. The beauty of the black coating being somewhat marred by the manipulation, is restored by treating the articles with a solution of sulphate of copper, sal ammoniac, and saltpetre, and finally polishing with very fine polishing agents.

The finished articles have a peculiar appearance, the gold

and silver designs upon a velvety-black ground presenting frequently a striking resemblance to an embroidery executed in gold and silver threads upon black velvet.

There are several other alloys somewhat resembling Britannia metal which are known under various names. Of these we mention :—

Ashberry metal.—It is composed of-

|           | Parts. |     |  |  |
|-----------|--------|-----|--|--|
|           | Ĩ.     | ,   |  |  |
| Copper    | 2.0    | 3.0 |  |  |
| Tin       | 80.0 7 | 9.0 |  |  |
| Antimony  | 14.0 1 | 5.0 |  |  |
| Zine      | 1.0    | 2.0 |  |  |
| Nickel    | 2.0    | 1.0 |  |  |
| Aluminium | 1.0    |     |  |  |

Minofor metal.—This alloy is composed of-

|          | Parts.   |  |  |  |
|----------|----------|--|--|--|
|          | I. II.   |  |  |  |
| Copper   | 3.26 4   |  |  |  |
| Tin      | 67.53 66 |  |  |  |
| Antimony | 17.00 20 |  |  |  |
| Zine     | 8.94 9   |  |  |  |
| Iron     | — 1      |  |  |  |
|          |          |  |  |  |

This alloy, as well as the Ashberry metal, is employed for making forks and spoons, coffee-pots, tea-pots, and all similar articles generally made of ordinary Britannia metal, composed of 9 parts of tin and 1 of antimony. Britannia metal in fact surpasses both the Ashberry and Minofor metals in beauty, but the latter are harder.

*English metal* is a more complex alloy and is composed of: Tin 88 parts, pure copper 2, brass (copper 75, zinc 25) 2, nickel 2, bismuth 1, antimony 8, tungsten 2.

# CHAPTER XIII.

## LEAD ALLOYS.

LEAD in a pure state is but little used except for pipes, foil, and for certain chemical purposes. Some of its alloys, however, are of great importance, and are generally used, notwithstanding many efforts to replace them, especially for typographical purposes. An addition of other metals generally makes the lead harder and more or less injures its ductility. An addition of copper imparts to the alloy greater hardness without impairing its ductility to a serious extent, and if the content of copper be small such an alloy can be drawn to pipes or rolled out to thin sheet.

A content of arsenic, antimony, and tin increases the hardness of lead, but considerably impairs its ductility. Antimony and arsenic especially exert a strong influence in this respect while the lead-tin alloys retain their ductility. Leadantimony alloys containing less than 22 per cent. antimony contract on cooling and are therefore not suitable for sharp castings; only mixtures richer in antimony expand on cooling and reproduce the finest depressions of the mould. The hardness of lead-antimony alloys increases with the content of antimony, alloys with 11 to 17 per cent. antimony being about four times as hard as lead, and alloys with 23.5 per cent. antimony five times. A larger content of antimony makes the alloys still harder (with over 25 per cent. twelve times as hard as lead), but on account of their brittleness they are not suitable for technical purposes. The affinity of zinc

### LEAD ALLOYS.

and iron for lead being very small, it is difficult to prepare alloys with them. The most important alloys of lead are typemetal and shot-metal; the first generally an alloy of lead with antimony, and the latter, one with arsenic.

# Type-Metal.

An alloy to serve for type-metal must allow of being readily cast, fill the moulds sharply, and at the same time be as hard as possible. Though it is difficult entirely to satisfy these demands, an alloy consisting of lead and antimony answers the purpose best. Antimony increases the hardness of lead and renders it very brittle if present in too large a proportion. An alloy of lead 76 parts, and antimony 24, appears to be the point of saturation of the two metals. More fusible than the average fusibility of the two component metals, ductile and considerably harder than lead, this alloy expands in cooling, and to this property is due its employment for the manufacture of type. But the above compound does not answer perfectly well, especially for small type. When too soft it gets out of shape, when too hard it cuts the paper; and it happens very often that the founder passes to one or the other extreme. When the alloy is melted in contact with the air antimony is oxidized much before lead, and this accounts for the difficulty of obtaining an exact composition. It is a constant subject of study for type-founders to arrive at a fusible and homogeneous metal with much expansion, resistant as much as possible, and, at the same time, soft enough to be repaired and to bear the action of the press without being soon put out of shape.

The alloy of equal proportions is dry, porous, and brittle. These defects increase in the same ratio as the proportion of antimony increases. On the other hand they disappear when the lead takes the place of antimony. An alloy of lead 4 parts and antimony 1 is compact, much harder than lead, and remains malleable.

An alloy of antimony 1 part and lead 8 is very tough, and has a specific gravity greater than the proportional specific gravity of the two metals. It is more malleable than the preceding alloy and retains a certain hardness. The hardness imparted by antimony, the increase of toughness, and that of the specific gravity, are very perceptible up to the alloy of antimony 1 part and lead 16.

At present a great many receipts for type metal are known, in the preparation of which other metals besides lead and antimony are used for the purpose of rendering the alloy more fusible (additions of bismuth as imparting to them greater power of resistance, copper and iron having been recommended for the purpose). By such admixtures the fusibility of the alloys is, however, impaired, and the manufacture of the types becomes much more difficult than with an alloy of lead and antimony alone. In the following table some alloys suitable for casting type are given :—

| Metals.  | Parts. |     |      |     |    |     |      |       |      |    |
|----------|--------|-----|------|-----|----|-----|------|-------|------|----|
|          | Ι.     | II. | III. | IV. | v. | VI. | VII. | VIII. | IX.  | х. |
| Lead     | 3      | 5   | 10   | 10  | 70 | 60  | 55   | 55    | 100  | 6  |
| Antimony | 1      | 1   | 1    | 2   | 18 | 20  | 25   | 30    | - 30 |    |
| Copper   |        |     | —    | _   | 2  | -   | —    | -     | 8    | 4  |
| Bismuth  |        |     | —    | 1   |    |     | —    | —     | 2    |    |
| Zinc     |        | —   |      | —   | -  |     |      |       |      | 90 |
| Tin      |        |     |      |     | 10 | 20  | 20   | 15    | -20  |    |
| Nickel.  | -      |     |      | -   | -  |     | -    |       | 8    |    |

French and English type-metals always contain a certain quantity of tin, as shown by the following analysis :----

LEAD ALLOYS.

|           |       | Eng  | glish typ | es.  | French types |  |  |  |
|-----------|-------|------|-----------|------|--------------|--|--|--|
| Lead      | <br>• | 69.2 | 61.3      | 55.0 | 55           |  |  |  |
| Antimony. | <br>• | 19.5 | 18.8      | 22.7 | 30           |  |  |  |
| ·Tin      | <br>  | 9.1  | 20.2      | 22.1 | 15           |  |  |  |
| Copper    |       | 1.7  |           | _    |              |  |  |  |
|           |       | 99.5 | 100.3     | 99.8 | 100          |  |  |  |

According to Ledebur, type-metal contains :---

| Lead      |  |   |  |   |  | 75              | 60 | 80 | 82   |
|-----------|--|---|--|---|--|-----------------|----|----|------|
| Antimony. |  |   |  |   |  | $\overline{23}$ | 25 | 20 | 14.8 |
| Tin       |  | • |  | • |  | <b>2</b>        | 15 |    | 3.2  |

I. Ordinary; II. fine quality of type-metal; III. alloy for sticks; IV. for stereotype plates.

*Erhart's type-metal.*—Erhart recommends the following alloys as being hard and at the same time ductile : Zinc 89 to 93, tin 9 to 6, lead 2 to 4, copper 2 to 4.

The tin is first melted and then the lead, zinc and finally the copper are added in succession.

The manufacture of the types from the alloys is seldom effected by cold stamping in steel moulds, the process being very expensive; hence they are generally cast. According to the old process the types are cast piece by piece by means of a small casting ladle, but for types\_with a large face and much detail, the motion of the hand is barely sufficient to give the momentum required to throw the metal into the matrix and produce a clean, sharp impression. A machine is then used, which may be compared to a small forcing-pump, by which the mould is filled with the fluid metal; but from the greater difficulty of allowing the air to escape such types are in general considerably more unsound in the shaft or body, so that an equal bulk of them only weigh about threefourths as much as types cast in the ordinary way by hand,

and which for general purposes is preferable and more economical.

Some other variations are resorted to in type-founding; sometimes the mould is filled twice, at other times the faces of the types are *dabbed* (the *cliché* process), many of the large types and ornaments are stereotyped and either soldered to metal bodies or fixed by nails to wooden blocks. The music type and ornamental borders and dashes display much curious power of combination. *Plates for engraving music* are generally made of tin 5 to 7.5 parts, antimony 5 to 2.5.

Type-metal being easily cast may also be used for candlesticks, statuettes, etc., sand moulds being generally employed for the purpose, though for decorated articles metallic moulds thoroughly rubbed inside with oil can be advantageously used.

An alloy for keys of flutes and similar parts of instruments consists of lead 2 parts, antimony 1.

## Shot-Metal.

THE mixture of metal used for the manufacture of shot consists of lead and arsenic. The latter, as previously mentioned, possesses the property of hardening lead, the alloy being at the same time more fusible than pure lead. Shot, as is well known, is prepared by letting fall from an elevated place drops of lead into water, and an addition of a very small quantity of arsenic to the lead helps its solidification and gives to the shot a more spherical shape.

On account of the poisonous properties of the arsenious vapors certain precautions have to be observed in preparing the alloy. In a cast-iron pot provided with a well-fitting lid the lead is first melted and then covered with a layer of char-

#### LEAD ALLOYS.

coal dust. Only after this is done should the arsenic or arsenious combination to be used be introduced. In many shot-factories this precaution is omitted, which, however, deserves censure, as everything should be done to protect the workmen from the injurious effects of the poisonous arsenious vapors. If the metal is covered with a layer of charcoal dust, the vapors cannot reach the air as easily as when the bright metal is in direct contact with the air. White arsenic (arsenious acid) is generally used as an addition to the lead, though in some cases red arsenic (realgar or red orpiment) is employed. Immediately after the introduction of the arsenic the mass is vigorously stirred with a wooden rod, and the pot is then covered with the lid, which is luted around the edges with moist elay.

A strong fire is now kept up to render the contents of the pot thinly-fluid. After about three hours the lid is removed and the charcoal and oxides floating upon the surface being carefully lifted off, the alloy is poured with ladles into moulds. This alloy serves for the preparation of the actual shot-lead, which is prepared by melting lead and adding a certain quantity of the alloy of lead and arsenic. It is in all cases preferable first to prepare the arsenious alloy in the manner prescribed, it being otherwise difficult intimately and homogeneously to combine the lead with the comparatively small quantity of arsenic required for shot-metal.

In working by the preceding process generally 1000 parts of lead are alloyed with 20 of arsenic, and equal parts of this alloy and of lead are subsequently melted together. For the direct preparation of the alloy of lead and arsenic for shot, 2.4 parts of arsenious acid are used for 600 parts of refined lead, or 3.0 parts of arsenic to 700 parts of lead. As will be seen

the quantity of arsenic is exceedingly small, and should in no case exceed that actually required for hardening the lead and rendering it easy to cast. The quantity considered necessary for this varies much in different countries. While, for instance, in England 10 parts of arsenic are allowed for 1100 parts of lead, in France 3 to 8 parts are considered sufficient for 1000 parts of lead.

This variation in the proportions of arsenic used for hardening the lead is readily accounted for by the difference in the qualities of the lead used; the purer and softer the lead the greater the quantity of arsenic required. But under no circumstances should good shot-metal contain more than from  $\frac{1}{1000}$  to  $\frac{10}{1000}$  of the weight of lead used.

Both a too small or too large content of arsenic is injurious; if the lead contains too little arsenic, the resulting shot has the shape of tears, and the interior is frequently full of cavities, while with too much arsenic the drops are lenticular. As even with much experience it is quite difficult to hit at once the right proportion, it is advisable, before melting together large quantities of lead and arsenic, first to make tests with small quantities. From the shape of the shot obtained from these samples it can be readily judged whether the proportions are right or in what respect they have to be changed.

Many manufacturers of shot, it would seem, vary the composition of the alloys used by them, for, besides lead and arsenic, other metals are frequently found in shot, especially antimony and copper, though the latter only in exceedingly small quantities. The content of antimony is, however, larger, reaching in many cases 2 per cent. of the total weight, and from this it would appear that the manufacturers endeavor to replace the arsenic by antimony.

#### LEAD ALLOYS.

Casting of shot.—According to the old method, shot is prepared by allowing the melted metal to fall in drops from a tower of considerable height. This method is said to have originated with a plumber of Bristol, England, named Watts, who, about the year 1782, dreamed that he was out in a shower of rain, that the clouds rained lead instead of water, and the drops of lead were perfectly spherical. He determined to try the experiment, and, accordingly, poured some melted lead from the tower of St. Mary Redcliffe Church into some water below; the plan succeeded, and he sold the invention for a large sum of money.

For carrying out this invention shot-towers and shot-wells have been constructed. At the top of the tower melted lead is poured into a colander and the drops are received into a vessel of water below. The surface of the lead becomes covered with a spongy crust of oxide called *cream*, which is used to coat over the bottom of the colander to prevent the lead from running too rapidly through the holes, whereby they would form oblong spheroids instead of spheres. The colanders are hollow hemispheres of sheet-iron, the holes in them differing according to the size of the shot. They must be at a distance of at least three times the diameter of the shot from each other, as otherwise it might happen that two or more drops of lead would, while falling down, unite to one mass, which, of course, would be useless and have to be remelted.

The water serving for the reception of the drops must be frequently changed to prevent it from becoming too hot or boiling. By some it is recommended to pour a layer of oil upon the surface of the water, the shot retaining thereby its spherical shape better than when dropping directly into the

water. To prevent the shot, when taken from the water, from losing its metallic appearance by oxidation, a small quantity (about 0.25 per cent.) of sodium sulphide is dissolved in the water serving for the reception of the shot, by means of which the drops falling into it are at once coated with a thin film of sulphide of lead of a lustrous, metallic, gray-black color, which is permanent even in moist air.


In more recent times the formation of shot by centrifugal power has been introduced, which does away with the expensive towers. The melted lead is poured in a thin stream upon a rapidly revolving metal disk, surrounded at some distance by a screen against which the shot is thrown. The moment the melted lead falls upon the metal disk it is divided by the centrifugal force into drops, the size of which depends on the rapidity with which the disk revolves. The drops are hurled in a tangential direction from the disk and are stopped by the above-mentioned screen.

David Smith, of New York, has invented and put into practice a new mode of manufacturing drop-shot. The chief feature of this invention consists in causing the fused metal to fall through an ascending current of air, which shall travel at such a velocity that the dropping metal shall come in contact with more particles of air in a short tower than it would in falling through the highest towers before in use. Fig. 22 is a vertical sectional elevation of a sheet-metal cylinder set up as a tower within a building; and may be about 20 inches internal diameter and 50 feet high or less. This tower, although mentioned in Smith's patent, is now dispensed with in the middle of the height, so that only an open space remains. Fig. 23 is a plan at the line a b; Fig. 24 is a plan at the line q r; Fig. 25 is a section at o p; and Fig. 26 is a section at m n, Fig. 22.

#### LEAD ALLOYS.


369

C is a water cistern beneath the tower. B is a pipe from the blowing apparatus leading into the annular chamber f; the upper surface g is perforated as shown in Fig. 24 to dispense the ascending air. The outer side of this annular ring

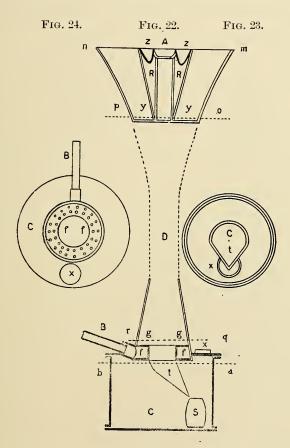

f forms the base of a frustum of a cone, forming the tower D, passing the blast through the frame y y, Fig. 25; and in Fig. 22 is shown to support a cylindrical standard R, the upper central portion of which receives the pouring pan A. This pan is charged with each separate size of shot. Round the

pouring pan A is a circular waste-trough z. The object of this arrangement is that the fluid metal, running through the pouring pan A into the ascending current of air, will be operated upon in the same manner as if it fell through stagnant air of great height. The shot falls through the open

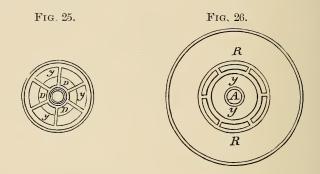

centre of the ring f into the water cistern C, where a chute t carries it into the tub S, which when full may be removed through x, an aperture in the cover of the cistern.

Sorting the shot .- Even with the most careful work it happens that drops of unequal size or cornered masses are found among the shot, and the latter, after being taken from the water and dried, must be sorted. This was formerly effected by hand in the following manner: A slab of polished iron is tilted at a certain angle, and the shot are strewed along the upper part of the inclined plane thus formed. The perfect shot proceed rapidly in straight lines and fall into a bin placed to receive them, about a foot away from the bottom of the slab. The misshapen shot, on the contrary, travel with a slower zigzag motion and fall without any bound into a bin placed immediately at the end of the incline. The perfect shot are then subjected to another sorting by passing them through sieves with meshes of exactly the same size as the apertures in the casting colanders.

The finished shot, which are now of dead silvery-white color, are polished and made dark in an iron barrel or *rumble* containing a quantity of powdered plumbago. They are then tied up in canvas bags and are ready for sale.

At present the shot are, however, generally sorted by means of sorting drums consisting of inclined cylinders perforated with holes whose diameter corresponds to that of the shot. The forward motion of the shot in these drums is effected by means of an Archimedean screw.

Large shot are at the present time also frequently prepared by casting in moulds like bullets, or by stamping them from thin plates of the alloy. In both cases the resulting shot shows a seam which is removed by bringing the shot together with very fine quartz sand into revolving drums. By the action of the sand the seams are ground off, and a perfectly spherical shape imparted to the shot.

Alloys of lead and iron.—Lead, as previously stated, has no affinity for iron. A piece of lead thrown into a bath of melted iron becomes oxidized, or is separated and found at the bottom of the bath after the cast-iron has been run out. As soon as the lead is introduced into the melted cast-iron, a certain agitation appears on the surface, and even through the whole bath, and the cast-iron seems more fluid. When thin or large pieces are to be cast, the founders, who are aware of this phenomenon, often throw a certain quantity of lead into the melted cast-iron in order to prevent it from congealing too soon against the sides of the casting ladle.

This want of affinity of lead for iron, and conversely, is made use of for separating iron from other metals, such as silver, for instance. Thus, if lead is added in sufficient quantity to a fused alloy of cast-iron and silver, it will combine

with the silver, and the iron will float on the surface of the bath.

All the authors who have occupied themselves with the question of alloys agree upon the impossibility of alloying lead and iron.

Alloys of lead and other metals.—Lead, as seen from the preceding sections, is much used in the preparation of alloys which have been already partially mentioned under the respective mixtures of metals. Lead is also frequently alloyed with cadmium and bismuth, and forms an important constituent of the so-called soft-solder. In speaking of these compounds, the lead alloys not yet mentioned will be referred to. Only type-metal and shot-metal can be considered as lead alloys, *i. e.*, alloys of which lead forms the greater portion.

## CHAPTER XIV.

## CADMIUM ALLOYS.

CADMIUM shares with bismuth the property of considerably lowering the melting points of alloys, but while the bismuth alloys are nearly all brittle, many alloys of cadmium possess considerable ductility, and can be worked under the hammer as well as between rolls. They act, however, very differently in this respect, there being alloys which are very ductile, and others again, though containing in addition to cadmium the same metals only in different proportions, which are very brittle.

An alloy consisting, for instance, of cadmium and silver, shows this phenomenon in the most remarkable manner. By melting together one part of cadmium and one to two parts of silver a very ductile alloy is obtained which can be rolled out to a very thin sheet. By taking, however, two parts of cadmium to one of silver, the resulting alloy is so brittle as to break into pieces under the hammer.

As cadmium imparts to the alloys a very low melting point, it is frequently used in the preparation of very fusible solders, for casting articles not to be exposed to a high temperature, and, in dentistry, for compounds for filling hollow teeth.

Alloys of cadmium contain generally tin, lead, bismuth, and sometimes mercury, the latter being chiefly added to lower the melting point still more. Alloys of cadmium and mercury alone (cadmium amalgams) are solid and malleable, hence the addition of mercury does not impair their solidity.

(373)

Lipowitz's alloy.—This alloy is composed of cadmium 3 parts, tin 4, bismuth 15, lead 8. It is best prepared by heating the comminuted metals in a crucible and stirring, as soon as fusion begins, with a stick of hard wood. This stirring is of importance in order to prevent the metals, whose specific gravity varies considerably, from depositing themselves in layers. This alloy softens at 140°F., and melts completely at 158°F.

Lipowitz's metal has a silvery-white color, a lustre like polished silver, and can be bent short, hammered, and worked in the lathe. It, therefore, possesses properties adapting it for many purposes where a beautiful appearance is of special importance, but on account of the considerable content of cadmium and bismuth, the alloy is rather expensive and finds but limited application. Castings of small animals, insects, lizards, etc., have been prepared with it, which in regard to sharpness were equal to the best galvano-plastic products. Plaster of Paris is poured over the animal to be cast, and after sharply drying, the whole animal is withdrawn from the mould and the latter filled up with Lipowitz's metal. The mould is then placed in a vessel containing water, and by heating the latter to the boiling point the metal is melted and deposits itself in the finest impressions of the mould.

The alloy is very suitable for soldering tin, lead, etc., and on account of its silver-white color is especially adapted for soldering Britannia metal and nickel. But the costliness of the alloy prevents its general use for this purpose, and cheaper alloys having nearly the same properties as Lipowitz's metal have been prepared.

Cadmium alloy (melting point 170° F.).—Cadmium 2 parts, tin 3, lead 11, bismuth 16.

Cadmium alloy (melting point 167° F.).—Cadmium 10 parts, tin 3, lead 8, bismuth 8.

Cadmium alloys (melting point  $203^{\circ}$  F.).—The following compositions have all the same melting point ( $203^{\circ}$  F.).

|           |      | Parts.      |
|-----------|------|-------------|
|           |      | I. II. III. |
| Cadmium . | <br> | <br>. 1 1 1 |
| Tin       | <br> | <br>.2 3 1  |
| Bismuth   | <br> | <br>.352    |

Very fusible alloy.—An alloy with a melting point of 150° F. is composed of :—

|                            |   |   |   |   |   |   |   |   |   |   |   |    |   |   |   |   |   |   |   |   | Parts         | ·. |
|----------------------------|---|---|---|---|---|---|---|---|---|---|---|----|---|---|---|---|---|---|---|---|---------------|----|
|                            |   |   |   |   |   |   |   |   |   |   |   |    |   |   |   |   |   |   |   |   |               |    |
| Tin                        | ٠ | • | ٠ | · | • | • | ٠ | ٠ | • | • | • | •  | • | • | • | • | • | • | ٠ | 1 | or            | 4  |
| Lead                       | • | • |   |   |   | • | • | • | • | • |   |    |   |   |   |   |   | • | • | 2 | $\mathbf{or}$ | 3  |
| $\operatorname{Bismuth}$ . |   |   |   |   |   |   |   |   | • |   | • | ¥. |   | • | • |   |   |   |   | 4 | or            | 15 |
| Cadmium                    | • | • |   | • | • | • | • | • | • |   | • | •  | • | • | • | • | • | • | • | 1 | $\mathbf{or}$ | 3  |

Wood's alloy or metal melts between  $140^{\circ}$  and  $161.5^{\circ}$  F. It is composed of lead 4 parts, tin 2, bismuth 5 to 8, cadmium 1 to 2. In color it resembles platinum and is malleable to a certain extent.

Cadmium alloy (melting point  $179.5^{\circ}$  F.).—Cadmium 1 part, lead 6, bismuth 7. This alloy, like the preceding, can be used for soldering in hot water.

Cadmium alloy (melting point 300° F.).—Cadmium 2 parts, tin 4, lead 2. This alloy yields an excellent soft solder, with a melting point about 86°, below that consisting of lead and tin alone.

Cliché metal.—An alloy consisting of lead 50 parts, tin 36, and cadmium  $22\frac{1}{2}$ , is especially adapted for the preparation of cliché, since with as low a melting point as the cliché metals (of bismuth alloys) generally used, it combines the valuable property of greater hardness. With a cliché from this alloy a large number of sharp impressions are obtained.

According to Hauer's researches, given below, the melting points of fusible alloys are relative to the composition :—

| Atomic weights.  | Melting points. |
|--|-----------------|
| Cd <sub>1</sub> Sn <sub>1</sub> PbBi                   | 155.1° F.       |
| $\mathrm{Cd}_2\mathrm{Sn}_2\mathrm{Pb}_2\mathrm{Bi}_2$ | 155.1           |
| $\mathrm{Cd}_3\mathrm{Sn}_4\mathrm{Pb}_4\mathrm{Bi}_4$ | 153.5           |
| $\mathrm{Cd}_4\mathrm{Sn}_5\mathrm{Pb}_5\mathrm{Bi}_5$ | 150.0           |
| Mixing proportion.                                     |                 |
| 1Cd6Pb7Bi  | 190.4           |
| 1Cd2Bi3Pb  | 193.0           |
| 2Cd4Bi7Pb  | 203.0           |

The alloys of cadmium with mercury (cadmium amalgam) will be discussed in speaking of the amalgams, and those containing gold, which are used by gold-workers for certain purposes, will be referred to under gold alloys.

It has been stated that cadmium alloys are not reliable in regard to their melting points, and that, on account of the volatility of cadmium, the alloy becomes the more difficult to fuse the oftener it is remelted. A glance at the above figures shows plainly that cadmium cannot volatilize at these temperatures, and, further, a series of experiments made especially for the purpose has shown that the respective alloys can be remelted as often as desired without their melting points undergoing any sensible change. It may, however, happen that the originally homogeneous alloy may liquate into several with differently high melting points if a large quantity be allowed to stand in a melted state for a long time. This evil can, however, be readily prevented by not keeping

the alloy in a fluid state until this liquation takes place, it requiring many hours, and if it does take place, by vigorous stirring of the melted alloy.

# CHAPTER XV.

## BISMUTH ALLOYS.

LIKE cadmium, bismuth possesses the property of lowering the melting points of metals, and is, therefore, frequently used in the preparation of fusible alloys, which would be still more extensively used if bismuth could be obtained in abundance and at a small cost. The alloys are now chiefly used in the preparation of delicate clichés, very fusible solders, and in the manufacture of safety-valves of a peculiar construction for steam boilers.

The behavior of bismuth towards other useful metals is given by Guettier as follows :—

Alloys of bismuth and copper.—These alloys are easily effected notwithstanding the difference in the points of fusion of the two metals. They are brittle and of a pale-red color whatever the proportions employed. Their specific gravity is sensibly equal to the average of the two metals.

Alloys of bismuth and zinc.—These alloys are seldom made and produce a metal more brittle, presenting a larger crystallization with less adherence than zinc or bismuth taken singly. On that account they are useless in the arts.

Alloys of bismuth and tin.—The combinations of bismuth and tin take place easily and in all proportions. A very small quantity of bismuth imparts to tin more hardness, sonorousness, lustre, and fusibility. On that account and for certain applications a little bismuth is added to tin to increase its hardness. However, bismuth being easily oxidized and (378) often containing arsenic, the alloys of tin and bismuth would be dangerous for the manufacture of domestic utensils such as culinary vessels, pots, etc.

The alloys of tin and bismuth are more fusible than each of the metals taken separately. An alloy of equal parts of the two metals is fusible between  $212^{\circ}$  and  $302^{\circ}$  F. When tin is alloyed with as little as 5 per cent. of bismuth, its oxide acquires the peculiar yellowish-gray color of the bismuth oxide. According to Rudberg, melted bismuth begins to solidify at 507° F., and tin at 550° F. For the alloys of the two metals the "constant point" is 289° F.

Alloys of bismuth and lead.—These two metals are immediately alloyed by simple fusion with merely the ordinary precautions. The alloys are malleable and ductile as long as the proportion of bismuth does not exceed that of lead. Their fracture is lamellar, and their specific gravity greater than the mean specific gravity of either metal taken singly. An alloy of equal parts of bismuth and lead has a specific gravity equal to 10.71. It is white, lustrous, sensibly harder than lead, and more malleable. The ductility and malleability diminish with an increased proportion of bismuth, while they increase with the excess of lead in the alloy. An alloy of bismuth 1 part and lead 2 is very ductile, and may be laminated into thin sheets without cracks. According to Berthier, its point of fusion is 331° F.

Alloys of bismuth and iron.—Authorities disagree as to the possibility of combining bismuth and iron. The presence of bismuth in iron renders the metal brittle.

It will be seen, from the preceding data, that the alloys of bismuth are not at present of importance in the arts excepting the fusible alloys made of bismuth and certain white metals, such as tin, lead, etc., and a few others. Alloys of bismuth with antimony.—The alloys of these two metals alone are grayish, brittle, and lamellar. In order to remove the brittleness, varying quantities of tin and lead are added, whereby their fusibility rather increases than decreases. Alloys containing the above metals are much used in the preparation of Britannia and Queen's metals, but they are also employed for some special purposes of which the following are examples :—

*Cliché metal.*—This alloy is composed of tin 48 parts, lead 32.5, bismuth 9, and antimony 10.5. It is especially suitable for *dabbing* rollers for printing cotton goods. and, possessing a considerable degree of hardness, it wears well.

For filling out defective places in metallic castings, the following alloy can be used to advantage: bismuth 1 part, antimony 3, lead 8.

Alloys of bismuth, tin, and lead.—The compounds obtained by alloying these metals have a somewhat higher melting point than the cadmium alloys. They have, however, been known for a long time, and are used for various purposes.

Newton's metal consists of bismuth 8 parts, lead 5, tin 3. It melts at 202°F.

Rose's alloys consist of :----

|                        |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | I.       | II.    |
|------------------------|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|----------|--------|
| Bismuth                |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   |   | <b>2</b> | 8) 5   |
| Bismuth<br>Tin<br>Lead |   |   | • | • |   |   |   | • |   |   |   | • | • |   |   |   |   |   |   | • | 1        | 3 { ar |
| Lead                   | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | • | 1        | 8) x   |

The first of these alloys melts at 200.75°F., and the other at 174.2°F. These alloys were formerly used in the preparation of the so-called safety-plates which were inserted in the tops of steam boilers. The composition of these plates was such that they became fluid at a determined temperature cor-

## BISMUTH ALLOYS.

responding to a certain steam pressure in the interior of the boiler, thus giving the steam a chance to escape through the aperture formed. Such plates acted as a sort of safety-valve, and were intended to prevent the explosion of the boiler with too high a tension of steam.

At the present time their use has, however, been almost entirely abandoned, it having been found that boilers provided with these plates would explode, without a previous melting of the plates. A chemical and physical examination has shown that, by long-continued heating of the plates, alloys are formed whose melting points are much higher than those of the compositions originally used. The following table gives the compositions of some alloys which are said to melt, if the pressure of the steam exceeds that indicated :---

| Bismuth. | Lead.                                   | Tin.            | Melting point.<br>Degrees F. | Corresponding<br>pressure of steam<br>in atmosphere. |
|----------|---|-----------------|------------------------------|--|
| 8        | 5                                       | 3               | 212                          | 1  |
| 8        | 8                                       | 4               | 235.9                        | $1\frac{1}{2}$                                       |
| 8        | 8                                       | 8               | 253.9                        | 2  |
| 8        | 10                                      | 8               | 266                          | $\frac{21}{3}$                                       |
| 8        | 12                                      | 8               | 270.3                        | 8  |
| 8        | 16                                      | 14              | 289.5                        | $3\frac{1}{2}$                                       |
| 8        | $\begin{array}{c}16\\22\\32\end{array}$ | 12              | 300.6                        | 4  |
| 8        | 22                                      | $\frac{24}{36}$ | 308.8                        | 5  |
| 8        | 32                                      | 36              | 320.3                        | 6  |
| 8        | 32                                      | 28              | 331.7                        | 7  |
| 8        | 30                                      | 24              | 341.6                        | 8  |
|          |   |                 | · .                          | 1  |

Onion's fusible alloy consists of lead 3 parts, tin 2, bismuth 5. It melts at 197° F.

*D'Arcet's fusible alloys.* Mr. D'Arcet gives the following proportions for fusible alloys :—

| No.   | Pa                                     | urts.                                       |               | Remarks.  |
|---|--|---|---------------|---|
|   | Bismuth.                               | Lead.                                       | Tin.          |   |
| $\frac{1}{2}$   | 7<br>8                                 | $\frac{2}{2}$                               | $\frac{4}{6}$ | Softens at 212° F., without melting.<br>Softens at 212° F., easily oxidized.            |
| $\frac{3}{4}$   | $\begin{array}{c} 8\\16\\9\end{array}$ | $\frac{2}{4}$                               | 474           | Softens more or less at 212° F. No. 4<br>becoming softer than either No. 3 or<br>No. 5. |
| $\frac{6}{7}$   | $\frac{16}{8}$                         | 53  | 4<br>7<br>4   | Becomes nearly fluid at 212° F.<br>Becomes quite liquid at 212° F.                      |
| $\frac{8}{9}$   | 8<br>8                                 | $\frac{4}{7}$                               | 4             | Becomes very liquid at 212° F.<br>Becomes soft at 212° F., but does not melt.           |
| $     \begin{array}{c}       10 \\       11 \\       12     \end{array} $ |  | $\begin{array}{c} 15 \\ 5 \\ 6 \end{array}$ | 3             | Neither liquid nor soft at 212° F.<br>Melts at 205° F.<br>Melts at 205° F.              |
| 13  | 16                                     | 9   | $\frac{2}{7}$ | Becomes very liquid at 212° F.  |

These alloys are generally hard, but may be cut. Their fracture is a dead blackish-gray. They are rapidly tarnished in the air, and more so in boiling water, in which they become covered with a wrinkled pellicle which falls as a black powder.

Bismuth alloys for delicate castings.—For the preparation of castings of delicate articles, and taking impressions from dies, medals, etc., bismuth alloys of the following compositions have been recommended :—

|             |   |  |  |   |   |   |   |   |   |         | Pa     | rts.      |        |
|-------------|---|--|--|---|---|---|---|---|---|---------|--------|-----------|--------|
| Bismuth     |   |  |  |   |   |   |   |   |   | I.<br>6 |        | 111.<br>9 | IV.    |
| Tin<br>Lead | • |  |  | • | • | • | • | • | • | 3       | 2<br>3 | 1<br>1    | 3<br>5 |

On cooling, these alloys expand strongly, and, consequently, fill out the finest depressions and elevations.

Bismuth alloy for cementing glass.—Most cements in use are dissolved by petroleum, or, at least, softened. The following alloy, which melts at 212° F., is, however, not attacked by petroleum, and is therefore well adapted for fastening the metal parts upon glass lamps: Lead 3 parts, tin 2, bismuth 2.5.

The following table, made by Messrs. Parkes and Martin, indicates the various points of fusion of the fusible combinations of bismuth, lead, and tin :—

| Pt                                     | urts.                                   |   | Temperature<br>of fusion.                 | Pa            |   | Temperature<br>of fusion. |                   |
|--|---|---|---|---------------|---|---------------------------|-------------------|
| Bismuth.                               | Lead.                                   | Tin.                                    | Degrees F.                                | Bismuth.      | Lead.                                       | Tin.                      | Degrees F.        |
| 8                                      | $\begin{bmatrix} 5\\ 6 \end{bmatrix}$   | 3                                       | $\frac{202^\circ}{208}$                   | 8<br>8        | $\frac{16}{18}$                             | $\frac{24}{24}$           | 316°<br>312       |
| 8                                      | 8                                       | $\begin{vmatrix} 3\\4 \end{vmatrix}$    | $226 \\ 236$                              | 8             | $\begin{array}{c} 10\\ 20\\ 22 \end{array}$ | $\frac{24}{24}$           | 310               |
| 8                                      | 8<br>8<br>8                             | 6                                       | 243                                       | 8             | 24  | 24                        | 308<br>310        |
| 8                                      | 10                                      | 8<br>8                                  | $\begin{array}{c} 254 \\ 266 \end{array}$ | 8<br>8        | $\frac{26}{28}$                             | $\frac{24}{24}$           | 320<br>330        |
| 88888888888888888888888888888888888888 | $12 \\ 16$                              | 8<br>8<br>8                             | $\begin{array}{c} 270\\ 300 \end{array}$  | 8<br>8        | $\begin{array}{c} 30 \\ 32 \end{array}$     | $\frac{24}{24}$           | $\frac{342}{352}$ |
| 8                                      | $\begin{array}{c c} 16\\ 16\end{array}$ | $\begin{array}{c} 10 \\ 12 \end{array}$ | $\frac{304}{294}$                         | $\frac{8}{8}$ | $\frac{32}{32}$                             | $\frac{28}{30}$           | 332<br>328        |
| 8                                      | $\begin{array}{c c} 16\\ 16\end{array}$ | 14<br>16                                | $\frac{\overline{290}}{292}$              | 8             | 32<br>32                                    | $\frac{32}{34}$           | 320<br>318        |
| 8<br>8<br>8<br>8<br>8                  | 16                                      | 18                                      | 298                                       | ********      | 32  | 36                        | 320               |
| 8                                      | 16 $16$                                 | $20 \\ 22$                              | $\frac{304}{312}$                         | 8<br>8        | $\frac{32}{32}$                             | $\frac{38}{40}$           | $322 \\ 324$      |
| 8<br>8                                 | $\begin{array}{c c} 16\\ 16\end{array}$ | $\begin{bmatrix} 20\\22 \end{bmatrix}$  | $\begin{array}{c} 304\\ 312 \end{array}$  | 8<br>8        | 32<br>32                                    | $     38 \\     40 $      | 322<br>324        |

These alloys are valuable baths for tempering small steel tools. They give a very exact temperature, which may be adjusted to the purpose intended. They are used, according to Thurston,\* by placing the article on the surface of the unmelted alloy and gradually heating until fusion occurs and they fall below the surface, at which moment their temperature is right; they are then removed and quickly cooled in water. It is not easy, even if possible at all, to give as uniform a temperature by the ordinary processes of heating or to obtain the exact heat desired, and the quality of the tool is not so easy of adjustment by any other method.

\* Brasses, Bronzes and other Alloys, p. 196.

Alloys of lead and bismuth have also been tried. They are too easily oxidized, and are difficult to make on account of the separation of the lead. An alloy of equal parts of bismuth and lead possesses a toughness from fifteen to twenty times that of lead.

Alloys of bismuth and tin succeed better; those which are best known are—

| Bismuth.  | Tin.     |  |  |  |   | ] | Melts at about |
|-----------|----------|--|--|--|---|---|----------------|
| 50 parts. | 50 parts |  |  |  |   |   | 310° F.        |
| 33 "      | 67 ''    |  |  |  |   |   | 325            |
| 10 "      | 80 ''    |  |  |  | • |   | 480            |

The first alloy (equal parts bismuth and tin) is called "cutlanego," of which the oxide makes a white enamel.

New fusible alloy.—" La Nation" gives the formula for a new alloy which is suitable for many applications in the arts. It melts at about 158° F., and, consequently, at a much lower temperature than that at which the so-called "magic spoon" melts in a cup of hot tea. It is composed of bismuth 48 parts, cadmium 13, lead 19, tin 26. The alloy resists great pressure.

# CHAPTER XVI.

## SILVER ALLOYS.

PURE silver possesses but little hardness, and articles manufactured from it would be subject to considerable wear. For this reason silver-ware is never made of the pure metal, but always of alloys with other metals, excepting certain chemical utensils which must be of pure silver, as alloys would be attacked by the substances to be manipulated in them.

The alloys of silver present a real interest only when they are made with gold, copper, or aluminium. With the other metals, with very few exceptions, they are of no use in the arts. The alloys of silver and gold and silver and copper are those employed for articles of luxury and for coinage. The alloys of silver, gold, and copper are used for the same purpose. An alloy of silver, copper, and tin is made into a solder for plated-ware and false jewelry. In modern times alloys containing silver and nickel, or silver, nickel, and zinc, are much used for table utensils; they having a beautiful white appearance and being much cheaper than alloys of copper and silver, which were formerly exclusively used for the purpose.

Alloys of silver and aluminium. — These alloys have previously been briefly referred to. Aluminium and silver form beautiful white alloys considerably harder than pure aluminium, and take a very high polish. They have the advantage over copper alloys of being unchangeable on 25 (385)

exposure to the air and retaining their white color. It has, therefore, been proposed to alloy coins with aluminium instead of with copper, which would render them much more durable, but the results of experiments made on a large scale were not satisfactory.

The alloys of aluminium and silver show very varying physical properties according to the content of aluminium. An alloy consisting of 100 parts of aluminium and 5 of silver differs but little from pure aluminium, but is considerably harder and takes a beautiful polish. An alloy of aluminium 169 parts and silver 5 possesses considerable elasticity, and is recommended for fine watch-springs and dessert knives. An alloy of equal parts of aluminium and silver shows a hardness equal to that of bronze.

Tiers-argent (one-third silver).—This alloy is chiefly prepared in Paris factories for the manufacture of various utensils, and as indicated by its name consists of silver 33.33 parts and aluminium 66.66. The advantages of this alloy over silver consist in the lower price and greater hardness; it is also stamped and engraved with greater ease than the alloys of copper and silver.

Alloys of silver and zinc.—Silver and zinc have great affinity for each other, and consequently are readily alloyed. The alloys are prepared by throwing the required quantity of zinc previously wrapped in paper into the melted and stronglyheated silver, stirring thoroughly with an iron rod, and pouring the fused mass at once into moulds. Alloys of silver and zinc can be obtained both ductile and flexible. An alloy consisting of zinc 2 parts and silver 1 has nearly the color of pure silver and is quite ductile. With a larger proportion of zinc it becomes, however, brittle. In preparing the alloy a

small quantity of zinc volatilizes, and hence somewhat more has to be taken than the finished product is to contain.

Alloys of silver and zinc have many valuable properties, especially that of retaining their white color and being more fusible than alloys of silver with copper. It has therefore been proposed to use them for coinage, and especially for small coins. Comparative experiments have, however, shown that for coins it is best to use alloys which besides silver and zinc contain copper, the following composition being especially recommended for the purpose: Silver 835 parts, copper 93, zinc 72.

The alloy is readily rolled into a sheet of suitable thickness, and should it become brittle its ductility can be restored by annealing.

Alloys of silver, copper, and nickel.—Nickel by itself makes silver very hard and brittle, such alloys being difficult to work into utensils. But by adding some copper the alloys can be cast, rolled, and fused, and the articles manufactured from them are harder than those from silver and copper alloys. Alloys of silver, nickel, and copper are much used by French manufacturers for articles formerly prepared from standard silver. These compositions may be considered as an argentan whose properties have been improved by a content of silver.

Argent-Ruolz.—The articles manufactured by Ruolz, of Paris, from the so-called Ruolz silver, or argent français, have the appearance of pure silver, but are much cheaper and harder. According to the quality of the articles, different alloys are used, a few such compositions being given as follows:

1822

|          |   |   |  |   |   |  |  |   | Parts.     |          |          |  |  |  |  |  |  |
|----------|---|---|--|---|---|--|--|---|------------|----------|----------|--|--|--|--|--|--|
|          |   |   |  |   |   |  |  |   | ĩ          | II.      | <br>111. |  |  |  |  |  |  |
| Silver . |   | • |  |   |   |  |  | • | 33         | 40       | 20       |  |  |  |  |  |  |
| Copper.  |   |   |  |   |   |  |  |   | 37  to  42 | 30 to 40 | 45 to 55 |  |  |  |  |  |  |
| Nickel   | • |   |  | • | • |  |  |   | 25 to 30   | 20 to 30 | 25 to 35 |  |  |  |  |  |  |

C. D. Abel, of London, has patented in England several alloys containing silver and nickel. They are divided into two classes, the first consisting of alloys of silver, copper, and nickel, with or without an addition of manganese. The alloys of this class can be composed according to the following proportions :—

|        | Per cent.                        |                                  |
|--------|----------------------------------|----------------------------------|
| Silver | B.<br>40<br>20 to 30<br>30 to 40 | C.<br>20<br>25 to 35<br>45 to 55 |

The second group of these alloys consists of silver, copper, nickel, and zinc, with or without manganese, and is composed of the following proportions :—

|          |  |  |  |  |   |  |   |     | Parts. |     |
|----------|--|--|--|--|---|--|---|-----|--------|-----|
|          |  |  |  |  |   |  |   | D.  | E.     | F.  |
| Silver   |  |  |  |  | , |  | , | 333 | 340    | 400 |
| Copper.  |  |  |  |  |   |  |   | 418 | 420    | 446 |
| Zine .   |  |  |  |  |   |  |   | 163 | 160    | 108 |
| Nickel . |  |  |  |  |   |  |   | 86  | 80     | 46  |

Of the above-mentioned alloys A, D, and E are especially intended for rolled, pressed, or drawn silver articles, C for casting, and F for jewelry. The content of silver in these alloys varies from 20 to 40 per cent., according to the purposes for which they are to be used—the proportion of nickel being the less, the greater that of silver.

For the alloys of the first group the patentee uses the purest copper found in commerce and purified nickel, the purification of the latter being effected in the following manner: The ordinary impure nickel of commerce is dissolved in nitric acid or in dilute sulphuric acid, the solution in the latter case being promoted by connecting the nickel with the positive pole of a galvanic battery. The solution is treated with chlorine and the ferric oxide precipitated by boiling with calcium carbonate. The solution is subsequently precipitated with soda, the precipitate re-dissolved in hydrochloric acid, the solution diluted with a large quantity of water, saturated with chlorine, and then treated with barium carbonate and allowed to cool. From the fluid separated from the precipitate the nickel is subsequently precipitated by the galvanic method and then reduced.

Nickel-speiss can be treated by the dry method by melting 100 parts of it with 20 of saltpetre and 100 of feldspar, whereby the cobalt forms a blue glass. The residue is roasted, washed, and dissolved in sulphuric acid, the resulting fluid being treated in the same manner as above. But no matter how the nickel may have been purified, it is of advantage before preparing the alloys to remelt it in a crucible together with yellow or red prussiate of potash, 50 parts of yellow or 25 to 30 of red prussiate of potash being used for 1000 parts of nickel. Frequently this method alone suffices for the purification of the commercial nickel, which by these means is obtained in well-fluxed, homogeneous pieces of any desired size.

The nickel purified in the above or any other manner is melted with the copper and an addition of charcoal and yellow, or, better, red prussiate of potash, which, when used as flux, is claimed to impart special properties to the alloys. In preparing an alloy which is to contain the highest content of silver and the smallest of copper, it is of advantage to add some manganese to prevent oxidation as much as possible, since the addition of nickel, if exceeded above a certain proportion, would impair the quality of the alloy. For this purpose sufficient oxide of manganese previously glowed with charcoal in a closed crucible is added to the mixture of copper and nickel before melting, so that a preliminary alloy, consisting of 80 to 90 parts of copper and nickel and 10 to 20 parts of manganese, is obtained-borax, red or yellow prussiate of potash, and charcoal, being used as flux. The manganese readily combines with the copper, and the nickel and silver form with them a ductile alloy readily worked.

For the preparation of the alloys D, E, and F, the patentee employs the purest commercial copper and zinc and nickel purified by one of the methods above described. He first melts the copper and zinc together in the right proportions and adds to the alloy thus obtained the nickel by remelting, using the above-mentioned fluxing agents. For an alloy with a large percentage of silver, manganese is added in the same manner as above described.

The preliminary alloys thus obtained are subsequently melted together with the necessary quantity of silver, either yellow or red prussiate of potash, charcoal or borax, together with phosphorus, being added. For the production of an alloy of phosphorus and copper the use of phosphor-copper deserves the preference. Its content of phosphorus being

SILVER ALLOYS.

previously determined by an analysis, is is added to the argentiferous alloy in such a quantity that the content of phosphorus of the latter amounts to  $\frac{1}{2}$  to 2 per cent. The phosphor-copper is best prepared by heating 8 parts of comminuted copper with 1 part of a mixture of 40 parts of charcoal and 27 of super-phosphate of lime. The final silver alloys can also be at once fused with this mixture of charcoal and super-phosphate of lime previously heated to a slight red heat, using 1000 parts of the alloy to 100 of the mixture. Bv this process the content of phosphorus in the alloys will be the greater the longer the heating has been continued. The introduction of phosphorus makes the alloys more fusible and more homogeneous, and at the same time imparts to them a white color. To retain these advantages and to restore to the alloy its ductility lost by the addition of phosphorus, the latter is almost entirely removed, after homogeneous ingots have been obtained, by heating the alloy with charcoal powder in a closed crucible for several hours.

Alloys of silver, copper, nickel, and zinc.—These alloys have been used for the preparation of small coins, especially in Switzerland. The coins while wearing well, however, soon lose their original beautiful white color and acquire a disagreeable yellowish shade resembling the color of poor brass. For coinage these alloys have the further disadvantage of the silver contained in them being only regained by a very tedious process.

|        | 20 centimes.                                | 10 centimes. | 5 centimes. |
|--------|---|--------------|-------------|
|        | Parts.                                      | Parts.       | Parts.      |
| Silver | $\begin{array}{c} 15\\ 50\\ 25 \end{array}$ | 10 $55$ $25$ | $560 \\ 25$ |
| Zine   | 10  | 10           | 10          |

Alloys for Swiss fractional coins.

Mousset's silver alloy.—Copper 59.06 parts, silver 27.56, zinc 9.57, nickel 3.42. Color, yellowish with a reddish tinge, but white upon the fractured surface.

The argent-Ruolz sometimes contains also certain quantities of zinc. The following alloys can be rolled into sheet or drawn out into wire :—

|            | Parts.   |
|------------|----------|
|            |          |
| I.         | II. III. |
| Silver     | 34 40    |
| Copper     | 42 44.6  |
| Nickel 8.6 | 8 4.6    |
| Zine       | 18 10.8  |

Alloys of silver and arsenic.—These alloys may be formed by direct fusion, and the silver will retain a certain proportion of arsenic even when the temperature is very high. The compound made of 86 parts of silver to 14 of arsenic is of a dead grayish-white color, brittle, and acquires a metallic lustre by friction. It is very fusible. An alloy composed of silver 49 parts, copper 49, and arsenic 2, is very ductile and has a beautiful white color. It was formerly used for the manufacture of table-ware, for which it is, however, not suitable on account of the poisonous proprieties of the arsenic. Alloys of silver, copper, and cadmium.—Cadmium imparts to silver alloys great flexibility and ductility, without impairing their white color. Some of the more important alloys of this group are composed of—

|         | Parts. |     |           |     |     |     |                    |  |  |  |
|---------|--------|-----|-----------|-----|-----|-----|--------------------|--|--|--|
|         | I.     | 11. | III.      | IV. | v.  | VI. | VII.               |  |  |  |
| Silver  | 980    | 950 | 900       | 860 | 666 | 667 | $500 \\ 50 \\ 450$ |  |  |  |
| Copper  | 15     | 15  | 18     82 | 20  | 25  | 50  | 50                 |  |  |  |
| Cadmium | 5      | 35  | 82        | 180 | 309 | 284 | 450                |  |  |  |

In preparing these alloys the great volatility of cadmium must be taken into consideration. The silver and copper are, as a rule, first alloyed; the cadmium wrapped in paper is then brought into the fused mass, the whole quickly stirred and at once poured into moulds. By this mode of procedure volatilization of cadium is best prevented.

Silver is also used in the preparation of other alloys, especially in connection with platinum, which will be referred to later on. No true alloys of silver and iron have been made, only more or less intimate mixtures, where silver appears in the shape of drops or filaments. The alloys of silver with cobalt and chromium are generally very hard and brittle and thus far have found no application in the industries.

Alloys of silver and copper.—These alloys are more used than any other compounds of silver, and in most countries form the legal composition of coins and silverware, Silver and copper are easily alloyed in all proportions, the combination taking place with expansion and its specific gravity being less than that calculated from the proportions of the component metals. The copper imparts to silver greater

hardness, strength, and toughness, the alloys acquiring the property of giving out a beautiful sound. The presence of copper does not modify the color of silver so long as the proportion of copper does not exceed 40 to 50 per cent.; a greater proportion imparts to the alloy a yellowish tint similar to that of brass, and if the compound contains from 65 to 70 per cent. of copper the color is reddish, approaching that of pure copper.

The alloys of copper and silver, though easily affected by the ordinary process of fusion, are, nevertheless, subject to the defect of separation, or "liquation," which necessitates certain precautions when running the metal into moulds. When such an alloy is run into a cold ingot mould, the centre of the ingot shows a lower degree of fineness than the portion nearer the mould; and even in the monetary alloys all the portions are not of the same degree of fineness.

Formerly the silver used for coinage frequently contained small quantities of gold, and for this reason nearly all the older coins are treated in the mints by the wet method to regain the gold.

At the present time the fineness of all coins is determined by thousandths, the standard varying according to the size of the coins, and the laws of the different countries, from  $\frac{900}{1000}$  to  $\frac{750}{1000}$ . In the following table the composition of the silver coins of various countries is given :—

#### SILVER ALLOYS.

| Country.       | Coins.  | Fineness. |
|----------------|---|-----------|
| Austria        | Pieces of 3 and 2 guldens   | 900       |
| Belgium        | 5 franc-piece   | 897       |
| ·· · ·         | 2   | 835       |
| Brazil.        | Milreis, pieces of 500 and 200 reis   | 916       |
| Denmark .      | Dobbelt rigsdaler, rigsdaler, halvdaler,                                      | 875       |
| "              | Mark ( $\frac{1}{6}$ rigsdaler)   | 500       |
| East Indies .  | Pieces of $1, \frac{1}{2}, \frac{1}{4}, \frac{1}{8}$ rupee.                   | 916.66    |
| Egypt          | Fleves of 20, 10, and 5 plastics  | 8331      |
| · · ·          | Pieces of 1 piastre   | 755       |
|                | Pieces of 1 piastre       Pieces of $\frac{1}{2}$ and $\frac{1}{4}$ piastre   | 750       |
| France         | Pieces of 5, 2, and 1 franc, and 50 and 20 cen-                               |           |
|                | times   | 835       |
| Germany .      | Mark piece  | 900       |
| Great Britain. | Crown, half-crown, and shilling   | 925       |
| Greece         | Pieces of 5, 1, $\frac{1}{2}$ , and $\frac{1}{4}$ drachme                     | 900       |
| Holland        | Pieces of $2\frac{1}{2}$ , 1, and $\frac{1}{2}$ gulden                        | 945       |
| Italy          | Pieces of 5, 2, 1, $\frac{1}{2}$ , and $\frac{1}{4}$ lina                     | 835       |
| Mexico         | Peso (average by U. S. Mint assay)  | 901       |
| "              | Peso of Maximilian (average by U.S. Mint                                      |           |
|                | assay).<br>Pieces of $1, \frac{1}{2}, \frac{1}{5}, \frac{1}{16}$ specie daler | 9023      |
| Norway         | Pieces of 1, $\frac{1}{2}$ , $\frac{1}{5}$ , $\frac{1}{70}$ specie daler      | 875       |
| Portugal       | Pieces of 500 reis (by U. S. Mint assay)                                      | 912       |
| Prussia        | Thaler pieces   | 900       |
| "              | Old Thalers before 1857   | 750       |
| Russia         | Pieces of 1, $\frac{1}{2}$ , and $\frac{1}{4}$ ruble                          | 768.5     |
| "              | Pieces of $\frac{1}{5}$ , $\frac{1}{10}$ , $\frac{1}{20}$ ruble               | 750       |
| Spain          | Dollar of 5 pesetas   | 900       |
| · · · ·        | Peseta (present, by U. S. Mint assay)   | 835       |
| Sweden         | Riksdaler, crown, and $\frac{1}{2}$ riksdaler                                 | 750       |
| Switzerland .  | Pieces of $2$ , 1, and $\frac{1}{2}$ frances                                  | 800       |
| Turkey         | Pieces of 20, 10, 5, and 2 piastres   | 830       |
| United States. |   |           |
|                | dime, and three cent piece  | 900       |
|                | · ·   |           |

| Countries.                 |   |   |   |  |  |   |   |   | F | 'ineness.  |
|----------------------------|---|---|---|--|--|---|---|---|---|--|
| Prussia, Saxony, Brunswick |   |   |   |  |  |   |   |   |   | 780  |
| Austria, Bavaria           |   |   |   |  |  |   |   |   |   | 812  |
| England                    | • | • | • |  |  | • | • | • |   | 925  |
| France, Italy, Belgium     |   |   |   |  |  |   |   |   |   | $\Big\{ \begin{array}{c} 950 \\ 800 \end{array} \Big.$ |

Silver alloyed with copper in the preceding proportions has, in the form of wire or sheet, a hardness equal to that of

cold-forged copper. By continued mechanical manipulation the hardness increases, however, and may be made equal to that of wrought-iron. Silver is also sometimes used for casting small articles of art, but it is difficult to obtain castings entirely free from blow-holes. This evil can, however, be readily prevented by adding to the alloy a small quantity of zinc, about 1 per cent. The resulting castings will be homogenous, and free from blow-holes, while the ductility of the alloy is not in the least impaired by such a small percentage of zinc.

In consequence of the frequent annealing required in working articles of silver, they gradually acquire a steel-gray color, which is due to the oxidation of copper. Hence the finished articles must be subject to a special manipulation called "blanching." This is effected by boiling the articles in a fluid consisting of 40 parts of water and one part of sulphuric acid. The oxide of copper readily dissolves in the mixture, leaving the surface of the article coated with a layer of chemically pure silver.

The Japanese have a remarkable series of alloys, in which the precious metals replace the tin and zinc of ordinary bronze, but really their main alloys, with the exception of bronze, are comprised in the following examples given by Prof. W. C. Roberts-Austen in a paper read before the Society of Arts, June 13, 1890.

The first is called *shaku-do*; it contains:

| I.                      | II.    |
|-------------------------|--------|
| Copper,                 | 95.77  |
| Silver                  | 0.08   |
| Gold                    | 4.16   |
| Lead 0.11               |        |
| Iron and arsenic traces |        |
|                         |        |
| 99.89                   | 100.01 |

#### SILVER ALLOYS.

As will be seen from the analyses, the alloy contains in addition to about 95 per cent. of copper as much as 4 per cent. of gold. It has been used for very large works. Colossal statues are made of it, one cast at Nara in the seventh century being especially remarkable. The quantity of gold is, however, very variable, and certain specimens contain only 1.5 per cent. of the precious metal.

The next important alloy used by the Japanese is called *Shibu-ichi*, the following being typical analyses of it :

| Copper                    |   |   |  |   |   |  |   |   |   |  | 67.31  | 51.10  |  |
|---------------------------|---|---|--|---|---|--|---|---|---|--|--------|--------|--|
| $\operatorname{Silver}$ . |   |   |  |   |   |  |   |   |   |  | 32.07  | 48.93  |  |
| Gold                      |   | • |  | • | • |  | • | • | • |  | traces | 0.12   |  |
| Iron                      | • |   |  |   |   |  |   |   |   |  | 0.52   |        |  |
|                           |   |   |  |   |   |  |   |   |   |  |        |        |  |
|                           |   |   |  |   |   |  |   |   |   |  | 99.90  | 100.15 |  |

There are many varieties of it, but in both these alloysskaku-do and shibu-ichi-the point of interest is, that the precious metals are, as it were, sacrificed in order to produce definite results, gold and silver, when used pure, being employed very sparingly to heighten the general effect. In the case of shaku-do, it will be seen presently that the gold appears to enable the metal to receive a beautiful rich purple coat or patina when treated with certain pickling solutions, while shibu-ichi possesses a peculiar silver-gray tint of its own, which, under ordinary atmospheric influences, becomes very beautiful, and to which the Japanese artists are very partial. These are the principal alloys, but there are several varieties of them as well as combinations of shaku-do and shibu-ichi in various proportions, as, for instance, in the case of kin-shibu-ichi, the composition of which would correspond to one part of skaku-do rich in gold, and two parts of shibuichi, rich in silver.

With regard to the use of pickling solution, they are made up respectively in the following proportions, and are used boiling.

| I.                             | II.                | III.            |
|--------------------------------|--------------------|-----------------|
| Verdigris 438 grains           | 87 grains          | 220 grains      |
| Sulphate of copper. 292 grains | 437  grains        | 540 grains      |
| Nitre —                        | $87 \ { m grains}$ | -               |
| Common salt —                  | 146  grains        | <u> </u>        |
| Sulphur —                      | 233 grains         | -               |
| Water 1 gallon                 | _                  | 1 gallon        |
| Vinegar —                      | 1 gallon           | 5 fluid drachms |

The most widely employed is No. I. When boiled in No. III. solution, pure copper will turn a brownish red, and shaku-do, which contains a little gold, becomes purple. The effect of small quantities of metallic impurity as affecting the color resulting from the action of the pickle will be appreciated from the following remarks. Copper containing a small quantity of antimony gives a shade very different from that resulting from the pickling of pure copper. But the copper produced in Japan is often the result of smelting complex ores, and the methods of purification are not so perfectly understood as in the West. The result is that the so-called "antimony" of the Japanese art metal-workers, which is present in the variety of copper called "kuromi" is really a complex mixture containing tin, cobalt, and many other metals, so that a metal-worker has an infinite series of materials at command with which to secure any particular shade; and these are used with much judgment, although the scientific reason for the adoption of any particular sample may be hidden from him. It is strictly accurate to say that each particular shade of color is the result of minute quantites of metallic impurity.

#### SILVER ALLOYS.

The action of the above mentioned solutions is remarkable. Take copper to which a small amount of silver and a small amount of gold are added. The amount of gold may be variable, and artificers often take credit for putting in much more than analysis proves to be present, but a small amount of gold, it may be only one per cent., is sufficient to entirely change the character of copper, and when it is treated by pickling solutions the result is entirely different from that if copper alone is employed. The Japanese also take copper and dilute it, sometimes half copper and half silver, sometimes only about one-third silver and all the rest copper, and that gives the lovely series of grey alloys, which, either by exposure to atmospheric influences, by handling or by treatment with suitable pickles, gives the beautiful series of light and dark grays of which the Japanese are so particularly fond, and to which the name shibu ichi is given. Then again they have copper in which small amounts of impurities may be present, and the nature of such impurity and the amount, which seldom exceeds two-tenths per cent., is quite sufficient to change the character of the copper. The Japanese working in no small measure by rule of thumb, find that certain varieties of


copper are best suited for definite processes, and store them up and use them in definite ways.

Other Japanese alloys of special interest are those to which the

Frg. 27.

name moku-me (wood-grain) and miyu-nagashi (marbled) are given. The characteristic alloys which the Japanese employ

are taken in thin sheets and soldered together—kuromi, shibuichi and shaku-do in alternating layers, as shown in the diagram Fig. 27; then you drill conical holes, A B in them to a

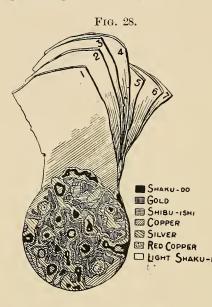

SHARU-DO SHARU-DO SHARU-DO SUBLE-ISHI 

up a seven-layered plate

from behind, and filing the surface flat.

## Alloys resembling Silver.

There is a large number of silver-like alloys containing various metals, which are used as substitutes for silver alloys for many purposes. A few of them together with their properties are here given :

*Warne's metal.*—Tin 10 parts, nickel 7, bismuth 7, cobalt 3. White, fine-grained, quite difficult to fuse.

*Minargent.*—This alloy, which has a very beautiful white color, is composed of copper 1000 parts, nickel 700, tungsten 50, aluminium 10.

A beautiful white alloy closely resembling silver is manufac-

#### SILVER ALLOYS.

401

tured in Paris, which, according to an analysis by Prof. Rochleder, of the Prague University, is composed of copper 69.8 parts, nickel 19.8, zinc 5.5, and cadmium 4.7.

Detailot's alloy.—This white, silver-like alloy is claimed to possess properties adapting it as a substitute for several alloys now in use. It consists of 80 parts of pure copper, 2 of manganese, 18 of zinc, and 1 of phosphate of lime. First melt the copper, then add gradually the manganese, and when this is thoroughly dissolved, the phosphate of lime. Remove the scoria and about ten minutes before casting add the zinc. To promote the fusion of the manganese  $\frac{1}{2}$  part of calcium fluoride,  $\frac{1}{2}$  part of borax, and 1 part of charcoal may be added.

Tournu-Leonard's alloy.—This alloy, which closely resembles silver, is prepared in the following manner: 200 parts of fine tin are introduced into a crucible heated to a red heat. When the metal is melted add 64 parts of bell-metal, previously comminuted to the size of lentils. Add only small portions at one time, and stir the mixture with an iron rod to effect the solution as quickly as possible. Finally add 300 parts more of tin, stir thoroughly, and pour the alloy into moulds of copper or sand. By the content of copper in the bell-metal, the tin is sufficiently hardened to allow of the alloy being worked into table-ware, plates for printing music, and even into jewelry.

Clark's patent alloy consists of shot-copper 1 ounce, nickel 3 dwts. 18 grains, spelter 1 dwt. 22 grains, tin 12 grains, cobalt 12 grains.

Pirsch-Baudoin's alloy.—This alloy resembling silver is composed of copper 71 parts, nickel 16.5, cobalt (in the form of oxide) 1.75, tin 2.5, and zinc 7. Some aluminium (about 26

 $\frac{1}{2}$  per cent.) may also be added. Prepare first an alloy of all the nickel, an equal quantity of the copper and the zinc; then melt this alloy together with the iron, the remainder of the copper, the cobalt, and some charcoal powder under a surface covering of charcoal powder in a graphite crucible at a strong heat. Allow the melted mass to cool and then add the zinc, previously alloyed with copper, at a temperature just sufficient for its fusion. Now take the crucible from the fire, stir the contents with a wooden stick, add the tin previously wrapped in paper, stir the mass once more, and pour out into moulds. But a small quantity of zinc remains in the alloy, the greater portion of it volatilizing during fusion.

# CHAPTER XVII.

### GOLD ALLOYS.

GOLD has been known and used by every nation, both uncivilized and civilized, from the earliest period down to our time. It is found among the old Egyptian monuments, and semi-barbarous nations have used it in the form of dust as the principal medium of exchange, the instrument of association. When America was discovered by Columbus gold was well known to its inhabitants; the Chinese have used it from time immemorial; the Medes and Persians were remarkable, even more than other Asiatics, for their love of gold; jewels of costly description were employed to indicate the rank of the wearer, and this custom is still continued in the East at the present time. To show the sacred value the Egyptians in ancient times placed on gold, it was represented by a circle with a dot in the middle, this circle amongst that nation being the symbol of divinity and perfection.

Gold is one of the metals which most readily enter into combination with other metals. But this property is without importance when we consider the inutility of the majority of the compounds and the necessity of not debasing its value or impairing its properties. Moreover, it is certain that excepting its alloys with copper, silver, iron, and platinum, the latter two being without actual utility, gold loses part of its ductility, resistance, and cohesion, when it is combined with other metals such as zinc, tin, lead, etc. Therefore, it is entirely useless to experiment on those alloys where gold loses

not only a part of its money value, but also those valuable properties which participated in making it a noble metal.

The principal alloys of gold used at the present time are those with copper or silver, or, in rare cases, with both these metals.

Gold and copper have great mutual affinity and may be alloyed in all proportions. The alloys are harder and more fusible than gold alone. Copper diminishes the ductility of gold when it enters into the combination in a proportion over 10 to 12 per cent. The specific gravity of an alloy of gold and copper is less than the average of the two metals. The color of the alloy varies between dark yellow and red, according to the quantity of copper. Pure copper must be used in the preparation of the alloys, as the impure metal alters the malleability of gold and may render it brittle.

Gold and silver may be easily mixed together, but do not appear to form true combinations. These compounds are more fusible than gold and are generally greenish-white, more ductile, harder, more sonorous and elastic than gold or silver considered singly. One-twentieth of silver is sufficient to modify the color of gold. Silver, like copper, increases the firmness of gold, and on that account it is employed at various degrees of fineness for jewelry work. These alloys are known by jewellers under the names of *yellow gold*, green gold, and *pale gold*, according to the proportion of silver.

As previously mentioned the alloys of gold with other metals are of no practical utility and need only be biefly referred to. Gold alloyed with iron forms pale gray masses, brittle and somewhat magnetic. An alloy holding  $\frac{1}{6}$  of iron is employed in jewelry under the name of gray gold.

Lead shows a peculiar behavior towards gold. Both metals

are very soft and ductile, but when alloyed they form an exceedingly brittle metal of a pale yellow color, strongly crystalline, and hard as glass. According to Berthier, one-half of one-thousandth of lead alloyed to gold is sufficient to render the latter metal entirely brittle and without ductility.

Arsenic or antimony alloyed with gold gives a brittle, very crystalline alloy of a white or gray color. Accidental admixtures of arsenic or antimony can, however, be removed in a simple manner, it being only necessary to keep the metal in a melted state for some time, whereby the arsenic and antimony volatilize, the pure gold remaining behind.

Alloys of gold and palladium.—Alloys of gold, copper, silver, and palladium have a brownish-red color and are as hard as iron. They are sometimes used for bearings of the arbors in fine watches, as they cause but little friction (less than the jewels used for the same purpose) and never rust on exposure to the air. The composition used in the Swiss and English watch factories consists of gold 18 parts, copper 13, silver 11, palladium 6.

Alloy of aluminium and gold.—This alloy, which is also known as Nürnberg gold, is frequently used in the manufacture of cheap gold-ware, it being well adapted for the purpose as its color exactly resembles that of pure gold and remains unchanged in the air. The composition of most articles of Nürnberg gold is according to the following proportions: Copper 90 parts, gold 2.5, aluminium 7.5

An addition of cadmium to an alloy of gold and silver imparts to it a beautiful green color. These alloys will be referred to in speaking of colored gold.

# Preparation of Gold Alloys.


The preparation of alloys varies according to the purpose for which they are to be used, this difference being especially apparent in the moulds employed for casting. The manufacturers of gold articles rarely use moulds for shaping the articles excepting such as have considerable thickness, as sealrings, medals with especially high relief, etc. The casting of such articles is generally effected in moulds of very fine sand or finely pulverized and elutriated cuttle-fish.

For coinage the gold is always cast into ingots or bars, iron moulds being generally used for the purpose. The bars are either rolled out to sheet or drawn into wire, the larger part of jewelry being also manufactured from such sheet or wire. The shape of the iron moulds used for casting varies according to the shape the ingot is to have; for ingots to be drawn out into wire it is best to use cylindrical tubes open on top and closed on the lower end by an iron plug. The gold contracting strongly in solidifying can be removed from the tubes without difficulty.

Ingots to be used for the preparation of gold plates are best cast in the form of four-sided prisms, casting ladles with a corresponding bowl being used for the purpose. For casting very thin plates upright ladles covered with a level plate are also used.

The melting of the metals constituting the alloys is always effected in graphite crucibles, the gold being in all cases first melted, and as it does not oxidize even at a red heat a protecting cover is not required. The gold being entirely melted, it is heated as strongly as the furnace will permit, and the other metals previously converted into small pieces are then introduced. On account of the great density of gold as compared with that of the other metals, the mixture of the metals is promoted by stirring with an iron rod sharpened on the point and made previously red hot. The crucible is then quickly withdrawn and its contents poured into a suitable ingot mould, previously warmed and greased to prevent adhesion. The warming of the mould is quite indispensable,

Fig. 29.

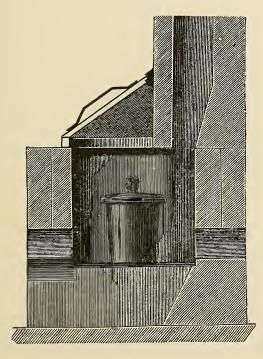

but if made too hot the metal on being turned into it will spit and fly about, and besides incurring great loss of gold, dangerous results might thereby happen to the person in charge. The same remark applies when the ingot mould is cold. It is hot enough when the hand will just stand touching it for a second or so.

The melting point of gold being very high, the furnace used should have a good draught. In some mints which alloy daily large quantities of gold and silver, furnaces heated by gas are used.

The furnace used by most manufacturers of gold-ware is, however, the wind-furnace, one admirably suited for the purpose being shown in Fig. 29. The crucible and fuel are introduced through an oblique iron door lined inside with fireclay. These furnaces can also be used for the preparation of granulated gold, frequently used by gold-workers in the manufacture of jewelry. For this purpose thin sheet gold or wire is cut with scissors into small pieces, which are enveloped in charcoal dust in a graphite crucible and heated in the furnace. The pieces of gold melt to small balls of corresponding dimensions, which, after being freed from adhering foreign bodies by washing, are separated into sizes by passing through a sieve.

When it is desired to produce very tough gold, use as flux a tablespoonful of charcoal and one of sal ammoniac, adding it to the gold just before melting; the sal ammoniac burns away while toughening the gold. The employment of the mixture of sal ammoniac will bring the ingots of gold up bright and clear; it will also prevent them from splitting or cracking when rolled and in subsequent working.

In remelting scrap-gold from the work-shop and old gold, care should be taken that they are not too much contaminated by solder and are free from organic matter, wax, etc. The solder used in soldering gold-ware contains tin, lead, bismuth, and sometimes zinc, and the presence of these metals has an injurious effect upon the ductility of the gold. It is recommended to separate much-contaminated gold from the

foreign metals by the wet process, and alloy the resulting chemically pure gold.

In most countries there are legally fixed standards for gold alloys. Generally such alloys are considered as consisting of so many carats to the unit, the pound, or half pound being divided into 24 carats, each of which contains 12 grains. What is termed 18 carat gold is a unit of 24 carats of alloy containing 18 carats gold and 6 of copper. Since the introduction of the decimal system in many countries the fineness of gold alloys has been determined by thousandths, the fineness of the alloys being officially expressed in this manner. Notwithstanding the simplicity of the system, many manufacturers still hold to the old method and calculate according to carats and grains. To save calculation the conversion of carats and grains into thousandths is given in the following table :

| 1  | $\operatorname{grain} =$ | 3.47                    | 7 carats =    |
|----|--------------------------|-------------------------|---------------|
| 2  | "                        | · · · · · · · · 6.95    | 8 "           |
| 3  |                          | · · · · · · · · 10.42   | 9             |
| 4  | "                        | 13.89                   | 10            |
| 5  | "                        | 17.36                   | 11 "          |
| 6  | "                        | 20.84                   | 12 " 500.000  |
| 7  |                          |                         | 13 " 541.667  |
| 8  | "                        |                         | 14 "          |
| 9  |                          |                         | 15 " 624.555  |
| 10 |                          |                         | 16 " 666.667  |
| 11 | 66                       | · · · · · · · · · 38.19 | 17 "          |
| 12 | 66                       | 41.67                   | 18 "          |
| 1  | carat =                  | 41.667                  | 19 "          |
| 2  |                          |                         | 20 "          |
| 3  |                          | 125.001                 | 21 "          |
| 4  | "                        | 166.667                 | 22            |
| 5  | 45                       |                         | 23 "          |
| 6  | "                        |                         | 24 " 1000.000 |

# Use of Gold Alloys.

Gold alloys are principally used for coinage and ornamental articles. They are further employed in the manufacture of genuine gold-leaf, in the preparation of genuine *Leonis* wires (which consist of silver coated with gold), and in filling teeth.

Standard gold.—The alloy used at present in all countries for gold coins consists of gold and copper. Many coins contain a small quantity of silver, but this is due to a contamination of the copper with this metal, many copper ores containing silver, but in such small quantities that the separation of the two metals would not pay. As coins are subjected to considerable wear through frequently passing from hand to hand, the amount of loss occasioned thereby is worthy of some little consideration. Of course, this amount will be in proportion to the length of time the coins have been in circulation. To provide against this the English government allows a sovereign to be a legal tender till it is reduced not below 122.5 grains, the difference between this and the full standard weight of 123.147 grains being the remedy allowed by English law for abrasion or loss by wear. The depreciation of a coin depends upon its hardness, wearing much more when soft, and also upon the rapidity of circulation. In most countries the fineness of gold coins is fixed by law, and though, as will be seen from the following table, the differences are slight, commerce would be greatly facilitated if all countries would adopt a universal standard of fineness.

| Ducats  | , Hungarian      |      |   |  |  |  | 989 | thousandths. |
|---------|------------------|------|---|--|--|--|-----|--------------|
| "       | Austrian         |      |   |  |  |  | 986 | 44           |
| "       | Dutch            |      |   |  |  |  | 982 | "            |
| Englis  | a sovereigns     | <br> |   |  |  |  | 916 | "            |
| Prussia | n Friedrichsd'or |      | • |  |  |  | 902 | 4.6          |

GOLD ALLOYS.

۰.

| German gold coins |                      |             |
|-------------------|----------------------|-------------|
| Austrian crowns   |                      |             |
| French gold coins |                      |             |
| Belgian           |                      |             |
| Italian           |                      | housandthe  |
| Swiss             |                      | nousanutns. |
| Spanish           |                      |             |
| Greek             |                      |             |
| United States     |                      |             |
| Chinese           | j                    |             |
| Older German gold | coins (pistoles) 895 | "           |
|                   |                      |             |

In the manufacture of jewelry alloys of gold with copper, or with silver, or with both metals are used. The alloy with copper alone is termed *red*, while if silver is used it is termed *white*, and if both metals are alloyed with gold the caratation is termed *mixed*. In most countries there are legally fixed standards for gold jewelry. In England 16, 18, and 22 carat gold is stamped, or, as it is termed *Hall marked*, in France 18, 20, and 22 carat, in Germany 8, 14, and 18 carat, and, also, under the term *joujou* gold, a 6 carat gold used for jewelry to be electro-gilt. Though this is intended as a protection to the buyer, the price of the articles does not depend alone on the quantity of gold used, but to a great extent on the labor expended on its production, and, therefore, these legal regulations are, in many cases, illusive.

| Fineness.                                     |  | Parts.  | Color.  |  |  |
|---|--|---|---|--|--|
|   | Gold.  | Silver.   | Copper.   |  |  |
| 583<br>583<br>583<br>666<br>666<br>750<br>750 | $     \begin{array}{r}       14 \\       14 \\       16 \\       16 \\       16 \\       18 \\       18 \\       18 \\     \end{array} $ | $\begin{array}{c} 6\\ 3\\ 1\\ 4.66\\ 1.60\\ 3.50\\ 2.50\end{array}$ | $\begin{array}{r} 4\\7\\9\\3.33\\6.40\\2.50\\3.50\end{array}$ | yellow.<br>dark yellow.<br>very red.<br>yellow.<br>red.<br>yellow.<br>red. |  |

Gold alloys which can be legally used in various countries.

|          |   | Fineness. |
|----------|---|-----------|
| England  | 1   | 750       |
| France   | ) highest standard $\ldots$   | 920       |
| Belgium  | $\left. \begin{array}{c} \text{second} & \text{``} & \dots & \dots & \dots \\ \text{third} & \text{``} & \dots & \dots & \dots & \dots \end{array} \right.$ | 840       |
| Italy    | $\int$ third "  | 750       |
| Austria, | No. I   | 326       |
| " "      | No. II  | 545       |
| "        | No. III   | 767       |

# Pforzheim gold-ware.

|                  |      |     |     |      |    |     |   |   |   |   |    |     |    | Fi      | neness.  |
|------------------|------|-----|-----|------|----|-----|---|---|---|---|----|-----|----|---------|----------|
| Ordinary ware    | (jo  | aje | ou) | •    |    | •   | • | • |   |   | •  | •   | •  | 130     | to 250   |
| Finer quality    |      | •   | •   |      | •  | •   | • | • | • | • | •  | •   | •  | 563     | ;        |
| Finest quality   |      | •   | •   |      | •  | •   |   |   |   | • |    | •   | •  | 588     | 6 to 750 |
|                  |      |     |     |      |    |     |   |   |   |   | Go | old |    | Silver. | Copper.  |
|                  |      |     |     |      |    |     |   |   |   |   | Pa | rts | š. | Parts.  | Parts.   |
| Elastic gold all | oy ( | (sp | riı | ıg į | go | ld) | ) |   |   |   | 2. | 66  |    | 2.66    | 5.33     |

The following table shows the proportions of various metals incorporated in the gold alloys used by jewelers :

| GOLD | ALLOYS. |
|------|---------|
|------|---------|

| Carats.  | Parts.   |
|--|--|
|  | Copper. Silver. Gold.                                  |
| $\begin{array}{c} 23 \\ 22 \\ 22 \\ \ldots \\ \end{array}$   | $\begin{array}{c ccccccccccccccccccccccccccccccccccc$  |
| $222 \dots 220 \dots 200 0 000 0 000 0 000 00$ | $\begin{array}{ c c c c c c c c c c c c c c c c c c c$ |
| $10 \dots 10 \dots$  | $\begin{array}{c ccccccccccccccccccccccccccccccccccc$  |
| $\begin{array}{cccccccccccccccccccccccccccccccccccc$   | $\begin{array}{ c c c c c c c c c c c c c c c c c c c$ |
| $\begin{array}{c} 9 \\ 8 \\ \cdot  | $10\frac{1}{2}$ $4\frac{1}{2}$ 9                       |
| 7  | $\begin{array}{c ccccccccccccccccccccccccccccccccccc$  |

Colored gold.—As previously remarked, the color of gold alloys varies according to the proportions of copper or silver used. Manufacturers of jewelry and other gold-ware make extensive use of the various colors of alloys, one article being frequently composed of several pieces of different colors. The appended table gives the composition of the alloys most frequently used, with their specific colors :—

|   | Color.  |                     |                                     |  |   |  |  |  |  |  |
|---|---|---------------------|-------------------------------------|--|---|--|--|--|--|--|
| Gold.   | Gold. Silver. Copper. Steel. Cadmium.   |                     |                                     |  |   |  |  |  |  |  |
| $\begin{array}{c} 2 \text{ to } 6 \\ 75.0 \\ 74.6 \\ 75.0 \\ 1.0 \\ 4.0 \\ 14.7 \\ 14.7 \\ 3.0 \\ 10.0 \\ 1.0 \\ 1.0 \\ 30.0 \\ 4.0 \\ 29.0 \\ 1 \text{ to } 3 \end{array}$ | $\begin{array}{c} 1.0\\ 16.6\\ 11.4\\ 12.5\\ 2.0\\ 3.0\\ 7.0\\ 9.0\\ 1.0\\ 1.0\\ 1.0\\ -\\ 3.0\\ -\\ 11.0\\ -\\ 11.0\\ -\\ \end{array}$ | $ \begin{array}{c}$ | <br><br><br><br>2.0<br>1.0<br><br>1 |  | green.<br>"<br>pale yellow.<br>dark yellow.<br>"<br>pale red.<br>"<br>dark red.<br>"<br>gray.<br>"<br>blue. |  |  |  |  |  |

The alloys containing cadmium, given in the above table, are malleable and ductile and can be used for plating. To prepare them the constituent parts must be carefully melted together in a covered crucible lined with coal dust. The resulting alloy is then remelted with charcoal or powdered rosin and borax in a graphite crucible. If, notwithstanding these precautions, a considerable portion of the cadmium volatilizes the alloy must be again remelted with an excess of cadmium to bring it up to the required percentage.

In modern times certain alloys of gold are also prepared by the galvanic process, and articles showing various colors are now manufactured by this method. It is generally done by immersing the article of gold in a diluted bath of chloride of gold in which is a plate of silver connected with the positive pole of a battery : silver separates upon the gold, a certain alloy being formed which is used as a basis for further coloring. When the desired color has made its appearance, the plate of silver is replaced by one of colored gold, whose color corresponds to the shade the article is to have.

In many factories it is customary to color the finished gold articles, *i. e.*, to impart to them, by treatment with agents capable of dissolving copper, a color approaching that of chemically pure gold. By this operation the alloy of gold and copper is decomposed on the surface of the article, the copper being dissolved out. By allowing the surface of the article to remain in contact with the bath for some time the copper is entirely dissolved, a layer of pure gold with its characteristic color remaining behind. By allowing the bath to act for a shorter time only a portion of the copper is dissolved, and, by skilful manipulation, the various shades between red and yellow can be imparted to the articles.

# CHAPTER XVIII.

## ALLOYS OF PLATINUM AND PLATINUM METALS.

PLATINUM alloys readily with all metals. Many of these alloys possess properties making them extremely useful for certain purposes, and they are frequently used in the manufacture of artificial teeth, measuring scales, and articles subject to especially strong mechanical action. (Alloys of platinum and iridium are used for cylinders in which the touch-hole of cannon is to be bored). Pure platinum, as well as its alloys, with iridium and palladium, being indifferent to most chemical agents is much used in the manufacture of standard weights and scales. The so-called platinum vessels used in the laboratories of chemists, in manufactories of sulphuric acid and other chemical products, consist generally of platinum alloyed with one of its allied metals.

The platinum occurring in nature is never pure, but generally contains a number of other metals, those most frequently associated with it being silver, gold, iron, palladium, osmium, iridium, ruthenium, rhodium, further small quantities of nickel, cobalt, etc. The enumeration of these metals occurring in combination with platinum explains why the latter metal combines so readily with others, the native platinum occurring in nature being actually not such in the true sense of the word, but a platinum alloy.

Platinum melting only at a very high temperature, a furnace of peculiar construction heated with oxy-hydrogen gas is required for the preparation of the alloys. The melting point of the latter is, however, frequently so low as to allow of their being melted in ordinary furnaces. In the following we will briefly describe a platinum furnace exhibited by the French government at the Paris Exhibition in 1878, which is used for melting the platinum required in the manufacture of standard meters.

This furnace, or, more correctly, melting apparatus, consists of an oblong bowl of lime with a cavity capable of holding 440 pounds of melted platinum. Upon this bowl a lid of lime can be lowered by means of a lever mechanism. In this lid are so-called Daniell's cocks, used for ordinary oxy-hydrogen blow-pipes. The products of combustion escape through apertures in the periphery of the bowl. The oxy-hydrogen gas used in this apparatus does not consist of oxygen and hydrogen, but of oxygen and illuminating gas.

For the preparation of platinum alloys on a small scale an apparatus resembling the above in its main features may be used. A bowl holding several pounds of platinum can be fashioned from chalk over a wooden mould, and is, before use, converted into caustic lime by heating to a white heat. An ordinary oxy-hydrogen blow-pipe is used, the compressed oxygen and hydrogen being contained in strong vessels, or in bags of strong canvas made gas-proof by several coats of caoutchouc varnish. In preparing alloys of platinum with base metals in such a bowl, it must be taken into consideration that the latter are at once oxidized by the smallest excess of oxygen, and hence care must be had to set the cocks of the oxy-hydrogen blow-pipe so that the flame receives a small excess of hydrogen. In preparing the alloys the quantity of platinum required is first brought into flux, and then the other metals are added all at once through an aperture in the lid of the bowl which otherwise is closed with a lime-plate.

## ALLOYS OF PLATINUM AND PLATINUM METALS. 417

Immediately after the introduction of the metals into the fused platinum, the flame can be modified or in some cases entirely extinguished, the alloys having, as a rule, a much lower melting point than that of platinum. The melted alloy is cast in ingots or cylindrical bars in moulds of lime. The ingots are especially adapted for rolling out into sheet, while the bars are more suitable for wire.

Alloys of platinum and iridium.—Pure platinum is a very soft metal, being scarcely harder than gold. The solidity of platinum articles found in commerce is nearly always due to the presence of a certain quantity of iridium, and for the manufacture of vessels alloys of the two metals are used. They are much harder and more tenacious than pure platinum and more capable of resisting chemical agents, an alloy of 90 parts of platinum and 10 of iridium not being attacked even by nitro-muriatic acid. Vessels prepared from this alloy when used become very lightly coated with pure iridium, and are then indifferent to mechanical and most chemical influences. On account of their great ductility these alloys can be rolled out cold to a very thin sheet and drawn to very fine wire.

The other alloys of platinum with platinum-metals have found no technical application up to the present time, though the alloy with palladium could certainly be advantageously used for many purposes on account of its strength and ductility. Among the alloys of platinum with other precious metals there are several which are used to some extent in various branches of the metal industry, and they are prepared either by themselves (platinum with gold, or platinum with silver) or with addition of tin, nickel, copper, etc.

Alloys of platinum and gold.—The two metals may be al-27 loyed in all proportions, but on account of the refractory nature of the platinum the combination takes place only at a very high temperature. A very small quantity of platinum suffices to change the properties of gold to a considerable extent. With a very small percentage the color becomes sensibly lighter than that of pure gold, and the alloys show a high degree of elasticity, which they nearly lose, however, if the content of platinum exceeds 20 per cent. The melting point of the alloys is very high, and those with 70 per cent. platinum can be fused only in the flame of oxy-hydrogen gas. Alloys containing less platinum may be prepared in a furnace which must, however, be capable of producing the strongest white heat possible. The application of platinumgold alloys is limited; one containing from 5 to 10 per cent. platinum is used in the form of sheet and wire in the manufacture of artificial sets of teeth.

Platinum-gold-alloys for dental purposes :

| Platinum  | 6 14 10 |
|-----------|---------|
| Gold      | 2 4 6   |
| Silver    | 1  6  - |
| Palladium | 8       |

Alloys of platinum and silver.—By an addition of platinum the hardness of silver is increased and its pure white color changed to gray, an alloy containing but a few per cent. of platinum showing a much darker color than pure silver. Alloys with 17 to 35 per cent. of platinum are prepared and known as *platine au titre*. Their use is limited, they being chiefly employed in dentistry. The alloys are difficult to produce on account of the liquation of the platinum, which is due to its superior specific gravity.

Alloys of platinum, gold, silver, and palladium.-The alloys

## ALLOYS OF PLATINUM AND PLATINUM METALS. 419

composed of these metals are especially prepared for dental purposes, and the compositions of those found in commerce vary very much. They are best prepared with the assistance of oxy-hydrogen gas, though it is possible to fuse them in an ordinary furnace. The readily fusible metals are first melted, and after increasing the fire as much as possible the platinum metals are added. In the following the compositions of a few of these alloys are given :—

Platinor.—The alloy known under this name in commerce has a beautiful golden-yellow color (hence its name) without containing any gold. It consists of varying quantities of platinum, silver, copper, zinc, and nickel, the variations in the percentage of copper and zinc being very likely due to the fact that the two metals are not used directly, but in the The use of the latter has the advantage of form of brass. making the alloy more homogeneous and preventing, to some extent, the loss of zinc. An alloy with a color closely resembling that of pure gold and quite constant in the air may be made as follows: Melt 1 part of silver with 5 of copper, add to the melted mass 2 parts of brass, then 1 of nickel, and, after raising the temperature to the highest point the furnace is capable of producing, 2 parts of platinum, which is best used in the form of a very fine powder, the so-called platinum-black.

Platinum-bronze.—This alloy deserves attention, it possessing properties not to be found to the same extent in other alloys, and besides it is not very expensive. Platinum-bronzes are indifferent to the action of air and water, and, once polished, retain their bright lustre for a long time. Up to the present time they have only been used for tableware and articles of luxury, and occasionally, on account of their sonor-

ousness, for bells. Besides tin, platinum-bronze always contains platinum and some compositions, a certain quantity of silver, which, however, can be replaced by a corresponding quantity of brass, without impairing the resistance against atmospheric influences. The following table gives the composition of some varieties of platinum-bronze :---

| Uses.                         | Parts.  |  |   |         |             |  |  |  |  |  |
|-------------------------------|---|--|---|---------|-------------|--|--|--|--|--|
|                               | Nickel.   | Platinum.  | Tin.  | Silver. | Brass.      |  |  |  |  |  |
| For table utensils<br>" bells | $     \begin{array}{r}       100 \\       100 \\       100 \\       100 \\       60     \end{array} $ | $     \begin{array}{c}       1 \\       1 \\       0.5 \\       20 \\       10     \end{array} $ | $     \begin{array}{r}       10 \\       20 \\       15 \\       20 \\      \end{array} $ | 2       | <br><br>120 |  |  |  |  |  |

Alloys of platinum with the base metals.—Among the alloys of platinum with the base metals only those with copper and iron are of importance. The other metals also form alloys with platinum, which, however, are not suitable for technical purposes. The alloys with iron are also of secondary interest, since platinum-iron and platinum-steel have not found the general application in the industries which was at one time prophesied by many. It may, however, be said that a certain addition of platinum imparts to steel many excellent properties, an alloy consisting of 1 part of platinum and 70 of steel being, for instance, on account of its great hardness, very suitable for the manufacture of cutting tools. For knives with especially sharp edges, an alloy containing only one-half per cent. of platinum is claimed to be the most suitable.

With pure iron, platinum forms a steel-gray mass very difficult to fuse, and so hard as to be scarcely scratched by the best file. Berthier tried alloys made of 1 part of platinum

## ALLOYS OF PLATINUM AND PLATINUM METALS. 421

with from 4 to 10 parts of iron. The fracture of the alloy was gray and granular, and it was possible to flatten the metal with a hammer before breaking it.

Alloys of platinum and copper.—These alloys, possessing with great ductility and toughness a very beautiful color, can be advantageously used for some technical purposes. The color of the copper is modified by the presence of a comparatively small quantity of platinum, copper containing but 4 per cent. of it showing a rose color, which, in the presence of more platinum, soon changes to golden-yellow.

The alloys of copper with platinum are very ductile, malleable, and easily worked. By adding zinc, a mixture of metals is obtained which, as regards color and durability of lustre, is equal to gold, and, for this reason, is used in the manufacture of ornaments. The properties of the alloys vary very much according to the quantity of metals they contain, and, hence, they are adapted for many technical purposes.

Golden-yellow alloys of platinum and copper.—Alloys so composed that their color approaches that of pure gold are suitable for the manufacture of jewelry and other ornaments, and as regards the price of the metals can be prepared for about twice the cost of silver. With an equally beautiful color they surpass gold, on account of their much lower price, and, especially, their durability.

The composition of the alloys used in the manufacture of ornaments varies within very wide limits. The following are, however, the most important :

|          | Parts.          |
|----------|-----------------|
|          |                 |
|          | I. II. III. IV. |
| Platinum | 2 20 7 3        |
| Copper   | 5 - 16 13       |
| Zine     | 1 -             |
| Silver   | 1 20 — —        |
| Brass    | 2 240 — —       |
| Nickel   | 1 120           |

The alloy No. IV., which is known as Cooper's gold, is especially adapted for ornamental articles, it having a color which cannot be distinguished from that of 18 carat gold, even by a close comparison. It can be drawn out to the finest wire, and rolled out to very thin sheet.

Other alloys suitable for ornaments, on account of their gold-like appearance, are composed of—

|          | Parts.         |  |  |
|----------|----------------|--|--|
| ,<br>I   | . II. III. IV. |  |  |
| Platinum | 5 16 7 6       |  |  |
| Copper   | 0 7 16 26      |  |  |
| Zine     | 1 1 1          |  |  |

The success in preparing these alloys depends, however, on using metals entirely free from iron, experiments having shown that the  $\frac{8}{1000}$  part of the weight of the alloy of iron suffices to render it sensibly brittle. If any one of the constituent metals contains iron, the alloy, though showing a beautiful color, will be too hard, and besides so brittle as to make it impossible to draw it out into fine wire or roll it out to thin sheet.

Cooper has thoroughly examined the properties of platinum alloys, and to his researches we are indebted for some import-

## ALLOYS OF PLATINUM AND PLATINUM METALS. 423

ant compositions which he has termed mirror-metal and penmetal, they being especially suitable for these purposes.

Cooper's mirror-metal.—Copper 35 parts, platinum 6, zinc 2, tin 16.5, arsenic 1. This alloy being entirely indifferent to the action of the weather, and taking a beautiful polish on account of its hardness, is especially adapted for the manufacture of mirrors for optical instruments.

*Cooper's pen-metal.*—The preceding alloy is also very suitable for the manufacture of pens, but is too expensive to compete successfully with steel. An alloy frequently used for the preparation of pen-metal consists of: Copper 1 or 12 parts, platinum 4 or 50, silver 3 or 36.

Their great hardness and resistance against atmospheric influences make Cooper's pen alloys very suitable for the manufacture of mathematical and other instruments of precision. It can, for instance, scarcely be calculated how long a chronometer, whose train of wheels is constructed of such an alloy, can run before it shows any irregularity attributable to wear.

Palladium alloys.—Palladium occurs associated with platinum and is obtained as a by-product in refining platinum. Pure palladium is but little used. It is sometimes employed in the preparation of mirrors by the galvanic process or of semicircular protractors for fine mathematical instruments.

The pure metal is, however, more frequently used in the preparation of alloys which are chiefly employed in dentistry and in the manufacture of fine watches. The most important of these alloys are the silver alloys and the so-called palladium bearing-metal.

Alloys of palladium and silver.—This alloy, which is almost exclusively used for dental purposes, consists of 9 parts of palladium and 1 part of silver. It does not oxidize, and is, therefore, very suitable for plates for artificial teeth. The following alloy is still more frequently used: Platinum 10 parts, palladium 8, gold 6.

Palladium bearing-metal.—This alloy is uncommonly hard, and is said to produce less friction upon arbors of hard steel than the bearings of jewels generally used for fine watches. The alloy has the following composition : Palladium 24 parts, gold 72, silver 44, copper 92.

Palladium alloys.

|           | Ι. | II. |
|-----------|----|-----|
| Palladium | 20 | 6   |
| Gold      | 80 | 18  |
| Silver    |    | 11  |
| Copper    | _  | 13  |

Alloy No. I is white, hard as steel, unchangeable in the air, and suitable for dental purposes. Alloy No. II is red brown, hard, has a very fine grain, and is especially suitable for pivot bearings of watch-works.

The alloys of the other platinum metals are but little used, particularly on account of their rarity and costliness. The alloys of platinum and iridium are only used for special scientific purposes, for instance, for standard scales, etc. Iridium as well as rhodium possesses the property of imparting great hardness to steel, but the rhodium and iridium steel found in commerce contain, in many cases, not a trace of either. The alloy of iridium with osmium is distinguished by great hardness and resistance, and has, therefore, been recommended for pivots, for fine instruments, and points for ships' compasses.

Alloys for watch manufacturers.—For the manufacture of

## ALLOYS OF PLATINUM AND PLATINUM METALS. 425

parts of watches which are to be insensible to magnetism, the following very tough and hard alloys may be recommended :

|           | Ι.      | II.   | III.  | IV.   | v.   | VI.  | VII. |
|-----------|---------|-------|-------|-------|------|------|------|
| Platinum  | . 62.75 | 62.75 | 62.75 | 54.32 | 0,5  | 0.5  | _    |
| Copper    | . 18.00 | 16.20 | 16.20 | 16.00 | 18.5 | 18.5 | 25.0 |
| Nickel    | . 18.00 | 18.00 | 16.50 | 24.70 | _    | 2.0  | 1.0  |
| Cadmium   | . 1.25  | 1.25  | 1.25  | 1.25  |      | _    |      |
| Cobalt    | . —     | —     | 1.50  | 1.96  |      | —    |      |
| Tungsten  | . —     | 1.80  | 1.80  | 1.77  |      | —    | —    |
| Palladium | . —     | —     | —     |       | 72.0 | 72.0 | 70.0 |
| Silver    | . —     |       |       |       | 6.5  | 7.0  | 4.0  |
| Rhodium   | . —     | _     | —     | —     | 1.0  | —    | —    |
| Gold      |         |       |       |       | 1.5  |      | -    |

*Phosphor-iridium.*—For preparing larger pieces of iridium than found in nature for making points for stylographic pens, Mr. John Holland, of Cincinnati, has devised the following ingenious process: The ore is heated in a Hessian crucible to a white heat, and, after adding phosphorus, the heating is continued for a few minutes. In this manner a perfect fusion of the metal is obtained, which can be poured out and cast into any desired shape. The material is about as hard as the natural grains of iridium, and, in fact, seems to have all the properties of the metal itself.

Phosphor-iridium, as this metal may be called, possesses some very remarkable properties. It is as hard, if not harder, than iridosmine, from which it is prepared. It is somewhat lighter, owing to its percentage of phosphorus and increase of volume. It is homogeneous and easy to polish, and forms some alloys impossible to prepare in any other manner. It combines with small quantities of silver and forms with it the most flexible and resisting alloy of silver. With gold or tin no alloy has thus far been obtained. Added in small quanti-

ties to copper it furnishes a metal possessing very small resistance to friction, and is especially adapted for articles subjected This alloy seems to possess more than any to great pressure. other metal the power of retaining lubricants. With iron, nickel, cobalt, and platinum, phosphor-iridium forms combinations in all proportions which are of great importance. With iron an alloy is obtained which retains the properties of phosphor-iridium, although its hardness decreases with a larger addition of iron. The alloy is slightly magnetic, and is not attacked by acids and alkalies, and the best file produces no effect upon it, even if it contains as much as 50 per cent. of iron. With more than 50 per cent. of iron the power of resistance decreases gradually, and the nature of the metal approaches that of iron.

# CHAPTER XIX.

## ALLOYS OF MERCURY AND OTHER METALS OR AMALGAMS.

MERCURY, as is well known, is the only metal which is liquid at an ordinary temperature. It solidifies at  $-40^{\circ}$  F., forming a ductile, malleable mass, and boils at 662° F., forming a colorless vapor; it volatilizes, however, even at ordinary temperatures. Compounded with other metals it forms alloys whose properties vary very much according to the metals used. In most cases the amalgams are at first liquid and after some time acquire a crystallized form, whereby the mercury in excess is separated.

The amalgams offer an excellent means of studying the behavior of the metals towards each other, the examination being facilitated by the low temperature at which these combinations are formed. If a metal be dissolved in mercury, and the latter be present in excess, a crystalline combination will in a short time be observed to separate from the originally liquid mass. This crystalline combination forms the actual amalgam and is composed of proportions which can be expressed according to determined atomic weights, and can be readily obtained by removing the excess of mercury by pressure.

Many amalgams require considerable time to pass into the crystalline state, and are at first so soft that they can be kneaded in the hand like wax, but harden completely in

time. They are especially adapted and much used for filling hollow teeth.

Before the action of the galvanic current upon solutions of metals was known, amalgams were of great importance for gilding and silvering, which was effected by coating the article to be gilt or silvered with the amalgam and volatilizing the mercury by the application of heat, whereby the gold and silver remained behind as a coherent coat (fire gilding).

The affinity of metals for mercury varies very much; while many metals combine with it with great ease, others do so only with great difficulty, and their union with the mercury can only be accomplished in a round-about manner.

Though the amalgams are of considerable theoretical interest and of great importance for a general knowledge of alloys, only a limited number of them are used in the industries, which will be somewhat more closely described in the following :—

Gold amalgam.—Gold and mercury alloy freely, and the amalgam can be prepared by the direct union of the two metals. If the gold to be used has been obtained by the chemical process (by the reduction of salts of gold) it dissolves with difficulty in the mercury, it being in a finely divided state, and the finer particles apt to float upon the surface of the mercury. If, however, the gold is reduced in the form of larger crystals, the solution takes place in a comparatively short time. Such small gold crystals can be readily obtained by dissolving chloride of gold in amyl alcohol and heating the solution to boiling, whereby the gold is separated in the form of very small, lustrous crystals.

In gaining gold from auriferous sand, gold amalgam is prepared in large masses, and by subsequent heating in iron re-

## ALLOYS OF MERCURY AND OTHER METALS. 429

torts the combination is destroyed, the mercury volatilizing, while the pure gold remains behind. Gold forms with mercury a chemical combination of the formula  $Au_4Hg$ , showing great tendency towards crystallization, which, in preparing the amalgam, must be prevented as much as possible, it being difficult to apply a crystalline amalgam to the articles to be gilded.

An amalgam suitable for fire gilding is best prepared as follows: Heat in a graphite crucible, rubbed inside with chalk to prevent adhesion, the gold to be alloyed, to a red heat. It is not absolutely necessary to use chemically pure gold, but it should be at least 22 carat fine, and preferably alloyed with silver instead of copper. Gold amalgam containing copper becomes stone hard in a short time, and a small content of it impairs its uniform application to the metals to be gilded. It is best to use the gold in the form of thin sheets, which is cut into small pieces by means of scissors, and brought into the crucible. When the gold is heated to a red heat, introduce about the eighth or ninth part of the weight of the gold of mercury previously heated to boiling. Stir constantly with an iron rod, and after a few minutes remove the crucible from the fire. If the finished amalgam were allowed to cool in the crucible, it would become strongly crystalline and be unsuitable for fire gilding. To prevent this it is at once poured into a larger vessel cooled by water. By keeping this amalgam for some time, crystallization takes place nevertheless, the amalgam separating from the mercury in excess, and it is therefore advisable to prepare it fresh a short time before use. Crystalline amalgam can be restored by heating it in a crucible with an excess of mercury.

In preparing the amalgam, as well as in using it for gild-

ing, a wind-furnace connected with a well-drawing chimney has to be used, as otherwise the vapors evolved from the mercury exert an injurious effect upon the health of the workmen.

Amalgam of silver.—The properties of silver amalgam are nearly the same in most respects as those of gold amalgam, it having, however, a still greater tendency towards crystallization. Only pure silver can be used for its preparation, a content of copper producing the same injurious effect as in gold amalgam. Silver amalgam is best prepared by using pulverulent silver obtained by the reduction of silver solution. It may be prepared by bringing a solution of nitrate of silver in 10 to 15 parts of water into a bottle, adding a few small pieces of sheet zinc and vigorously shaking a few minutes. The silver separating in the form of a very fine black-gray powder need only be washed and dried to be suitable for the preparation of amalgam. This finely divided powder can be directly dissolved in the mercury, though it requires some time. The object is more quickly attained by heating the mercury nearly to boiling in a crucible, then throwing in the pulverulent silver, and quickly combining the mass by vigorous stirring with an iron rod.

Silver amalgam can also be prepared without the use of heat, it being only necessary to compound a concentrated solution of nitrate of silver (1 part of nitrate of silver in 3 of distilled water) with four times the quantity of mercury and combine the liquids by shaking. The silver is reduced from the nitrate by the mercury and dissolves immediately in the excess of it. If the amalgam is to be used for fire-silvering, the presence of the small quantity of nitrate of mercury adhering to it is of no consequence, and it can be at once applied.

## ALLOYS OF MERCURY AND OTHER METALS. 431

Fire-gilding.—Fire-gilding as well as fire-silvering is always effected with a pure amalgam, *i. e.*, such as is freed as much as possible from an excess of mercury. For this purpose the amalgam is tied in a bag of strong chamois leather and subjected to a gradually increasing pressure, whereby the mercury is forced through the pores of the leather while the amalgam remains in the bag. The pressed-out mercury contains a considerable quantity of gold or silver in solution, and is used in the preparation of fresh amalgam.

Fire-gilding as well as silvering is, of course, only applicable to articles of metals which, without melting, will stand a temperature near that of the boiling point of mercury. The amalgam adhering only to absolutely bright metals, the articles before gilding are subjected to a preparatory operation. This consists in heating them to a glowing heat, whereby the grease, dust, etc., adhering to the surface are burnt, and the metal becomes covered with a layer of oxide. The articles are then dipped in a mixture of 3 parts of nitric acid and 1 of sulphuric acid, whereby the oxide is rapidly dissolved and the metal acquires a bright surface. Articles to be heavily gilded must remain for some time in the acid mixture, a rougher surface being required for the adherence of a larger quantity of amalgam.

The pickled articles are then rinsed in water without touching them with the hands, and, to prevent oxidation, placed in water until they are to be *amalgamated*, which consists in covering the bright articles with a layer of metallic mercury. This so-called amalgamating water is prepared by dissolving 100 parts by weight of mercury in 110 parts by weight of strong nitric acid and compounding the solution with 25 parts by weight of water. This amalgamating water is applied to the metal by means of a brush of fine brass wire. By the action of the metal upon the mercury salt the latter is reduced to metallic mercury in the form of very small drops, whereby the articles acquire a white color.

The articles being thoroughly amalgamated, the amalgam is quickly and uniformly applied with a stiff scratch-brush and the articles placed upon glowing coals, whereby the mercury vaporizes while the gold or silver remains behind in a coherent layer. While heating the articles must, however, be frequently taken out and defective places provided with amalgam. This process is very injurious to health; the mercury volatilized by the heat insinuates itself into the body of the workmen notwithstanding the greatest care, and those who are so fortunate as to escape for a time absolute disease are constantly liable to salivation from its effects. Though firegilding is the most durable, it is more and more abandoned and electro-plating substituted for it.

Many articles are not finished by one gilding, and have to be subjected to the same process twice and frequently three times, whereby the layer of gold becomes, of course, thicker. By suitable treatment during the heating and by burning off the so-called gilder's wax, various shades can be given to the gilding. But, as these operations belong to another branch of industry, we cannot enter upon a further description of them.

Amalgams of the platinum metals.—Though the platinum metals can be combined with mercury, the amalgams obtained are thus far not used in the industries, the plating of articles with platinum or allied metals being entirely effected by means of the electric current.

Amalgam of copper.-On account of its peculiar properties

## ALLOYS OF MERCURY AND OTHER METALS. 433

amalgam of copper finds quite an extensive use in several branches of industry.

It crystallizes with great ease, and on solidifying becomes so hard that it can be polished like gold. It can also be worked under the hammer and between rolls, be stamped, and retains its metallic lustre for some time on exposure to the air, but tarnishes quickly and turns black on being brought in contact with air containing sulphuretted hydrogen. A peculiar property of amalgam of copper is that it becomes soft on being placed in boiling water, and so flexible that it can be used for moulding the most delicate articles. In a few hours it again solidifies to a fine-grained mass which is quite malleable.

Copper amalgam, on account of its peculiar properties, was formerly recommended for filling hollow teeth, but is no longer used for that purpose, there being other amalgams just as suitable and free from poisonous copper. An important application of copper amalgam is for cementing metal, it being only necessary to apply it to the metals to be cemented, which must be bright and previously heated to from  $176^{\circ}$  to  $194^{\circ}$  F., and press them together; they will be joined as tightly as if soldered

Many directions have been given for preparing amalgam of copper, but it is effected with the greatest ease as follows: Place strips of zinc in a solution of sulphate of copper and shake vigorously. The copper thus obtained in the form of a delicate powder is washed, and, while still moist, treated in a rubbing-dish with a solution of mercurous nitrate. Hot water is then poured over the copper, the dish kept warm, and the mercury added. The contents of the dish are then kneaded with a pestle until the pulverulent copper combines with the mercury to a plastic mass; the longer the kneading is continued the more homogeneous the mass will be. The best proportions to use are 3 parts of copper and 7 of mercury.

When the amalgam has the proper consistency, the water is poured off and the soft amalgam moulded in the shape in which it is to be preserved. For the purpose of cementing it is recommended to roll it into small cylinders about  $\frac{1}{8}$  inch in diameter and  $\frac{3}{4}$  to  $1\frac{1}{2}$  inches long.

A composition of 25 parts of copper in fine powder, obtained by precipitation from solutions of the oxide by hydrogen, or of the sulphate by zinc, washed with sulphuric acid and amalgamated with 7 parts of mercury, after being well washed and dried, is moderately hard, takes a good polish, and makes a fine solder for low temperatures. It will adhere to glass.

An imitation of gold, *known as Vienna metallic cement*, which, on account of its golden-yellow color and capability for taking a fine polish, is suitable for the manufacture of cheap jewelry, consists of copper 86.4 parts, mercury 13.6. The color of the alloy being, however, very easily affected by sulphuretted hydrogen, it is recommended to provide the articles with a thin coating of pure gold by the galvanic method.

Dronier's malleable bronze is made by adding 1 per cent. of mercury to the tin when hot, and this amalgam is carefully introduced into the melted copper.

Amalgam of tin.—This amalgam was formerly of much greater importance for the manufacture of mirrors and looking-glasses than it is at the present time, when mirrors coated with a thin layer of silver surpass those coated with amalgam in beauty and cheapness. The great affinity of tin for mer-

# ALLOYS OF MERCURY AND OTHER METALS. 435

cury renders the preparation of the amalgam easy; all that is necessary being to combine the tin, which is best used in the form of fine shavings or of foil with the mercury. According to the quantity of mercury rubbed together with the tin, an amalgam solidifying in a shorter or longer time is obtained.

Amalgam of tin for filling teeth.—This amalgam is prepared by intimately rubbing together 1 part of tin with 4 of mercury, removing the excess of mercury by pressing in a leather bag and kneading or rubbing for some time. It is obtained in a flexible mass which hardens in a few days.

Amalgam for mirrors and looking-glasses.—The amalgam which serves for silvering mirrors is a complete saturation of the two metals. It is, however, not prepared by itself, but directly upon the plate of glass which is to form the mirror. The operation is as follows: The glass plate having been thoroughly cleansed from all grease and dirt with puttypowder and wood ash, the workman proceeds to lay a sheet of tin foil of larger dimensions than the plate to be silvered smoothly upon the silvering table, pressing out with a cloth dabber all wrinkles and places likely to form air-bubbles.  $-\mathbf{A}$ small quantity of mercury is then poured upon it and uniformly distributed by means of a fine woolen cloth. When the surface is uniformly covered more mercury is added so as to attain a height of 2 or 3 lines; the coating of oxide is removed with a wooden rod and a brilliant surface produced. The plate of glass is then pushed slowly forward from the side with the longest edge foremost, and dipping below the surface of the mercury so as completely to exclude the air. In this way the glass is brought into contact with the metals and a brilliant surface produced. The plate may now be said to be floating on a bed of mercury. To get rid of the excess

of metal the mirror is loaded with weights and the table inclined  $10^{\circ}$  or  $12^{\circ}$ , when the excess of mercury drains off. A further portion is got rid of by setting the plate up on edge. and in the course of three or four weeks a dry, permanent coating of tin amalgam is left upon the plate.

If curved glass plates are to be converted into mirrors, the amalgam is prepared by itself, and after spreading it as uniformly as possible upon the glass the latter is heated until the amalgam melts.

This method of silvering has many objections: The vapor of mercury is poisonous to the workmen; the plates are liable to fracture from the heavy load placed upon them, and when set up on edge drops of mercury sometimes trickle down, carrying the amalgam with them, thus rendering it necessary to resilver the whole mirror. Moreover, the amalgam is liable to spoil by crystallization or carriage. For these reasons this process has been almost entirely abandoned and that of silvering by precipitation substituted for it.

Amalgam for electric machines.—This amalgam, known as Kienmayer's, consists of mercury 2 parts, tin 1, and zinc 1. It is best prepared by heating the mercury in a rubbing dish and combining with it the metals previously converted into fine shavings by constant kneading. To prevent the amalgam from becoming crystalline a small quantity of tallow is finally added and the kneading continued until the tallow is also completely combined with the amalgam. The finished amalgam must be kept in a well-stoppered glass vessel, and should be used within a few months, as in time it becomes crystalline.

Amalgam for tinning.—Small articles of iron, for instance pins, can be tinned by making them first bright by pickling

# ALLOYS OF MERCURY AND OTHER METALS.

437

in an acid, dipping in melted tin amalgam, blanching in dilute acid, drying and polishing.

Amalgam of zinc.—Zinc amalgamates readily with mercury, it being only necessary to heat the latter to the boiling point and introduce the zinc in small pieces. Zinc amalgam is not directly employed, but is largely used in the zinc anodes of galvanic batteries. For this purpose it is, however, prepared upon the zinc plate itself by heating the latter to about 482° to 500° F., and, after quickly and uniformly coating it by means of a brush with a solution of chloride of zinc and ammonia, dipping at once into mercury. Amalgamation takes place at once, and the plates thus amalgamated give currents of greater constancy and intensity than ordinay zinc plates.

Amalgam of cadmium.—Cadmium readily combines with mercury to an amalgam which easily becomes crystalline. For the preparation of the actual cadmium amalgam, whose composition is  $Cd_5Hg_8$ , proceed in the same manner as already described for other amalgams. Heat the mercury nearly to boiling in a crucible and introduce the cadmium in the form of thin sheet. Cadmium amalgam remains soft for some time and becomes crystalline only after a considerable period. The mass obtained by heating is, therefore, allowed to stand in the crucible until the excess of mercury separates out or it can be separated in the ordinary manner by pressing in a leather bag.

Pure cadmium amalgam forms a tin-white or silver-white mass which softens on being moderately heated and can be kneaded like wax. It is used for filling hollow teeth either by itself or compounded with other metals which make it still better for the purpose. An addition of tin or bismuth makes it more pliant in the heat, and for this reason the mass used

for filling teeth is at present frequently composed of amalgams containing several metals. A few such compositions are given in the following. Those containing lead are, however, not recommended, as lead has poisonous properties and is attacked even in the form of an amalgam by organic acids:

Amalgams for filling teeth

|           |   |   | <b>71</b> | 110 |   | 90 | <br>00 901 | Journy of |        |        |    |
|-----------|---|---|-----------|-----|---|----|------------|-----------|--------|--------|----|
|           |   |   |           |     |   |    | -          |           | Parts. |        |    |
|           | • |   |           |     |   |    |            |           |        |        |    |
|           |   |   |           |     |   |    | I.         | II.       | III.   | IV.    | v. |
| Cadmium   |   |   | •         |     | • |    | 25.99      | 21.74     | 1      | 1 to 2 | 3  |
| Mercury . |   | • | •         | •   |   | •  | 74.01      | 78.26     | _      |        |    |
| Tin       |   |   |           | •   |   |    | —          |           | 2      | 2      | 4  |
| Lead      |   | • | •         | •   | • | •  |            |           |        | 7 to 8 | 15 |

Amalgam No. I. corresponds to the centesimal composition of the above-mentioned combination of cadmium and mercury and is well adapted for filling teeth, it acquiring in time such hardness that it can be worked with the lathe or file, and, of course, becomes hard in the mouth. Cadmium amalgams being very ductile can, moreover, be used for many other purposes. An amalgam of equal parts of cadmium and mercury is extremely plastic and can be stretched under the hammer like pure gold. It is silver-white and constant in the air.

Evans's metallic cement.—This alloy is obtained by dissolving a cadmium amalgam consisting of 25.99 parts of cadmium and 74.01 of mercury in an excess of mercury, slightly pressing the solution in a leather bag and thoroughly kneading. By kneading, especially if the amalgam be previously heated to about 97° F., Evans's metallic cement is rendered very plastic and like softened wax can be brought into any desired form. On cooling it acquires considerable hardness, which is, however, not equal to that of pure cadmium amalgam.

# ALLOYS OF MERCURY AND OTHER METALS.

Amalgams of the "fusible alloys."—The fusible alloys already mentioned in speaking of the alloys of cadmium and bismuth possess the property of melting in an amalgamated state at a still lower temperature than by themselves. By adding a suitable quantity of mercury to them they can be converted into masses well adapted for filling teeth or for cementing metals.

Amalgam of Lipowitz's metal.—This amalgam is prepared as follows: Melt in a dish cadmium 3 parts, tin 4, bismuth 15, and lead 8, and add to the melted alloy mercury 2 parts, previously heated to about 212° F. Amalgamation takes place readily and smoothly. After the introduction of the mercury the dish is immediately taken from the fire and the liquid mass stirred until it solidifies. While Lipowitz's alloy becomes soft at 140° F. and melts at 158° F., the amalgam melts at about 143.5° F. It is very suitable for the production of impressions of objects of natural history, direct impressions of leaves and other delicate parts of plants being obtained, which, as regards sharpness, are equal to the best plaster of paris casts, and, on account of the silver-white color, fine lustre, and constancy of the amalgam, present a very neat appearance. The amalgam can also be used for the manufacture of small hollow statuettes and busts, which can be readily gilt or bronzed by the galvanic process.

The manufacture of small statuettes is readily effected by preparing a hollow mould of plaster of Paris, and, after uniformly heating it to about 140° F., pouring in the melted amalgam. The mould is then swung to and fro, this being continued until the amalgam is solidified. After cooling the mould is taken apart and the seams trimmed with a sharp knife. Some experience being required to swing the mould

so that all parts are uniformly moistened with the amalgam, it may happen that defective casts are at first obtained; in such case the amalgam is simply remelted and the operation commenced anew. With some skill the operator will soon succeed in applying a uniform layer to the sides of the mould and preparing casts with very thin sides. The operation may also be modified by placing the mould upon a rapidly revolving disk and pouring in the melted amalgam in a thin stream. By the centrifugal force developed the melted metal is hurled against the sides of the mould, and in this manner statuettes of considerable size can be cast.

Amalgam of iron.—Iron possessing but little affinity for mercury, it is impossible directly to combine the two metals. The amalgam may, however, be prepared by rubbing together very finely divided iron with mercuric chloride and water and a few drops of metallic mercury, Pure amalgam of iron forms lustrous white crystals, which, however, soon lose their lustre on exposure to the air and become coated with rust. By lying in the air the iron contained in the amalgam is in a short time converted into ferric oxide, which floats upon the metallic mercury.

Though scientifically of interest amalgam of iron is only used in the industries in rare cases where iron is to be fire-gilt, and then is produced upon the article to be gilded itself. For this purpose the article previously made bright by pickling is boiled in a mixture of mercury 12 parts, zinc 1, copperas 2, water 12, hydrochloric acid 1.5. The mercury dissolved in the solution separates upon the iron article, a thin lustrous layer of iron amalgam being formed upon the surface to which the amalgam of gold can be readily and uniformly applied without further preparation. The subsequent treatment of the gilded article is the same as described under fire-gilding.

# ALLOYS OF MERCURY AND OTHER METALS. 441

Amalgam of bismuth.—By introducing mercury into melted bismuth a combination of the two metals is readily effected. The resulting amalgam being very thinly fluid can be advantageously used for filling out very delicate moulds. Other amalgams are also renderer more thinly fluid by an addition of bismuth amalgam, a few examples of which have already been given under cadmium amalgams, and such combinations, being cheaper than pure bismuth amalgam, are frequently used.

Bismuth amalgam can be used for nearly all purposes for which cadmium amalgams are employed. On account of their lustre, which is at least equal to that of silver, they are preferred for certain purposes, such as for silvering glass globes and the preparation of anatomical specimens.

Amalgams for silvering glass globes, etc.—Glass globes can be readily silvered by either of the following compositions:

Parts.

|         |  |  |  |  |  |  |  | Ť | II. | TIL |
|---------|--|--|--|--|--|--|--|---|-----|-----|
| Bismuth |  |  |  |  |  |  |  |   |     | 2   |
| Lead    |  |  |  |  |  |  |  |   |     | 2   |
| Tin     |  |  |  |  |  |  |  |   | 2   | 2   |
| Mercury |  |  |  |  |  |  |  |   |     | 18  |

First melt the lead and tin and then add the bismuth. After removing the drosses pour the mercury into the compound and stir vigorously. Leaves of Dutch gold are sometimes introduced into the mixture according to the color to be imparted to the globes. For silvering the globes heat them carefully to the melting point of the amalgam. Then pour a small quantity of the amalgam into the cavity of the globe and swing it to and fro until its entire surface appears covered.

Amalgam of bismuth for anatomical preparations.—Colored wax was formerly exclusively used by anatomists for injecting vessels. A bismuth amalgam, being of a silvery-white color, is, however, preferable, and by becoming hard on cooling contributes essentially to the solidity of the preparation. The amalgam used for the purpose melts at 169° F. and remains liquid at 140° F., the latter property rendering its use especially suitable for larger preparations. It is composed of: Bismuth 10 parts, lead 3.2, tin 3.5, mercury 2. For use, heat the amalgam in a dish in a water-bath to 212° F., which insures it being forced by the injection-pump into the finest ramifications of the vessels.

Amalgam of sodium.—By itself this amalgam is not used, it quickly decomposing on exposure to the air into caustic soda and mercury. It can, however, be used in the preparation of many amalgams which cannot be made by the direct method. By bringing, for instance, amalgam of sodium together with a solution of a metallic chloride, the respective metal is generally separated from the chlorine combination by the sodium, and the moment it is liberated unites with the mercury to an amalgam while the sodium combines with the chlorine. The presence of a very small quantity of sodium amalgam exerts, moreover, a very favorable effect upon the formation of amalgams, and by its use in the process of amalgamation for gaining gold and silver considerable time is saved and the amalgamation more complete.

Sodium amalgam can be prepared by melting sodium under petroleum and introducing the mercury through a very narrow glass tube. Both metals combine at once with the emission of a peculiar noise, and the amalgam solidifies to a silver white mass, which, to prevent the oxidation of the sodium, must, however, be kept under petroleum until it is to be used.

# ALLOYS OF MERCURY AND OTHER METALS. 443

By introducing sodium amalgam into a solution of chloride of ammonium it swells to many times its former bulk, rises to the surface of the fluid, and is converted into amalgam of ammonium, which is, however, very unstable, being decomposed into ammonia hydrogen, and metallic mercury on exposure to the air.

*Makenzie's amalgam.*—This amalgam, which is solid at an ordinary temperature and becomes liquid by simple friction, may be prepared as follows: Melt 2 parts of bismuth and 4 of lead in separate crucibles, then throw the melted metals into two other crucibles, each containing 1 part of mercury. When cold these alloys or amalgams are solid, but will melt when rubbed one against the other.

Other amalgams.—Besides the amalgams described in the preceding section, there are a number of others, each metal, as previously mentioned, being capable of forming an amalgam. It is, however, not necessary to enter further into this subject, as none besides those mentioned are of any technical value.

The preparation of all these amalgams is effected in the same manner. Introduce into the solution of the pure chloride of the respective metal a corresponding quantity of sodium amalgam. The sodium combines at once with the chlorine, while the liberated metal forms an amalgam with the mercury.

The amalgams of many metals have not as yet been thoroughly examined, and some of them, as, for instance, the amalgams of nickel, cobalt, and chromium, may yet be called upon to take an important part in the practice of the industrial arts.

# CHAPTER XX.

# MISCELLANEOUS ALLOYS.

UNDER this head alloys will be found which could not be very well classified in the preceding chapters.

First may be mentioned a mixture especially adapted for serving as a protective cover in remelting metallic alloys. It is composed of borax, calcined soda, calcined alum and fluor spar, each 1 part.

Alloy for spoons.—A beautiful alloy closely resembling silver is obtained by melting together 50 parts of copper, 25 of nickel, and 25 of zinc.

Alloy resembling German silver consists of copper 58 parts, zinc 27, nickel 12, tin 2, aluminium 0.5, and bismuth 0.5. The separate metals are first melted by themselves and then combined by vigorous stirring. This metal retains its polish for a long time.

Alloy resembling silver.—Copper 70 parts, manganese 30, zinc 20 to 25.

Non-oxidizable alloy.—Iron 10 parts, nickel 36, copper 18, tin 18, zinc 18. This metal has a white color, with a slightly reddish tinge.

Calin.—This term is applied to an alloy for metallic foils used by the Chinese for lining tea-chests. It is composed of lead 126 parts, tin 17.5, and copper 1.25, besides a trace of zinc.

Alloy for moulds for pressed glass.—An alloy suitable for this purpose is obtained, according to C. H. Knoop, of Dresden, by melting together 100 parts of iron with 10 to 25 parts of nickel.

New method of preparing alloys.—The alloys consist of heavy metals and the sulphides of the alkali metals or metals of the alkaline earths. Preferably sulphide of strontium is alloyed with copper in order to obtain a product of a constant gold-like color. For this purpose zinc is melted together with 8 to 15 per cent. of calcined strontium sulphate and the resulting alloy allowed to cool. To this alloy a varying quantity of copper is added, according to the color and power of resistance required. As much of the zinc as may be desired can be expelled by subsequent cupellation.

Alloys of indium and gallium.—L. de Boisbaudran, the discoverer of gallium, has experimented with alloys of indium and gallium. They are distinguished by not having a fixed melting point, but soften gradually, like fats. In this semi-liquid condition they form a mixture of melted and crystalline metal. L. de Boisbaudran has prepared the following alloys:

1. Indium 227 parts, gallium 69.9 parts. This alloy is white, granular, and can be readily cut with the knife; it begins to melt at 132.8° F., and is viscid at 167° F.

2. Iridium 113.5 parts, gallium 69.9. This alloy forms a white coherent mass, but is still softer than the first alloy. It is hard at  $60.8^{\circ}$  F., semi-liquid at  $113^{\circ}$  F., and liquid at from  $140^{\circ}$  to  $176^{\circ}$  F.

3. Iridium 113.5 parts, gallium 139.8. White; soft. It hardens at  $60.8^{\circ}$  F., is butyraceous at  $64.4^{\circ}$  F.; liquid from 140° to 176° F.

4. Indium 113.5 parts, gallium 279.6. This alloy is white, commences to melt at  $62^{\circ}$  F., is semi-liquid at  $95^{\circ}$  F., and liquid at  $122^{\circ}$  F.

Steel composition.—Steel shavings 60 parts, copper 22.5, mercury 20, tin 15, lead 7.5, and zinc 15, are gradually introduced and dissolved in 860 parts of nitric acid. The resulting reddish-brown paste is dried, melted together with twenty times its weight of zinc, and the mass cast in ingots. After cooling, the alloy is remelted with a corresponding addition of tin, according to whether it is to be softer or harder.

Malleable ferro-cobalt and ferro-nickel .--- For the direct gaining of malleable ferro-cobalt or ferro-nickel, the "Fonderie de nickel et méteaux blancs" of Paris claims to utilize either the ores themselves or to prepare first an especially suitable initial product for the final result by melting together corresponding quantities of nickel or cobalt and chromium In melting together the ores the degree of heat at ores. which the liquation of the iron would take place must, however, not be attained. This product of melting, or the raw materials themselves, are melted together in a suitable crucible with potassium ferrocyanide and peroxide of manganese. In running off, a small quantity of aluminium is added. According to the condition desired for the final product, and according to the original content of iron of the ores, a larger or a smaller quantity of cast-iron or wroughtiron can be added from the start, whereby a more or less soft and malleable product is obtained. If, for instance, an alloy of 70 per cent. of nickel and 30 per cent. of iron, with a very small content of sulphur, be used, 71.9 parts of fused nickel, 12 of peroxide of manganese, 16 of potassium ferrocyanide, and 0.1 of aluminium are taken for the mass to be melted together. If, however, nickel ore containing only about 25 per cent. of pure nickel with 64 per cent. of iron, and 11 per cent. of other admixtures, be used, the

melting material is best composed of about 82 parts of fused nickel, 8 of peroxide of manganese, and 10 of potassium ferrocyanide. The alloys thus obtained are claimed to excel in perfect malleability, and completely to retain this property when remelted, so that, on the one hand, malleable ingots are at once produced, and, on the other, all waste and defective castings can be again utilized.

Bronze resisting acids.—Débié gives the following receipt : Copper 15 parts, zinc 2.34, lead 1.82, antimony 1. This alloy melted into a crucible can be worked in the ordinary manner, and is claimed to answer as substitute for lead for lining vessels used in the manufacture of sulphuric acid, etc.

Zinc-iron, being very brittle, is used little as alloy, but on account of its brilliant light promises to become of considerable value for pyrotechnics. Theoretically it is also interesting as an alloy of a very volatile with a non-volatile metal, and, further, it offers the readiest means of obtaining zinc in a finely divided state for purposes where the presence of iron is not objectionable. The best method of preparing the alloy is as follows: Heat 1 to 2 pounds of zinc in a clay crucible to the melting point, then throw 3 to 3.5 ounces of anhydrous sodium ferrous chloride upon the surface of the melted zinc and immediately cover the crucible. A very vigorous reaction takes place during the formation of the alloy mixed with zinc chloride  $(Zn + FeCl_2 + Fe)$ . The excess of the zinc alloys with the reduced iron and forms the exceedingly brittle zinc-iron which can be readily pulverized.

An alloy which expands on cooling is prepared from lead 9 parts, antimony 2, and bismuth 2. It is very suitable for filling up small holes and defective places in cast-iron.

Spence's metal.—This compound is an English invention,

and is named after the inventor. Strictly speaking, it is not a metal, but a compound obtained by dissolving metallic sulphides in melted sulphur, which is found to be capable of receiving into solution nearly all the sulphides of the metals. For most purposes Mr. Spence employs in the production of his "metal" the sulphides of iron, lead, and zinc, in varying proportions, according to the quality of the product desired, which will depend on the uses for which it is designed. On cooling the mixture solidifies, forming a homogenous, tenacious mass, having ordinarily a specific gravity of 3.37 to 3.7. It is said to be exceedingly useful in the laboratory for making the air-tight connections between glass tubes by means of caoutchouc and a water or mercury jacket where rigidity is no advantage. The fusing point is so low that it may be run into the outer tube on to the caoutchouc, which it grips, on cooling, like a vise and makes it perfectly tight. It melts at 320° F., expands on cooling, is claimed to be capable of resisting well the disintegrating action of the atmosphere, is attacked by but few acids and by them but slowly, or by alkalies; is insoluble in water and may receive a high polish. It makes clean, full castings, taking very perfect impressions; it is cheap and easily worked. It has been used as a solder for gas-pipes and as a joint material in place of lead.

Lutecine, or Paris metal.—Copper 800 parts, nickel 160, tin 20, cobalt 10, iron 5, and zinc 5.

Alloys for small patterns in foundries.

I. Tin 7.5 parts, lead 2.5.

II. Zinc 75 parts, tin 25.

III. Tin 30 parts, lead 70.

The last of these alloys is for patterns which will not be in frequent use and which may be mended, bent, etc. The first

gives harder and stiffer patterns; the second is harder than tin and more tenacious than zinc, while at the same time it preserves a certain ductility.

Alloys for calico-printing rollers.—Hauvel considers a semihard bronze of the following composition the best material for the rollers : Copper 86 parts, tin 14, zinc 2.

Rendel, on the other hand, found an English roller material composed of: Copper 5.6 parts, zinc 78.3, tin 15.8. Though this compound gives a hard, fine-grained alloy, it is likely to be very readily attacked by the colors used in printing.

According to analysis by J. Dépierre and P. Spiral, the composition of the scrapers (sometimes called doctors or ductors) intended to remove the surplus of colors from the rollers is as follows :---

|                         | Copper. | Zinc. | Tin. |
|-------------------------|---------|-------|------|
| Yellow French scrapers  | . 78.75 | 12.50 | 8.75 |
| Yellow English scrapers | . 80.50 | 10.50 | 8.00 |
| Yellow German scrapers  | . 85.80 | 9.80  | 4.90 |

According to the researches of the above-named scientists, three groups are to be distinguished: 1. Copper with 95 to 100 per cent. of copper; 2. Brass with about 60 per cent. of copper and 40 per cent. of zinc; and 3. Alloys. In the annexed table I. the physical properties of the examined pieces are given, whereby it has, however, to be remarked that in rollers for printing calico, where the hardness of the metal is of considerable importance, the chemical composition alone does not express the characteristics of the metal, they depending also on the manner of hardening and tempering.

Table II. shows the chemical composition of the samples.

Besides red copper the alloys containing 25 to 30 per cent. of zinc and 75 to 70 per cent. of copper are essentially suitable for rollers. Even as small a content of lead as 0.5 per

cent. exerts an injurious influence, and the samples containing lead showed blow-holes. The presence of phosphorus could not be detected in any of the samples, but Messrs. Dépierre and Spiral are of the opinion that rolls of copper, containing 1 to 2 per cent. of phosphorus, would yield excellent results as regards resistance against chemical influences, as well as hardness, fineness of grain, homogeneousness and durability. An addition of one per cent. of phosphorus might also be recommended for varieties of brass containing 30 to 35 per cent. of zinc.

| -   |             | 1             |                |                     |              |                           |
|---|-------------|---------------|----------------|---------------------|--------------|---------------------------|
| Sample.   | Color.      | Class.        | Density.       | Grain.              | Hardness.    | Remarks.                  |
| 1   | red         | 1             | 8.82           | coarse              | hard         |                           |
| $     \begin{array}{c}       1 \\       2 \\       3 \\       4 \\       5 \\       6     \end{array} $ |             |               | 8.83           | fine                | "            |                           |
| - 3   | "           | î             | 8.82           | coarse              | very soft    |                           |
| 4   | "           | 1             | 8.83           | very fine           | medium       |                           |
| 5   | yellow      | 3             | 8.40           | very fine<br>coarse | hard         | blow-holes.               |
| 6   | "           | 2             | 8.25           | very fine, homo-    | "            |                           |
|   |             |               |                | geneous             |              |                           |
| 7   | "           | 3             | 8.58           |                     | very brittle |                           |
|   |             |               |                | geneous             |              |                           |
| 8   | red         | 1             | 8.88           | very fine           | hard         | burnt.                    |
| 9   | "           | 1             | 8.80           | coarse              | soft         | suitable for print-       |
| -   |             |               |                |                     |              | ing.                      |
| 10  |             | $\frac{2}{3}$ | 8.15           | very fine [ous      | hard         | very unequal.             |
| 11  |             |               | 8.45           | coarse, homogene-   |              |                           |
| 12  | ••          | 3             | 8.50           | fine, not very      | very brittle | many blow-holes           |
| 10  |             |               |                | homogeneous         |              | (1835).                   |
| 13  | red         | 1             |                |                     |              | very good.                |
| 14  |             | 1             | 8.90           | fine                | hard         | bad.                      |
| $\frac{15}{16}$   | yellow      | $\frac{3}{3}$ | $8.35 \\ 8.20$ |                     |              | very good.<br>blow-holes. |
| $10 \\ 17$  | "           | $\frac{3}{2}$ | 0.20           | fine, homogeneous   |              | very bad.                 |
| 18  | red         | $\frac{2}{1}$ | 8 90           | fine                | "            | good.                     |
| 19  |             | -             | 0.00           | nne                 |              | good                      |
| $\hat{20}$  | yellow      | 2             | 8.20           | coarse, not very    | soft         |                           |
|   | 5 //        |               | 0.00           | homogeneous         |              |                           |
| 21  | 66          | 2             | 8.15           | fine, homogeneous   | hard         |                           |
| 22  | "           | 2             | 8.22           | middling            | soft         |                           |
|   | red         | 1             | 8.85           | fine                | hard         |                           |
| 24  | yellow      | $\frac{2}{3}$ |                |                     | -            |                           |
| 25  | gray-yellow | 3             |                |                     |              | attacked by colors.       |
|   |             |               |                |                     |              |                           |

| Ta | ble | I. |
|----|-----|----|
|    |     |    |

| T | ab | le | II. |
|---|----|----|-----|
| 1 | au | 00 | 11, |

|         | of the<br>aples.   | Copper.  | Tin.  | Lead.   | Zine.   | Remarks.   |
|---------|--|--|---|---|---|--|
| Copper. | $3 \\ 4 \\ 8 \\ 9 \\ 1 \\ 2 \\ 14 \\ 18 \\ 23$   | 99.11<br>99.16<br>99.13<br>99.03<br>99.93<br>99.67<br>99.40<br>99.84<br>99.52                      | 0.05<br>0.02<br>0.03<br>0.03<br>traces<br>"<br>"                                      | 0.12<br>0.12<br>0.19<br>0.12<br>0.14<br>0.07<br>0.48<br>traces                      | $\begin{array}{c} 0.57\\ 0.58\\ 0.45\\ 0.60\\ 0.67\\\\\\\\\\\\\\\\\\\\ -$                         | some aluminium.<br>some aluminium and sulphur.<br>""""""""<br>"""" |
| Brass.  | $ \begin{array}{r}     6 \\     10 \\     20 \\     22 \\     21 \\     17 \end{array} $   | $\begin{array}{c} 60.33\\ 61.70\\ 64.41\\ 68.60\\ 58.25\\ 77.68\end{array}$                        | 0.03<br>0.08<br>0.21<br>traces  | $\begin{array}{c} 0.68\\ 0.64\\ 2.86\\ 0.39\\ 0.43\\ 0.42\end{array}$               | $\begin{array}{r} 38.68\\ 37.51\\ 31.88\\ 30.53\\ 41.02\\ 41.41\end{array}$                       |  |
| Alloys. | $     \begin{array}{r}       11 \\       12 \\       7 \\       5 \\       15 \\       16 \\       24 \\       25 \\       \end{array} $ | $\begin{array}{r} 74.51 \\ 76.96 \\ 77.63 \\ 74.12 \\ 79.42 \\ 72.15 \\ 70.40 \\ 15.0 \end{array}$ | $\begin{array}{c} 2.80 \\ 2.55 \\ 2.58 \\ 2.37 \\ 4.17 \\ 3.27 \\ - \\ - \end{array}$ | $\begin{array}{c} 2.18 \\ 1.88 \\ 1.94 \\ 2.22 \\ 1.23 \\ 1.71 \\ 0.60 \end{array}$ | $\begin{array}{c} 19.85 \\ 17.83 \\ 17.16 \\ 20.59 \\ 14.49 \\ 22.16 \\ 28.0 \\ 84.0 \end{array}$ | all contain traces of arsenic<br>and iron.                         |

Alloy for silvering. This alloy consists of tin 80 parts, lead 18, silver 2; or tin 90 parts, lead 9, silver 1. Melt the tin, and when the bath is lustrous white add the granulated lead and stir the mixture with a pine stick; then add the silver and stir again. Increase the fire for a short time until the surface of the bath assumes a light yellow color, then stir thoroughly and cast the alloy into bars. The operation of silvering is executed as follows:

The article, for instance a knife blade, is dipped in a solution of hydrochloric or sulphuric acid, rinsed in clean water, dried, rubbed with a piece of soft leather or dry sponge, and then exposed in a muffle five minutes to a temperature of  $158^{\circ}$  to  $176^{\circ}$  F. The effect of this treatment is to render the surface of the iron or steel porous. With iron not very good and coarsely porous the silvering process is difficult to execute. With steel, however, the process is easy; the article heated to about  $140^{\circ}$  F. is dipped into the alloy melted in a crucible over a moderate fire. The bath, which must be completely liquid, is stirred with a pine or poplar stick. The surface of the bath should show a fine silver-white color. One or two minutes' dipping suffices for a knife blade. When taken from the bath the article is dipped into cold water, or, if necessary, hardened and tempered in the usual manner. It is then rubbed dry and polished without heating.

Articles thus treated have the appearance of silver and also possess the sound of silver, and resist oxidation in the air. To protect them from the action of acid liquids they are first dipped in an amalgam bath of 69 parts of mercury, 39 parts of tin, and 1 part of silver; then, while hot, in melted silver, and electroplated with silver. This method of silvering is claimed to be very durable and not costly.

Robertson alloy for filling teeth.—Gold 1 part, silver 3, tin 2. First melt the gold and silver in a crucible, and at the moment of fusion add the tin. The alloy, when cold, may be finely pulverized. Equal quantities of the powder and mercury are kneaded together in the palm of the hand to form a paste for filling teeth.

American sleigh-bells.—These bells, excelling in beauty, fine tone, and small specific gravity, are manufactured by fusing together 10 parts of nickel and 60 of copper. When this alloy has become cold, add 10 parts of zinc and two-fifths part of aluminium, fuse the mass and allow it to cool; then

remelt it with the addition of  $\frac{2}{5}$  part of mercury and 60 parts of melted copper.

Alloy for casting small Articles.—Fuse a mixture of 79 per cent. of cast-iron, 19.50 of tin, and 1.50 of lead. This alloy has a beautiful appearance, fills the mould completely, and is therefore well adapted for casting small articles. It is malleable to a certain extent.

Arnold's iron alloy.—A compact and malleable iron alloy capable of a fine polish is obtained by melting together 100 parts of crude cast-iron, 1 of soda, 1 of copper,  $\frac{1}{2}$  of tin,  $\frac{1}{2}$  of antimony, and 5 of zinc. The material is claimed to be especially adapted for ship's screws, it resisting the corrosive action of sea-water remarkably well. By omitting the soda and decreasing the quantity of zinc a softer kind of iron is obtained, and a harder material by using a greater quantity of soda and zinc and decreasing the proportion of copper.

Lemarquand's non-oxidable alloy.—Copper 750 parts, nickel 140, black oxide of cobalt 20, tin in sticks 18, zinc 72. The metals must be pure.

Marlie's non-oxidizable alloy.—Iron 10 parts, nickel 35, brass 25, tin 20, zinc 10. Articles prepared from this alloy are heated to a white heat and dipped into a mixture of sulphuric acid 60 parts, nitric acid 10, hydrochloric acid 5, and water 25.

Alloy for sign-plates.—An excellent metal for engraving firm names, etc., upon plates which are to be attached to machines, etc., is prepared as follows: Mix 100 parts of pure melted copper in succession with 6 parts magnesium, 57 parts sal ammoniac, 18 parts unslaked lime, and 9 parts cream of tartar, all the ingredients to be in a finely pulverized state. Now, while stirring constantly, add 15 parts of zinc or tin in

small pieces and continue stirring until the whole is thoroughly melted and mixed. Allow the alloy to remain quietly on the fire for half an hour longer, remove the scum, and pour out the metal. This alloy has a golden color, a very fine grain, is ductile, and does not readily lose its color.

Durano metal.—This alloy is distinguished by great strength and malleability and slight specific gravity (8.3). It contains according to G. Knorre, copper 64.78 per cent., zinc 29.50, tin and antimony 2.22, iron 1.71, aluminium 1.70.

A brass mixed with ferro-aluminium and resembling delta metal contained copper 61.46, zinc, 35.98, lead 0.86, iron 0.91 and manganese 0.76.

# CHAPTER XXI.

# SOLDERS AND SOLDERING.

# Solders in General.

THE so-called solders are alloys in the true sense of the word, but being used for special purposes will have to be separately described. Soldering is the process of uniting the edges or surfaces of metals by means of a more fusible metal which, being melted upon each surface, serves, partly by chemical attraction and partly by cohesive force, to bind them together. There is a great variety of solders know by the names of hard, soft, spelter, silver, white, gold, copper, tin, plumbers', and many others; they may, however, be broadly distinguished as hard solders and soft solders. The former fuse only at a red heat, and are therefore only suitable for metals and alloys which will stand that temperature; the soft solders fuse at a comparatively low temperature, and may consequently be used for nearly all metals. Nearly all the principal metals take part in the composition of solder. The metals to be united may be either the same or dissimilar, but the uniting metal must always have an affinity for both, and should agree with them as nearly as possible in hardness and malleability. When this is the case, as when zinc solder is used to unite two pieces of brass, or of copper, or one piece of each, or when lead or pewter is united with soft solder, the work may be bent or rolled almost as freely as if it had not been soldered. But when copper or brass is united

by soft solder, the joint is very liable to be broken by accidental violence or the blow of a hammer. In all soldering processes the following conditions must be observed: 1. The surfaces to be united must be bright, smooth, and chemically clean. 2. The contact of air must be excluded during the soldering, because it is apt to oxidize one or other of the surfaces and thus to prevent the formation of an alloy at the point of union. This latter object is effected by means of fluxes, which will be referred to later on.

The process called autogenous soldering takes place by the fusion of the two edges of metals themselves without interposing another metallic alloy as a bond of union. The process is possible with the majority of metals and alloys, even the refractory ones, and though it does not actually belong here, the subject being alloys, it will be briefly The union of the metals is accomplished by described. directing a jet of burning oxyhydrogen gas from a small movable beak upon the two surfaces or edges to be soldered together. Metals thus joined together are much less apt to crack asunder at the line of union by differences of temperature, flexibility, etc., than when the common soldering process is employed. This method of soldering is especially of great advantage in chemical works for joining the edges of sheet lead for sulphuric acid chambers and concentrating pans, because any solder containing tin would soon corrode.

All soldered work should be kept under motionless restraint for a period, as any movement of the parts during the transition of the solder from the fluid to the solid state disturbs its crystallization and the strict unity of the several parts. In hard soldering it is frequently necessary to bind the work together in their respective positions; this is done with soft

iron *binding wire*, which for delicate jewelry work is exceedingly fine, and for stronger work is  $\frac{1}{20}$  or  $\frac{1}{30}$  inch in diameter; it is passed around the work in loops, the ends of which are twisted together with the pliers.

In soft soldering the binding wire is scarcely ever used, as, from the moderate and local application of the heat, the hands may in general be freely used in retaining most of the work in position during the process. Thick work is handled with pliers or tongues whilst being soft soldered, and the two surfaces to be united are often treated much like glue joints, if we conceive the wood to be replaced by metal and the glue by solder, they being frequently coated or tinned whilst separated, and then rubbed together to distribute and exclude the greater part of the solder.

# Soft Solders.

The soft solders serve chiefly for soldering tin-plate, sheetzinc, and kitchen utensils of sheet-brass. Their melting points lie between 284° and 464° F. For special purposes the two previously mentioned alloys of cadmium and bismuth, with as low a melting point as 140° F., would be very suitable, but their costliness prevents their general use.

Pure tin is the simplest of all soft solders, and is frequently used for soldering fine utensils of tin. Absolutely pure tin should, however, only be used, as the presence of foreign metals, especially that of iron, considerably increases the melting point. Tin solder is generally employed in the form of semi-cylindrical bars or very thin prisms. For soldering very delicate work tin-foil of very pure tin is frequently used. The surfaces being thoroughly cleansed, and, if necessary, nicely fitted together with a file, a piece of tin-foil is placed

between them. They are then firmly bound together with binding wire and heated in the flame of a lamp or a Bunsen burner, or in the fire, until the tin melts and unites with both surfaces. Joints carefully made may be united in this way so neatly as to be invisible.

The soft solder most frequently used consists of 2 parts of tin and 1 of lead. A cheaper solder is formed by increasing the proportion of lead;  $1\frac{1}{2}$  tin to 1 lead is the most fusible solder, unless bismuth be added. The following table gives the composition of some of these solders with their points of fusion :—

| No. | Parts. |       | Melts at   | No. | Pa                       | rts.  | Melts at   |
|-----|--------|-------|------------|-----|--------------------------|-------|------------|
|     | Tin.   | Lead. | degrees F. |     | Tin.                     | Lead. | degrees F. |
| 1   | 1      | 25    | 558°       | 7   | $\frac{1\frac{1}{2}}{2}$ | 1     | 334°       |
| 2   | 1      | 10    | 541        | 8   |                          | 1     | 340        |
| 3   | 1      | 5     | 511        | 9   | 3                        | 1     | 356        |
| 4   | 1      | 3     | 482        | 10  | 4                        | 1     | 365        |
| 5   | 1      | 2     | 441        | 11  | 5                        | 1     | 378        |
| 6   | 1      | 1     | 370        | 12  | 6                        | 1     | 381        |
|     |        |       |            | 1   |                          |       |            |

For ordinary plumber's work the solders from 4 to 8 are used with tallow as a flux. For lead and tin pipes No. 8 is used with a mixture of rosin and sweet-oil as a flux. For Britannia metal No. 8 is used with chloride of zinc or rosin as a flux. It can also be used for soldering cast-iron and steel, with common rosin or sal ammoniac as a flux. The same solder can also be used for copper and many of its alloys, such as brass, gun-metal, etc., sal ammoniac, chloride of zinc, or rosin being used as a flux. The solder No. 5 is what is called in England *plumbers' sealed solder*, which is assayed and stamped by an officer of the "Plumbers' Company."

The preparation of soft solder is very simple. The tin is first melted, a porcelain or stoneware vessel being best adapted for the purpose, as with the use of iron vessels there is danger of the absorption of iron by the solder. The tin being completely melted the lead is added, and the two metals are thoroughly combined by stirring. The finished alloy is then poured into suitable moulds.

Many manufacturers simply pour the finished solder in a fine stream upon a stone-slab, and subsequently break the sheet thus obtained into small pieces. It is, however, recommended to cast the solder in moulds, as it is more handy for working in this shape, and besides its composition can be better controlled. The most suitable shape is that of thin bars about  $7\frac{3}{4}$  by  $1\frac{1}{2}$  inches and  $\frac{1}{8}$  to  $\frac{1}{4}$  inch thick.

Experts judge the quality of a solder by the appearance of the surface of the cast pieces, and attach special value to its being radiated-crystalline, which is technically called the "flower," and should have a stronger lustre than the dull ground of a dead silver color. If, as it sometimes happens, the solder shows a uniform gray-white color, it contains too little tin, and it is best to remelt it with an addition of a small quantity of tin.

Bismuth solder is composed of bismuth 1 part, tin 1, and lead 1. It melts at 284° F. As will be seen from the composition, it is much dearer than ordinary solder on account of the content of bismuth. It is, however, well adapted for certain purposes, as it is very thinly fluid and considerably harder than ordinary solder.

As previously mentioned every readily fusible metallic composition can be used for soldering, and consequently the fusible alloys of cadmium and of bismuth might be classed

with the soft solders. They are, however, only used in exceptional cases on account of their costliness.

# Hard Solders.

Under this name very different alloys are used, their composition depending principally on that of the metals or alloys to be soldered. Though hard solders are found in commerce, many large manufacturers prefer to make their own solders in order to have them entirely suitable for the purpose they are intended for. According to the metals or alloys for which they are to be used, hard solders are divided into brass-solder for soldering brass, copper, etc., argentan-solder for German silver, gold and silver solders for gold and silver, etc., and this division will be retained here.

Brass-solder is the most fusible of all hard solders and is prepared according to various proportions. It is generally made by melting a good quality of brass together with a determined quantity of pure zinc, or sometimes adding some tin to the mixture. Such solders are composed of brass 8 parts, zinc 1. A somewhat more refractory composition consists of brass 6 parts, zinc 1, and tin 1. And a still more refractory one of brass 6 parts, zinc 1, tin 1, copper 1. The latter solder is the so-called hard brass-solder and is used for soldering iron and copper. In speaking of the respective alloys attention was drawn to the fact that with an increase in the content of tin the color of the brass passes from golden yellow more and more into gray, and that the ductility decreases at a corresponding rate. Varities of brass very rich in tin are no longer ductile, but possess a considerable degree of brittleness. By adding to such compositions tin, their hardness and brittleness are still further increased, and mix-

tures are thus obtained, which, according to their peculiar color, are designated as *yellow*, *half-yellow* or *half-white*, and *white* solder.

Regarding the quantity of metals to be added to the brass, it has to be taken into consideration that solders containing much tin, though quite thinly fluid, acquire such a degree of brittleness as to break in most cases on bending at the soldered place.

In making solders, great care should be taken to secure uniformity of composition; they are often found in commerce in a granulated form or cast in ingots. The most suitable mode of their preparation is as follows: Perfectly homogeneous sheet-brass is used, it being preferable to cast brass, as by rolling it has acquired greater homogeneousness. To prepare the brass for the manufacture of solders directly by melting together copper and zinc, is not advisable, as the unavoidable loss of zinc during the operation can never be exactly determined. By using finished brass it can, however, be readily melted down and compounded, if necessary, with zinc, without any sensible volatilization of the latter.

The brass is first melted in a crucible at as strong a heat as possible, and when thoroughly fused the entire quantity of zinc to be used in the manufacture of the solder, and which has previously been strongly heated, is added. The contents of the crucible are then vigorously stirred and after a few minutes poured out. The granulation of the solder is effected by pouring the melted metal from the crucible or ladle through a wet broom or from a considerable height into cold water. The size of the grains thus obtained varies within wide limits, and in order to obtain a uniform product the grains have to be passed through different-sized sieves and all excessively large pieces remelted.

According to another method, the melted metal is poured into a shallow vessel filled with cold water in which lies a large cannon ball so as partially to project from the fluid. The metal falling in a fine stream upon the cannon ball fies into small pieces of nearly uniform size, which fall into the water, where they quickly harden.

The finest and most beautiful product is, however, obtained in the following manner. At some distance above the level of the water serving for the collection of the grains, a horizontal pipe is arranged which is connected either with a powerful forcing pump or a water reservoir situated at a high level. Before pouring out the melted metal the cock on the pipe is opened so that the jet of water issuing from the pipe is thrown in a horizontal direction over the vessel containing the water; upon this jet of water the stream of melted metal is poured. The greater the force with which the water is hurled from the pipe the greater also the force with which the stream of melted metal is divided, and by this means it is possible, within certain limits, to obtain grains of a determined size. As will be seen from the above description the scattering of the stream of melted metal is based on the same principle as that employed in diffusing fragrant liquids in the air.

Casting being finished, the grains of solder deposited on the bottom of the vessel are collected and quickly dried to prevent them from becoming covered with a layer of oxide, which would exert a disturbing influence in soldering.

The following table shows the composition of various kinds of solder which have stood a practical test for various purposes :—

|                                | Copper.     | Zinc.     | Tin.      | Lead.     |
|--------------------------------|-------------|-----------|-----------|-----------|
|                                |             |           |           |           |
|                                | per cent.   | per cent. | per cent. | per cent. |
| Very refractory                | $^{-}57.94$ | 42.06     |           | ·         |
|                                | 58.33       | 41.67     |           |           |
| Refractory.                    | 50.00       | 50.00     |           |           |
| Readily fusible.               | 33.34       | 66.66     |           | _         |
| Half-white, readily fusible.   | 44.00       | 46.90     | 3.30      | 1.20      |
| White.                         | 57.44       | 27.98     | 14.58     |           |
| Malleable solder.              | 72.00       | 18.00     | 4.00      |           |
| Hard solder according to Volk. |             | 46.70     |           |           |
| 0                              |             |           |           |           |

Since these solders, as previously mentioned, are generally prepared by melting together brass and zinc, we give in the following table the proportions of brass (in sheet) and zinc required for the purpose.

|                  |   | Parts.   |      |
|------------------|---|--|------|
|                  | Brass.  | Zine.  | Tin. |
| Very refractory. | $\begin{array}{c} 85.42 \\ 7.00 \\ 3.00 \\ 4.00 \\ 5.00 \\ 5.00 \\ 12.00 \\ 44.00 \\ 40.00 \\ 22.00 \\ 18.00 \\ 78.25 \\ 81.12 \end{array}$ | $\begin{array}{c} \hline 12.58 \\ 1.00 \\ 1.00 \\ 2.00 \\ 4.00 \\ 5.00 \\ 20.00 \\ 2.00 \\ 2.00 \\ 12.00 \\ 17.25 \\ 18.88 \\ \end{array}$ |      |

| Prechtl | 's brass-so | lders. |
|---------|-------------|--------|
|---------|-------------|--------|

Parts

|                             | 1 (11 (15)    |            |  |  |  |  |
|-----------------------------|---------------|------------|--|--|--|--|
|                             |               | <u>-</u>   |  |  |  |  |
|                             | Copper. Zinc. | Tin. Lead. |  |  |  |  |
| Yellow, refractory          | 53.30 43.10   | 1.30 0.30  |  |  |  |  |
| Half white, readily fusible | . 44.00 49.90 | 3.30  1.20 |  |  |  |  |
| White                       | 57.44 27.98   | 14.58 —    |  |  |  |  |

Composition of the solder

Brass-solders according to Karmarsch :---

|                           |                    |           | ~     |
|---------------------------|--------------------|-----------|-------|
| Brass                     | Zinc               | Copper    | Zine  |
| Yellow, very refractory 7 | 1                  | = 58.33   | 41.67 |
| " refractory 3 to 4       | 1                  | = 50.00   | 50.00 |
| " readily fusible 5       | $2 \ {\rm to} \ 5$ | = 33.34   | 66.66 |
| Half-white                | 4 to 7             | and 1 tin |       |
| ··                        | 10                 | " 1"      |       |
| White 20                  | 1                  | ·· 4 ··   |       |
| "········· 11             | 1                  | " 2 "     |       |
| ·· 6                      | 4                  | ··· 10 ·· |       |

-solders according to Karmarsen .---

Brass-solders containing lead are very rarely used at the present time, those containing besides copper, zinc, and perhaps a small quantity of tin being generally preferred.

Argentan-solder.—The metallic mixture to which this term is applied, not only serves for soldering articles of argentan or German silver, but, on account of its refractory character and considerable toughness, is generally used for soldering articles where the joints are to be especially solid. It is very frequently employed for soldering fine articles of steel and iron.

As regards its centesimal composition, argentan-solder is a variety of German silver especially rich in zinc, which must show considerable brittleness, so that it can be mechanically converted into a fine powder. The proportions according to which the solder is composed vary, and depend chiefly on the composition of the articles of German silver to be soldered with it. Manufacturers of German silver articles especially rich in nickel, and consequently more difficult to fuse, use, as a rule, a somewhat more refractory solder than those manufacturing alloys which contain but little nickel, and which are consequently more fusible. As argentan-solder is not only employed for soldering German silver, but also for articles of steel, efforts have been made to prepare compositions answering all demands, of which the following have stood a practical test :—

a. Readily fusible argentan-solder.—Copper 35 parts, zinc 57, nickel 8.

b. Less fusible argentan-solder (especially adapted for iron and steel).-Copper 38 parts, zinc 50, nickel 12. The alloys are melted in the same manner as German silver and cast in thin plates, which, while still hot, are broken into pieces and converted into as fine a powder as possible in an iron mortar previously heated. If the alloy is readily converted into powder, it contains too much zinc, or if with difficulty, too little zinc. But in either case it does not possess the properties of argentan-solder of the proper proportions, and nothing is left but to remelt it. Hence it is recommended first to ascertain by small samples whether the alloy has the correct composition. For this purpose a small quantity of the melted metal is taken from the crucible by means of a ladle and poured upon a cold stone and then tested as to its behavior in the mortar. If it can be readily pulverized, it indicates an excess of zinc.

This excess of zinc can be removed by keeping the alloy in flux for some time with the crucible uncovered, whereby a considerable quantity of zinc volatilizes, and, after continuing the heating for some time, an alloy showing the required content of zinc is obtained. This method is, however, expensive, as it consumes time and a considerable quantity of fuel. It is, therefore, more suitable to throw small pieces of strongly heated German silver into the melted

alloy and effect an intimate mixture of the metals by stirring with a wooden rod.

If a sample of the alloy cannot be pulverized or broken into pieces by vigorous blows with a hammer, it is a sure proof that zinc is wanting. This defect can be more readily corrected than the preceding one, it being only necessary to throw a small quantity of zinc into the crucible and distribute it as uniformly as possible in the melted mass. After repeating the addition of zinc and testing once, or at the utmost twice, a solder answering all requirements will be obtained.

Argentan-solder has a pure, white color and strong lustre. It melts at quite a high temperature and for this reason is well adapted for soldering, for instance, lamps used for the production of high temperatures (so-called Berzelius lamps) which were formerly much used in chemical laboratories, but which at the present are generally replaced by gas.

# Solders Containing Precious Metals.

Solders containing precious metals—gold and silver—are chiefly used in the manufacture of gold and silver wares, but are also employed for soldering articles of cast-iron, copper, bronze, etc., and by manufacturers of fine mechanical works. Generally these solders consist of an alloy of silver and copper, or silver and brass, for silver-solder; sometimes a small quantity of tin is added, which lowers the melting point and gives a soft silver-solder. The composition of silver solders varies according to the purpose for which they are to be used. In the following the compounds employed in the preparation of the solders most frequently used are given.

Ordinary hard silver-solder .--- Copper 1 part, silver 4. This

alloy is quite tenacious and very ductile. It is preferably used for soldering articles to be worked under the hammer or stamped.

Brass silver-solder.—The alloy known under this name shows also considerable hardness and ductility, and has a somewhat lighter color than the preceding. It is prepared by melting together a fine quality of brass with silver, and is consequently an alloy of silver, copper and zinc. It is composed of sheet-brass 1 part and silver 1.

Soft silver-solder.—The solders given above have a comparatively high melting point. To facilitate the working of smaller articles, solders with a lower melting point are used, which is attained by the addition of a small quantity of tin, which must, however, be very pure. An excellent soft silversolder is composed of sheet-brass 32 parts, silver 32, tin 2.

Hard silver-solders; a. Very hard.—Silver 40 parts, copper 10.

b. Hard.—Silver 40 parts, copper 2, brass 18.

c. Middling hard. Silver 40 parts, copper 10, brass 40, tin 10.

Soft silver-solders: a. For after-soldering, i. e., for soldering articles that have parts already soldered, silver 20 parts, brass 10.

b. Quick running and brittle.—Silver 25 parts, brass 30, zinc 10.

The last composition is frequently used for soldering silveralloys with a very small content of silver. In consequence of the great brittleness of such solder, the soldered places readily spring open.

Silver-solder for cast-iron.—Silver 20 parts, copper 30, zinc 10.

Silver-solder for steel.-Silver 30 parts, copper 10.

For soldering articles of silver the alloy itself of which they are manufactured is in many cases used. But the manipulation is somewhat troublesome on account of the difficulty of keeping the places to be soldered clean, and the pieces must be very nicely fitted together. The solder, in this case, is used in the form of fine shavings and is melted by means of a keen flame. For small articles the flame of a blow-pipe suffices as a rule, but for larger articles it is best to use a special small blowing apparatus, by means of which the solder can be applied very uniformly. It offers the further advantage of leaving both hands free, which is of importance for turning the vessel in front of the flame and for the application of the solder.

Gold-solders.—In color and fusibility the solder used for articles of gold should approach as nearly as possible the alloy of which they are made; the smaller the content of gold in the alloy to be soldered, the more fusible the alloy used for soldering must be. Gold-solders consist in most cases of alloys containing, besides gold, copper and silver; by adding, as is sometimes done, small quantities of zinc, solders with a comparatively low melting point are obtained, the use of which has, however, the disadvantage of the soldered places frequently acquiring a black color during the subsequent coloring of the articles.

Manufacturers use for articles of gold of various fineness solders which must correspond in regard to color and fusibility with the alloy to be soldered. The following table gives the composition of some gold-solders in general use :

|                |               |   |        |       |    |       | Parts.                    |                   |   |               |
|----------------|---------------|---|--------|-------|----|-------|---------------------------|-------------------|---|---------------|
|                |               |   |        |       |    |       | Gold.                     | Silver.           | Copper.   | Zinc.         |
| Hard :<br>Soft |               | or finen  |        | · · · |    |       |                           | $\frac{2.0}{7.0}$ | $\frac{1.0}{3.0}$                                   |               |
| Solder         |               | 11 11<br>11 11  | 583    | •••   |    |       | $\frac{12.0}{3.0}$<br>2.0 | $2.0 \\ 0.5$      | $\begin{array}{c}  5.0 \\  1.0 \\  0.5 \end{array}$ | _             |
| "              | for less      | s finenes   |        |       |    | •••   | $1.0 \\ 1.0$              | $2.0 \\ 2.0$      | 1.0   | =             |
| "              | رر<br>readily | ،،<br>fusible ر   | "      | 583   |    |       | $1.0 \\ 1.0 \\ 11.94$     | $\frac{2.0}{-}$   | $2.0 \\ 28.17$                                      | 5.01          |
| "              | reauny<br>"   | , in the second | for ye | llow  | go | old . |                           | 5.0               |   | $1.0^{-5.01}$ |

Solder for enameled work.—Articles which are being finished are to be decorated with enamel cannot be soldered with every kind of gold solder, since many enamels require so high a degree of heat for fusion as to endanger the durability of the soldered joints. Hence solders with a high melting point have to be used. The following compositions will be found to answer all requirements :—

a. Refractory solder.-Gold 74 parts, silver 18.

b. More readily fusible solder.—Gold (750 fineness) 32 parts, silver 9, copper 3.

Fine gold-solder.—For soldering platinum vessels to be used in laboratories chemically pure gold was formerly used, as alloys of gold and silver are attacked by sulphuric acid, etc., at a boiling heat and even below that temperature. Soldering with fine gold is, however, very difficult, as gold requires a very high temperature to become fluid, and even then runs so thick as to require special skill for the production of a perfect joint. In modern times soldering with gold has been almost entirely abandoned, the pieces of platinum being now directly united with the assistance of the flame of oxyhydrogen gas.

Aluminium gold-solder.—This solder is frequently used by dentists for joining together the separate metallic portions of sets of artificial teeth. Besides aluminium it generally contains gold and silver, though in the place of the latter platinum and copper are now frequently used. In the following we give two receipts for preparing aluminium gold-solder :

I. Gold 3 parts, platinum 0.1, silver 2, aluminium 10.

II. Gold 5 parts, silver 1, copper 1, aluminium 20.

Alloys containing precious metals must, on account of their costliness, be brought into such shape that as little as possible be wasted in using them. In most cases they are cast into thin rods and rolled between steel rolls into thin sheet, which is cut with the shears or pressed into thin strips, the so-called "pallions," or filed into dust, which is no doubt the best method of using them.

# Treatment of the various solders in soldering and soldering fluids, etc.

Solders adhere only to bright and clean metal, and the surfaces of the plates to be soldered must consequently be subjected to a special treatment in order to remove any oxide, grease, etc.

Many substances are used for this purpose in the practice, the most important of which will be briefly discussed in the following: According to their behavior the chemical preparations used in soldering can be divided into several groups, namely, in those which produce a bright surface of the metals by dissolving the layer of oxide upon them.

Dilute mineral acids are generally used for pickling the places to be soldered, hydrochloric (muriatic) acid being chiefly employed for the purpose. By touching the place

where the solder is to be applied with a brush dipped in dilute hydrochloric acid, the oxide is at once dissolved and the melted solder spreads rapidly over the surface. Hydrocloric acid is used upon zinc as well as upon tin. The combination formed by the solution of zinc in hydrocloric acid is, however, very volatile in the heat imparted to the metal by the soldering iron, and a considerable quantity of vapors injurious to the health and also to the metal of the soldering iron are evolved. It is, therefore, recommended to provide the workshop, where much of such soldering is done, with thorough ventilation.

Instead of dilute hydrochloric acid, the so-called soldering fluid is used in many places. It is prepared by dividing a certain quantity of hydrochloric acid into two equal parts, compounding one of these parts with pieces of zinc and leaving it in contact with an excess of it until the development of gas has ceased. The other portion of hydrochloric acid is compounded with carbonate of ammonia until no more effervesence due to the escape of carbonic acid takes place. The two liquids are then combined. In place of the saturated solution of carbonate of ammonia a solution of sal ammoniac in water can be used, equal volumes of the zinc solution and sal ammoniac being in this case taken for the preparation of the soldering fluid.

For brass articles ammonia alone is frequently used, which acts by reducing the layer of oxide upon the surface of the metals. As fluxes for coarser work turpentine, colophony, and a mixture of sal ammoniac and olive oil are also used.

The composition known under the name of "soldering fat" may be prepared by introducing powdered colophony in melted and strongly heated tallow and adding sal ammoniac.

## THE METALLIC ALLOYS.

The mass is stirred until homogeneous and then allowed to solidify.

For hard soldering, substances are used which dissolve the layer of oxide, and form with it a glass-like combination which is melted by the heat and forced out by pressing the soldered pieces together. The best-known agent of this kind is borax, which readily dissolves the oxides in consequence of the excess of boracic acid it contains. For higher degress of temperature, readily fusible glass finely pulverized also does good service, the fused glass dissolving the oxides. A solution of water-glass also answers the purpose and is frequently used in hard soldering.

Hard-soldering fluid.—The composition known under this name consists of a solution of phosphoric acid in alcohol. It is prepared by dissolving phosphorus in nitric acid, evaporating the solution to expel any excess of nitric acid and mixing the syrupy mass with an equal quantity of strong alcohol. The phosphoric acid dissolves the layer of oxide, the combination formed melting under the soldering iron, and is displaced by the melted solder which now comes in contact with the bright metallic surface. The hard-soldering fluid can be advantageously used in soldering copper as well as brass, bronze and argentan. The phosphate of ammonia or of soda is also used in soldering copper.

Still more suitable as a flux in hard soldering is the use of quartz-sand and some decomposed soda. Quartz-sand consists of silicic acid and soda of sodium carbonate. Both these substances on coming together in a strong heat combine to sodium silicate, which, if silicic acid be present in excess, dissolves the oxides. For very high temperatures, as for instance in welding iron, the use of pure quartz-sand by itself

## SOLDERS AND SOLDERING.

473

suffices. By strewing the sand upon the red-hot iron, placing the other piece of iron also red hot upon it, and uniting both by vigorous blows of the hammer, the combination of the silicic acid with the ferric oxide formed upon the surfaces of the pieces of the metal is pressed out in a fluid form, and the two surfaces of iron having become bright will unite.


In soldering copper and brass, or similar metals, with soft solder, many workmen use the soldering iron exclusively, whilst in many cases a better joint may be made by carefully filing the places to be soldered, so that they fit accurately one upon the other, applying soldering fluid to them, and laying a piece of thin tin-foil between them. The parts are then bound together with wire and held over the lamp until the tin foil is melted. Solders 19 and 21 in the annexed table may be recommended for this purpose. The fusing points given in the table may be of advantage to the workmen in case the same piece of work requires several soldering joints. If, for instance, a joint has been soldered with tin-solder No. 5, an adjoining joint may, without hesitation, be soldered with solder No. 16, the melting points of these two solders being far apart.

# 474

# THE METALLIC ALLOYS.

| Melting<br>Point. | 797° F.<br>439° F.<br>388° F.<br>334° F.<br>340° F. | above<br>797° F.   | )<br>320° F.<br>311° F.  | 291° F.<br>232° F.   | 201° F.<br>—  |
|-------------------|---|--|--|--|---|
| Flux.             | Colophony   | Borax<br>Borax<br>Borax<br>Borax<br>Borax<br>Borax<br>Borax  | Borax.<br>Colophony, or zincehlo-<br>Colophony, or zincehlo-<br>Colophony, or zincehlo-<br>ride solution         | Colophony, or zine chlo-<br>ride solution<br>Colophony, or zine chlo-<br>ride solution | ride solution                                       |
| Composition.      | Tin, 1       part; lead 3                           | Malfeable brass, 5 parts; zine, 1<br>Copper, 1 part; zine, 1 | Gold, 12 parts; silver, 2; copper, 4 .<br>Lead, 4 parts; tin, 4; bismuth, 1<br>Lead, 3 parts; tin, 3; bismuth, 1 | 20 50 1<br>20 5 5<br>20 5 5<br>20 5<br>20 5<br>20 5<br>20 5<br>20 5                    | ,<br>,<br>,<br>,<br>,<br>,<br>,<br>,<br>,<br>,<br>, |
| Name of Solder.   | Lead solder, coarse ordinary                        | Hard solder for copper readily fusible                       | Gold solder  |  | Tin solder  |
| No.               |   | 1110<br>1110<br>1110<br>1110<br>1110<br>1110<br>1110<br>111  | 15<br>16<br>17   | 18<br>20   |   |

Soldering jewelry.—Watchmakers in the country, who are often called upon to repair jewelry, can doubtless use the soldering pan described and illustrated in the Swiss "Uhrmacher Zeitung." As is known, the broken parts, for instance, the soldered joint of a finger ring, must be carefully united by binding wire before the actual job of soldering is commenced. This part of the process requires a certain practice, if the repairer does not desire to spend too much time on the job. Next there are various difficulties in hard soldering jewelry with pearls or jewels, because these cannot withstand the heat. These two difficulties are fairly well remedied by the pan shown in the accompanying illustrations. It consists of a suitable deep copper pan—A, Fig. 30—furnished with handle. The pan has two lateral projections, a and c, in which move two milled screws, K and M. These may be used to good

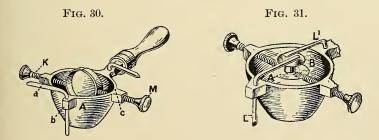


effect if a broken ring is to be soldered, as it is only necessary to fasten it between the screws K and M, as shown in Fig 30, with the joint to be soldered turned up, after which the job of soldering may be undertaken without even soiling one's finger with the coal.

For other purposes the two clamps L L', Fig. 31, are used besides the screws K and M, for instance, when the upper plate B is to be soldered upon a shirt button. Of the two

# THE METALLIC ALLOYS.

 clamps, one moves in the handle of the pan; the other in an opposite shoulder b, Fig. 30, moving with tight friction so that they will keep steady the part B to be soldered, if previously the lower part A of the shirt button was fastened between the screws (see Fig. 31).

In Fig. 32 the pan is shown in cross section, to indicate how it is to be used in case a ring with jewel is to be soldered.



This is to be fastened as deeply as possible between the screws, and the pan is then filled to a proper height with sand. Above is placed a layer, *O*, of small

pieces of coal or asbestos, and soldering may then be commenced without danger to the jewel.

# CHAPTER XXII.

# DETERMINATION OF THE CONSTITUENTS OF METALLIC ALLOYS, OF THE IMPURITIES OF THE TECHNI-CALLY MOST IMPORTANT METALS, ETC.

SINCE most metals dissolve in nitric acid, pour over the sample in a glass flask chemically pure nitric acid and assist solution by careful heating over a spirit flame.

1. Gold and platinum dissolve only in aqua regia; tin and antimony are only oxidized by nitric acid. Hence if an undissolved residue of the sample remains, it indicates *gold*, *platinum* or *antimony* (or carbon with cast-iron). Filter the residue, which may be termed A, from the solution and treat it further as given under 15.

2. Dilute a sample of the filtrate (or, if filtration be not necessary, a sample of the solution) in a test-glass with distilled water. If turbidity or a white precipitate appears it indicates *bismuth*, which has been precipitated as basic salt from the solution by water. The non-appearance of this reaction, however, is not conclusive proof of the absence of bismuth, since an excess of nitric acid prevents the precipitation of basic bismuth nitrate. To be certain, first evaporate the sample to drive off the acid and then dilute with water.

3. Another sample of the solution is mixed with dilute sulphuric acid. If a white, granular precipitate is formed, the sample of metal contains *lead*, because only sulphates of lead are insoluble in acids.

4. If, on mixing a portion of the original solution, or in (477)

# THE METALLIC ALLOYS.

case the test for lead was successful, a portion of the filtrate free from lead, with pure hydrochloric acid, a white, caseous precipitate is formed if the metallic sample contains *silver* or *mercury*. In case test No. 3 has not been previously executed, a precipitate of chloride of lead may take place if *lead* is present. For the further treatment of this precipitate, which may be termed B, see under 14.

5. Add to a small sample of the solution in nitric acid a few drops of caustic ammonia. If the solution acquires a fine blue color, the sample of metal contains *copper*.

6. To test for *mercury*, evaporate a few drops of the solution in nitric acid to expel the acid, and dilute with water. If a copper wire placed in the aqueous solution turns gray and becomes white with a metallic lustre on rubbing with the finger, the presence of mercury is shown.


7. Next conduct into a somewhat larger sample of the solution sulphurretted hydrogen and compound it with water containing sulphuretted hydrogen. All metals mentioned in 1 to 6 are precipitated as metallic sulphides. Hence, a precipitate, which may be termed C, will generally be obtained. This precipitate is filtered off, thoroughly washed with water containing sulphuretted hydrogen, and further tested for cadmium as given under 16. Since sulphuretted hydrogen is frequently used, it being a reagent of great value to the chemist, a simple and cheap apparatus, so that a supply may at any time be had, may be made as follows: Cut off the bottom of a long bottle\* of small diameter, D, say about two inches, and fit it into a fruit jar E, as in Fig. 33.

\* Cut a nick, with a large file, in the spot where you wish to start a crack near the bottom, then heat a rod or poker nearly red hot, place it on the nick; a crack starts; draw your hot iron and the crack will fol-

# CONSTITUENTS OF METALLIC ALLOYS.

The top A should be fitted loosely, so that it may be removed and let air pass through. The cork at B must be air-

tight. Fit a small tube into the cork after bending it in a spiritlamp flame—a quarter-inch tube with an eighth-inch aperture is sufficiently large and is easily bent. Take an inch rod of iron, let the blacksmith heat it white hot and press it into a small roll of brimstone; this will give you

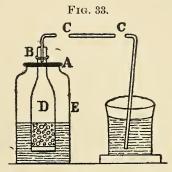

iron sulphide-you need it in pieces as large as bullets; it melts readily against the brimstone. Place some cotton in the neck of the bottle, and, having fitted a plug of wood with holes in it for the bottom of the bottle, invert the bottle and fill it half of iron sulphide lumps, fasten the wooden plug in the bottom, not very tightly, but tightly in three or four places, so that water can pass freely, and yet the plug be well fixed in. Put the bottle in its place, resting in the jar at A, and somewhat loosely fastened. But this must be after you have half filled the jar with a mixture of equal parts common hydrochloric acid and rain water. Sulphuretted hydrogen will form immediately, and if you have made all connections perfectly as in the figure, the gas will pass from this apparatus into the sample of the solution in the beaker, and precipitation will soon take place. The advantage of this apparatus is, that if you tie two little blocks of wood against the side of the rubber tubes CC, so as to press the sides together and stop the gas

low; when nearly cracked around, pull the bottom off. A glass chimney may be used, but it is rather too small to contain sufficient iron sulphide.

from flowing, the gas forming pushes the water out of the interior glass D, and the gas stops forming, but is ready at any moment to begin as soon as the string around the blocks is removed.

8. Neutralize the filtrate from the previous experiment and mix it with ammonium sulphide. The precipitate formed, which may be termed D, is washed out with water containing ammonium sulphide and tested according to 10. *Magnesium* may also be contained in the filtrate.

9. To determine *magnesium* evaporate a small quantity of the filtrate obtained in 8, and add some *sodium phosphate* and *ammonia*. If the solution contains magnesium, a crystalline precipitate of ammonium magnesium phosphate is formed, which is insoluble in ammoniacal water.

10. Pour dilute hydrochloric acid over the precipitate D (from 8). If a black residue—consisting of *sulphides of nickel* and cobalt—which may be termed E, is formed, it is filtered off and further tested according to 11. Boil the filtrate until the sulphuretted hydrogen is completely driven off, then compound it with nitric acid, boil again, and evaporate. Now compound with strong alkaline lye in excess, boil and filter. The precipitate, which may be termed F, is analyzed according to 12. The filtrate may contain zinc or alumina. Both are determined according to 13.

11. The residue E (from 10) is dissolved in hydrochloric acid, a few drops of nitric acid are added and the solution is evaporated nearly to dryness. By adding some sodium nitrate and acetic acid, and after standing for some time in the heat, a yellow precipitate is formed if cobalt be present. After 12 hours filter off and compound the filtrate with caustic soda. Nickel is present when a greenish precipitate is formed, which

does not completely dissolve in the excess of the precipitating agent.

12. A portion of the precipitate F (from 10) is dissolved in hydrochloric acid and a sample of it tested :

a. With potassium ferrocyanide for *iron*.

b. Melt another sample with *potassium carbonate* and *potassium chlorate*, and boil the melted mass with water. If *chromium* was present it has been converted into chromic acid (yellow solution), and can be readily recognized by compounding the solution with *sugar of lead*. If chromium is not found, a portion of the sample is tested with the blow-pipe for *manganese*.

c. If chromium was found, a portion of the hydrochloric acid solution is neutralized with *potassium carbonate*, compounded with caustic soda in excess, and the precipitate tested for *manganese* and the filtrate for *zinc*, according to 13.

13. Moisten the solution to be tested for manganese upon a platinum-sheet with some soda and a trace of saltpetre, and let the flame of the blow-pipe act upon it. If the solution contains manganese a green paste is obtained, which on cooling turns blue-green. The filtrate from 10 may contain zine or alumina. Compound a portion of it with sulphuretted hydrogen; a white precipitate (sulphate of zinc) indicates zinc. Acidulate another portion with hydrochloric acid, add ammonia in slight excess and warm. Alumina, if contained in the solution, is precipitated as aluminium hydrate.

14. The white precipitate B (from 4) may contain chloride of silver, chloride of lead or subchloride of mercury. Treat it with much *water*, whereby chloride of lead is dissolved; the *lead* may then be determined as in 3, with sulphuric acid. Treat the residue with *ammonia*. If complete solution takes

place, the residue consists of chloride of silver, and from the solution the *silver* is again precipitated as chloride of silver by nitric acid. A black residue, insoluble in water and ammonia, consists of chlorine and *mercury* (subchloride of mercury).

15. The residue which remained by dissolving in nitric acid is warmed in aqua regia. If a white insoluble powder is separated it generally consists of chloride of silver, more rarely of chloride of lead. Though silver and lead by themselves are soluble in nitric acid, by alloying with the more noble metals they are frequently protected from solution, and may be contained in the residue. They are determined according to 14. A portion of the solution is now mixed with ferrous sulphate solution. A fine brownish separation consists of *metallic gold*. A yellow precipitate produced by sal ammoniac establishes the presence of *platinum*.


If the residue A consists of a white powder it is washed with water and boiled in a flask with tartaric acid. If it is soluble it consists of oxide of antimony; if insoluble it contains *tin*.

16. The precipitate C (from 7) obtained with sulphuretted hydrogen contains a number of metallic sulphides, a portion of which—antimony, arsenic, tin, gold, platinum—is dissolved by ammonium sulphide. The residue is boiled with dilute nitric acid and dissolves thereby, separating flaky sulphur, which floats upon the solution. If a portion remains undissolved it consists of *oxide of mercury*. From the filtered solution separate the lead by means of sulphuric acid (see 3), and after settling, filter, and mix with ammonia. A precipitate indicates *bismuth*; a blue coloration *copper*. Evaporate the solution completely, add some acetic acid and water, and precipitate the copper with sulphuretted hydrogen. *Cadmium*, if present, is precipitated as sulphide of cadmium, and hence the

# CONSTITUENTS OF METALLIC ALLOYS. 483

precipitate has to be treated with boiling sulphuric acid. The sulphide of cadmium is dissolved, while sulphide of copper remains undissolved. If the alloy contains cadmium *yellow* sulphide of cadmium is precipitated from the filtrate by sulphuretted hydrogen.

17. Some alloys contain arsenic, it being also found as an impurity in many metals. To complete the analysis, a test for arsenic must therefore be made. Marsh's apparatus is used for this purpose. It consists of a flask a (Fig. 34), in

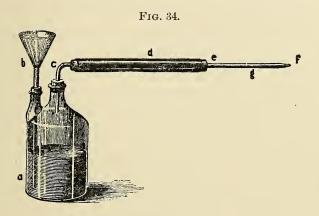

which hydrogen gas is developed from chemically pure zinc and dilute pure sulphuric acid. The tube c ends in a wide glass tube d, which is filled with calcium chloride for drying the gas. The gas escapes through the smaller tube e, running to a point at f. If now through the funnel b a few drops of the metallic solution are brought into the apparatus, the flame of hydrogen will acquire a *blue* coloration if the solution contains arsenic, and a white smoke of arsenious acid will rise from it. The arsenietted hydrogen formed is very poisonous, a few bubbles of it being sufficient to cause death. If a piece of glass or porcelain is depressed upon the flame it will acquire

# THE METALLIC ALLOYS.

a metallic mirror of arsenic. The metallic mirror, however, is not an infallible test, since *antimony* produces the same phenomenon. To ascertain whether arsenic or antimony has to be sought for in the metal, drop a little solution of calcium chloride upon the metallic mirror; arsenic is immediately dissolved, while antimony remains unchanged.

Testing brass.--Evaporate the alloy with nitric acid to dryness, take up with a few drops of nitric acid and with water, filter the residue (oxide of tin, with or without oxide of antimony), precipitate from the filtrate lead with sulphuric acid, from the filtrate of sulphate of lead copper with sulphuretted hydrogen, from the oxidized filtrate any iron present by ammonia and ammonium chloride, and from another portion of the filtrate by potash lye manganese to be tested with saltpetre and soda. For establishing a content of antimony in the separated oxide of zinc dissolve the latter in as little hydrochloric acid as possible, bring the fluid upon a platinum sheet and a small piece of zinc, whereby if antimony is present a darkbrown to black stain is formed. In the absence of tin and presence of small quantities of antimony in solution, supersaturate the solution in nitric acid with potash lye, heat with solution of potassium bisulphide, filter, and precipitate from the filtrate with hydrochloric acid sulphide of antimony as well as sulphide of arsenic; dissolve the precipitate in fuming hydrochloric acid and test upon a platinum sheet with zinc for antimony. Dissolve the residue (sulphide of arsenic) insoluble in the acid in a little hydrochloric acid and potassium chlorate, heat until the odor of chlorine disappears, and test for arsenic in Marsh's apparatus, Fig. 34. A content of bismuth may be detected by dissolving a larger quantity of alloy in as little dilute hydrochloric acid of 1.12 specific gravity as

485

possible, heating carefully, filtering off separated oxide of tin, precipitating bismuth from the filtrate with ammonia, dissolving the precipitate in greatly dilute hydrochloric acid and allowing the solution to fall drop by drop into a large quantity of water, whereby a white turbidity appears.

Testing Britannia metal. Good qualities of Britannia metal, which can be rolled, contain 90 to 93 per cent. tin, and, at the utmost, 10 per cent. antimony and 0 to 3 per cent. copper, while inferior qualities contain less than 85 per cent. tin. Hence, the principal point would be the determination of the content of tin. For the purpose of testing whether, besides tin and antimony, other metals are present, oxidize with nitric acid, super-saturate with ammonia, add ammonium sulphide and heat. If the resulting solution is not clear, other metals are present.

Decompose the bronze with nitric acid, Testing bronze. evaporate to dryness, heat the residue with water, filter off the stannic acid, separate from the filtrate lead by means of alcohol and sulphuric acid, and from the filtrate thereof copper by means of sulphuretted hydrogen; filter, add to the filtrate, freed from sulphuretted hydrogen by heating, some potassium chlorate, precipitate iron with ammonia in excess, and from filtrate, supersaturated with acetic acid, zinc with sulphuretted hydrogen; supersaturate the filtrate thereof with ammonia and precipitate manganese with ammonium sulphate. A test for arsenic may be made in Marsh's apparatus by dissolving a sample in hydrochloric acid, with addition of potassium chlorate and heating the fluid to be tested until the chlorine odor disappears. A very sensitive test is, according to Gutzeit, as follows: Pour over zinc in a test tube hydrochloric or sulphuric acid, add the solution to be tested for arsenic, close the

# THE METALLIC ALLOYS.

mouth of the tube with a cotton stopper, place filtering paper over the latter and bring upon the centre of the paper a drop of a solution of nitrate of silver in equal parts of water. In the presence of arsenic the moistened place acquires, first below and then on top, a lemon-yellow color, a brown-black ring being at the same time formed on the periphery, which gradually extends towards the centre and finally disperses the vellow coloration. In the presence of much arsenic the vellow coloration is only transitory. Antimony gives only a dark brown-red ring on the periphery, while in the presence of much antimony the interior space of the ring appears graywhite. To detect *phosphorus* precipitate from the solution in aqua regia, copper and tin, with sulphuretted hydrogen, supersaturate the filtrate with ammonia, precipitate iron, zinc and manganese with ammonium sulphate, and from the filtrate thereof, ammonium-magnesium phosphate with ammonium chloride, magnesium chloride and ammonia.

Testing German silver.—The quality of German silver being dependent on the content of nickel, is recognized by its color, a yellowish coloration indicating an inferior product. A content of arsenic is detected by dissolving a sample of the alloy in nitric acid, evaporating with sulphuric acid until the nitric acid is expelled, diluting with water and testing in Marsh's apparatus, Fig. 34, or according to Gutzeit's method given above.

To test gold-ware.—When a sample of the alloy cannot be had for a chemical test, the touchstone forms a convenient means of examination. It consists of a species of black basalt obtained chiefly from Silesia. If a piece of gold be drawn across its surface a golden streak is left which is not affected by moistening with nitric acid, whilst the streak left by brass

# CONSTITUENTS OF METALLIC ALLOYS.

487

or any similar base alloy would be rapidly dissolved. Experience enables an operator to determine by means of the touchstone nearly the amount of gold present in the alloy, comparison being made with the streaks left by alloys of known composition.

Resistance of a Few Metals and Alloys to Calcium Hydrate.— Filings and turnings of the metals to be examined, in quantities of 77 grains, were left, at a normal temperature, to the action of milk of lime with 4 per cent. hydrate for 14 days; they were then separated from the lime solution by washing until phenolpthaleine showed no longer a red coloration, dried and weighed. The results were as follows:

1. "Saxonia" pure soft lead : loss of weight, 0.811 per cent. The metal was considerably attacked.

2. Antimony regulus: the metal remained entirely unchanged.

3. Lead pipe (with 25 per cent. slag lead): loss of weight, 0.299 per cent.; considerably attacked.

4. Lead plate (12 per cent. slag lead): loss of weight, 0.658 per cent.; considerably attacked.

5. Pure cast iron : increase in weight, 0.014 per cent. ; very much corroded.

6. Brass: loss of weight, 0.686 per cent.; considerably attacked.

7. Phosphor-bronze: no alteration.

8. Pure tin : loss of weight, 0.122 per cent.; the metal was but little attacked.

From these results it may safely be concluded that for pumps intended for the conveyance of milk of lime, phosphorbronze or an alloy of tin and antimony is most suitable.

To Distinguish Tin-foil from Lead-foil .- Treat the foil with

concentrated sulphuric acid; tin is dissolved, while lead remains undissolved.

To Test Mercury as to its Purity.—Pour nitric acid over a drop of mercury in a dish. If pure the mercury moves for a moment and then remains quiet and motionless. If it contains foreign metals it commences at once a vigorous circular motion, which is kept up until the mercury is completely dissolved.

Tin is generally tested as to its purity by breaking it, whereby it gives out a single, crackling sound (the cry of tin). To recognize the nature of impurities dissolve a sample in aqua regia; arsenic and antimony are detected by Marsh's apparatus (see p. 483). Mix another portion of the solution with potassium ferrocyanide: a white precipitate indicates the purity of the tin; a blue precipitate generally the presence of *iron*, and a red-brown precipitate that of *copper*. Lead may be detected by the addition of sulphuric acid or Glauber's salt.

Soft Solders are tested in the same manner. They should contain only tin and lead. Some soft solders contain bismuth, which is detected by diluting the solution (see under 2, p. 477).

To Detect Lead in Tin.—Make a solution of potassium bichromate in water. Next apply some acetic acid to the tin to be tested, which will produce a whitish coating. Then apply some of the potassium bichromate solution, and if the whitish coating turns yellow the tin contains lead, and the more the yellower the coating becomes.

White metals should always be tested with Marsh's apparatus, Fig. 34. If the metallic mirror is only partially dissolved by chloride of lime, the sample contains *arsenic* and antimony. The other constituents are found in the manner already stated.

# CONSTITUENTS OF METALLIC ALLOYS.

Nickel has only to be tested for copper, iron and cobalt. The manner of determining copper has been given under 5, p. 478. Iron can be recognized by its reaction with potassium ferro-cyanide. To determine the presence of *cobalt*, dissolve the metal in hydrochloric acid, dilute the solution with water, and write with a clean goose-quill upon a strip of white paper. After drying heat the writing; if it appears emerald-green to blue-green the solution contains cobalt. For other methods see under 11, p. 480.

# COLORING OF ALLOYS.

In many cases alloys are provided with a coating, the object being either to increase their beauty or to protect them from oxidation and discoloration. Articles of ordinary alloys, which are not to be exposed to the fire, are frequently only provided with a coating of lacquer consisting usually of a solution of shellac in alcohol, that made with 'stick lac'' being as a rule, the best. The lacquer may be colored by any permanent transparent alcoholic solution giving the desired tint. Dragon's blood, red sanders, or annotto is senerally used for red, and gamboge, sandarac, saffron, turmeric, or aloes for yellow; these coloring matters may be replaced by aniline colors. In applying the lacquer care should be had to keep the article to be lacquered warm and of uniform temperature, and to perform the work as quickly and smoothly as possible. Keep the lacquers in well-stoppered bottles, best of opaque material. For use pour them into dishes of convenient size, and apply them with a thin, wide flat brush. The following is Graham's\* table of lacquers:-

> \*Brass-Founder's Manual, London, 1887. ( 490 )

| -  |  | ]       | 1              |  |                    |                        | 1                   | 1                    | 1  | 1   |          |  | 1   |                                   |             |                 |   |
|--|--|---------|----------------|--|--------------------|------------------------|---------------------|----------------------|--|---|----------|--|---|-----------------------------------|-------------|-----------------|---|
| Number.  | Shellac.   | Mastic. | Canada balsam. | Spirits of wine.   | Pyro-acetic ether. | Spirits of turpentine. | Turpentine varnish. | Simple pale lacquer. | Dragon's blood.  | Annotto.  | Sanders. | Turmeric.  | Gamboge.  | Saffron.                          | Cape Aloes. | Sandarac.       |   |
| 1<br>2<br>3<br>4<br>4<br>5<br>6<br>7<br>8<br>9<br>10<br>11<br>12<br>13<br>14<br>15<br>16<br>17<br>18<br>19 | $\begin{array}{c} \text{oz.} & 4 \\ 1 \\ 1 \\ 1 \\ 2 \\ 2 \\ 5 \\ - \\ 3 \\ 3 \\ 1 \\ 3 \\ 3 \\ 3 \\ - \\ 1 \\ 15 \end{array}$ | dr.<br> | dr.<br>        | $\begin{array}{c} \text{pt.} \\ 1 \\ 1 \\ 1 \\ 1 \\ 2 \\ 2 \\ 1 \\ 3 \\ -1 \\ 4 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ - \\ 6 \\ - \end{array}$ | oz.<br>            | dr.                    | oz.<br>             | pt                   | dr.<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>- | dr111 | gr.      | $\begin{array}{c} \mathrm{dr.} & - & - \\ - & - & - \\ - & - & - \\ - & - &$ | dr.<br>-<br>1<br>1<br>1<br>6<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>-<br>- | dr2<br>42<br>42<br>12<br>11<br>10 | dr          | dr 8 8 14 5 277 | Strong simple.<br>Simple pale.<br>Fine pale.<br>Pale yellow.<br>Gold.<br>"<br>Deep gold.<br>"<br>Red.<br>"<br>Tin lacquer.<br>Green, for<br>bronze. |

By coating articles of copper or brass with good fat copal lacquer, and heating after drying until the lacquer commences to smoke, a coat is obtained which protects the articles as well as the tinning against the action of acid liquids.

Articles of copper and bronze exposed for a long time to the action of the air acquire a beautiful brown or green color, which considerably contributes to their handsome appearance. This color is known as *Aerugo nobilis* (noble rust) or *patina*.

Though there are many agents by means of which a layer of patina can be produced upon the bronze, the coating thus obtained cannot compare, as regards beauty and durability, with the genuine patina.

In order to obtain a coating similar to genuine patina, is is recommended to pursue as nearly as possible the same course by which the latter is naturally formed. By the action of the rain, which always contains salts, though in very minute quantity, in solution, the copper is attacked and basic salts of copper are formed upon the surface, which in the course of time are converted by the action of the carbonic acid of the air into basic copper carbonate. The latter has a beautiful green color and is found

in nature as malachite. But besides this process others also take place upon the surface of the article, especially upon that of monuments erected in large cities. The air of the latter is constantly charged with certain quantities of sulphur combinations originating partially from the putrefaction of excrements, etc., in the sewers and partially from the combustion of coal containing sulphur. Now copper being very sensible to the action of sulphuretted hydrogen, a coating of black cupric sulphide is consequently formed upon the surface of the object, which explains why bronze statues erected in large cities frequently turn black. Dust and fine particles of soot, which deposit themselves especially in the depressions on the objects, further contribute to their becoming black. Cupric sulphide has, however, the property of becoming rapidly converted in the air into copper sulphate, from which is again formed copper carbonate, or, so to say, a coating of malachite. Genuine patina, especially that observed on very antique statues, consists, therefore, of a very firmly adhering coating of malachite.

To produce upon a statue a patina-like deposit, brush it over with a very dilute solution of cupric nitrate to which a small quantity of common salt solution may be added. When the statue is entirely dry, brush it with a fluid consisting of 100 parts of weak vinegar, 5 parts of sal ammoniac, and 1 part of oxalic acid, and repeat the application after drying. In consequence of this treatment the statue in the course of about one week acquires a greenbrown color resembling that of genuine patina.

A finer coating, which more closely resembles genuine patina, is, however, obtained by dipping the article into the solution of cupric nitrate, and placing it in a room where a large quantity of carbonic acid is developed, the fermenting room of a distillery being especially adapted for this purpose, since the high temperature prevailing therein promotes the formation of the green coating. The progress can in this case be watched from day to day, and if in about a week the statue has not acquired the desired coloration, the application of the above-mentioned solution is repeated, this being continued until the desired tint is obtained. The formation of the patina under these conditions taking place in a similar manner as in the open air, a very beautiful and durable coating is obtained.

For coating articles of brass with a green patina apply a solution

prepared by dissolving 10 parts of copper in 20 parts of nitric acid, diluting the solution with 150 parts of vinegar and adding 5 parts of sal ammoniac. Allow the articles to stand a few days in the air, and when a green coloration has made its appearance, brush them with old linseed oil and after a few days rub them with a soft woolen rag. If after the application of the linseed oil the article readily bronzes, a very beautiful patina will soon appear.

There are several methods of giving an agreeable brown patina to medals. It is, however, most readily accomplished by heating the medal in a spirit flame and then brushing with graphite. To color a number of medals at the same time dissolve 30 parts of verdigris and 30 parts of sal ammoniac in 100 parts of vinegar, and add water to the solution until a precipitate is no longer formed. Place the medals without touching each other upon the bottom of a shallow dish, pour the boiling hot solution over them, and allow them to remain until they have acquired the desired tint, which should be a fine brown.

Copper articles before being brought into commerce receive generally a brown coloration, which is produced by polishing the articles with pumice stone and then coating them with a paste prepared from 5 parts of verdigris, 5 parts of colcothar, and some weak vinegar. The articles are then heated over a coal fire until the coating is entirely dry and has acquired a black color. It is then removed by washing with water, and the dry articles are rubbed bright with a rag greased with a very small quantity of tallow. A beautiful brown color is also obtained by applying a paste of colcothar and water, heating over a coal fire, and removing the coat by rubbing.

Another method of browning copper consists in rubbing it bright with glass paper, heating strongly over a coal fire, and brushing with the following solution: Crystallized acetate of copper 5 parts, sal ammoniac 7, dilute acetic acid 3, distilled water 85. Finally rub the article with a solution of 1 part of wax in 4 parts of oil of turpentine.

To brown gun-barrels prepare the following solutions: (a) Solution of ferric chloride (liq. ferri sesquichlor.) 1.40 parts, corrosive sublimate 3 parts, blue copperas 3 parts, fuming nitric acid 3 parts, and distilled water 80 parts. (b) Potassium sulphide 10 parts, distilled water 900. Apply solution a twice or three times to the

polished barrel by means of a sponge or soft brush, placing it after each application in a cool room in order to retard drying, and brush it thoroughly before each new application with a steel wire brush (scratch brush). When the barrel appears dark enough place it for 20 to 30 minutes in the bath b, and after taking it out wash with warm water and next with soap water. The dry barrel is finally rubbed with linseed-oil varnish.

For another method the following baths are prepared: (a) Fuming nitric acid 2 parts, distilled water 98. (b) Nitrate of silver 1 part, distilled water 99. The polished barrel is brushed over with a, and treated with the scratch brush in the same manner as described in the preceding process until a beautiful layer of oxide is formed. It is then thoroughly cleansed with the scratch brush and the bath b applied until it is sufficiently dark, and finally rubbed with linseed-oil varnish.

The new bronze upon French bronze figures shows all shades of pale or clay yellow to red brown and of red to dark and black brown. It has a bronze-like appearance and adheres tightly to the metal; *i. e.*, is chemically combined with it. To produce such colorations, solutions of sulphur, combinations of arsenic and antimony have been successfully used. After chasing and pickling the article must be subjected to a thorough washing with water, as otherwise every trace of acid left behind will later on in drying or bronzing penetrate through the seams and produce indelible stripes and stains. The drying of the article must also be done with the greatest care. For applying the solutions a tuft of cotton or a soft, close brush is used. The work is best commenced by first applying a dilute solution of ammonium bisulphide as sparingly as possible, brushing over a certain limited portion of the figure at one The quicker and more uniformly this is done the better time. and more beautiful the bronzing will be. After drying the sulphur separated out is brushed off and a solution of sulphide of arsenic in ammonia applied, the result being a coloration similar to massive gold. The oftener this solution of sulphide of arsenic is applied the browner the color becomes, and a very dark brown can be finally obtained by a solution of sulphide of arsenic in ammonium bisulphide. By solutions of sulphide of antimony in ammonia or ammonium sulphide the coloration becomes reddish, it being possible to produce the most delicate rose-color as well as

the deepest dark red. By rubbing certain portions somewhat more strongly a very fine metallic lustre is produced. Ammonia or ammonium sulphide redissolves the bronzing, so that places not thoroughly colored can be improved, though in such case it is better to rub off the entire figure with ammonium sulphide. In the same manner as the solutions in ammonia or ammonium sulphide, those in hydrate or sulphide of potassium or sodium can also be used, the latter being in some cases even more advantageous. By pickling the figure the color of the bronze is changed. If a casting of bronze or brass is left too long in the pickle, the metal becomes coated with a greenish-gray film, which on rubbing with a cloth rag becomes lustrous and adheres firmly. On treatment with the above metallic sulphides this coating acquires a dull-yellow coloration.

*Graham's bronzing liquids*\* have a great range of composition and of application as follows:—

|  |  |                  |                      |                     |                    |                         |                     |                                |                    |                       | <u> </u>                               |                             |                       | <u>´</u>     |              | ,  |
|--|--|------------------|----------------------|---------------------|--------------------|-------------------------|---------------------|--------------------------------|--------------------|-----------------------|--|-----------------------------|-----------------------|--------------|--------------|--|
| Number.  | Water.   | Nitrate of iron. | Perchloride of iron. | Permuriate of iron. | Nitrate of copper. | Tersulphide of arsenic. | Muriate of arsenic. | Potash solution of<br>sulphur. | Pearlash solution. | Cyanide of potassium. | Ferrocyanide of<br>potassium solution. | Sulphocyanide of potassium. | Hyposulphite of soda. | Nitric acid. | Oxalic acid. |  |
| 1  | pt.<br>1   | dr.<br>5         | dr.<br>—             | pt.                 | oz.                | gr.                     | oz.                 | dr.                            | dr.                | oz.                   | pt.                                    | dr.                         | dr.                   | dr.          | oz.          | Brown, and<br>every shade  |
| $\frac{2}{3}$  | 1<br>1   | $\overline{16}$  | 5                    | -                   | -                  | -                       | =                   | _                              | =                  |                       | -                                      | =                           | 16                    | _            | Ξ            | to black.<br>" " "<br>Brown, and<br>every shade  |
| $4 \\ 5 \\ 6 \\ 7 \\ 8 \\ 9 \\ 10 \\ 11 \\ 12 \\ 13 \\ 14$ | $ \begin{array}{c} 1\\ 1\\ 1\\ 1\\ 2\\ 1\\ 1\\ 1\\ 1\\ 1\\ 1\\ 1 \end{array} $ |                  |                      |                     |                    |                         |                     |                                |                    |                       |  |                             |                       |              |              | brownish-red,<br>Brownish-red,<br>Dark brown,<br>Yellow to red,<br>Orange.<br>Olive-green.<br>Slate.<br>Blue.<br>Steel-gray.<br>Black. |

| I |  | For | brass | (by | simpl | e imm | ersion) | • |
|---|--|-----|-------|-----|-------|-------|---------|---|
|---|--|-----|-------|-----|-------|-------|---------|---|

In the preparation of No. 5 the liquid must be brought to boil and cooled. In using No. 13 the heat of the liquid must not be

\* Brass-Founder's Manual, London, 1887.

under 180° F. No. 6 is slow in action, sometimes taking an hour to give good results. The action of the others is usually immediate.

| Number.<br>Water.  | Nitrate of iron.  | Sulphate of copper. | Sulphide of anti-<br>mony. | Sulphur. | Muriate of arsenic. | Pearlash.         | Sulphocyanide of<br>potassium. | Hyposulphite of soda. | Hydrochloric acid. |  |
|--|-------------------|---------------------|----------------------------|----------|---------------------|-------------------|--------------------------------|-----------------------|--------------------|--|
| $\begin{array}{c c} & & & \\ 15 & 1 \\ 16 & 1 \\ 17 & 1 \\ 18 & 1 \\ 19 & 1 \\ 20 & 1 \end{array}$ | dr.<br>5<br>5<br> | oz.<br><br>         | dr.<br>                    | dr.      | dr.<br>             | oz.<br><br>1<br>1 | dr.<br>2<br>                   | oz.<br><br>           | dr.<br>            | Brown, and every shade to<br>Dark brown-drab. [black.<br>"Bright red.<br>Red, and every shade to<br>Steel-gray, at 180° F. [black. |

II. For copper (by simple immersion).

| III. | For | zinc | (by) | simple | imm | ersion | ). |
|------|-----|------|------|--------|-----|--------|----|
|      |     |      |      |        |     |        |    |

| Number.  | Water.  | Nitrate of iron. | Protochloride of<br>tin. | Sulphate of copper. | Muriate of iron. | Muriate of lead. | Pearlash. | Sulphocyanide of potassium. | Hyposulphite of soda. | Garancine infusion. | Logwood infusion. |  |
|--|---|------------------|--------------------------|---------------------|------------------|------------------|-----------|-----------------------------|-----------------------|---------------------|-------------------|--|
| 21<br>22<br>23<br>24<br>25<br>26<br>27<br>28<br>29<br>30 | $\begin{array}{c} \text{pt.} \\ 1 \\ 1 \\ 2 \\ - \\ 2 \\ - \\ 1 \\ 1 \\ - \\ \end{array}$ | dr.<br>5<br>     | dr.<br>1<br>1<br>        | dr.<br>             | dr.<br>          | oz.              | oz.       | dr.<br><br>                 | dr.                   | *                   | *                 | Black.<br>"<br>Dark gray.<br>"<br>Green-gray.<br>Red (boil).<br>Copper color.<br>"<br>(with agita-<br>Purple (boil). [tion.) |

\*Made to the consistency of cream.

To provide articles of brass or bronze with a very lustrous gray or black coating, the tendency of certain metallic salts of forming

gray or black combinations with sulphur is utilized. For *gray* dip the article first into a very dilute solution of acetate of lead, or for *black* into a solution of sulphate of copper, and after drying into a hot dilute solution of hyposulphite of soda.

By using the solutions in a very dilute state the articles acquire a peculiar, iridescent appearance similar to soap-bubbles, and it is also due to the same cause. It is well known from the teachings of physics that many bodies show, when in very thin layers, the peculiar color-phenomenon termed iridescence, and this is also produced by a very thin layer of sulphide of lead or sulphide of copper. By repeating the treatment of the article in very dilute solutions, the iridescence passes into a red, brownish, or violet coloration. It is impossible to give exact proportions for the production of these colors, the success of the coloration depending largely on the skill of the operator.

Very beautiful, but not very permanent, iridescent coatings can be produced by placing the bright metal in a bath of a heavy metal decomposable by the galvanic current, touching it for a moment with the negative pole of the battery, taking it out, rinsing off and drying. The metal will show all the colors of the rainbow, but the coating is so delicate that it must be protected by immediately dipping the article after drying into a quick-drying varnish.

There are many means of providing small articles of brass with a coating of one color, various liquids being, for instance, used to produce determined shades of color upon brass buttons. For a pure golden yellow, the buttons are dipped for a few seconds in a perfectly neutral (absolutely free from acid) solution of acetate of copper. A gray-green shade is produced by repeatedly dipping them in a dilute solution of chloride of copper and drying after each dipping. A violet tint is obtained by heating the buttons to a temperature at which oxidation does not take place, and rubbing them with a tuft of cotton dipped in a solution of antimony in hydrochloric acid.

For the production of the *beautiful gold color* possessed by many French articles of brass the following process may be used: Dissolve 1.76 ounces of caustic soda and 1.41 ounces of milk sugar in 2.11 pints of water. Boil the solution for fifteen minutes, and after taking it from the fire compound it with 1.41 ounces of cold 32

concentrated solution of sulphate of copper. The red precipitate of cuprous oxide, which is immediately formed, deposits on cooling upon the bottom of the vessel. The polished articles resting upon a wooden sieve are then placed in the vessel containing the After about a minute the sieve is taken out in order to solution. ascertain how far the operation has progressed; it is then replaced, and at the end of the second minute the golden color is generally dark enough. The sieve is then taken out, and the articles after washing dried in saw-dust. By allowing the articles to remain for a longer time in the solution they acquire in a short time a greenish tint, which soon becomes yellow and then bluish-green, until finally the iridescent colors are formed. In order to obtain a uniform coloration it is necessary to produce the color slowly, which is best attained at a temperature of from 132° to 136° F. The bath can be repeatedly used and kept for a long time in well-stoppered bottles. If partially exhausted, it can be restored by an addition of 5.64 drachms of caustic soda, sufficient water to replace that lost by evaporation, heating to the boiling point, and finally adding 14.11 drachms of cold solution of sulphate of copper.

To produce a beautiful silver color upon brass proceed as follows: Dissolve in a well-glazed vessel  $1\frac{1}{2}$  ounces of pulverized cream of tartar and 2.25 drachms of tartar emetic in 2.11 pints of hot water, and add to the solution  $1\frac{3}{4}$  ounces of hydrochloric acid,  $4\frac{1}{3}$ ounces of granulated, or, still better, pulverized tin, and 1 ounce of pulverized antimony. Dip the article to be coated into the solution heated to the boiling point. After boiling one-quarter to one-half hour, they will be provided with a beautiful lustrous coating which is hard and durable.

Browning liquid for copper.—Add acetic acid to 11 drachms of spirit of sal ammoniac until blue litmus paper dipped into the liquid turns red. Then add  $5\frac{1}{2}$  drachms of sal ammoniac and sufficient water to make 2.11 pints. With the solution thus obtained repeatedly moisten the copper surfaces, rubbing after each application until the desired brown tint is produced.

For coloring brass Ebermayer, of Nürnberg, gives the following directions: (1) 8 parts of sulphate of copper, 2 of sal ammoniac, and 100 of water give by boiling a greenish color. (2) 10 parts of potassium chlorate, 10 of sulphate of copper, and 1000 of water give by boiling a brown-orange to cinnamon-brown color. (3)

By dissolving 8 parts of sulphate of copper in 100 of water, and adding about 100 parts of caustic soda until precipitate is formed, and boiling the articles in the solution, they acquire a greenishbrown color, which can be made darker by the addition of colcothar. (4) With 50 parts of caustic soda, 50 of sulphide of antimony, and 500 of water, and boiling, a light fig-brown color is obtained. (5) Boil 29 parts of sulphate of copper, 20 of hyposulphite of soda, and 10 of cream of tartar in 400 of water. The brass first acquires a rose color and then a blue color. By adding 20 parts of ammonio-ferric sulphate and 20 of hyposulphite of soda, the colors change from yellow to rose color and blue; after the latter yellow makes again its appearance, and finally a beautiful gray is formed. (6) 400 parts of water, 20 of potassium chlorate. and 10 of nickel salt give, after boiling for some time, a brown color, which is, however, not formed if the sheet has been pickled. (7) 250 parts of water, 5 of potassium chlorate, 2 of carbonate of nickel, and 5 of nickel salt give, after boiling for some time, a brown-yellow color playing into a magnificent red. (8) 250 parts of water, 5 of potassium chlorate, and 10 of nickel salt give a beautiful dark brown. (9) 250 parts of water, 5 of orpiment, and 10 of crystallized soda give at first a beautiful red which passes into blue, then into pale blue, and finally becomes white. (10) 250 parts of water, 5 of nickel salt, 5 of sulphate of copper, and 5 of potasssum chlorate give a well-covering yellow-brown color. (11) 100 parts of water, 1 of liver of sulphur, and 5 of ammonia. The articles being allowed to lie in a closed vessel finally acquire a very beautiful blue color.

Coloring of soft solders.—For giving the solder used in soldering copper the same color as the latter, prepare first a saturated solution of pure sulphate of copper and apply it to the solder. By then touching the solder with an iron or steel wire the latter becomes covered with a film of copper, which can be augmented as much as desired by repeated moistening with the solution of sulphate of copper and touching with the wire. If the soldering is to show a yellow color, mix 1 part of saturated solution of sulphate of zinc with 2 parts of solution of sulphate of copper, apply the mixture to the coppered place and rub the latter with a zinc rod. If the soldered place is to be gilded, copper it as above described, then coat it with a solution of gum or isinglass, and strew bronze

powder upon it. This forms a surface which, when the gum is dry, can be polished.

Bronzing of copper, bronze-metal and brass.—Black bronzing is produced by brushing the metals with dilute nitric acid containing a small quantity of silver in solution, and blazing off over the fire. This operation is repeated if after again brushing the articles with the acid and blazing off, the color is not sufficiently deep. Nitric acid which has been used for dissolving fine silver and then poured off is most suitable for the purpose. A bismuth solution may also be used for coloring the above mentioned black; after the operation they are coated with lacquer. Brass may be bronzed black as follows: Dissolve copper in an excess of nitric acid, dilute the resulting liquid with a large quantity of rain water, apply it to the warmed brass, allow to dry in a warm place, and finally rub with a brush or with leather. Or amalgamate the brass by brushing it with solution of mercurous nitrate, and convert the mercury upon the surface into black sulphide of mercury by potassium sulphide solution.

Brown bronze color is produced in the same manner as black, only besides silver the nitric acid must contain copper. Another method is as follows: Dissolve 1 oz. of sal ammoniae and  $\frac{1}{3}$  oz. of oxalic acid in  $\frac{1}{2}$  pint of water and brush the metal several times with the solution. Sulphuretted hydrogen will also produce a brown color. Dissolve liver of sulphur in 30 parts of water, pour the solution into shallow earthen-ware vessels and place the latter in a room protected from draught. Put the articles to be bronzed near the vessels. The object is still more rapidly attained by placing the articles over the vessels containing the sulphur of liver solution. This method of bronzing is especially suitable for articles soldered with soft solder which for that reason cannot be exposed to the fire.

Red brown or copper brown upon copper is produced by brushing the articles with a paste-like bronze consisting of a triturated mixture of horn shavings 1 part, verdigris 4, colcothar 4 and some vinegar, or by placing them in a liquid bronze prepared as follows: Boil a solution of verdigris 2 parts, and sal ammoniac 1 in vinegar, remove the scum, dilute with water, allow to settle, pour off the supernatant liquid, boil again in a porcelain dish and quickly pour it over the copper articles. The liquid should be much

diluted, the metallic articles carefully freed from grease and rest upon a wooden grate in a vessel which is immediately placed over the fire and the fluid brought to the boiling point; finally rinse in clean water.

Green bronze color is produced as follows: Dissolve a mixture of sal ammoniac  $\frac{1}{2}$ , argol 1 oz., and common salt 2 ozs. in  $\frac{1}{2}$  pint of vinegar. To this solution add  $2\frac{3}{4}$  ozs. of cupric nitrate solution, brush the articles with the resulting liquid and allow to dry.

# Recovery of Waste Metals.

*Gold.* Besides dust, the sweepings accumulating in gold workers' shops contain gold and silver as well as other metals alloyed with the gold or silver. To obtain the gold and silver proceed as follows:

Burn the sweepings with the addition of some saltpetre in a red hot crucible, lixiviate the residue with water, dry it, and melt it with an addition of 2 per cent. of dehydrated borax. Dissolve the metallic mass thus obtained in aqua regia. The precipitate formed thereby consists of chloride of silver, and is worked into The solution in aqua regia is then evaporated until it silver. commences to become viscous. It is now diluted with water and a bright sheet of copper immersed in the fluid whereby the gold in solution separates in the form of a brown powder which is filtered off, washed, dried, and melted with a small quantity of borax, the product obtained being chemically pure gold. The precipitate of chloride of silver, mentioned above, is filtered off, thoroughly washed with water, and brought into a vessel. Water compounded with 10 per cent. of hydrochloric acid is then poured over it and a sheet of zinc immersed in the fluid. After some time the chloride of silver is thereby converted into a gray powder of metallic silver, which is filtered off, washed with distilled water, dried, and melted with a small quantity of borax.

The water used by the workmen in gold-workers' shops for washing their hands contains gold and silver. The water is collected in a tank and from time to time drawn off from the sediment. When a sufficient quantity of the latter has accumulated, it is dried, the residue mixed with 5 per cent. of saltpetre, the mass decrepitated in a red hot crucible, washed with water, dried, and melted with a small quantity of borax. The metallic mass

thus obtained is treated in the same manner as that from the sweepings.

For the recovery of gold from coloring baths a solution of 2 parts by weight of ferrous sulphate (green vitriol) in 18 parts by weight of hot water may be used. The waste water as well as the exhausted coloring salts should be preserved in a large stone-ware jar kept for the purpose. Add the solution of ferrous sulphate to the contents of the jar and stir well, when the gold will begin to precipitate. Repeat this each time after coloring, and as the jar becomes full add a little more ferrous sulphate and thoroughly stir the contents. If this produces no effect upon the solution, the gold has all been precipitated. Now allow to settle, and then draw off the supernatant water, being very careful not to disturb the precipitate, which forms a dark spongy mass at the bottom. Wash the precipitate several times with hot water to free it from every trace of acid, then dry it in an iron vessel and then fuse it in a covered crucible with a flux, which for 1 lb. of prepared sediment consists of carbonate of potash 8 ozs., common salt 4 ozs., common bottle glass 4 ozs. Reduce all the ingredients to a fine powder and mix them well together. In order to effect a complete reduction of the gold great heat is required.

According to Boettger gold may be recovered from auriferous fluids by the following process: Heat the fluid in a porcelain vessel to the boiling point and then mix it with a sodium stannate solution. Keep the mixture boiling until all the gold—in combination with tin—is separated in the form of a fine precipitate of an intense black color. This precipitate is washed and then dissolved in aqua regia. The solution thus obtained consists of a mixture of chloride of gold and chloride of tin. By slightly evaporating the solution, diluting with distilled water, mixing with sufficient quantity of potassium and sodium tartrate (Rochelle salt), and heating, every trace of gold is precipitated in the form of very delicate, brownish powder, while the tin remains in solution.

Recovery of gold from old cyanide solutions. Evaporate the solution to dryness, reduce the residue to a fine powder, mix it intimately with an equal weight of litharge (oxide of lead), and fuse at a strong heat. From the resulting button of gold and lead alloy, the lead is extracted by warm nitric acid, the gold remaining behind as a loose, spongy mass.

By the *wet process* the gold may be recovered from old cyanide solutions as follows: Acidulate the solution, which contains gold, silver and copper, with hydrochloric acid, whereby hydrocyanic acid is disengaged. This gas being extremely poisonous, the operation should be carried on in the open air, or where there is a good draught or ventilation to carry off the fumes. A precipitate consisting of the cyanides of gold and copper and chloride of silver is formed. This is well washed and boiled in aqua regia, whereby the gold and copper are dissolved as chlorides, while the chloride of silver is left behind. The solution containing the gold and copper is evaporated nearly to dryness in order to remove the excess of acid, the residue is dissolved in a small quantity of water, and the gold precipitated therefrom as a brown metallic powder by the addition of ferrous sulphate (green vitriol). The copper remains in solution.

Finely divided zinc—so-called zinc dust—is an excellent agent for precipitating gold in a pulverulent form from old cyanide solutions. By adding zinc dust to an exhausted gilding bath and thoroughly shaking or stirring from time to time, all the gold is precipitated in two or three days. The quantity of zinc required for the precipitation depends of course on the quantity of gold present, but, generally speaking,  $\frac{1}{2}$  lb. or at the utmost 1 lb. of zincdust will be required for 100 quarts of exhausted gilding bath. The pulverulent gold obtained is washed, treated first with hydrochloric acid to remove adhering zinc-dust, and next with nitric acid to free it from silver and copper.

Separating silver. Dissolve the alloy or metal containing silver in the least possible quantity of nitric acid. Mix the solution with a large excess of ammonia and filter into a tall glass cylinder provided with a stopper. Introduce into the liquid a bright strip of copper, which should be long enough to project above the liquid. Pure metallic silver will be quickly separated. The reduction is completed in a short time, and the reduced silver is then washed first with ammoniacal solution and next with distilled water. The more ammoniacal and concentrated the solution, the more rapid the reduction. The strip of copper should not be too thin, as it is considerably attacked, and any little particles which might separate from a thin sheet would contaminate the silver. Any accompanying gold remains behind during the treat-

ment of the metal or alloy with nitric acid; chloride of silver, produced by impurities in the nitric acid is taken up by the ammoniacal solution like the copper, and is also reduced to the metallic state, and whatever other metal is not left behind, oxidized by the nitric acid, is separated as hydrate on treating with ammonia. Any arseniate which may have passed into the ammoniacal solution is not decomposed by the copper.

Recovery of silver from old cyanide solutions. The solution may be evaporated to dryness, the residue mixed with a small quantity of calcined soda and potassium cyanide and fused in a crucible, whereby metallic silver is formed which, when the heat is sufficiently increased, will be found as a button upon the bottom of the crucible; or if it is not desirable to heat to the melting point of silver, the fritted mass is dissolved in hot water, and the solution containing the soda and cyanide quickly filtered off from the metallic silver.

According to the *wet method* the old cyanide solution is strongly acidulated with hydrochloric acid, observing the precaution to provide for the effectual carrying off of the hydrocyanic acid liberated as given under gold. Remove the precipitated chloride of silver and cyanide of copper by filtration, and after thorough washing, transfer it to a porcelain dish and treat it, with the aid of heat, with hot hydrochloric acid, which will dissolve the cyanide of copper. The resulting chloride of silver is then reduced to the metallic state by mixing it with four times its weight of crystallized carbonate of soda and half its weight of pulverized charcoal. The whole is made into a homogeneous paste which is thoroughly dried, and then introduced into a strongly heated crucible. When all the material has been introduced the heat is raised to promote complete fusion and to facilitate the collection of the separate globules of silver into a single button at the bottom of the crucible, where it will be found after cooling. If granulated silver is wanted, pour the metal in a thin stream, and from a certain height, into a large volume of water.

Utilization of nickel waste. For the utilization of waste from rolled and cast uickel anodes, and of the nickel sand gradually collecting upon the bottoms of vats used in plating, the following method is recommended: Wash the waste repeatedly in clean, hot water, and then boil in dilute sulphuric acid (1 part acid to 4 parts water)

until the water poured upon the waste is no longer clouded by it. Then pour off the liquid, and treat the waste or sand with concentrated nitric acid. This must be done very carefully, and a capacious porcelain vessel should be used to prevent the solution from running over. When the solution is sufficiently concentrated, so that it contains little free acid, it should be filtered and slowly evaporated to drvness over a water bath. The product is nickel This nickel nitrate is dissolved in hot distilled water, and nitrate. the solution precipitated with caustic soda carefully and gradually added. The precipitate of hydrated nickel oxide is then carefully filtered and washed, and next treated with dilute sulphuric acid with the assistance of the heat until solution has taken place. The solution is concentrated by evaporation, and an excess of concentrated solution of ammonium sulphate is added. The precipitate is the double sulphate of nickel and ammonium, or Adams' nickel-plating salt, which is commonly used for nickel-plating.

Recovery of copper. In works where great quantities of copper are operated upon, it is advantageous to recover the metal dissolved in the cleaning baths, which can be done by an easy and inexpensive process. All the liquids holding copper are collected in a large cask filled with wrought or cast-iron scraps. By the contact of the copper solution with the iron a chemical reaction immediately takes place, by which the iron is substituted for the copper to make a soluble salt, while the copper falls to the bottom of the cask as a brown powder. The cask should be of sufficient capacity to hold all the liquids employed in a day's work. The liquids are decanted every morning. The old iron scrap is generally suspended in a wicker basket near the top of the liquid, and by occasionally moving it about in the liquid, the metallic powder of copper alone falls to the bottom of the cask. The copper thus obtained is quite pure, and by calcining it in contact with the air a black oxide of copper is obtained.

To separate silver from copper. Boil the metal in a mixture of sulphuric acid. nitric acid and water, of each 1 part, until it is completely dissolved, adding fresh liquid from time to time as the action ceases. When the solution is complete, throw in a little common salt dissolved in water, stir vigorously, and allow the precipitated silver to settle. When no more precipitate is formed by the addition of salt water, allow to settle, collect and wash the precipitate on a filter, and fuse in a crucible.

Recovery of tin from tin-plate waste. Treat the waste with dilute chlorine at a temperature above the boiling point of chloride of tin, so that the latter immediately after its formation is carried away in the form of vapor, since if it remains in the form of fluid in contact with the residues, it gives rise to the formation of chloride of iron, chloride of tin being reduced. The vapors of chloride of tin are precipitated by steam or by contact with moist surfaces in roomy condensing chambers, or are absorbed by chloride of tin solution of medium concentration.

Another method is as follows: Bring the waste into contact with sulphur in a boiling-hot solution of sodium sulphide, whereby the iron is completely freed from tin. The waste thus freed from tin is thoroughly washed and dried, heated to a welding heat in tubes of rolled iron, taken out and hammered into rod iron. The solution of sodium sulphide holding the tin is evaporated, the residue calcined in a reverberatory furnace, and the calcined mass reduced to tin, at a raised heat, by means of a mixture of small coal, charcoal, and calcined soda, or burnt lime.

To separate lead from zinc. Melt the alloy. The specifically heavier lead collects in the lower portion of the crucible while the lighter zinc stands over it and can be poured off.

Recovery of brass from a mixture of iron and brass turnings. This may be effected by means of magnets which attract the iron and steel turnings while the brass remains behind. The same object may be attained in a very simple and economical manner by a melting process. Mix the iron and brass turnings and the slag from brass-casting with limestone, powdered coal and ferric oxide and melt the mixture, whereby the brass separates from the liquid slag formed, settles on the bottom and is run off into ingot moulds.

BEL, C. D., alloys patented by, 388- | Alloy, Robertson, for filling teeth, 452 A 391 Acid, sulphuric, mixture of with water,7 Acids, action of, upon lead-tin alloys, 122 - 124bronze resisting, 447 resistance of copper-tin and copperzinc alloys towards, 119, 120 Aerugo nobilis, 491 Aich's metal, 153, 154 Ajax metal, 306 Alabama, bauxite in. 25 Alchemy, influence of, upon chemistry, 4 Alfénide, 269. 281, 282 Algiers metal, 229 Alkali metals, 16 special properties of, 22 Alloy, aluminium gold. 405 Berthier's, 270 changing the properties of an, 67 Clark's patent, 401 constitution of an, 6 definition of, 1 Delalot's, 401 for anti-friction brasses 305 for casting small articles, 453 for keys of flutes and similar parts of instruments, 364 for metal stop cocks which deposit no verdigris, 305 for moulds for pressed glass, 444, 445for sign-plates, 453, 454 for silvering, 451, 452 for spoons, 444 for type metal, 341 fusible, Onion's, 381 iron-zinc. 46 Lipowitz's, 374 new fusible, 384 nickel and steel, 42 non-oxidizable, 444 Lemarquand's, 453 Marlie's, 453 Pirsch-Baudoin's, 401, 402 resembling German silver, 444 silver, 444

silver-like, 280 Toucas's, 282 Tournee-Leonard's, 401 Trabuk's, 282 very fusible, 375 which expands on cooling, 447 Wood's, 375 Alloys, action of the atmosphere on, 118 advance in the industry of preparing, 129 aluminium, 319-348 -copper, 322-333 -gold, 320 -iron, 321 -nickel copper, 336-339 -silver. 320 bismuth, 378-384 -antimony, 380 -copper, 378 iron, 379 -lead, 379 -tin, 378, 379 -lead, 380 .zinc, 378 cadmium, 47, 48, 373, 377 change in the nature of, by remelting, 128, 129 color of, 114-117 coloring of, 490 501 conductivity for electricity of, 113, 114 heat of, 112, 113 constant, 68 copper-antimony, 318 arsenic, 308 -cobalt. 317 iron, 309, 310 -lead, 309 -magnesium, 317, 318 names of, 55 ·tin, 199-267 -tungsten. 316, 317 -zinc. table of properties of, 192 - 195crystallization of, 95-97 crystallizing power of, 6

```
(507)
```

Alloys, crystals of, 8 density of, 71-95 determination of the constituents of, 477-489 division of, according to specific gravities, 94 ductility of, 104, 105 earliest historical data in reference to, 2 expansion of, by heat, 111 for baths used by cutlers, 351, 352 for bearings, 235, 236 for calico printing rollers, 449-451 for casting type, 362 for small patterns in foundries, 448, 449for speculum metal, composition of, 242for watch manufacturers, 424, 425 formulæ for calculating the specific gravity of, 73, 74 fusible, amalgams of the, 439, 440 D'Arcet's, 381, 382 fusing points of. 105-111 general properties of, 66-124 gold, 403-414 palladium. 405 hardness of. 100-104 historical order of, 3 indium gallium, 445 iron, 38 Japanese. 396-400 lead, 360-372 iron. 371, 372 liquation of, 66-71 liquid, solidification of, 67, 68 magnesium, 34 miscellaneous, 444-454 mixture for a protective cover in remelting, 444 new. experiments in the preparation of, 130, 131 new method of preparing, 445 nickel, 41.268-298 -copper, 270, 271 -zine, 271-275 not showing either expansion or contraction, 94 of copper and much zine, 311, 312 with base metals, 137 other metals, 308-318 of mercury with other metals, 427-443 of platinum and platinum metals, 415 - 426of tin with little copper and additions of antimony, etc., 299-307 palladium, 423-425 platinum gold, 417, 418

Alloys, platinum-silver palladium, 418, 419 -iridium, 417, 424 silver, 418 preparation of, in general, 125-131 resembling silver, 400-402 resistance of, to calcium hydrate, 487 towards chemical influences, 117–124 showing contraction, 94 expansion, 94 silver, 385-402 alumininm, 385, 386 -arsenic, 392 -copper, 393-400 -cadmium, 392, 393 nickel, 387 -zinc, 391, 392 ·zinc, 386, 387 Sorel's, 189, 190 specific gravity of, 71-95 suitable for statue bronze, 255, 256 strength of. 97-100 tin, 349-359 -lead, 349-352 utensils used in the manufacture of, 125 variations in. 9 various, of copper with manganese, tin, iron and zinc, strength of, 99, 100 which can be filed, 312 Alpaka, 269 Alumina, determination of, 481 Aluminium, 15, 16 action of, upon brass, 334, 335 addition of, to Babbitt metal, 304 alloy for dentists' fillings, 340, 341 alloying power of, 319 alloys, 30. 319-348 production of, 319, 320 with the precious metals, 320 brass, 334-336 tests of, 336 uses of, 335, 336 brasses, 158 bronze, 323-333 alloy, 341 brazing, 341 casting of, 326-331 dilution of, 326 examples of rolling of, 332 forging of, 331, 332 preparation of, 325 production of, 30-32 properties of, 323, 324 remelting of. 325, 326 results of tests of, 333 selection of metals for, 324, 325

Aluminium bronze, soldering of, 341-343 ( solders for, 342. 343 -chromium alloy, 341 commercial, analyses of, 30 conductivity of heat of, 23, 24 -copper alloys, 322-333 preparation of, 333 distribution of, 24 electric conductivity of, 24 gold alloy, 405 alloys, 320 solder, 470 industrial preparation of, 25-32 ·iron alloys, 321 nickel copper alloys, 336-339 preparation of, by the Pittsburgh Reduction Co., 27-30 properties of, 23-32 reduction of. by electrolysis, 27-30 sheet, solder for, 345 silver alloys, 320 soldering of, 343-348 specific heat of, 23 -steel, 321, 322 -tin alloy, 341 wire, solder for, 345 Amalgamating water, 431 Amalgam, bismuth, 441, 442 cadmium, 47, 437, 438 copper, 432-434 crystalline, restoration of, 429 definition of, 1 for electric machines, 436 for filling teeth, 435 for mirrors and looking glasses, 435, 436 for silvering glass globes, 441 for tinning, 436, 437 gold, 428-430 iron, 440 Mackenzie's, 443 magnesium, 34, 35 of Lipowitz's metal, 439, 440 silver, 430 sodium, 442, 443 tin, 434, 435 zinc, 437 Amalgams, 427-443 mercury, 56, 57 of the fusible alloys, 439, 440 platinum metals, 432 properties of, 427, 428 use of, by the Greeks and Arabians, 3 American anti-friction metal, 306 sleigh-bells, 452, 453 Anatomical preparations, bismuth amalgam for, 442 Andrews, G. F., alloys recommended by, 340

Ansonia Brass and Copper Co., Tobin bronze of the, 157 Anti-attrition metal, Babbitt's, 303, 304 -friction brasses, alloy for, 305 metal, 306 American, 306 salgee, 306 Antimony, alloy of, with gold, 405 -bismuth alloys, specific gravity of, 85, 86 effect of, upon bronze, 202 copper, 133 ·lead alloys, specific gravity of, 86 of the Japanese, 398 properties of, 60, 61 resistance of, to calcium hydrate, 487 -tin alloys, specific gravity of, 84, 85 -zinc alloys, crystallization of, 96 crystals of, 8 Aphtit, 279 Arabians, use of amalgams by the, 3 development of chemistry by the, 4 early use by, of bronze for casting cannon, 217 Argentan, 269, 275, 286 solder, 464-466 Argent-Ruolz, 387, 388 Argiroide, 281, 282 Arguzoid, 279 Aristotle, account by, of an alloy of copper and zinc, 138 Arkansas, bauxite in, 25 Arnold's iron alloy, 453 Arsenic, alloy of, with gold, 405 determination of, 483, 484 effect of, on German silver, 272 the conducting power of copper, 113 upon bronze, 202 copper, 133 influence of, upon a metal, 19, 20 properties of. 61, 62 Ashberry metal, 359 Atomic weights, 130 of elementary bodies, 21 Austria, use of silicon bronze telegraph wire in, 251, 252 Austrian arsenals, orduance bronze prepared in the. 223, 224 Autogenous soldering, 456 BABBITT'S anti-attrition metal, 303, 304 Banca, tin in, 51 Barium, 16 properties of, 22, 23 Base metals, 14 Bath metal, 190

Bauxite, deposits of, 25

Bearing metal, Dunlevie and Jones', 312 | Brass, ancient, 137 graphite, 306 palladium, 424 metals, 300-307 analyses of, 306, 307 cheaper, composition of, 312 Bearings, alloys for, 235, 236 composition of white metals for, 303 compositions of, 302, 303 metals for, 236 soft metal, use of, 302 Bell metal, 224–229 good, principal requisite of a, 225, 226 melting and casting of, 226, 227 properties of, 226 silver, 229 metals, composition of some, 228 Bells, church, introduction of, 225 early use of, 225 large, weight of some, 225 Belgium, baser coin of, 231 nickel-copper coins of, 270 Berlin bronzes, 179 Berthier's alloy, 270 Biddery metal, 358, 359 Biermann, production of cupro-manganese by, 313 Binding wire, 457 Birmingham platinum, 189 Bismuth alloys, 378-384 amalgam, 441, 442 for anatomical preparations, 442 -antimony alloys, 380 bronze, 278, 279 -copper alloys, 378 determination of, 477, 482 effect of, upon copper, 104, 133 -gold alloys, specific gravities of, 92, 93 group, 60, 61 -iron alloys, 379 -lead alloys, 379, 384 specific gravities of, 91, 92 -tin alloys, fusing points of, 383 properties of, 60 -silver alloys, specific gravities of, 91 solder, 459 -tin alloys, 378, 379, 384 \* -lead alloys, 380 -zinc alloys, 378 Block tin, 53 Bobierre's metal, 152 Boilers, safety plates in, 380, 381 Borax, anhydrous, 126 Bourbouze's aluminium solder, 344 Brass, action of aluminium upon, 334, 335 aluminium, 334-336

mode of manufacture, 158, 159 and iron turnings. recovery of brass from a mixture of, 506 articles, moulds for casting, 170 beautiful bronze as substitute for, 237, 238 Bristol, 150 bronzing liquids for, 495 of, 500 cast, 146-150 analyses of, 147 casting, 168-175 change of the molecular structure of, 142 cleansing or pickling of, 175-177 color of, 139, 140 composition of, 138, 139 crystalline structure of, 140 ductile, metals for the preparation of, 142 dull, lustreless surface on, 176, 177 Ebermayer's directions for coloring, 498, 499 effect of iron on, 143 tin on, 143 fine cast, 148 for cartridge shells, 145 for sheet and wire, analyses of, 145, 146French cast. for fine castings, 149, 150 furnaces, 161-165 fusion of the charge in preparing, 166, 167 gold color upon, 497, 498 golden yellow color upon, 497 gray green shade upon, 497 green patina upon, 492, 493 ingots, casting of, 168-170 iridescent coatings upon, 497 its properties, manufacture and uses, 138 - 177Japanese, 146 lustrous gray or black coating upon, 496, 497 malleable, 150-158 mangauese, 316 manufacture of, 158-168 according to the old method with the use of zinciferous ores, 159, 160 by fusing the metals together, 160-168 melting point of, 142, 143 ordinary cast, 147, 148 plate, casting of, 170-175 recovery of, from a mixture of iron and brass turnings, 506

Brass, red, 177-188 reference to, by Pliny, 2 resistance of, to calcium hydrate.487 sheet, 144-146 crystallization of, 141 silver color upon, 498 solder, 467 solder, 460-464 for, 458 soldering of, 473 strength of, 142 testing of, 484, 485 tough for tubes, 148, 149 use of old copper in the manufacture of, 143 uses of, in the arts, 143, 144 violet tint upon, 497 Brasses, aluminium, 158 anti-friction, alloy for, 305 Brazing aluminium bronze, 341 Bristol brass, 150 Britannia metal, 352-359 casting of. 356, 357 composition of. 354 electro-plating of, 357 moulds for, 355 preparation of, 355 properties of, 352-354 solder for, 458 testing, 485 Brocade, 187, 188 Bronze, absorption of oxygen by, 207, 208 additions to, 218, 219 -aluminium, 323-333 production of, 30-32 basin, Turkish, 240 beautiful, as substitute for brass, 237, 238 bismuth, 278, 279 carbon, 306 castings, perfect, difficulty of obtaining, 207 cobalt, 39, 40, 317 color, brown, 500 green, 501 of, 203 commercial, admixtures in, 200 conditions affecting the physical properties of, 202, 203 contraction of, in casting, 206, 207 Cornish, 306 Damascus, 306 deoxidized, 157, 158 different kinds of, 214-217 Dronier's malleable, 434 ductility of, 200 early knowledge of, 3 effect of antimony upon, 202 arsenic upon, 202

Bronze, effect of iron upon, 201, 202 lead upon, 201 nickel upon, 202 oxygen upon, 207, 208 phosphorus upon, 202 sulphur upon, 202 zinc upon, 200, 201 for articles exposed to shocks and very great friction, 237 for medals and coins, 230-232 with figures in high relief, 231 for ship-sheathing, 234 for small castings, 233 for telephone line, 252-254 for valve balls and other constituent parts to which other parts are to be soldered with hard solder, 237 furnace for melting a large quantity of. 213, 214 Graney, 306 Harrington, 307 imitation, 180 in general, 199-267 iridescent coatings upon, 497 liquation of, 209 lustrous gray or black coating upon, 496, 497 manganese, 306, 315, 316 manner of securing the greatest strength of, 205 melting and casting of, 210-217 furnace for, 208, 209 points of, 206 metal, brazing of, 500 molecular change in, by forging, 204, 205 new, upon bronze figures, 494, 495 nickel, 278 old Peruvian, 240 phosphor, 242-250 platinum, 419, 420 powders, 185–188 compositions of the alloys for some colors of, 187 direct preparation of, 188 preparation of, 186, 187 prehistoric, 137, 215-217 principal constituent of, 199 resisting acids, 447 the action of the air, 237 reverberatory furnace for melting, 212 - 213Richards', 336 statue, 254-258 sheet, crystallization of, 141 silicon, 250-254 strength and hardness of, 204 sun, 340

Bronze, testing of, 485, 486 Carats and grains, conversion of, into to be gilded, 234 Tobin, 157, 306 weapon, antique, 240 Bronzes, ancient, composition of, 216, 217 Berlin, 179 Chinese, 238, 239 for various purposes, 229-240 Japanese, 239, 240 Bronzing liquids, Graham's, 495, 496 Button metals, Guettier's, 191 Buttons, alloys for, 189 ADMAN, A. W., Babbitt metal patented by, 304 Cadmium, addition of, to an alloy of gold and silver, 405 alloying power of. 47, 48 alloys, 47, 48, 373-377 reliability of, 376, 377 amalgam, 47, 437, 438 -bismuth alloys, specific gravities of. 90 determination of, 482. 483 -lead alloys, specific gravities of, 90, 91 properties of, 46-48, 373 pure metallic, preparation of, 46, 47 Calamine, 44 Calcium, 16 hydrate, resistance of metals and alloys to, 487 properties of, 22, 23 Calico-printing rollers, alloys for, 449-451Calin, 444 Calvert and Johnson, experiments of, on the hardness of coppertin alloys, 101. 102 investigations by, on the conductivity for heat, of alloys, 112, 113 investigations by, on the influence of sea-water upon. copper-zinc and copper zinc-tin alloys, 120investigations by, on the resistance of coppertin and copper-zinc alloys towards acids and salts, 119, 120 Camelia metal, 306 Candle-sticks, alloys for, 179, 180 German silver for, 276 Cannon, early use of bronze for casting, 217

old, use of, in casting ordnance, 222 Caratation, mixed, 411

thousandths, 409 Carbon, behavior of, towards iron, 63, 64 bronze, 306 influence of, upon a metal, 19, 20 properties of, 63, 64 Car box metal, 307 brasses, metal for lining, 306 Carnegie, Phipps & Co., tests of nickelsteel made by, 298 Carroll, C. C., aluminium alloy patented by, 340, 341 Cartridge shells, brass for, 145 sheet for, 270 Carty, specific gravities of tin-bismuth alloys according to, 87, 88, 91, 92 Cassiterite, 51 Cast brass, 146-150 analyses of, 147 fine, 148 ordinary, 147, 148 Casting and melting bronze, 210-217 brass, 168-175 German silver, 288-290 ingots of brass, 168-170 plate brass, 170-175 small articles, alloy for, 453 statue bronze, 257, 258 Castings, bronze, difficulty of obtaining perfect, 207 delicate, bismuth alloys for, 382 metallic, alloy for filling out defective places in, 380 small, bronze for, 233 Cast iron, 19 resistance of, to calcium hydrate. 487 silver solder for, 467 solder for, 458 solidification of, 72 Cement, Evans's metallic, 438 Vienna metallic, 434 Chandeliers, alloys for, 179 Charcoal, 126 Chemical combination, definition of, 20 influences, resistance of alloys to, 117 - 124Chemistry, development of, by the Arabs, 4 influence of alchemy upon, 4 China silver, 269 Chinese bronzes, 238, 239 Chloride of silver for soldering aluminium, 346 reduction of, 501 Christophle metal, 269 Chrome-steel, 43 Chromium, determination of, 481 properties of, 42, 43

Chrysochalk, 180 Chrysorin, 149, 180, 181 Cinnabar, 56 Clark's patent alloy, 401 Cliché metal, 375, 376, 380 Clock bells, alloys for, 228, 229 Cobalt, 18 association of, with nickel, 273 bronze, 39, 40, 317 determination of, 480, 481 properties of, 39, 40 Coelestin, 16 Coin bronze, 230-232 Coinage, casting gold for, 406 excellence of, in the Middle Ages, 4 nickel, 42 silver used for, 394 Coins, alloy for, 387 gold, fineness of, 410, 411 manganese brass for, 316 nickel-copper, 270 Roman, 216 silver, fineness of, 394 of various countries, composition of, 394, 395 Swiss fractional, alloys for, 392 Cologne, weight of large bells in, 225 Color of alloys, 114-117 Colored gold, 413, 414 Coloring baths, recovery of gold from, 502of alloys, 490-501 Conductivity for heat of alloys, 112, 113 Cooper's gold, 422 mirror-metal, 423 pen metal, 423 Copper, action of silicon upon, 250 alloying power of, 55 alloys, 132-198 difficulties in the manufacture of, 132 most important, 136 names of, 55 of platinum with, 421, 422 of, with other metals, 308–318 of, with the base metals, 137 -aluminium alloys, hardness of, 102, strength of, 100 amalgam, 432-434 and gold, mutual affinity of, 404 and much zinc, alloys of, 311, 312 -antimony alloys, 318 -arsenic alloys, 308 articles, browning of, 493 behavior of, towards admixtures, 134, 135best evidence of the quality of a brand of, 145 33

Copper, bronzing liquids for, 496, 498 of, 500 -cobalt alloys, 317 commercial, foreign metals in, 1 source of, 135 copper-brown upon, 500, 501 determination of, 478, 482 effect of arsenic upon the conducting power of, 113 cuprous oxide upon, 133, 134 iron upon, 133 lead upon the ductility of,  $132, \bar{1}33$ silicium upon, 134 sulphur upon, 134 various metals upon, 104, 133 -gold alloys, 136, 137 specific gravity of, 81, 82 strength of, 100 intensity of coloration produced by, 115, 116 -iron alloys, 309, 310 -lead alloys, 309 liquation of, 70 -magnesium alloys, 317, 318 -nickel alloys, strength of, 99 -silver alloys, analyses of, 285, 286 tin alloys, strength of, 99 old, use of, in the manufacture of brass, 143 properties of, 55, 56 recovery of, 505 red-brown upon, 500, 501 separation of silver from, 505 -silver alloys, 137 action of chemical agents upon, 121 specific gravity of, 80, 81 strength of, 100 wear of, 103 solder for; 458 soldering of, 473 -steel, 310, 311 Suhl white, 268, 269 tensile strength of, 267 -tin alloys, 199-267 changes in the specific gravity of, 76-79 conductivity of, for heat, 113for electricity, 114 crystallization of, 95, 96 expansion of, by heat, 111 fusing point of, 108 hardness of, 101 liquation of, 69

AKOTA, tin in, 51, 52 Copper-tin alloys, resistance of, towards acids and salts, 119, 120 scale of colors of, 116 Damascus bronze, 306 D'Arcet, best bronze for statues, accordspecific gravities of, 74-79 ing to, 256 strength of, 97, 98 D'Arcet's fusible alloys, 381, 382 table of properties of, 259gilding metals, 150 Davy, isolation of magnesium by, 33 Dead head, 219 264-nickel alloys, with or without Delalot's alloy, 401 zinc, analyses of, 285 zinc alloys, scale of colors of, D'Elhujar, discovery of tungsten by, 50 116 Delta metal, 155, 156 advantages claimed for, 156 -tungsten alloys, 316, 317 analyses of, 155, 156 -zinc alloys, collective term of, 138 strength of, 156 conductivity for heat, of, 113 crystallization of, 96 Density of alloys, 71-95 expansion of, by heat, 111 point of greatest, of water, 72 fusing point of, 108, 109 Dental purposes, platinum-gold alloys hardness of, 101, 102 for, 418 Dentists' fillings, aluminium alloy for, historical notice of, 138 340, 341 influence of sea-water upon, 120 Deoxidized bronze, 157, 158 liquation of, 70 Dépierre and Spiral, analyses by, of the physical properties of, 140 composition of scrapers, 449 Deville, H. St. Claire, labors of, 24 resistance of, towards acids and salts, 119, 120 Dewrance's patent bearing for locomoscale of colors of, 116 tives, 305 Diamond, the, 63 specific gravities of, 79, 80 strength of, 98, 99 Dienett's German silver, 281 table of properties of, 144, Dipping brass, 175 192 - 195Dronier's malleable bronze, 434 -nickel alloys, analyses of, 283, Ductility of alloys, 104, 105 284Ductors, 449 Dudley, C. B., analyses of -iron alloys, analyses of, bearing 284, 285 metals by, 306, 307 -lead alloys, analyses of, Durano metal, 454 Dutch gold, 184, 185 284-tin alloys, influence of seametal, 172 water upon, 120 leaf, 184, 185 Cornish bronze, 306 Cornwall, tin in, 51 BENER, E., introduction of brass into F Cowles Electric Smelting and Alumin-Germany by, 138 1 ium Co., examples of rolling alumin-Ebermayer's directions for coloring brass, 498, 499 ium-bronze, given by the, 332 Cowles Electric Smelting and Alumin-ium Co., furnace used by the, 30, 31 Electricity, conductivity of alloys for, 113, 114 Cronstedt, discovery of nickel by, 40 Crucibles, furnace for, 161–165 Electric machines, amalgam for, 436 Electrolysis, reduction of aluminium by, graphite, 127 27 - 30preparation of alloys in, 126 Elementary bodies, groups of, 11 Cryolite, 25 Elementary bodies, table of, 21 Crystallization of alloys, 95-97 Enameled work, solder for, 469 England, introduction of brass into, 138 Cuprous oxide, effect of, upon copper, English bronze powders, 187 133, 134 Cupro-manganese, 312-315 metal, 359 Cups, German silver for, 276 process of manufacturing German Cutlers, alloys for baths used by, 351, 352 silver, 290, 291 Cyanide solutions, recovery of gold and silver from, 502, 503, 504 sterro metal, 154 type metal, 362, 363 Cymbals, early use of, 225 white metal, 305

English white metal, ordinary, 191 Erfurt, weight of large bell in, 225 T ganese by, 38 Erhart's type metal, 363 Evans's metallic cement, 438 Ex. B. metal, 307 Georgia, bauxite in, 25 AHLUM brilliants, 350, 351 Fat, use of, in preparing alloys, 126, tured in, 217 127Fenton's alloy for axle-boxes for locomotives and wagons, 305 Ferro-chrome, preparation of, 43 145-cobalt, malleable, 446, 447 silver, 275-286 -German silver, 279, 280 -nickel, malleable, 446, 447 -tungsten, 50 Fire-gilding, 431, 432 early knowledge of, 3 preparation of amalgam for, 429 -silvering, 431, 432 Fleitmann, Dr., process of, for refining and toughening nickel, 41 Flutes, alloy for keys of, 364 Flux for hard soldering, 472, 473 Fluxes used in soldering, 470, 471 Forks, German silver for, 276 Formulae for calculating specific gravity, 73, 74Foundries, alloys for small patterns in, 448, 449 France, baser coin of, 231 French cast brass for fine castings, 149, 150gold, 181, 182 type metal, 362, 363 Frishmuth's aluminium solder, 344 Furnace, double, used in the gunfoundry at Spandau, 220, 221 for bronze, 208, 209 for direct firing, 293 for melting platinum, 415, 416 for melting statue bronze, 257 for the fusion of brass, direct upon the hearth, 166 of the Cowles' Electric Smelting ganese by, 312 and Aluminium Co., 30, 31 Glass, 126 reverberatory for melting bronze, 211 - 213for wood firing, 173-175 open hearth, 125 Furnaces, brass, 161-165 445for crucibles, 161-165 for the use of coal, 165, 166 muffle, 293, 294 405Siemens' regenerative gas reverberatory, 173 special, for preparing brass, 161 404Fusing points of alloys, 105-111

AHN, extraction of metallic man-Gallium, discovery of, 48 properties of, 48, 49 Gedge's alloy for ship-sheathing, 154 Geitner, Dr., alloy of, 269 Germany, first bronze cannon manufac-German process of manufacturing German silver, 287–290 sheet brass for musical instruments, addition of iron to, 273 of silver to, 273 alloy resembling, 444 analyses of, 276, 277 Dienett's, 281 effect of lead upon, 277, 278 tin on, 274 English process of manufacturing, 290, 291 foil, 293 German process of manufacturing, 287-290 influence of arsenic upon, 272 manufacture of, on a large scale, 287 - 292mechanical manipulation of, 274, 275 Pirsch's patented, 281 plating of, 274 resistance of, towards chemical influences, 271, 272 sheet, manufacture of, 292-294 solder for, 291, 292 substitutes for, 278 testing of, 486 uses of, 292 variations in the compositions of the alloys for, 275, 276 various additions to, 277 names of, 269 Germany, introduction of brass into, 138 Gersdorff, preparation of cupro-manbismuth alloy for cementing, 382, 383 globes, amalgam for silvering, 441 pressed, alloys for moulds for, 444, Gold, alloying power of, 59, 403 alloy of, with arsenic or antimony, alloys, 403-414 fineness of, 409 inutility of the majority of, 403,

Gold, alloys, jewellers', 412, 413 legal, 411, 412 legal standards for. 409 melting of, 406, 407 preparation of, 406-409 by the galvanic process, 414 use of, 410-414 aluminium solder, 345 amalgam, 428-430 ancient use of, 403 and copper, mutual affinity of, 404 silver, combinations of, 404 articles, casting of, 406 finished, coloring of, 414 behavior of lead towards, 404, 405 blue, 413 -bronze, 233 casting of, for coinage, 406 coins, Europe, 136 fineness of, 410, 411 colored, 404, 413, 414 coloring power of, 117 Cooper's, 422 -copper, 180 alloys, effect of zinc upon the ductility of, 105 hardness of, 103 liquation of, 71 determination of, 482 Dutch, 184, 185 effect of alloying apon the ductility of, 104, 105 French, 181, 182 furnace for, 407 granulated, preparation of, 408 gray, 404, 413 green, 404, 413 group, 58-60 joujou, 411 Lyons, 179 Manilla, 184 Mannheim, 180 mosaic, 149 Nürnberg, 405 pale, 404 -palladium alloys, 405 . plates, casting ingots for, 406 -platinum alloys, fusing points of, 109, 110 precipitation of, by zinc, 503 properties of, 58, 59 recovery of, by the wet process, 503 from anriferous fluids, 502from coloring baths, 502 from cyanide solutions, 502, 503 from wash water, 501, 502

Gold, red, 413 sacred value placed on, by the Egyptians, 403 -scrap, re-melting of, 408, 409 -silver alloy, addition of cadmium to, 405 alloys, action of chemical agents upon, 121, 122 conductivity for electricity of, 114 conductivity for heat of, 113crystallization of, 96 liquation of, 71 solder, fine, 469 solders, 468-470 standard, 410-412 talmi, 182, 183 -tin alloys, crystallization of, 8, 96 tough, preparation of, 408 ware, Pforzheim, 412 testing of, 486, 487 waste, recovery of, 501-503 yellow, 404, 413 Gongs, Chinese, 227, 228 Graham's bronzing liquids, 495, 496 Graham's table of lacquers, 490, 491 Grain tin, 53 Graney bronze, 306 Granite moulds for casting plate brass, 171, 172 Graphite, 63 bearing metal, 306 Greeks, knowledge in the art of mixing metals by the, 2 use of amalgams by the, 3 Greenockite, 46 Guettier's button metals, 191 Gun-barrels, browning of, 493, 494 Gun-metal, 217-224 comparison of density and composition of, 205, 206. content of tin in, 219 good, properties of a, 217, 218 solder for, 458 study of, 217 Guns, wrought iron, 217  $\underset{27-30}{\text{Hall, Charles M., inve}}$ Hall, Charles M., invention of, Hamilton's metal, 149 Hampe, researches of, on the behavior of copper towards admixtures, 134, 135 Hardness of alloys, 100-104 Hard silver solder, ordinary, 466 solder, preparation of, 461, 462 table of composition of, 462, 463

soldering fluid, 472

Hard solders, 460-466 division of, 460 Harrington bronze, 307 Harveyized plates, 42 Heat, conductivity for, of alloys, 112, 113 of, of metals, 24 expansion of alloys by, 111 specific, of alloys, 111, 112 Heavy metals, groups of, 17, 18 special properties of the, 35-65 Henniger Bros., alloy of, 269 Hercules metal, 341 Holland, J., process of, 425 Holzmann, specific gravities of antimonybismuth alloys according to, 85, 86 bismuth-gold alloys according to, 92,93 bismuth-silver alloys according to, 91 cadmium-lead alloys according to, 90,91 tin-gold alloys according to, 89, 90 tin-mercury alloys according to, 93 tin-silver alloys according to, 88 Höper's phosphor bronze, analyses of, 249 wire, 249 Hopkinson, experiments of, on nickel steel, 298 Howe on the preparation of ferro-chrome, 43 Hoyle's patent alloy for pivot bearings, 305 Hydrogen, sulphuretted, apparatus for the production of, 478-480 NDIUM, discovery of, 48 -gallium alloys, 445 properties of, 48 Ingots, brass, casting of, 168-170 for gold plates, 406 Inkstands, alloys for, 179, 180 Instruments, alloy for parts of, 364 Iridium osmium alloy, 424 -steel, 424 Iron, addition of, to German silver, 273 alloy, Arnold's, 453 alloying power of, 37, 38 alloys of, 38 alloys of platinum with, 420, 421 amalgam, 440 for tinning, 436, 437 and brass turnings, recovery of brass from a mixture of, 506 argentan solder for, 465 behavior of carbon towards, 63, 64 cast, 19

Iron, cast, resistance of, to calcium hydrate, 487 solidification of, 72 chemically pure, preparation of, 36, 37 cold-short, 20 commercial, foreign metals in, 1 determination of, 481 effect of, phosphorus upon, 19, 20, 64 sulphur upon, 19, 20 upon brass, 143 bronze, 201, 202 copper, 133 group, 35-44 hot short, 20 influence of carbon upon, 19 -manganese alloys, crystallization of, 96, 97 native, 36 oxidation of. 37 properties of, 36-38 pure, 19 red short, 20 -tin alloys, crystallization of, 96 -zinc alloy, 46 Italy, baser coin of, 231 APANESE, antimony of the, 398 brass, 146 bronzes, 239, 240 series of alloys of, 396 Jeancon, J. A., aluminium bronze alloy, patented by, 341 Jewelers, gold alloys used by, 412, 413

Jewelry, gold alloys for, 411 soldering of, 475, 476 Joujou gold, 411

ALISCHER, S., researches of, on the crystallization of metals, 140–142 Kapfenberg, ferro chrome from, 43

Karmarsh, Dr. K., brass solders according to, 464

determination of the specific gravity of copper-silver alloys by, 80, 81

experiments of on the strength of coppergold and coppersilver alloys, 100

- experiments of, on the wear of copper-silver alloys, 103
- investigations by, of Britannia metal, 354,355

Keir, J., patent of, 151

Kerl, Bruno, analyses of commercial |Lead-tin alloys, action of acids and salt tin by, 52 solutions upon, 122-124 King crucible, 163 fusing point of, 110 hardness of, 103, 104 Kingston's metal, 304 Kirkaldy, tests of phosphor-bronze by, to detect in tin, 488 246, 247Leaves, impressions of, 439 Knapp, investigations by, of the action Lechesne, 339, 340 Lecoq de Boisbaudran, discovery of of acids and salt solutions upon leadtin alloys, 122-124 gallinm by, 48 Külne's phosphor-lead bronze, 249 Ledebur, type metal, according to, 363 Künzel and Montefiore-Levi, experi-Lemarquand's non-oxidizable alloy, 453 ments of, with nickel-copper al-Lipowitz's alloy, 374 loys, 271 metal, amalgam of, 439, 440 investigations of, on the strength of Liquation, 66-71 prevention of, 67 alloys, 99, 100 Kupfernickel, 40 Lithium, 16 Kuromi, 398 Loam, moulds for casting plate brass, 171 Locomotive axle-boxes, alloy for, 305 ACQUERS, 490, 491 Locomotives, bearing for, 305 🖌 Lamps, alloys for, 179 Long, specific gravities of antimony-tin Lancon, M. H., aluminium solder, patalloys according to, ented by, 344, 345 Langley, J. W., on the preparation of 84, 85 aluminium steel, 322 tin-lead al-Lead, affinity of, for oxygen, 54 loys, according to, alloying power of, 54 alloys, 360-372 88, 89 amalgams, specific gravities of, 93 Looking glasses, amalgam for, 435, 436 and other metals, alloys of, 372 Lutecine, 448 -antimony alloys, expansion of, by Lyons gold, 179 heat, 111 fusing point of, 110, 111 ACHINE bronze, 234–238 hardness of, 103 metals for various purposes, 237 behavior of, towards gold, 404, 405 Machines, composition of white metal determination of, 477, 478, 481 for, 305 effect of, upon bronze, 201 McGee, C. K., on the electric conduc-German silver, 277, tivity of aluminium, 24 278Macht's yellow metal, 152 the ductility of cop-MacKellar, T., alloy for type metal patper, 104, 132, 133 ented by, 341 foil, to distinguish tin foil from, Mackenzie's amalgam, 443 487, 488 Magnesium, 15, 16 -gold alloys, specific gravity of, 83 alloys of, 34 group, 53, 54 amalgam, 34, 35 determination of, 480 influence of other metals upon, 360, properties of, 33-35 361 -iron alloys, 371, 372 Magnolia metal, 306 Magnus, Albertus, discovery of metallic -mercury alloys, specific gravities zinc by, 44 of, 93 pipe, resistance of, to calcium hy-Maillechort, 269 drate, 487 Malleable brass, 150–158 Mallet, experiments of, on the strength pipes, solder for, 458 -platinum alloy, effect of the air of copper-zinc alloys, 98, 99 upon a, 119 Mallet's table of the properties of copper properties of, 53, 54, 360 zinc alloys, 144 rolled, crystalline structure of, 142 Manganese, alloying power of, 39 separation of, from zinc, 506 brass, 316 -silver alloys, crystallization of, 96 bronze, 306, 315, 316 liquation of, 71 bronze, properties of, 315, 316

Manganese, determination of, 481 German silver, 279 metallic, 38 properties of, 38, 39 Manganin, 281 Manilla gold, 184 Mannheim gold, 180 Marbeau's nickelo-spiegel, 297 Marcus Aurelius, statue of, 3 Maréchal and Saunier, beautiful gold bronze, according to, 233 Marlie's non-oxidizable alloy, 453 Marsh's apparatus, 483, 484 Martino, H., alloy invented by, 280, 281 Matthiessen, determination of the specific gravities of cadmium-bismuth alloys by, 90 of specific gravities of lead mercury alloys by, 93 of the specific gravity of antimony-lead alloys by, 86 of the specific gravity of lead-gold alloys by, 83 of the specific gravity of silver-gold alloy sby, 82,83 of the specific gravity of silver-lead alloys by, 84 of the specific gravity of tin-cadmium alloys by, 86, 87 experiments of, on the conductivity of metals for electricity, 113, 114 Maumené, E. J., analyses of Japanese bronzes by, 239 Medal bronze, 230–232 Medals, brown patina upon, 493 manufacture of, 232 with figures in high relief, bronze for. 231 Melting and casting bronze, 210-217 points of the principal metals, 65 statue bronze, 257, 258 Mercury, alloying power of, 56, 57 alloys of, with other metals, 427-443amalgams of, 56, 57 determination of, 478, 482 early knowledge of, 3 properties of, 56, 57, 427 test for, 478, 488 Metal, Aich's, 153, 154 Ajax, 306 Algiers, 229 American anti-friction, 306

Metal, anti-friction, 306 Ashberry, 359 Babbitt's anti-attrition, 303, 304 Bath, 190 beautiful white, closely resembling silver, 400, 401 Biddery, 358, 359 Bobierre's, 152 Britannia, 352-359 camelia, 306 car-box, 307 change in the properties of a, by alloying, 1, 2 cliché, 375, 376, 380 definition of a, 12 delta, 155, 156 Durano, 454 Dutch, 172 English, 359 Ex. B., of the Pennsylvania Railroad Co., 307 for lining car brasses, 306 graphite bearing, 306 Hamilton's, 149 Hercules, 341 Lipowitz's amalgam of, 439, 440 Macht's yellow, 152 magnolia, 306 Minofor, 359 Mira, 318 Muntz, 151, 152 Newton's, 380 ordinary English white, 191 ordnance or gun, 217-224 Paris, 448 Prince's, 150 ronia, 150 Rose's, 380, 381 salgee anti friction, 306 shot, 364-371 Spence's, 447, 448 sterro, 154, 155 Tissier's, 183, 184 Tournay's, 184 type, 361-364 variation in the specific gravity of a, 73 Warne's, 400 white, 188-191, 306 Wood's, 375 yellow, 151, 152 Metals, 11 affinity of, for mercury, 428 oxygen, 14 sulphur for, 62 alkali, 16 special properties of, 22 alloying power of, 10 base, 14

Metals, base, alloys of copper with the, 137 | Metals, physical and chemical relations of bearing, 300-307 the, 11-21 analyses of, 306, 307 relations of the, 12-14 chemical combinations between, 9 resistance of, to calcium hydrate, 487 relations of the, 14-21 scale of colors of, 115 combination of, with non-metallic solution of, 477 elements, 130, 131 special properties of the, 22-65 combinations of, with sulphur, 62, succession in fusing, in preparing alloys, 127, 128 table of, 21 63 common properties of, 13, 14 conductivity of, for electricity, 113, specific gravities and melting points of the princi-114 of, for heat, 24 pal, 65 crystallization of, 140-142 waste, recovery of, 501-506 D'Arcet's gilding, 150 white, 300-307 decomposition of water by, 17, 18 testing of, 488 Metalline, 340 determination of the impurities of, Metalloids, 11 477 - 489diversity in color of, 114, 115 Meteorites, 36 endeavor of, to combine with one Mierzinski, solder for aluminium bronze, another, 1 recommended by, 342 for bearings, 236 Milan, weight of large bell in, 225 for the manufacture of sheet brass, Minargent, 400 144, 145 fused, formula for calculating the Minofor metal, 359 Mira metal, 318 temperature of, 107 Mirror-metal, Cooper's, 423 process of measuring the tem-Mirrors, amalgam for, 435, 436 perature of, 106, 107 concave, alloy for, 242 groups of, 15 Missouri zinc, 145 heavy, 15 Mitis castings, 321 Miyu-nagashi, 399 groups of, 17, 18 special properties of, 35-65 Molybdenum, 50, 51 incompleteness of the knowledge Moku-me, 399, 400 of, 5 Montefiori, Levi and Künzel, first use of influence of carbon, sulphur, phosphosphor bronze by, 243 Moors, development of chemistry by the,4 phorus and arsenic upon, 19, 20 Morfit, C., nickel-copper alloy of, 270 knowledge in the art of mixing by Mosaic gold, 149 the Greeks, 2 light, 15 Moscow, Russia, weight of large bells in, liquation in working, 66, 67 225liquid, solidification of, 67, 68 Mould used in casting statue bronze, lustre of, 12 258machine, for various purposes, 237 Moulds for Britannia metal, 355 casting articles of brass, 170 malleability of, 12, 13 mixtures of, in the Middle Ages, 4 bells, 229 known up to the time of German silver, 289 gold, 406 Charlemagne, 3 noble, 14, 15 ingots of brass, 169 alloying of, 2, 3 plate brass, 170-172 number of elementary bodies bepressed glass, alloys for, 444, longing to the class of, 5 445Mourey's aluminium solders, 343, 344 of the alkaline earths, 16 Mousset's silver alloy, 392 Muffle furnaces, 293, 294 special properties of the, 22, 23 earths proper, 16, 17 Munich, furnace used in the Royal special properties of, foundry at, 257 23 - 35Muntz metal, 151, 152 Music, plates for engraving, 364 of varying densities, alloys of, 128 Musical instruments, sheet brass for, 145 properties of, 12-14

ATURAL history objects, impressions | Paris metal, 448 of, 439 of, 439 Neusilber, 269 Newton's metal, 380 Nickel, alloying power of, 41, 42 alloys, 41, 268-298 properties of, 274 table of analyses of, 283-286 various, analyses of, 286 -aluminium, 340 and steel alloy, 42 bronze, 278 coinage of, 42 coloring power of, 116, 117 -copper alloys, 270, 271 coins, 270 -zinc allovs, 271--275 determination of, 480 effect of, upon bronze, 202 copper, 133 metallic, preparation of, 40 metals allied to, 273 ores, occurrence of, 40 reduction of 272, 273 properties of, 40-42 purification of, 389 refining and toughening of, 41 sources of, 272 -speiss, treatment of, 389 -steel, 294-298 testing of, 489 waste, utilization of, 504, 505 Nickelo-spiegel, Marbeau's, 297 Noble metals, 14, 15 Non-metals, 11 table of, 21 Nürnberg gold, 405 Onion's further ways bell in, 225 Onion's fusible alloy, 381 Ordnance-bronze, composition of, 224 cooling of, 223 temperature for casting, 223French, composition of, 69, 70 metal, 217-224 use of old cannon in casting, 222 Orëide, 181, 182 Ormolu, 232 Oxygen, affinity of lead for, 54 metals for, 14 effect of, upon bronze, 207, 208 **DACKFONG** and packtong, 268 foil, 293 Palladium alloys, 423-425 bearing metal, 424 -silver alloys, 423, 424 Paracelsus, metallic zinc mentioned by,44

34

weight of large bell in, 225 Parkes, preparation of cupro-manganese by, 314 and Martin, alloys for baths used by cutters proposed by, 351, 352 Parkinson on alloys of magnesium, 34 Parson, preparation of ferriferous cupromanganese by, 312 Patina, 491 brown, upon metals, 493 composition of, 121 formation of, 120 green, upon brass, 492, 493 production of a coating similar to, 491, 492 Patterns, small, alloys for, 448, 449 Pattinson's desilvering process, 6, 66 Paulinus, introduction of church bells by, 225 Pen metal, Cooper's, 423 Pennsylvania Railroad Co., Ex. B. metal of the, 307 Pens, stylographic, points for, 425 Peruvian bronze, old, 240 Pewterers' Company of England, regulations by the. 352 Pforzheim gold ware, 412 Phosphor-aluminium bronze, 249, 250 -bronze, 65, 242-250 analyses of, 248 content of phosphorus in, 247 definition of, 242, 243 Höper's, analyses of, 249 preparation of, 244, 245 resistance of, to calcium hydrate, 487 sorts of, 247, 248 tests of 346, 247 uses of, 247 wire, Höper's, 249 practicability of the use of, 254 preparation of, 246 -copper, preparation of, 245 -iridium, 425, 426 -lead bronzes, 249 -tin, preparation of, 245, 246 Phosphorus, combination of metals with, 131 content of, in phosphor-bronze, 247 effect of, upon bronze, 202 copper, 134 iron, 64 the strength of coppertin alloys, 98 influence of, upon a metal, 19, 20 properties of, 64, 65 role of, in phosphor-bronze, 243, 244

#### 522

#### INDEX.

Pickle for giving brass a dull, lustreless | Recovery of copper, 505 surface. 177 of waste metals, 501-506 Pickles, properties of, 176 Red brass, 177-188 Pickling brass, 175-177 bearings, 301 solution. 398, 399 Regnault, law of the specific heat of alloys announced by, 111, 112 Pinchbeck, 181 Pipes, lead and tin. solder for, 458 Reich and Richter, discovery of iridium Pirsch's patented German silver, 281 by, 48 Pirsch-Baudoin's alloy, 401, 402
Pittsburgh Reduction Co., preparation of aluminium by the, 27-30 Reverberatory open hearth furnace, 125 Rhodium steel, 424 Richards' bronze, 336 Pivot bearings, alloy for. 305 solder for aluminium, 346-348 Richards, Dr. J. W., on the specific heat of aluminium, 23 Plate brass, casting of, 170-175 Platina, 184 Platine au titre. 418 determination of the specific Riche, Platinoid, 280, 281 gravity of copper zinc alloys by, 79, 80 Platinor, 419 Platinum, alloying power of, 60 experiments of, with copper tin alalloys of, with the base metals, 420, loys, 76-79 421and Thurston, determinations of preparation of, on a small specific gravities of copper-tin scale, 416, 417 alloys by, 74. 75 properties of, 415 Riley, James, on nickel and steel alloy, -aluminium solder, 345 42and platinum metals, alloys of, 415on nickel-steel, 297, 298 426Ring, broken, to solder a, 475 Roberts, Austen, Prof. W. C., examples Birmingham, 189 -bronze, 419, 420 of Japanese alloys given by, 396--copper alloys, 421, 422 400 determination of, 482 determination of the specific gravity furnace for melting, 415, 416 of copper-gold alloys by, 81, 82 •gold alloys, 417, 418 Robertson alloy for filling teeth, 452 -silver-palladium alloys, 418, Rocks, aluminium-bearing, 24, 25 419 Rome, early trade in brass in, 2 -iridium alloys, 417, 424 weight of large bell in, 225 -lead, 189 Ronia metal, 150 Roose, H., alloys for white metal bearmetals, amalgams of the, 432 associated with, 59 ings. used in the factory of, 305 native, 415 Rose's alloys, 380, 381 properties of, 59, 60 Rosine, 340 -silver alloys, 418 Ross, D., best proportions for speculum Pliny, reference to brass by, 2 metal according to, 241 Plumbers' sealed solder, 458 Rosse telescope, mirror of the, 242 Plumber's work, ordinary, solders for, Rosthorn's factory, sterro-metal from, 154 458Baron, tests of sterro-metal by, 155 Potassium, 16, 22 Ruolz alloys, analyses of, 285, 286 Potingris, 147, 148 Rust, noble, 491 Potin jaune, 147, 148 SAFETY-PLATES, 380, 381 Salgee anti-friction metal, 306 Prechtl's brass solders, 463 Prince's metal, 150 Putty-powder, 53 Salindres, preparation of aluminium at, 25 - 27Pyrolusite, 38 Salt, common, solutions of, 7, 8 UARTZ-SAND, use of, as a flux, 472, solutions, action of, upon lead-tin 473alloys, 122-124 Quicksilver, properties of, 56, 57 Salts, resistance of copper-tin and copper-zinc alloys to, 119, 120 ECOVERY of brass from a mixture Sauer, C., aluminium solder patented by, 346 of iron and brass turnings, 506

drate, 487 Scheelite, 50 Schlosser, solder for aluminium bronze given by, 342, 343 Schneider, Henri, patents of, for copper steel, 310, 311 Henry, patents of, for nickel-steel, 294 - 296Scrapers, 449 Sea-water, influence of, upon copperzinc and copper-zinc-tin alloys, 120Self, E. D., on the preparation of aluminium, 25-27 Shaft-furnace. French, 221, 222 Shaku do, 396, 397 phosphor - aluminium Shaw, Thos., bronze patented by, 249, 250 Sheet brass, 144-146 Shibu-ichi, 397 Ship, sheathing bronze for, 234 Gedge's alloy for, 154 Shot, casting of. 367-370 formation of, by centrifugal power, 368 metal, 364-371 sorting of, 370, 371 towers and wells, 367 Siemens regenerative gas reverberatory furnaces, 173 Silesian zinc, 145 Silicium, effect of, upon copper, 134 Silicon, action of, upon copper, 250 bronze, 250-254 telegraph and telephone wire, composition of, 251, 252 Silver, addition of, to German silver, 273 alloy, Mousset's, 392 alloys, 385-402 of, with various metals, 393 resembling, 400-402, 444 aluminium alloys, 385, 386 amalgam, 430 and gold, combinations of, 404 -arsenic alloys, 392 beautiful white metal, closely resembling, 400, 401 bell-metal, 229 blanching, 396 castings of, 396 chloride of, for soldering aluminium, 346 reduction of, 501 coins of various countries, composition of, 394, 395 -copper alloys, 393-400 effect of zinc upon the ductility of, 105

Saxonia, resistance of, to calcium hy- | Silver-copper alloys, fusing point of, 109 hardness of, 103 liquation of. 70, 71, 394 -cadmium alloys, 392. 393 -nickel allovs. 387 -zinc allovs, 391, 392 determination of. 478 effect of alloying upon the ductility of. 104, 105 upon copper. 133 -gold alloys, fusing point of, 109 specific gravity of, 82, 83 group, 55-58 -lead alloys, specific gravity of, 84 -mercury alloys, crystallization of, 96 sign-plates, alloy for, 453. 454 properties of, 57, 58 recovery of, by the wet method. 504 from old cyanide solutions, 504 wash water, 501,502 separating of. 503. 504 separation of, from copper. 505 solder for cast iron, 467 steel, 467, 468 ordinary hard. 466 soft, 467 solders, hard, 467 -ware, fineness of silver used in the manufacture of, 395 waste, recovery of, 501-503 -zine alloys, 386, 387 Silverine, 269 Silvering, alloy for, 451. 452 glass globes, amalgam for, 441 Similor, 180 Sleigh bells, alloys for. 228, 229 American, 452, 453 Smalt, 40 Smith, D., invention of. for manufacturing drop shot, 368-370 Sodium, 16 amalgam, 442. 443 properties of, 22 Soft solders, 457-460 Solder, argentan, 464-466 bismuth, 459 brass, 460-464 for enameled work, 469 German silver. 291, 292 hard, preparation of, 461, 462 table of composition of, 462, 463 judging the quality of a, 459 plumbers' sealed, 458 soft, preparation of. 459 Soldering aluminium, 343-348 bronze, 341-343 autogenous, 456

Soldering. conditions to be observed in, | Steel, 19 addition of platinum to, 420 456definition of, 455 argentan solder for, 465 fat, preparation of, 471, 472 ·bronze, 223, 224 fluids, 470-472 composition, 446 handling the work in, 457 effect of tungsten on, 50 jewelry, 475, 476 silver solder for, 467, 468 pan, 475, 476 solder for, 458 preparation of articles for, 470, 471 tools, small, baths for tempering, treatment of solders in, 470-474 383, 384 Solders and soldering, 455-476 Sterling metal, 147, 148 composition and melting points of, Sterro metal, 154, 155 474Stopcocks, alloy for, which deposits no containing precious metals, 466-470 verdigris, 305 Strabo, mention by, of an alloy of copfluxes, used for, 474 for aluminium, 343-348 per and zine, 138 bronze, 342, 343 Stream tin, 51 Strength of alloys, 97-100 gold, 468-470 hard, 460-466 Strontianite. 16 soft, 457-460 Strontium, 16, 22, 23 coloring of, 499, 500 Suhl white copper, 268, 269 testing of, 488 Sullage piece, 219 treatment of in soldering, 470 Sulphur, combination of metals with, varieties of, 455 131 Solutions, change in the physical propereffect of, upon bronze, 202 ties of, 7 copper, 134 influence of, upon a metal, 19, 20 properties of, 62, 63 crystals in, 8 Sorel's alloys, 189, 190 Sulphuretted hydrogen, apparatus for South Boston Iron Works, tests of aluminium-bronze at the, 333 the production of, 478-480 Sovereign, English, remedy allowed for Sun-bronze, 340 wear of, 410 Switzerland, baser coin of, 42, 231, 270, Spandau gun-foundry, double furnace in use at the, 220, 221 Sweepings, recovery of gold and silver Spanish zinc, 145 from, 501 Specific gravities of the principal metals, Symbols of elementary bodies, 21 65gravity, formulæ for calculating, ABLE bells, alloys for, 228, 229 73, 74of alloys of different colors suitable of alloys, 71-95 for statue bronze, 256 heat of alloys, 111, 112 of analyses of brass for sheet and Speculum metal, composition of some wire, 146 alloys used for, 242 cast brass, 147 Speiss, 40 nickel alloys, 283-Spelter, 45 286Spence's metal, 447, 448 colored gold alloys, 413 Spoons, alloy for, 444 composition and melting points of German silver for, 276 solders, and of fluxes, 474 Speculum metal, 240-242 of celebrated statues, 256 Standard gold, 410-412 Statue bronze, 254-258 compositions of some ancient bronzes, 216 color of, 255, 256 melting and casting, 257, 258 elementary bodies, 21 gold alloys legally fixed by the table of alloys of different various governments, colors suitable for, 256 412 Statues, best bronze for, 256 used by jewelers, 412, 413 celebrated, composition of, 256 solders, 469 Statuettes, small, manufacture of, 439, intensity of coloration produced 440by copper, tin and zinc, 116

Table of lacquers, 491 Table showing composition of ordnance properties of copper-tin alloys, bronze 259 - 264of var--zincalloys, ious 144, 192times 195a n d soft solders, 458 differspecific gravities and melting e n t points of the counprincipal mettries, als, 65 224 of antimony-bismuth silver alloys,85 coins -lead alof varloys, 86 ious tin alloys, coun-85tries, of bismuth-gold al-395 loys, 92 tombac, -lead al-179 loys, 92 fineness of gold coins of various -silver alcountries, 410, 411 lovs, 91 Tables showing composition of calicoof cadmium-bismuth printing rollers, 450, 451 alloys, Talmi gold, 182, 183 Tam-tams, Chinese, 227, 228 90 Teeth, amalgam for filling, 435 -lead al-Robertson alloy for filling, 452 loys, 91 of copper-gold alloys, Telegraph wire, silicon bronze, 251, 252 82 Telephone lines, bronze for, 252-254 -silver al-Testing brass, 484, 485 loys, 81 Britannia metal, 485 bronze, 485, 486 -tin alloys, German silver, 486 75 -zinc alloys, gold ware, 486, 487 80 mercury, 488 of lead-gold alloys, nickel, 489 soft solders, 488 83 tin, 488 -mercury alwhite metals, 488 loys, 93 Thallium, properties of, 54 of silver-gold alloys, 82, 83 Thermo-electric piles, nickel alloys for, -lead alloys, 275Thowles, O. M., aluminium solder, pat-84 ented by, 345, 346 Thurston, Prof. R. H., experiments of, of tin-bismuth alloys, 87 -cadmium on the strength of copalper tin alloys, 97, 98 loys, 87 note by, on the properties -gold alloys, 89 of copper-zinc alloys, -lead alloys, 89 -mercury al-196-198 sorts of phosphor-bronze loys, 93 -silver alloys,88 according to, 247, 248 white metals for bearings, 303 Tiers argent, 386 Tin, alloying power of, 53 showing composition of Britannia alloys, 349-359 metals, most frequently used, 299, 300 354hard solof, with little copper, and addider,463 tions of antimony, etc., 299-307

Tin amalgam, 434, 435 Type-metal, 361-364 amalgams, specific gravities of, 93 alloy for, 341 English, 362, 363 -antimony alloys, fusing point of, 110 -bismuth alloys, specific gravities Erhart's, 363 French, 362, 363 of, 87, 88 -cadmium alloys, specific gravity of Types, manufacture of, 363, 364 86, 87 commercial, analyses of, 52 NITED STATES government, results -cry, the, 52, 53 of armor-plate tests by determination of, 482 the, 42 effect of different metals on, 299, 300 manufacture of zinc in the, on brass, 143 45on copper, 114, 133 nickel coinage in the, 42 nickel-copper coins of, 270 on German silver, 274 -foil for soldering, 457, 458 tin in the, 51 -foil, to distinguish, from lead-foil, zinc ores in the, 44 487, 488Uranium, 43, 44 -gold alloys, specific gravities of, Utensils used in the manufacture of al-89, 90 loys, 125 group, 51-53 JALENCIENNES, preparation of cuintensity of coloration produced by, pro-manganese by, 314 116 -lead alloys, 349-352 Valve balls, bronze for, 237 densities of, 349, 350 Vanadium, 50, 51 melting points of, 351 Van der Ven, E., researches of, on bronze specific gravity of, 88, 89 for telephone lines, 252, 253 Vienna, metallic cement, 434 lead to detect in, 488 -mercury alloys, specific gravities weight of large bell in, 225 of, 93 Vinegar, action of, upon lead-tin alloys, -pipes, solder for, 458 122-124 -plate waste, recovery of tin from, JAGON axle boxes, alloy for, 305 506properties of. 51-53 Warne's metal, 400 Washington Navy Yard, test of alurecovery of, from tin-plate waste, 506 resistance of, to calcium hydrate, minium bronze at the, 333 Waste gold, recovery of, 501-503 487 -silver alloys, specific gravity of, 88 metals, recovery of, 501-506 stone, 51 silver, recovery of, 501-503 testing of, 488 Watch manufacturers, alloys for, 424, 425 Water, amalgamating, 431 decomposition of, by metals, 17, 18 use of, as a solder, 457 Tinning, amalgam for, 436, 437 mixture of, with sulphuric acid, 7 Tissier's metal, 183, 184 Tobin bronze, 157, 206 point of greatest density of, 72 Tombac, 178 recovery of gold and silver from, 501, 502 sheet, crystallization of, 141 Watts, invention by, of casting shot, 367 Tools, steel, baths for tempering, 383, 384 Weber, R., experiments of, on the behavior of lead-tin alloys towards vine-Toucas's alloy, 282 Toulonse, weight of large bell in, 225 gar, 124. Tournay's metal, 184 Webster's bismuth bronze, 278, 279 Tournu-Leonard's alloy, 401 Webster Crown Metal Co., England, al-Trabuk's alloy, 282 loys made by the, 336-339 Tubes, tough brass for, 148, 149 Weiller's alloy, 250 West, Thomas D., on casting aluminium Tungsten, 18 discovery of, 50 bronze and other strong metals, 328group, 49-51 331 White metal, 188-191, 300, 306, 307 metallic preparation of, 50 properties of, 50 bearings, advantages of, 301, Type, alloys for casting, 362 302

White metal bearings, alloys for, 305 composition of, for machines, 305 English, 305 ordinary English, 191 metals for bearings, composition of, 303 testing of, 488 Wiggin on cobalt bronze, 39, 40, 307 Wire, analyses of brass for, 145, 146 binding, 457 phosphor-bronze, preparation of, 246 sheet brass for the manufacture of, 144-146 Wood-grain, 399, 400 Wood's alloy or metal, 375 Wyoming, tin in, 52 ELLOW metal, 151, 152 solder, 461

ZINC, alloying power of, 46 amalgam, 437 bronzing liquids for, 496 Zinc, commercial, foreign metals in, 1 ductility of, 105 effect of, upon bronze, 200, 201 upon copper, 104, 133 upon the ductility of goldcopper and silver-copper alloys, 105 group, 44-49 intensity of coloration produced by, 116 -iron, 447 metallic, discovery of, 44 Missouri, 145 ores, occurrence of, 44 precipitating gold by, 503 properties of, 44-46 separation of lead from, 506 Silesian, 145 Spanish, 145 -tin alloys, expansion of, by heat, 111 hardness of, 104 liquation of, 71

white, 45

.

## **ELECTRO=PLATING OUTFITS**


FOR

# GOLD, SILVER, NICKEL, COPPER, ETC.

#### Just a Word about Dynamos.


Did you know that all the early experiments and improvements in dynamos were made with a view of perfecting an electrical machine for plating, and that this success was the forerunner of all the magnificent dynamo machines for other purposes in such general use to-day?

In 1876 we began manufacturing the

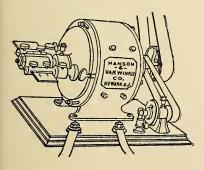


"Weston" Dynamo for electro-plating. This was the first machine in the market. It met with pronounced success, and to it can be traced the sudden

development of electro-plating and electrotyping. Many of these machines are still in use.

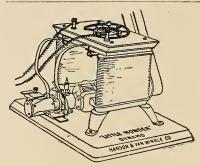


In 1885 we brought out the "Little Wonder" Dynamo. It became very popular. Over one thousand were sold.

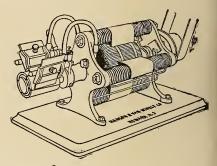

In 1886 we began manufacturing the "Wonder" Dynamo. It embodied many new improvements, and we thought then

that we had reached perfection.


In 1891 electrical science had devel-

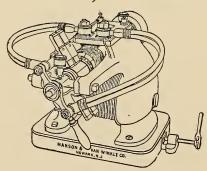

oped so many entirely new features, that in order to maintain our eminent position as leaders in the production of plating

machines, we brought out our H. & V. W. Dynamo. It embodied every late idea, and has had a remarkable sale.

On the following page we show for the first time *our new* H. & V. W. Dynamo. This also marks a new era in plating dynamos.

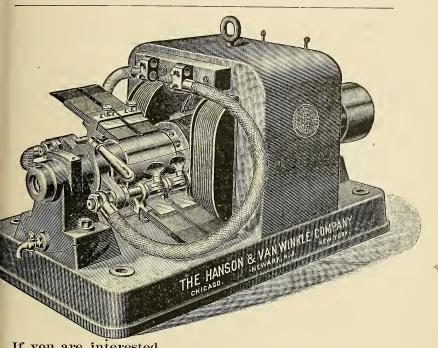

#### If you are interested

in Electro-plating, Electrotyping, Electro-refining of Metals or other Electro-chemical operations, you will naturally feel interested in anything that tends to bring these industries to the highest stage of development.

#### In introducing


this new dynamo to your notice, we feel that we are urging the claims of a machine which will materially aid you in reaching that point.

#### Many


who have only used the old style machines have no idea of the improvements that have recently been made in this class of dynamos; improvements that save time, money, labor, and trouble.

#### There are several

dynamos which are marked improvements on the old style of machines, but the new H. & V. W., while embracing all the good points found in other modern machines, has several improvements distinctively its own and is the result of years of experimenting.

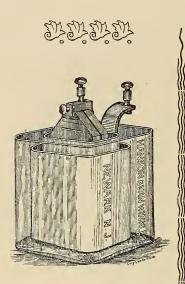

\*EIHE \*EIHE \*EIHE

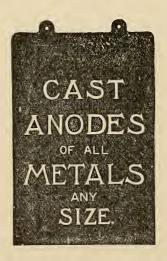



#### Nickel:

We are first hands in nickel and other metals, and the largest manufacturers of the various Metallic Salts; of Nickel, Silver, Copper and Gold, and of Cyanide of Potassium.

#### **Plating Solutions:**

We furnish Concentrated Plating Solutions of Silver, Gold, Copper, Nickel, Brass, etc.

#### **Batteries**:

Of all kinds. Our No. 1 H. & V. W. Battery has had a larger sale than any other for Electro-Plating and experimental work.

#### Anodes:

Our Cast Nickel Anodes are standard for whitest results. Anodes of Nickel, Silver, Gold, Electro-deposited Copper, Brass, etc. Nickel Castings.

#### Tanks:

Porcelain-lined, Iron, Wood, Slate, etc., for all purposes.


#### Lacquers:

Patent Celluloid Lacquers for metal, paper, etc. Gold and colored Lacquers.

#### **Chemical Solution:**

For removing sand, scale, etc., from castings, etc.

# No. 4 Polishing and Buffing Lathe.

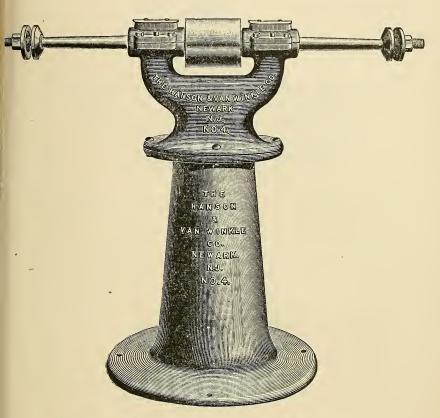

Spindle 50 Inches Long,  $1\frac{3}{4}$  Inch Diameter in Boxes.

This machine is designed for heavy work. It is fitted with extra long Babbitted boxes, giving the spindle sufficient bearing to insure stiffness. Without sacrificing strength, we have so reduced the width of head, that the machine will be found especially desirable by manufacturers of large, irregular pieces, and will commend itself to any one having bicycle, stove, chandelier or car trimmings to do, as with this lather there is no interference when working on large pieces. With this machine you can use a large wheel without the slightest jar or spring.

We show above a sample of one of our most salable Polishing Lathes.

We manufacture a complete line of \_\_\_\_\_

# GRINDING, Polishing and Buffing Machines,

and all the

Various Wheels and Buffs and Grinding

and Polishing Material.



FELT VIENNA LIME COMPRESS CARBORUNDUM EMERY WOOD CROCUS SHEEPSKIN WALRUS ROUGE PAPER PUMICE

#### POLISHING SUPPLIES.



#### TRIPOLI COMPOSITION.

Tripoli Composition is especially adapted for cutting down and polishing Brass, Bronze, Britannia, and other metals preparatory to plating.

| Standard | Tripoli | Composition, | O S, for cutting and polishing,         | per lb. |
|----------|---------|--------------|---|---------|
| "        | " "     | "            | M, very greasy,                         |         |
| "        | "       |              | No. 6, hard and fast cutting,           | " "     |
| " "      | " "     | 66           | H, very fast cutting,                   | 4.6     |
| "        | " "     | " "          | No. 9, similar to O S, slightly sharper | , "     |

#### CROCUS COMPOSITION.

Crocus Composition is largely used by stove manufacturers and others desiring to produce smooth finished surface on cast iron and steel.

| A, greasy, fast cutting, .     |       |        |      |     |   |   |   |   | per lb. |
|--------------------------------|-------|--------|------|-----|---|---|---|---|---------|
| F F, dry and fast entting,     | •     | •      | •    | •   | • |   |   | • | ٤٤ .    |
| S dry and extra fast cut       | ting, | •      |      |     |   | • | • |   | "       |
| O S, very finest grade of this | mate  | erial, |      |     |   |   |   |   | 44      |
| Emery Cake,                    |       |        | •    | •   |   |   |   | • | 6 G     |
| Emery Paste, in cartridges, al | il nu | mber   | s,   |     |   |   | • |   | ÷ ¢     |
| English Crocus, powdered, in   | keg   | s and  | casl | ks, |   | • | • | • | "       |

#### XXX BUFFING COMPOUND.

For polishing and coloring all metals where the higher color is required, with the greatest economy of time, and especially for work that is engraved or ornamented where rouge is objectionable.

Put up in cakes similar to Tripoli, per lb. . .

#### VIENNA LIME.

We are the largest importers of this article, and furnish it both in lump and powder, and send full instructions for getting best results. There is an increasing demand for this article for nickel and other work, and we are paying special attention to the quality.

Our 160-page Catalogue mailed on application, free of postage, to any address in the world.

# THE HANSON & VAN WINKLE CO., MANUFACTORY AND OFFICES:

219 & 221 Market Street,

NEWARK, N. J., U. S. A.

NEW YORK OFFICE: 81 Liberty Street.

WESTERN BRANCH: 35 & 37 S. Canal St., Chicago, Ill.

J. E. HARTLEY & CO., SOLE EUROPEAN AGENTS. St. Paul Square, Birmingham, England. 8

# Practical and Scientific Books

#### PUBLISHED BY

# HENRY CAREY BAIRD & CO.

INDUSTRIAL PUBLISHERS, BOOKSELLERS AND IMPORTERS.

#### 810 Walnut Street, Philadelphia.

AP Any of the Books comprised in this Catalogue will be sent by mail, free of postage, to any address in the world, at the publication prices.

A Descriptive Catalogue, 90 pages, 8vo., will be sent free and free of postage, to any one in any part of the world, who will furnish his address.

Where not otherwise stated, all of the Books in this Catalogue are bound in muslin.

#### AMATEUR MECHANICS' WORKSHOP:

A treatise containing plain and concise directions for the manipulation of Wood and Metals, including Casting, Forging, Brazing, Soldering and Carpentry. By the author of the "Lathe and Its Uses." Seventh edition. Illustrated. 8vo. . . . \$2.50 ANDRES.—A Practical Treatise on the Fabrication of Volatile

and Fat Varnishes, Lacquers, Siccatives and Sealing Waxes.

ARLOI.—A Complete Guide for Coach Painters: Translated from the French of M. ARLOT, Coach Painter, for eleven years Foreman of Painting to M. Eherler, Coach Maker, Paris. By A. A. FESQUET, Chemist and Engineer. To which is added an Appendix, containing Information respecting the Materials and the Practice of Coach and Car Painting and Varnishing in the United States and Great Britain. J2mo. . . . \$1.25

(1)

2

#### ARMENGAUD, AMOROUX, AND JOHNSON.—The Practical Draughtsman's Book of Industrial Design, and Machinist's and Engineer's Drawing Companion:

Forming a Complete Course of Mechanical Engineering and Architectural Drawing. From the French of M. Armengaud the elder, Prof. of Design in the Conservatoire of Arts and Industry, Paris, and MM. Armengaud the younger, and Amoroux, Civil Engineers. Rewritten and arranged with additional matter and plates, selections from and examples of the most useful and generally employed mechanism of the day. By WILLIAM JOHNSON, Assoc. Inst. C. E. Illustrated by fifty folio steel plates, and fifty wood-cuts. A new edition, 4to., half morocco

ARMSTRONG.—The Construction and Management of Steam Boilers:

By R. ARMSTRONG, C. E. With an Appendix by ROBERT MALLET, C. E., F. R. S. Seventh Edition. Illustrated. 1 vol. 12mo. 75

#### ARROWSMITH .- Paper-Hanger's Companion :

A Treatise in which the Practical Operations of the Trade are Systematically laid down: with Copious Directions Preparatory to Papering; Preventives against the Effect of Damp on Walls; the various Cements and Pastes Adapted to the Several Purposes of the Trade; Observations and Directions for the Panelling and Ornamenting of Rooms, etc. By JAMES ARROWSMITH. 12mo., cloth \$1.00 . . • . . . • . .

#### ASHTON.—The Theory and Practice of the Art of Designing Fancy Cotton and Woollen Cloths from Sample:

Giving full instructions for reducing drafts, as well as the methods of spooling and making out harness for cross drafts and finding any required reed; with calculations and tables of yarn. By FREDERIC T. ASHTON, Designer, West Pittsfield, Mass. With fifty-two illustrations. One vol. folio \$6.00

#### ASKINSON.—Perfumes and their Preparation :

A Comprehensive Treatise on Perfumery, containing Complete Directions for Making Handkerchief Perfumes, Smelling-Salts, Sachets, Fumigating Pastils; Preparations for the Care of the Skin, the Mouth, the Hair; Cosmetics, Hair Dyes, and other Toilet Articles. By G.W. ASKINSON. Translated from the German by ISIDOR FURST. Revised by CHARLES RICE. 32 Illustrations. 8vo. \$3.00

- BAIRD.—Miscellaneous Papers on Economic Questions. By Henry Carey Baird. (In preparation.)
- BAIRD.—The American Cotton Spinner, and Manager's and Carder's Guide:

A Practical Treatise on Cotton Spinning; giving the Dimensions and Speed of Machinery, Draught and Twist Calculations, etc.; with notices of recent Improvements: together with Rules and Examples for making changes in the sizes and numbers of Roving and Yarn. Compiled from the papers of the late ROBERT H. BAIRD. 12mo.

\$1.50

BAIRD.-Standard Wages Computing Tables:

BAKER.—The Mathematical Theory of the Steam-Engine: With Rules at length, and Examples worked out for the use of Practical Men. By T. BAKER, C. E., with numerous Diagrams. Sixth Edition, Revised by Prof. J. R. YOUNG. 12mo. 75 BARLOW.—The History and Principles of Weaving, by

BARLOW.—The History and Principles of Weaving, by Hand and by Power: Reprinted, with Considerable Additions, from "Engineering," with

Reprinted, with Considerable Additions, from "Engineering," with a chapter on Lace-making Machinery, reprinted from the Journal of the "Society of Arts." By ALFRED BARLOW. With several hundred illustrations. Svo., 443 pages . . . . \$10.00 BARR.—A Practical Treatise on the Combustion of Coal:

BAUERMAN.—A Treatise on the Metallurgy of Iron: Containing Outlines of the History of Iron Manufacture, Methods of Assay, and Analysis of Iron Ores, Processes of Manufacture of Iron and Steel, etc., etc. By H. BAUERMAN, F. G. S., Associate of the Royal School of Mines. Fifth Edition, Revised and Enlarged. Illustrated with numerous Wood Engravings from Drawings by J. B. JORDAN. 12mo. \$2.00

BAYLES.—House Drainage and Water Service: In Cities, Villages and Rural Neighborhoods. With Incidental Consideration of Certain Causes Affecting the Healthfulness of Dwellings. By JAMES C. BAYLES, Editor of "The Iron Age" and "The Metal Worker." With numerous illustrations. Svo. cloth,

BEANS.—A Treatise on Railway Curves and Location of Railroads:

By E. W. BEANS, C. E. Illustrated. 12mo. Tucks . \$1.50 BECKETT.—A Rudimentary Treatise on Clocks, and Watches and Bells:

By Sir EDMUND BECKETT, Bart., LL. D., Q. C. F. R. A. S. With numerous illustrations. Seventh Edition, Revised and Enlarged. 12mo. \$2.25

#### BELL .-- Carpentry Made Easy:

Or, The Science and Art of Framing on a New and Improved System. With Specific Instructions for Building Balloon Frames, Barn Frames, Mill Frames, Warehouses, Church Spires, etc. Comprising also a System of Bridge Building, with Bills, Estimates of Cost, and valuable Tables. Illustrated by forty-four plates, comprising aearly 200 figures. By WILLIAM E. BELL, Architect and Practical Builder. 8vo. \$5.00

BEMROSE.—Manual of Buhl-work and Marquetry: With Practical Instructions for Learners, and ninety colored designs. By W. BEMROSE, JR. I vol. quarto . . . . \$3.00

BEMROSE.—Manual of Wood Carving: With Practical Illustrations for Learners of the Art, and Original and Selected Designs. By WILLIAM BEMROSE, JR. With an Introduction by LLEWELLYN JEWITT, F. S. A., etc. With 128 illustrations, 4to. \$2.50

BILLINGS.-Tobacco:

#### BIRD .- The American Practical Dyers' Companion:

Comprising a Description of the Principal Dye-Stuffs and Chemicals used in Dyeing, their Natures and Uses; Mordants, and How Made; with the best American, English, French and German processes for Bleaching and Dyeing Silk, Wool, Cotton, Linen, Flannel, Felt, Dress Goods, Mixed and Hosiery Yarns, Feathers, Grass, Felt, Fur, Wool, and Straw Hats, Jute Yarn, Vegetable Ivory, Mats, Skins, Furs, Leather, etc., etc. By Wood, Aniline, and other Processes, together with Remarks on Finishing Agents, and Instructions in the Finishing of Fabrics, Substitutes for Indigo, Water-Proofing of Materials, Tests and Purification of Water, Manufacture of Aniline and other New Dye Wares, Harmonizing Colors, etc., etc.; embracing in all over 800 Receipts for Colors and Shades, accompanied by 170 Dyed Samples of Ratw Materials and Fabrics. By F. J. BIRD, Practical Dyer, Author of "The Dyers' Hand-Book." 8vo. \$10.00

#### BLINN.-A Practical Workshop Companion for Tin, Sheet-Iron, and Copper-plate Workers :

#### BOOTH.-Marble Worker's Manual:

Containing Practical Information respecting Marbles in general, their Cutting, Working and Folishing; Veneering of Marble; Mosaics; Composition and Use of Artificial Marble, Stuccos, Cements, Receipts, Secrets, etc., etc. Translated from the French by M. L. BOOTH. With an Appendix concerning American Marbles. 12mo., cloth \$1.50 BOOTH and MORFIT.—The Encyclopædia of Chemistry, Practical and Theoretical:

Embracing its application to the Arts, Metallurgy, Mineralogy, Geology, Medicine and Pharmacy. By JAMES C. BOOTH, Melter and Refiner in the United States Mint, Professor of Applied Chemistry in the Franklin Institute, etc., assisted by CAMPBELL MORFIT, author of "Chemical Manipulations," etc. Seventh Edition. Complete in one volume, royal Svo., 978 pages, with numerous wood-cuts and other illustrations. \$3.50

#### BRAMWELL.-The Wool Carder's Vade-Mecum .

A Complete Manual of the Art of Carding Textile Fabrics. By W. C. BRAMWELL. Third Edition, revised and enlarged. Illustrated. Pp. 400. 12mo. \$2.56

BRANNT.—A Practical Treatise on Animal and Vegetable Fats and Oils:

Comprising both Fixed and Volatile Oils, their Physical and Chemical Properties and Uses, the Manner of Extracting and Refining them, and Practical Rules for Testing them; as well as the Manufacture of Artificial Butter, Lubricants, including Mineral Lubricating Oils, etc., and on Ozokerite. Edited chiefly from the German of DRS. KARL SCHAEDLER, G. W. ASKINSON, and RICHARD BRUNNER, with Additions and Lists of American Patents relating to the Extraction, Rendering, Refining, Decomposing, and Bleaching of Fats and Oils. By WILLIAM T. BRANNT. Illustrated by 244 engravings. 739 pages. 8vo.

#### BRANNT.—A Practical Treatise on the Manufacture of Soap and Candles:

Based upon the most Recent Experiences in the Practice and Science; comprising the Chemistry, Raw Materials, Machinerv. and Utensils and Various Processes of Manufacture, including a great variety of formulas. Edited chiefly from the German of Dr. C. Deite, A. Engelhardt, Dr. C. Schaedler and others; with additions and lists of American Patents relating to these subjects. By WM. T. BRANNT. Illustrated by 163 engravings. 677 pages. Svo. . . \$7.50

BRANNT.—A Practical Treatise on the Raw Materials and the Distillation and Rectification of Alcohol, and the Preparation of Alcoholic Liquors, Liqueurs, Cordials, Bitters, etc.:
 Edited chiefly from the German of Dr. K. Stammer, Ibr. F. Elsner, and E. Schubert. By WM. T. BRANNT. Illustrated by thirty-one engravings. 12mo.

- BRANNT—WAHL.—The Techno-Chemical Receipt Book: Containing several thousand Receipts covering the latest, most in portant, and most useful discoveries in Chemical Technology, and their Practical Application in the Arts and the Industries. Edited chiefly from the German of Drs. Winckler, Elsner, Heintze, Mier zinski, Jacobsen, Koller, and Heinzerling, with additions by WM. 7. BRANNT and WM. H. WAHL, PH. D. Illustrated by 78 engravings. 12mo. 495 pages \$2.00
- BROWN.—Five Hundred and Seven Mechanical Movements: Embracing all those which are most important in Dynamics, Hydraulics, Hydrostatics, Pneumatics, Steam-Engines, Mill and other Gearing, Presses, Horology and Miscellaneous Machinery; and including many movements never before published, and several of which have only recently come into use. By HENRY T. BROWN. 12mo. \$1.00
- BUCKMASTER.—The Elements of Mechanical Physics: By J. C. BUCKMASTER. Illustrated with numerous engravings. 12mo. \$1.00
- BULLOCK .- The American Cottage Builder :

A Series of Designs, Plans and Specifications, from \$200 to \$20,000, for Homes for the People; together with Warming, Ventilation, Drainage, Painting and Landscape Gardening. By JOHN BULLOCK, Architect and Editor of "The Rudiments of Architectare and Building," etc., etc. Illustrated by 75 engravings. 8vo. \$3.00 BULLOCK.—The Rudiments of Architecture and Building:

- BULLOCK.—The Rudiments of Architecture and Building: For the use of Architects, Builders, Draughtsmen, Machinists, Engineers and Mechanics. Edited by JOHN BULLOCK, author of "The American Cottage Builder." Illustrated by 250 Engravings. 8vo. \$3.00
- BURGH.--Practical Rules for the Proportions of Modern Engines and Boilers for Land and Marine Purposes.
- By N. P. BURGH, Engineer. 12mo. . . . \$1.50 BYLES.—Sophisms of Free Trade and Popular Political Economy Examined.

By a BARRISTER (SIR JOHN BARNARD BYLES, Judge of Common Pleas). From the Ninth English Edition, as published by the Manchester Reciprocity Association. 12mo. . . . \$1.25

BOWMAN.—The Structure of the Wool Fibre in its Relation to the Use of Wool for Technical Purposes: Being the substance, with additions, of Five Lectures, delivered at

Being the substance, with additions, of Five Lectures, delivered at the request of the Council, to the members of the Bradford Technical College, and the Society of Dyers and Colorists. By F. H. Bow-MAN, D. Sc., F. R. S. E., F. L. S. Illustrated by 32 engravings. Svo. \$6,50

BYRNE.—Hand-Book for the Artisan, Mechanic, and Engineer:

Comprising the Grinding and Sharpening of Cutting Tools, Abrazive Processes, Lapidary Work, Gem and Glass Engraving, Varnishing and Lackering, Apparatus, Materials and Processes for Grinding and

б

BYRNE.—The Practical Metal-Worker's Assistant: Comprising Metallurgic Chemistry; the Arts of Working all Metals and Alloys; Forging of Iron and Steel; Hardening and Tempering; Melting and Mixing; Casting and Founding; Works in Sheet Metal; the Processes Dependent on the Ductility of the Metals; Soldering; and the most Improved Processes and Tools employed by Metal-Workers. With the Application of the Art of Electro-Metallurgy to Manufacturing Processes; collected from Original Sources, and from the works of Holtzapffel, Bergeron, Leupold, Plumier, Napier, Scoffern, Clay, Fairbairn and others. By OLIVER BYRNE. A new, revised and improved edition, to which is added an Appendix, containing The Manufacture of Russian Sheet-Iron. By JOHN PERCY, M. D., F. R.S. The Manufacture of Malleable Iron Castings, and Improvements in Bessemer Steel. By A. A. FESQUET, Chemist and Engineer. With over Six Hundred Engravings, Illustrating every Branch of the Subject. 8vo. \$5.00

- BYRNE.—The Practical Model Calculator: For the Engineer, Mechanic, Manufacturer of Engine Work, Nava, Architect, Miner and Millwright. By OLIVER BYRNE. 8vo., nearly 600 pages \$3.00

- CAMPIN.—A Practical Treatise on Mechanical Engineering: Comprising Metallurgy, Moulding, Casting, Forging, Tools, Workshop Machinery, Mechanical Manipulation, Manufacture of Steam-Engines, etc. With an Appendix on the Analysis of Iron and Iron Ores. By FFANCIS CAMPIN, C. E. To which are added, Observations on the Construction of Steam Boilers, and Remarks upon Furnaces used for Smoke Prevention; with a Chapter on Explosions. By R. ARMSTRONG, C. E., and JOHN BOURNE. Rules for Calculating the Change Wheels for Screws on a Turning Lathe, and for a Wheely cutting Machine. By J. LA NICCA. Management of Steel, Including Forging, Hardening, Tempering, Annealing, Shrinking and Expansion; and the Case-hardening of Iron. By G. EDE. Svo. Illustrated with twenty-nine plates and 100 wood engravings \$5.00

CAREY .-- A Memoir of Henry C. Carey.

| By DR. WM. ELDER. | With a portrait. 8vo., cloth | • | 75 |
|-------------------|------------------------------|---|----|
| CAREY The Work    | s of Henry C. Carey:         |   |    |

Harmony of Interests: Agricultural, Manufacturing and Commercial. 8vo. \$1.25 Manual of Social Science. Condensed from Carey's "Principles of Social Science." By KATE MCKEAN. I vol. 12mo. \$2.00 Miscellaneous Works. With a Portrait. 2 vols. 8vo. \$10,00 Past, Present and Future. 8vo. \$2.50 Principles of Social Science. 3 volumes, 8vo. \$7.50 The Slave-Trade, Domestic and Foreign; Why it Exists, and How it may be Extinguished (1853). 8vo. \$2.00 The Unity of Law: As Exhibited in the Relations of Physical, Social, Mental and Moral Science (1872). 8vo. \$2.50

CLARK.—Tramways, their Construction and Working: Embracing a Comprehensive History of the System. With an exhaustive analysis of the various modes of traction, including horsepower, steam, heated water and compressed air; a description of the varieties of Rolling stock, and ample details of cost and working expenses. By D. KINNEAR CLARK. Illustrated by over 200 wood engravings, and thirteen folding plates. I vol. 8vo. . \$9.00 COLBURN.—The Locomotive Engine:

Including a Description of its Structure, Rules for Estimating its Capabilities, and Practical Observations on its Construction and Management. By ZERAH COLBURN. Illustrated. 12mo. \$1.00

COLLENS.—The Eden of Labor; or, the Christian Utopia. By T. WHARTON COLLENS, author of "Humanics," "The History of Charity," etc. 12mo. Paper cover, \$1.00; Cloth . \$1.25 COOLEY.—A Complete Practical Treatise on Perfumery:

COOPER.—A Treatise on the use of Belting for the Transmission of Power.

With numerous illustrations of approved and actual methods of arranging Main Driving and Quarter Twist Belts, and of Belt Fastenings. Examples and Rules in great number for exhibiting and calculating the size and driving power of Belts. Plain, Particular and Practical Directions for the Treatment, Care and Management of Belts. Descriptions of many varieties of Beltings, together with chapters on the Transmission of Power by Ropes; by Iron and Wood Frictional Gearing; on the Strength of Belting Leather; and on the Experimental Investigations of Morin, Briggs, and others. By JOHN H. COOPER, M. E. 8vo. \$3.50

#### CROSS .- The Cotton Yarn Spinner :

Showing how the Preparation should be arranged for Different Counts of Yarns by a System more uniform than has hitherto been practiced; by having a Standard Schedule from which we make all our Changes. By RICHARD CROSS. 122 pp. 12mo. . 75

#### CRISTIANI .- A Technical Treatise on Soap and Candles:

With a Glance at the Industry of Fats and Oils. By R. S. CRIS-TIANI, Chemist. Author of "Perfumery and Kindred Arts." Illustrated by 176 engravings. 581 pages, 8vo. . . . \$15.00

#### COAL AND METAL MINERS' POCKET BOOK:

Of Principles, Rules, Formulæ, and Tables, Specially Compiled and Prepared for the Convenient Use of Mine Officials, Mining Engineers, and Students preparing themselves for Certificates of Competency as Mine Inspectors or Mine Foremen. Revised and Enlarged edition. Illustrated, 565 pages, small 12mo., cloth. \$2.00 Pocket book form, flexible leather with flap . \$2.75

DAVIDSON.—A Practical Manual of House Painting, Graining, Marbling, and Sign-Writing:

Containing full information on the processes of House Painting in Oil and Distemper, the Formation of Letters and Practice of Sign-Writing, the Principles of Decorative Art, a Course of Elementary Drawing for House Painters, Writers, etc., and a Collection of Useful Receipts. With nine colored illustrations of Woods and Marbles, and numerous wood engravings. By ELLIS A. DAVIDSON. 12mo. \$3.00

DAVIES.—A Treatise on Earthy and Other Minerals and Mining:

- DAVIES.—A Treatise on Metalliferous Minerals and Mining: By D. C. DAVIES, F. G. S., Mining Engineer, Examiner of Mines, Quarries and Collieries. Illustrated by 148 engravings of Geological Formations, Mining Operations and Machinery, drawn from the practice of all parts of the world. Fifth Edition, thoroughly Revised and much Enlarged by his son, E. Henry Davies. 12mo., 524 pages \$5.00
- DAVIS.—A Practical Treatise on the Manufacture of Brick, Tiles and Terra-Cotta:

Including Stiff Clay, Dry Clay, Hand Made, Pressed or Front, and Roadway Paving Brick, Enamelled Brick, with Glazes and Colors, Fire Brick and Blocks, Silica Brick, Carbon Brick, Glass Pots, Re-

#### 10 HENRY CAREY BAIRD & CO.'S CATALOGUE.

torts, Architectural Terra-Cotta, Sewer Pipe, Drain Tile, Glazed and Unglazed Roofing Tile, Art Tile, Mosaics, and Imitation of Intarsia or Inlaid Surfaces. Comprising every product of Clay employed in Architecture, Engineering, and the Blast Furnace. With a Detailed Description of the Different Clays employed, the Most Modern Machinery, Tools, and Kilns used, and the Processes for Handling, Disintegrating, Tempering, and Moulding the Clay into Shape, Drying, Setting, and Burning. By Charles Thomas Davis. Third Edition. Revised and in great part rewritten. Illustrated by 261 engravings. 662 pages . . \$5.00 . .

- DAVIS .- A Treatise on Steam-Boiler Incrustation and Methods for Preventing Corrosion and the Formation of Scale: By CHARLES T. DAVIS. Illustrated by 65 engravings. 8vo. \$1.50
- DAVIS .- The Manufacture of Paper :

Being a Description of the various Processes for the Fabrication, Coloring and Finishing of every kind of Paper, Including the Different Raw Materials and the Methods for Determining their Values, the Tools, Machines and Practical Details connected with an intelligent and a profitable prosecution of the art, with special reference to the best American Practice. To which are added a History of Paper, complete Lists of Paper-Making Materials, List of American Machines, Tools and Processes used in treating the Raw Materials, and in Making, Coloring and Finishing Paper. By CHARLES T. DAVIS. Illustrated by 156 engravings. 608 pages, 8vo. DAVIS.—The Manufacture of Leather: \$6.00

Being a description of all of the Processes for the Tanning, Tawing, Currying, Finishing and Dyeing of every kind of Leather; including the various Raw Materials and the Methods for Determining their Values; the Tools, Machines, and all Details of Importance connected with an Intelligent and Profitable Prosecution of the Art, with Special Reference to the Best American Practice. To which are added Complete Lists of all American Patents for Materials, Processes, Tools, and Machines for Tanning, Currying, etc. By CHARLES THOMAS DAVIS. Illustrated by 302 engravings and 12 Samples of Dyed Leathers. One vol., 8vo., 824 pages \$25.00 .

DAWIDOWSKY-BRANNT .- A Practical Treatise on the Raw Materials and Fabrication of Glue, Gelatine, Gelatine Veneers and Foils, Isinglass, Cements, Pastes, Mucilages, etc.:

Based upon Actual Experience. By F. DAWIDOWSKY, Technical Chemist. Translated from the German, with extensive additions, including a description of the most Recent American Processes, by WILLIAM T. BRANNT, Graduate of the Royal Agricultural College \$2.50

Being a Plain Practical System of Hand-Railing, embracing all its necessary Details, and Geometrically Illustrated by twenty-two Steel Engravings; together with the use of the most approved principles of Practical Geometry. By SIMON DE GRAFF, Architect. 4to.

\$2.50

DE KONINCK-DIETZ.-A Practical Manual of Chemical Analysis and Assaying :

As applied to the Manufacture of Iron from its Ores, and to Cast Iron, Wrought Iron, and Steel, as found in Commerce. By L. L. DE KONINCK, Dr. Sc., and E. DIETZ, Engineer. Edited with Notes, by ROBERT MALLET, F. R. S., F. S. G., M. I. C. E., etc. American Edition, Edited with Notes and an Appendix on Iror Ores, by A. A. FESQUET, Chemist and Engineer. 12mo. \$1.50

#### DUNCAN.-Practical Surveyor's Guide:

Containing the necessary information to make any person of common capacity, a finished land surveyor without the aid of a teacher By ANDREW DUNCAN. Revised. 72 engravings, 214 pp. 12mo. \$1.50

DUPLAIS.—A Treatise on the Manufacture and Distillation of Alcoholic Liquors:

Comprising Accurate and Complete Details in Regard to Alcohol from Wine, Molasses, Beets, Grain, Rice, Potatoes, Sorghum, Aspho del, Fruits, etc.; with the Distillation and Rectification of Brandy Whiskey, Rum, Gin, Swiss Absinthe, etc., the Preparation of Aromatic Waters, Volatile Oils or Essences, Sugars, Syrups, Aromatie Tinctures, Liqueurs, Cordial Wines, Effervescing Wines, etc., the Ageing of Brandy and the improvement of Spirits, with Copious Directions and Tables for Testing and Reducing Spirituous Liquors, etc., etc. Translated and Edited from the French of MM. DUPLARS, Ainè et Jeune. By M. MCKENNIE, M. D. To which are added the United States Internal Revenue Regulations for the Assessment and Collection of Taxes on Distilled Spirits. Illustrated by fourteen folding plates and several wood engravings. 743 pp. 8vo. \$10 oo

 DUSSAUCE.
 Practical Treatise on the Fabrication of Matches, Gun Cotton, and Fulminating Powder.

 By Professor H. DUSSAUCE.
 12mo.
 \$3 00

DYER AND COLOR-MAKER'S COMPANION: Containing upwards of two hundred Receipts for making Colors, on

Containing upwards of two hundred Receipts for making Colors, on the most approved principles, for all the various styles and fabrics now in existence; with the Scouring Process, and plain Directions for Preparing, Washing-off, and Finishing the Goods. 12mo. \$1.00 EDWARDS.—A Catechism of the Marine Steam-Engine,

For the use of Engineers, Firmen, and Mechanics. A Practical Work for Practical Men. By EMORY EDWARDS, Mechanical Engineer. Illustrated by sixty-three Engravings, including examples of the most modern Engines. Third edition, thoroughly revised, with much additional matter. 12mo. 414 pages \$2 00

EDWARDS.—Modern American Locomotive Engines, Their Design, Construction and Management. By EMORY EDWARDS. Illustrated 12mo. \$2.00

#### EDWARDS .- The American Steam Engineer :

Theoretical and Practical, with examples of the latest and most approved American practice in the design and construction of Steam Engines and Boilers. For the use of engineers, machinists, boilermakers, and engineering students. By EMORY EDWARDS. Fully illustrated, 419 pages. 12mo. \$2.50

#### 12 HENRY CAREY BAIRD & CO.'S CATALOGUE.

EDWARDS .- Modern American Marine Engines, Boilers, and Screw Propellers,

Their Design and Construction. Showing the Present Practice ot the most Eminent Engineers and Marine Engine Builders in the United States. Illustrated by 30 large and elaborate plates. 4to. \$5.00 CDWARDS.—The Practical Steam Engineer's Guide

In the Design, Construction, and Management of American Stationary, . Portable, and Steam Fire-Engines, Steam Pumps, Boilers, Injectors Governors, Indicators, Pistons and Rings, Safety Valves and Steam Gauges. For the use of Engineers, Firemen, and Steam Users. By EMORY EDWARDS. Illustrated by 119 engravings. A20 pages. I2mo. \$2 50

#### EISSLER .- The Metallurgy of Gold :

A Practical Treatise on the Metallurgical Treatment of Gold-Bearing Ores, including the Processes of Concentration and Chlorination, and the Assaying, Melting, and Refining of Gold. By M. EISSLER. With 132 Illustrations. 12mo, \$5.00

#### EISSLER.—The Metallurgy of Silver :

A Practical Treatise on the Amalgamation, Roasting, and Lixiviation of Silver Ores, including the Assaying, Melting, and Refining of Silver Bullion. By M. EISSLER. 124 Illustrations. 336 pp. \$4.25 I2mo. . .

ELDER .- Conversations on the Principal Subjects of Political Economy.

By DR. WILLIAM ELDER. 8vo. \$2.50

ELDER .-- Questions of the Day,

Economic and Social. By DR. WILLIAM ELDER. 8vo. . \$3.00

ERNI.—Mineralogy Simplified. Easy Methods of Determining and Classifying Minerals, including Ores, by means of the Blowpipe, and by Humid Chemical Analysis, based on Professor von Kobell's Tables for the Determination of Minerals, with an Introduction to Modern Chemistry. By HENRY ERNI, A.M., M.D., Professor of Chemistry. Second Edition, rewritten, \$3.0C enlarged and improved. 12mo. . .

FAIRBAIRN.—The Principles of Mechanism and Machinery of Transmission

Comprising the Principles of Mechanism, Wheels, and Pulleys, Strength and Proportions of Shafts, Coupling of Shafts, and Engaging and Disengaging Gear. By SIR WILLIAM FAIRBAIRN, Bart. C. E. Beautifully illustrated by over 150 wood-cuts. In one \$2.50 volume, 12mo .

# FLEMING .- Narrow Gauge Railways in America.

A Sketch of their Rise, Progress, and Success. Valuable Statistics 

FORSYTH .- Book of Designs for Headstones, Mural, and other Monuments:

- FRANKEL—HUTTER.—A Practical Treatise on the Manufacture of Starch, Glucose, Starch-Sugar, and Dextrine: Based on the German of LADISLAUS VON WAGNER, Professor in the Royal Technical High School, Buda-Pest, Hungary, and other authorities. By JULIUS FRANKEL, Graduate of the Polytechnic School of Hanover. Edited by ROBERT HUTTER, Chemist, Practical Manufacturer of Starch-Sugar. Illustrated by 58 engravings, covering every branch of the subject, including examples of the most
- Recent and Best American Machinery. 8vo., 344 pp. . \$3.50 GARDNER.—The Painter's Encyclopædia: Containing Definitions of all Important Words in the Art of Plain and Articia Painting with Database of Database in the Art of Plain
- GARDNER.—Everybody's Paint Book: A Complete Guide to the Art of Outdoor and Indoor Painting, Designed for the Special Use of those who wish to do their own work, and consisting of Practical Lessons in Plain Painting, Varnishing, Polishing, Staining, Peper Hanging, Kalsomining, etc., as well as Directions for Renovating Furniture, and Hints on Artistic Work for Home Decoration. 38 Illustrations. 12mc., 183 pp. . \$1.00
- SEE.—The Goldsmith's Handbook: Containing full instructions for the Alloying and Working of Gold, including the Art of Alloying, Melting, Reducing, Coloring, Collecting, and Refining; the Processes of Manipulation, Recovery of Waste; Chemical and Physical Properties of Gold; with a New System of Mixing its Alloys; Solders, Enamels, and other Useful Rules and Recipes. By GEORGE E. GEE. 12mo. . \$1.75
- GEE.—The Silversmith's Handbook: Containing full instructions for the Alloying and Working of Silver, including the different modes of Refining and Melting the Metal; its Solders; the Preparation of Imitation Alloys; Methods of Manipulation; Prevention of Waste; Instructions for Improving and Finishing the Surface of the Work; together with other Useful Information and Memoranda. By GEORGE E. GEE. Illustrated. 12mo. \$1.75
- GOTHIC ALBUM FOR CABINET-MAKERS: Designs for Gothic Furniture. Twenty-three plates. Oblong \$2.00
- GRANT.—A Handbook on the Teeth of Gears: Their Curves, Properties, and Practical Construction. By GEORGE B. GRANT. Illustrated. Third Edition, enlarged. 8vo. \$100
- GREENWOOD.—Steel and Iron: Comprising the Practice and Theory of the Several Methods Pursued in their Manufacture, and of their Treatment in the Rolling-Mills, the Forge, and the Foundry. By WILLIAM HENRY GREEN-WOOD, F. C. S. With 97 Diagrams, 536 pages. 12mo. \$2.00

#### GREGORY .- Mathematics for Practical Men:

Adapted to the Pursuits of Surveyors, Architects, Mechanics, and Civil Engineers. By OLINTHUS GREGORY. 8vo., plates \$3.00

#### GRISWOLD .- Railroad Engineer's Pocket Companion for the Field:

Comprising Rules for Calculating Deflection Distances and Angles, Tangential Distances and Angles, and all Necessary Tables for En gineers; also the Art of Levelling from Preliminary Survey to the Construction of Railroads, intended Expressly for the Young Engineer, together with Numerous Valuable Rules and Examples. By W. GRISWOLD. 12mo., tucks \$1.75 GRUNER.—Studies of Blast Furnace Phenomena:

By M. L. GRUNER, President of the General Council of Mines of France, and lately Professor of Metallurgy at the Ecole des Mines. Translated, with the author's sanction, with an Appendix, by L. D. B. GORDON, F. R. S. E., F. G. S. 8vo. . . . \$2.50

#### Hand-Book of Useful Tables for the Lumberman, Farmer and Mechanic:

Containing Accurate Tables of Logs Reduced to Inch Board Meas. ure, Plank, Scantling and Timber Measure; Wages and Rent, by Week or Month; Capacity of Granaries, Bins and Cisterns; Land Measure, Interest Tables, with Directions for Finding the Interest on 

#### HASERICK .- The Secrets of the Art of Dyeing Wool, Cotton, and Linen,

Including Bleaching and Coloring Wool and Cotton Hosiery and Random Yarns. A Treatise based on Economy and Practice. By E. C. HASERICK. Illustrated by 323 Dyed Patterns of the Yarni or Fabrics. 8vo. \$7.50 • • •

#### HATS AND FELTING:

A Practical Treatise on their Manufacture. By a Practical Hatter. Illustrated by Drawings of Machinery, etc. 8vo. . . \$1.25 HOFFER.-A Practical Treatise on Caoutchouc and Guita

Percha,

Comprising the Properties of the Raw Materials, and the manner of Mixing and Working them; with the Fabrication of Vulcanized and Hard Rubbers, Caoutchouc and Gutta Percha Compositions, Water-proof Substances, Elastic Tissues, the Utilization of Waste, etc., etc., From the German of RAIMUND HOFFER. By W. T. BRANNT. Iliustrated 12mo. . . . • . . \$2.50

#### HAUPT .- Street Railway Motors :

With Descriptions and Cost of Plants and Operation of the Various Systems now in Use. 12mo. . . . . \$1.75 .

#### HAUPT-RHAWN.-A Move for Better Roads:

HUGHES.—American Miller and Millwright's Assistant: By WILLIAM CARTER HUGHES. 12mo. \$1.50

HULME.—Worked Examination Questions in Plane Germetrical Drawing :

For the Use of Candidates for the Royal Military Academy, Woolwich; the Royal Military College, Sandhurst; the Indian Gvil Engineering College, Cooper's Hill; Indian Public Works and Telegraph Departments; Royal Marine Light Infantry; the Oxford and Cambridge Local Examinations, etc. By F. EDWARD HULME, F. L. S., F. S. A., Art-Master Marlborough College. Illustrated by 300 examples. Small quarte \$2.56 JERVIS.—Railroad Property:

A Treatise on the Construction and Management of Railways; designed to afford useful knowledge, in the popular style, to the holders of this class of property; as well as Railway Managers, Offi cers, and Agents. By JOHN B. JERVIS, late Civil Engineer of the Hudson River Railroad, Croton Aqueduct, etc. 12mo., cloth \$2.00

- KELLEY.—Speeches, Addresses, and Letters on Industrial and Financial Questions :

By HON. WILLIAM D. KELLEY, M. C. 544 pages, 8vo. . \$2.50 KELLOGG.—A New Monetary System :

KEMLO .- Watch-Repairer's Hand-Book:

Being a Complete Guide to the Young Beginner, in Taking Apart, Putting Together, and Thoroughly Cleaning the English Lever and other Foreign Watches, and all American Watches. By F. KEMLO, Practical Watchmaker. With Illustrations. 12mo. \$1.25

KENTISH .-- A Treatise on a Box of Instruments,

And the Slide Rule; with the Theory of Trigonometry and Loga rithms, including Practical Geometry, Surveying, Measuring of Timber, Cask and Malt Gauging, Heights, and Distances. By THOMAS KENTISH. In one volume. I2mo. \$1.25 KERL .- The Assayer's Manual:

An Abridged Treatise on the Docimastic Examination of Ores, and Furnace and other Artificial Products. By BRUNO KERL, Professor in the Royal School of Mines. Translated from the German by WILLIAM T. BRANNT. Second American edition, edited with Ex-tensive Additions by F. LYNWOOD GARRISON, Member of the American Institute of Mining Engineers, etc. Illustrated by 87 engravings. 8vo. KICK.-Flour Manufacture. • . . \$3.00 .

A Treatise on Milling Science and Practice. By FREDERICK KICK Imperial Regierungsrath, Professor of Mechanical Technology in the Imperial German Polytechnic Institute, Prague. Translated from the second enlarged and revised edition with supplement by H. H. P. POWLES, Assoc. Memb. Institution of Civil Engineers. Illustrated with 28 Plates, and 167 Wood-cuts. 367 pages. 8vo. . \$10.00

KINGZETT .- The History, Products, and Processes of the Alkali Trade :

Including the most Recent Improvements. By CHARLES THOMAS KINGZETT, Consulting Chemist. With 23 illustrations. 8vo. \$2.50 KIRK .- The Founding of Metals :

A Practical Treatise on the Melting of Iron, with a Description of the Founding of Alloys; also, of all the Metals and Mineral Substances used in the Art of Founding. Collected from original sources. By EDWARD KIRK, Practical Foundryman and Chemist. Illustrated, Third edition. 8vo. \$2.50

LANDRIN.-A Treatise on Steel:

Comprising its Theory, Metallurgy, Properties, Practical Working, and Use. By M. H. C. LANDRIN, JR., Civil Engineer. Translated from the French, with Notes, by A. A. FESQUET, Chemist and En gineer. With an Appendix on the Bessemer and the Martin Proresses for Manufacturing Steel, from the Report of Abram S. Hewitt United States Commissioner to the Universal Exposition, Paris, 1867. \$3.00 12mo. •

LANGBEIN.-A Complete Treatise on the Electro-Deposition of Metals:

Translated from the German, with Additions, by WM. T. BRANNT. 125 illustrations. 8vo. \$4.00 . .

LARDNER.—The Steam-Engine:

For the Use of Beginners. Illustrated. 12mo. . 75 LEHNER.-The Manufacture of Ink:

Comprising the Raw Materials, and the Preparation of Writing, Copying and Hektograph Inks, Safety Inks, Ink Extracts and Pow-ders, etc. Translated from the German of SIGMUND LEHNER, with additions by WILLIAM T. BRANNT. Illustrated. 12mo. \$2.00

#### HENRY CAREY BAIRD & CO.'S CATALOGUE.

#### LARKIN.—The Practical Brass and Iron Founder's Guide: A Concise Treatise on Brass Founding, Moulding, the Metals and their Alloys, etc.; to which are added Recent Improvements in the Manufacture of Iron, Steel by the Bessemer Process, etc., etc. By JAMES LARKIN, late Conductor of the Brass Foundry Department in Reany, Neafie & Co.'s Penn Works, Philadelphia. New edition, revised, with extensive additions. 12mo. . . . \$2.50

LEROUX.—A Practical Treatise on the Manufacture of Worsteds and Carded Yarns:

Comprising Practical Mechanics, with Rules and Calculations applied to Spinning; Sorting, Cleaning, and Scouring Wools; the English and French Methods of Combing, Drawing, and Spinning Worsteds, and Manufacturing Carded Yarus. Translated from the French of CHARLES LEROUX, Mechanical Engineer and Superintendent of a Spinning-Mill, by HORATIO PAINE, M. D., and A. A. FESQUET, Chemist and Engineer. Illustrated by twelve large Plates. To which is added an Appendix, containing Extracts from the Reports of the International Jury, and of the Artisans selected by the Committee appointed by the Council of the Society of Arts, London, on Woolen and Worsted Machinery and Fabrics, as exhibited in the Paris Universal Exposition, 1867. Svo. \$5.00

LEFFEL.—The Construction of Mill-Dams: Comprising also the Building of Race and Reservoir Embankments and Head-Gates, the Measurement of Streams, Gauging of Water Supply, etc. By JAMES LEFFEL & Co. Illustrated by 58 engravings. 8vo. \$2.50

LESLIE.—Complete Cookery: Directions for Cookery in its Various Branches. By Miss Leslie. Sirvitet theorem of New Aview and with the addition of New

Their Origin and Progressive Development; including the Most Recent Examples of Steam and Gas Motors, together with the Indicator, its Principles, its Utility, and its Application. By WILLIAM BARNET LE VAN. Illustrated by 205 Engravings, chiefly of Indicator-Cards. 469 pp. 8vo.

Or, Practical Directions to Assayers, Miners, and Smelters, for the Tests and Assays, by Heat and by Wet Processes, for the Ores of all the principal Metals, of Gold and Silver Coins and Alloys, and of Coal, etc. By OSCAR M. LIEBER. Revised. 283 pp. 12mo. \$1.50 Lockwood's Dictionary of Terms:

Used in the Practice of Mechanical Engineering, embracing those Current in the Drawing Office, Pattern Shop, Foundry, Fitting, Turning, Smith's and Boiler Shops, etc., etc., comprising upwards of Six' Thousand Definitions. Edited by a Foreman Pattern Maker, author of "Pattern Making." 417 pp. 12mo. \$3.00

#### LUKIN .-- Amongst Machines:

Embracing Descriptions of the various Mechanical Appliances used in the Manufacture of Wood, Metal, and other Substances. 12mo. \$1.75

LUKIN.—The Boy Engineers: What They Did, and How They Did It. With 30 plates. 18mo.

\$1.75

#### LUKIN .- The Young Mechanic :

Practical Carpentry. Containing Directions for the Use of all kinds of Tools, and for Construction of Steam-Engines and Mechanical Models, including the Art of Turning in Wood and Metal. By JOHN LUKIN, Author of "The Lathe and Its Uses," etc. Illustrated. 12mo. \$1.75

MAIN and BROWN.—Questions on Subjects Connected with the Marine Steam-Engine:

And Examination Papers; with Hints for their Solution. By THOMAS J. MAIN, Professor of Mathematics, Royal Naval College, and THOMAS BROWN, Chief Engineer, R. N. 12mo., cloth. \$1.00

MAIN and BROWN.—The Indicator and Dynamometer: With their Practical Applications to the Steam-Engine. By THOMAS J. MAIN, M. A. F. R., Ass't S. Professor Royal Naval College, Portsmouth, and THOMAS BROWN, Assoc. Inst. C. E., Chief Engineer R. N., attached to the R. N. College. Illustrated. 8vo. \$1.00 MAIN and BROWN.—The Marine Steam-Engine.

By THOMAS J. MAIN, F. R. Ass't S. Mathematical Professor at the Royal Naval College, Portsmouth, and THOMAS BROWN, Assoc. Inst. C. E., Chief Engineer R. N. Attached to the Royal Naval College. With numerous illustrations. Svo.

#### MAKINS .- A Manual of Metallurgy:

By GEORGE HOGARTH MAKINS. 100 engravings. Second edition rewritten and much enlarged. 12mo., 592 pages . \$3.00

#### MARTIN.—Screw-Cutting Tables, for the Use of Mechanica) Engineers:

Showing the Proper Arrangement of Wheels for Cutting the Threads of Screws of any Required Pitch; with a Table for Making the Universal Gas-Pipe Thread and Taps. By W. A. MARTIN, Engineer. 8vo.\_\_\_\_\_\_5c

MICHELL.-Mine Drainage:

Being a Complete and Practical Treatise on Direct-Acting Underground Steam Pumping Machinery. With a Description of a large number of the best known Engines, their General Utility and the Special Sphere of their Action, the Mode of their Application, and their Merits compared with other Pumping Machinery. By STEPHEN MICHELL. Illustrated by 137 engravings. 8vo., 277 pages . \$6.00

MOLESWORTH.—Pocket-Book of Useful Formulæ and Memoranda for Civil and Mechanical Engineers.

By GUILFORD L. MOLESWORTH, Member of the Institution of Civil Engineers, Chief Resident Engineer of the Ceylon Railway. Fullbound in Pocket-book form

#### MOORE.—The Universal Assistant and the Complete Mechanic:

Containing over one million Industrial Facts, Calculations, Receipts, Processes, Trades Secrets, Rules, Business Forms, Legal Items, Etc., in every occupation, from the Household to the Manufactory. By R. MOORE. Illustrated by 500 Engravings. 12mo. \$2.50

- MAUCHLINE.—The Mine Foreman's Hand-Book Of Practical and Theoretical Information on the Opening, Ventilating, and Working of Collieries. Questions and Answers on Practical and Theoretical Coal Mining. Designed to Assist Students and Others in Passing Examinations for Mine Foremanships. By ROBERT MAUCHLINE, Ex-Inspector of Mines. A New, Revised and Enlarged Edition. Illustrated by 114 engravings. 8vo. 337 pages . \$3.75

NAPIER.--A System of Chemistry Applied to Dyeing.

By JAMES NAPLER, F. C. S. A New and Thoroughly Revised Edition. Completely brought up to the present state of the Science, including the Chemistry of Coal Tar Colors, by A. A. FESQUET, Chemist and Engineer. With an Appendix on Dyeing and Calico Printing, as shown at the Universal Exposition, Paris, 1867. Illustrated. 8vo. 422 pages . \$3.50

NEVILLE.—Hydraulic Tables, Coefficients, and Formulæ, for finding the Discharge of Water from Orifices, Notches, Weirs, Pipes, and Rivers:

Third Edition, with Additions, consisting of New Formulæ for the Discharge from Tidal and Flood Sluices and Siphons; general information on Rainfall, Catchment-Basins, Drainage, Sewerage, Water Supply for Towns and Mill Power. By IOHN NEVILLE, C. E. M R I. A.; Fellow of the Royal Geological Society of Ireland. Thick, 12mo. \$5.50

NEWBERY.-Gleanings from Ornamental Art of every style:

NICHOLLS. - The Theoretical and Practical Boiler-Maker and Engineer's Reference Book:

Containing a variety of Useful Information for Employers of Labor. Foremen and Working Boiler-Makers, Iron, Copper, and Tinsmiths Draughtsmen, Engineers, the General Steam-using Public, and for the Use of Science Schools and Classes. By SAMUEL NICHOLLS. Illustrated by sixteen plates, 12mo. \$2.50

NICHOLSON.-A Manual of the Art of Bookbinding:

Containing full instructions in the different Branches of Forwarding, Gilding, and Finishing. Also, the Art of Marbling Book-edges and Paper. By JAMES B. NICHOLSON. Illustrated. 12mo., cloth \$2.25 NICOLLS.—The Railway Builder:

A Hand-Book for Estimating the Probable Cost of American Railway Construction and Equipment. By WILLIAM J. NICOLLS, Civil Engineer. Illustrated, full bound, pocket-book form \$2.00

NORMANDY.—The Commercial Handbook of Chemical Analysis:

Or Practical Instructions for the Determination of the Intrinsic on Commercial Value of Substances used in Manufactures, in Trades, and in the Arts. By A. NORMANDY. New Edition, Enlarged, and to a great extent rewritten. By HENRY M. NOAD, Ph.D., F.R.S., thick Izmo. \$5.00

NORRIS.—A Handbook for Locomotive Engineers and Machinists:

NYSTROM.—A New Treatise on Elements of Mechanics : Establishing Strict Precision in the Meaning of Dynamical Terms : accompanied with an Appendix on Duodenal Arithmetic and Me trology. By JOHN W. NYSTROM, C. E. Illustrated. 8vo. \$2.00 NYSTROM.—On Technological Education and the Construc-

tion of Ships and Screw Propellers:

For Naval and Marine Engineers. By JOHN W. NYSTROM, late Acting Chief Engineer, U.S.N. Second edition, revised, with additional matter. Illustrated by seven engravings. 12mo. . \$1.50 O'NEILL.—A Dictionary of Dyeing and Calico Printing:

- Containing a brief account of all the Substances and Processes in use in the Art of Dyeing and Printing Textile Fabrics; with Practical Receipts and Scientific Information. By CHARLES O'NEILL, Analytical Chemist. To which is added an Essay on Coal Tar Colors and their application to Dyeing and Calico Printing. By A. A. FESQUET, Chemist and Engineer. With an appendix on Dyeing and Calico Printing, as shown at the Universal Exposition, Paris, 1867. 8vo. 491 pages \$3.50
- ORTON .- Underground Treasures:

How and Where to Find Them. A Key for the Ready Determination of all the Useful Minerals within the United States. By JAMES ORTON, A.M., Late Professor of Natural History in Vassar College, N. Y.; Cor. Mem. of the Academy of Natural Sciences, Philadelphia, and of the Lyceum of Natural History, New York; author of the "Andes and the Amazon," etc. A New Edition, with Additions. Illustrated \$1.50 OSBORN .- The Prospector's Field Book and Guide:

In the Search for and the Easy Determination of Ores and Other Useful Minerals. By Prof. H. S. OSBORN, LL. D., Author of "The Metallurgy of Iron and Steel;" "A Practical Manual of Minerals, Mines, and Mining." Illustrated by 44 Engravings. 12mo. \$1.50

OSBORN.-A Practical Manual of Minerals, Mines and Mining:

Comprising the Physical Properties, Geologic Positions, Local Occurrence and Associations of the Useful Minerals; their Methods of Chemical Analysis and Assay: together with Various Systems of Excavating and Timbering, Brick and Masonry Work, during Driving, Lining, Bracing and other Operations, etc. By Prof. H. S. OSBORN, LL. D., Author of the "Metallurgy of Iron and Steel." Illustrated by 171 engravings from original drawings. 8vo. \$4.50 **OVERMAN.—The Manufacture of Steel:** 

- Containing the Practice and Principles of Working and Making Steel. A Handbook for Blacksmiths and Workers in Steel and Iron, Wagon Makers, Die Sinkers, Cutlers, and Manufacturers of Files and Hardware, of Steel and Iron, and for Men of Science and Art. By FREDERICK OVERMAN, Mining Engineer, Author of the "Manufacture of Iron," etc. A new, enlarged, and revised Edition. By A. A. FESQUET, Chemist and Engineer. 12mo. \$1.50 OVERMAN, —The Moulder's and Founder's Pocket Guide:
- **OVERMAN.**—The Moulder's and Founder's Pocket Guide : A Treatise on Moulding and Founding in Green-sand, Dry-sand, Loam, and Cement; the Moulding of Machine Frames, Mill-gear, Hollowware, Ornaments, Trinkets, Bells, and Statues; Description of Moulds for Iron, Bronze, Brass, and other Metals; Plaster of Paris, Sulphur, Wax, etc.; the Construction of Melting Furnaces, the Melting and Founding of Metals; the Composition of Alloys and their Nature, etc., etc. By FREDERICK OVERMAN, M. E. A new Edition, to which is added a Supplement on Statuary and Ornamental Moulding, Ordnance, Malleable Iron Castings, etc. By A. A. FESQUET, Chemist and Engineer. Illustrated by 44 engravings. 12mo. \$2.00
- ist and Engineer. Illustrated by 44 engravings. 12mo. \$2.00 PAINTER, GILDER, AND VARNISHER'S COMPANION. Containing Rules and Regulations in everything relating to the Arts of Painting, Gilding, Varnishing, Glass-Staining, Graining, Marbling, Sign-Writing, Gilding on Glass, and Coach Painting and Varnishing; Tests for the Detection of Adulterations in Oils, Colors, etc.; and a Statement of the Diseases to which Painters are peculiarly liable, with the Simplest and Best Remedies. Sixteenth Edition. Revised, with an Appendix. Containing Colors and Coloring-Theoretical and Practical. Comprising descriptions of a great variety of Additional Pigments, their Qualities and Uses, to which are added, Dryers, and Modes and Operations of Painting, etc. Together with Chevreul's Principles of Harmony and Contrast of Colors. 12mo. Cloth \$1.50 PALLETT .- The Miller's, Millwright's, and Engineer's Guide. By HENRY PALLETT. Illustrated. 12mo. \$2.04 . .

2]

#### PERCY .- The Manufacture of Russian Sheet-Iron.

By JOHN PERCY, M. D., F. R. S., Lecturer on Metallurgy at the Royal School of Mines, and to The Advance Class of Artillery Officers at the Royal Artillery Institution, Woolwich; Author of "Metallurgy." With Illustrations. 8vo., paper . . . . . . . . . . . . 50 cts. PERKINS .- Gas and Ventilation :

Practical Treatise on Gas and Ventilation. With Special Relation to Illuminating, Heating, and Cooking by Gas. Including Scientific Helps to Engineer-students and others. With Illustrated Diagrams, By E. E. PERKINS. 12mo., cloth \$1.25

PERKINS AND STOWE .- A New Guide to the Sheet-iron and Boiler Plate Roller:

Containing a Series of Tables showing the Weight of Slabs and Piles to Produce Boiler Plates, and of the Weight of Piles and the Sizes of Bars to produce Sheet-iron; the Thickness of the Bar Gauge in decimals; the Weight per foot, and the Thickness on the Bar or Wire Gauge of the fractional parts of an inch; the Weight per sheet, and the Thickness on the Wire Gauge of Sheet-iron of various dimensions to weigh 112 lbs. per bundle; and the conversion of Short Weight into Long Weight, and Long Weight into Short. Estimated and collected by G. H. PERKINS and J. G. STOWE. \$2.50

POWELL-CHANCE-HARRIS. The Principles of Glass Making.

By HARRY J. POWELL, B. A. Together with Treatises on Crown and Sheet Glass; by HENRY CHANCE, M. A. And Plate Glass, by H. G. HARRIS, Asso. M. Inst. C. E. Illustrated 18mo. \$1.5G PROCTOR.—A Pocket-Book of Useful Tables and Formulæ

for Marine Engineers :

REGNAULT.-Elements of Chemistry:

By M. V. REGNAULT. Translated from the French by T. FORREST BETTON, M. D., and edited, with Notes, by JAMES C. BOOTH, Melter and Refiner U. S. Mint, and WILLIAM L. FABER, Metallurgist and Mining Engineer. Illustrated by nearly 700 wood-engravings. Comprising nearly 1,500 pages. In two volumes, 8vo., cloth . \$7.50 **RICHARDS.**—Aluminium:

Its History, Occurrence, Properties, Metallurgy and Applications, including its Alloys. By JOSEPH W. RICHARDS, A. C., Chemist and Practical Metallurgist, Member of the Deutsche Chemische Gesell-schaft. Illust. Third edition, enlarged and revised (1895) . \$6.00 RIFFAULT, VERGNAUD, and TOUSSAINT.—A Practical

Treatise on the Manufacture of Colors for Painting:

Comprising the Origin, Definition, and Classification of Colors; the Treatment of the Raw Materials; the best Formulæ and the Newest Processes for the Preparation of every description of Pigment, and the Necessary Apparatus and Directions for its Use; Dryers; the Testing. Application, and Qualities of Paints, etc., etc. By MM. RIFFAULT, VERGNAUD, and TOUSSAINT. Revised and Edited by M.

F. MALEPEYRE. Translated from the French, by A. A. FESQUET, Chemist and Engineer. Illustrated by Eighty engravings. In one vol., 8vo., 659 pages \$5.00 . • ٠

ROPER.-A Catechism of High-Pressure, or Non-Condensing Steam-Engines :

Including the Modelling, Constructing, and Management of Steam-Engines and Steam Boilers. With valuable illustrations. By STE-PHEN ROPER, Engineer. Sixteenth edition, revised and enlarged. 18mo., tucks, gilt edge \$2.00

#### ROPER .- Engineer's Handy-Book:

Containing a full Explanation of the Steam-Engine Indicator, and its Use and Advantages to Engineers and Steam Users. With Formulæ for Estimating the Power of all Classes of Steam-Engines; also, Facts, Figures, Questions, and Tables for Engineers who wish to qualify themselves for the United States Navy, the Revenue Service, the Mercantile Marine, or to take charge of the Better Class of Stationary Steam-Engines. Sixth edition. 16mo., 690 pages, tucks, gilt edge \$3.50 .

### ROPER .- Hand-Book of Land and Marine Engines :

Including the Modelling, Construction, Running, and Management of Land and Marine Engines and Boilers. With illustrations. By STEPHEN ROPER, Engineer. Sixth edition. 12mo., twcks, gilt edge. \$3.50

#### ROPER.-Hand-Book of the Locomotive:

Including the Construction of Engines and Boilers, and the Construction, Management, and Running of Locomotives. By STEPHEN ROPER. Eleventh edition. 18mo., tucks, gilt edge \$2.50

- ROPER .- Hand-Book of Modern Steam Fire-Engines. With illustrations. By STEPHEN ROPER, Engineer. Fourth edition, 12mo., tucks, gilt edge \$3.50
- ROPER .- Questions and Answers for Engineers. This little book contains all the Questions that Engineers will be asked when undergoing an Examination for the purpose of procuring Licenses, and they are so plain that any Engineer or Fireman of ordinary intelligence may commit them to memory in a short time. By STEPHEN ROPER, Engineer. Third edition \$3.00
- ROPER.-Use and Abuse of the Steam Boiler. By STEPHEN ROPER, Engineer. Eighth edition, with illustrations. Ismo., tucks, gilt edge ROSE.—The Complete Practical Machinist : \$2.00

Embracing Lathe Work, Vise Work, Drills and Drilling, Taps and Dies, Hardening and Tempering, the Making and Use of Tools, Tool Grinding, Marking out Work, etc. By JOSHUA ROSE. Illus-trated by 356 engravings. Thirteenth edition, thoroughly revised and in great part rewritten. In one vol., 12mo., 439 pages \$2.50

#### ROSE.-Mechanical Drawing Self-Taught:

Comprising Instructions in the Selection and Preparation of Drawing Instruments, Elementary Instruction in Practical Mechanical Draw

ing, together with Examples in Simple Geometry and Elementary Mechanism, including Screw Threads, Gear Wheels, Mechanical Motions, Engines and Boilers. By JOSHUA ROSE, M.E. Illustrated by 330 engravings. 8vo., 313 pages . \$4.00

ROSE .- The Slide-Valve Practically Explained : Embracing simple and complete Practical Demonstrations of the operation of each element in a Slide-valve Movement, and illustrating the effects of Variations in their Proportions by examples carefully selected from the most recent and successful practice. By JOSHUA ROSE, M. E. Illustrated by 35 engravings \$1.00 . ROSS.-The Blowpipe in Chemistry, Mineralogy and Geology: Containing all Known Methods of Anhydrous Analysis, many Working Examples, and Instructions for Making Apparatus. By LIEUT.-COLONEL W. A. ROSS, R. A., F. G. S. With 120 Illustrations. 12mo. \$2.00 SHAW.—Civil Architecture: Being a Complete Theoretical and Practical System of Building, containing the Fundamental Principles of the Art. By EDWARD SHAW, Architect. To which is added a Treatise on Gothic Architecture, etc. By THOMAS W. SILLOWAY and GEORGE M. HARDING, Architects. The whole illustrated by 102 quarto plates finely engraved on copper. Eleventh edition. 4to. . . . . . . • \$7.50 SHUNK .-- A Practical Treatise on Railway Curves and Location, for Young Engineers. By W. F. SHUNK, C. E. 12mo. Full bound pocket-book form \$2.00 SLATER.-The Manual of Colors and Dye Wares. By J. W. SLATER. 12mo. . \$3.00 • • SLOAN .- American Houses : A variety of Original Designs for Rural Buildings. Illustrated by 26 colored engravings, with descriptive references. By SAMUEL SLOAN, Architect. 8vo. \$1.50 . . . . . • SLOAN.-Homestead Architecture : Containing Forty Designs for Villas, Cottages, and Farm-houses, with Essays on Style, Construction, Landscape Gardening, Furniture, etc., etc. Illustrated by upwards of 200 engravings. By SAMUEL SLOAN, Architect. 8vo. \$3.50 SLOANE .- Home Experiments in Science. By T. O'CONOR SLEANE, E. M., A. M., F. D. Illustrated by 91 engravings. 12mo. . . . . . \$1.50 • SMEATON .- Builder's Pocket-Companion: Containing the Elements of Building, Surveying, and Architecture; with Practical Rules and Instructions connected with the subject. By A. C. SMEATON, Civil Engineer, etc. 12mo. \$1.50 . . SMITH.-A Manual of Political Economy. By E. PESHINE SMITH. A New Edition, to which is added a full Index. 12mo, • . . . . . . . \$1-25

SMITH.—Parks and Pleasure-Grounds: Or Practical Notes on Country Residences, Villas, Public Parks, and Gardens. By CHARLES H. J. SMITH, Landscape Gardener and Garden Architect, etc., etc. 12mo. \$2.00 \$2.00 SMITH .- The Dyer's Instructor:

Comprising Practical Instructions in the Art of Dyeing Silk, Cotton, Wool, and Worsted, and Woolen Goods; containing nearly 800 Receipts. To which is added a Treatise on the Art of Padding; and the Printing of Silk Warps, Skeins, and Handkerchiefs, and the various Mordants and Colors for the different styles of such work, By DAVID SMITH, Pattern Dyer. 12mo. . . \$2.00 SMYTH.—A Rudimentary Treatise on Coal and Coal-Mining. \$2.00

By WARRINGTON W. SMYTH, M. A., F. R. G., President R. G. S. of Cornwall. Fifth edition, revised and corrected. With numerous illustrations. 12mo. \$1.75 . . . .

SNIVELY .- Tables for Systematic Qualitative Chemical Anal. ysis.

By JOHN H. SNIVELY, Phr. D. 8vo. \$1.00

SNIVELY.—The Elements of Systematic Qualitative chemical Analysis :

A Hand-book for Beginners. By JOHN H. SNIVELY, Phr. D. 16mo. \$2.00

- STOKES .- The Cabinet-Maker and Upholsterer's Companion : Comprising the Art of Drawing, as applicable to Cabinet Work; Veneering, Inlaying, and Buhl-Work; the Art of Dyeing and Stain-ing Wood, Ivory, Bone, Tortoise-Shell, etc. Directions for Lacker-ing, Japanning, and Vunishing; to make French Polish, Glues, Cements, and Compositions; with numerous Receipts, useful to work men generally. By STOKES. Illustrated. A New Edition, with an Appendix upor ...ench Polishing, Staining, Imitating, Varnishing, etc., etc. 12mo . . . . . . . \$1.25
- STRENGTH AND OTHER PROPERTIES OF METALS: Reports of Experiments on the Strength and other Properties of Metals for Cannon. With a Description of the Machines for Testing Metals, and of the Classification of Cannon in service. By Officers of the Ordnance Department, U. S. Army. By authority of the Secretary of War. Illustrated by 25 large steel plates. Quarto . \$10.00 SULLIVAN.-Protection to Native Industry.

By Sir EDWARD SULLIVAN, Baronet, author of "Ten Chapters on Social Reforms." 8vo. \$1.00

SULZ .-- A Treatise on Beverages : Or the Complete Practical Bottler. Full instructions for Laboratory Work, with Original Practical Recipes for all kinds of Carbonated Drinks, Mineral Waters, Flavorings. Extracts, Syrups, etc. By CHAS. HERMAN SULZ. Technical Chemist and Practical Bottler Illustrated by 428 Engravings. Sid pp. Svo . \$10.00

SYME .- Outlines of an Industrial Science.

By DAVID SYME. 12mo. \$2.00 TABLES SHOWING THE WEIGHT OF ROUND. SQUARE, AND FLAT BAR IRON, STEEL, ETC., By Measurement. Cloth

TAYLOR.-Statistics of Coal:

Including Mineral Bituminous Substances employed in Arts and Manufactures; with their Geographical, Geological, and Commercial Distribution and Amount of Production and Consumption on the American Continent. With Incidental Statistics of the Iron Manufacture. By R. C. TAYLOR. Second edition, revised by S. S. HALDE-MAN. Illustrated by five Maps and many wood engravings. 8vo., \$6.00 cloth

63

TEMPLETON .- The Practical Examinator on Steam and the Steam-Engine:

With Instructive References relative thereto, arranged for the Use of Engineers, Students, and others. By WILLIAM TEMPLETON, Engineer. 12mo. \$1.00

THAUSING .- The Theory and Practice of the Preparation of Malt and the Fabrication of Beer:

With especial reference to the Vienna Process of Brewing. Elaborated from personal experience by JULIUS E. THAUSING, Professor at the School for Brewers, and at the Agricultural Institute, Mödling, near Vienna. Translated from the German by WILLIAM T. BRANNT, Thoroughly and elaborately edited, with much American matter, and according to the latest and most Scientific Practice, by A. SCHWARZ and DR. A. H. BAUER. Illustrated by 140 Engravings. 8vo., 815 pages \$10.00

THOMAS .- The Modern Practice of Photography: By R. W. THOMAS, F. C. S. 8vo.

25 THOMPSON .- Political Economy. With Especial Reference to the Industrial History of Nations :

By ROBERT E. THOMPSON, M. A., Professor of Social Science in the University of Pennsylvania. 12mo. \$1.50

THOMSON.-Freight Charges Calculator: By ANDREW THOMSON, Freight Agent. 24mo. \$1.25

TURNER'S (THE) COMPANION:

Containing Instructions in Concentric, Elliptic, and Eccentric Turning; also various Plates of Chucks, Tools, and Instruments; and Directions for using the Eccentric Cutter, Drill, Vertical Cutter, and Circular Rest; with Patterns and Instructions for working them. I2mo. \$1.25

**TURNING**: Specimens of Fancy Turning Executed on the Hand or Foot-Lathe:

With Geometric, Oval, and Eccentric Chucks, and Elliptical Cutting Frame. By an Amateur. Illustrated by 30 exquisite Photographs. 4to. . \$3.00 . . . . . . . . .

# VAILE .- Galvanized-Iron Cornice-Worker's Manual :

#### VILLE.—On Artificial Manures :

#### VILLE .- The School of Chemical Manures :

VOGDES.—The Architect's and Builder's Pocket-Companion and Price-Book:

Consisting of a Short but Comprehensive Epitome of Decimals, Duodecimals, Geometry and Mensuration; with Tables of United States Measures, Sizes, Weights, Strengths, etc., of Iron, Wood, Stone, Brick, Cement and Concretes, Quantities of Materials in given Sizes and Dimensions of Wood, Brick and Stone; and full and complete Bills of Prices for Carpenter's Work and Painting; also, Rules for Computing and Valuing Brick and Brick Work, Stone Work, Painting, Plastering, with a Vocabulary of Technical Terms, etc. By FRANK W. VOGDES, Architect, Indianapolis, Ind. Enlarged, revised, and corrected. In one volume, 368 pages, full-bound, pocket-book form, gilt edges <u>\$2.00</u> Cloth <u>1.59</u>

VAN CLEVE.—The English and American Mechanic: Comprising a Collection of Over Three Thousand Receipts, Rules, and Tables, designed for the Use of every Mechanic and Manufacturer. By B. FRANK VAN CLEVE. Illustrated. 500 pp. 12mo. \$2.00

# WAHNSCHAFFE.—A Guide to the Scientific Examination of Soils:

Comprising Select Methods of Mechanical and Chemical Analysia and Physical Investigation. Translated from the German of Dr. F. WAHNSCHAFFE. With additions by WILLIAM T. BRANNT. Illustrated by 25 engravings. 12mo. 177 pages . . . \$1.50

#### WALL.—Practical Graining:

With Descriptions of Colors Employed and Tools Used. Illustrated by 47 Colored Plates, Representing the Various Woods Used in Interior Finishing. By WILLIAM E. WALL. 8vo. . \$2.50

#### WALTON.-Coal-Mining Described and Illustrated :

By THOMAS H. WALTON, Mining Engineer. Illustrated by 24 large and elaborate Plates, after Actual Workings and Apparatus. \$5.00

#### 28 HENRY CAREY BAIRD & CO.'S CATALOGUE.

#### WARE .- The Sugar Beet.

Including a History of the Beet Sugar Industry in Europe, Varieties of the Sugar Beet, Examination, Soils, Tillage, Seeds and Sowing, Yield and Cost of Cultivation, Harvesting, Transportation, Conservation, Feeding Qualities of the Beet and of the Pulp, etc. By LEWI S. WARE, C. E., M. E. Illustrated by ninety engravings. 8vo.

\$4.00

#### WARN.—The Sheet-Metal Worker's Instructor:

For Zinc, Sheet-Iron, Copper, and Tin-Plate Workers, etc. Containing a selection of Geometrical Problems; also, Practical and Simple Rules for Describing the various Patterns required in the different branches of the above Trades. By REUBEN H. WARN, Practical Tin-Plate Worker. To which is added an Appendix, containing Instructions for Boiler-Making, Mensuration of Surfaces and Solids, Rules for Calcutating the Weights of different Figures of Iron and Steel, Tables of the Weights of Iron, Steel, etc. Illustrated by thirtytwo Plates and thirty-seven Wood Engravings. 8vo. \$3.00

#### WARNER.--New Theorems, Tables, and Diagrams, for the Computation of Earth-work:

Designed for the use of Engineers in Preliminary and Final Estimates of Students in Engineering, and of Contractors and other non-professional Computers. In two parts, with an Appendix. Part I. A Practical Treatise; Part II. A Theoretical Treatise, and the Appendix. Containing Notes to the Rules and Examples of Part I.; Explanations of the Construction of Scales, Tables, and Diagrams, and a Treatise upon Equivalent Square Bases and Equivalent Level Heights. The whole illustrated by numerous original engravings, comprising explanatory cuts for Definitions and Problems, Stereonetric Scales and Diagrams, and a series of Lithographic Drawings from Models: Showing all the Combinations of Solid Forms which occur in Railroad Excavations and Embankments. By JOHN WARNER, A. M., Mining and Mechanical Engineer. Illustrated by 14 Plates. A new, revised and improved edition. Svo.

#### WATSON.-A Manual of the Hand-Lathe:

Comprising Concise Directions for Working Metals of all kinds, Ivory, Bone and Precious Woods; Dyeing, Coloring, and French Polishing; Inlaying by Veneers, and various methods practised to produce Elaborate work with Dispatch, and at Small Expense. By EGBERT P. WATSON, Author of "The Modern Practice of American Machinists and Engineers." Illustrated by 78 engravings. \$1.50

#### WATSON.—The Modern Practice of American Machinists and Engineers

Including the Construction, Application, and Use of Drills, Lathe Tools, Cutters for Boring Cylinders, and Hollow-work generally, with the most Economical Speed for the same; the Results verified by Actual Practice at the Lathe, the Vise, and on the Floor. Togethe 

#### WATSON.-The Theory and Practice of the Art of Weaving by Hand and Power

With Calculations and Tables for the Use of those connected with the Trade. By JOHN WATSON, Manufacturer and Practical Machine-Maker. Illustrated by large Drawings of the best Power Looms. 8vo. \$6.00

#### WATT .-- The Art of Soap Making :

#### WEATHERLY.—Treatise on the Art of Boiling Sugar, Crysa tailizing, Lozenge-making, Comfits, Guni Goods,

#### WIGHTWICK .- Hints to Young Architects:

#### WILL .- Tables of Qualitative Chemical Analysis.

With an Introductory Chapter on the Course of Analysis. By Proessor HEINRICH WILL, of Giessen, Germany. Third American, from the eleventh German edition. Edited by CHARLES F. HIMES Ph. D., Professor of Natural Science, Dickinson College, Carlisle, Pa 8vo. \$1-59

#### WILLIAMS .- On Heat and Steam :

Embracing New Views of Vaporization, Condensation, and Explsion. By CHARLES WYE WILLIAMS, A. I. C. E. Illustrated Svo.

\$2.50

#### WILSON .-- A Treatise on Steam Boilers :

Their Strength, Construction, and Economical Working. By ROBERT WILSON. Illustrated 12mo. \$2.50

W ILSON.—First Principles of Political Economy: With Reference to Statesmanship and the Progress of Civilization. By Professor W. D. WILSON, of the Cornell University. A new and revised edition. 12mo. \$1.50

#### WOHLER.-A Hand-Book of Mineral Analysis:

#### WORSSAM.—On Mechanical Saws:

From the Transactions of the Society of Engineers, 1869. By S. W. WORSSAM, JR. Illustrated by eighteen large plates. 8vo. \$2.50

#### RECENT ADDITIONS.

#### BRANNT.--Varnishes, Lacquers, Printing Inks and Sealing -Waxes:

Their Raw Materials and their Manufacture, to which is added the Art of Varnishing and Lacquering, including the Preparation of Putties and of Stains for Wood, Ivory, Bone, Horn, and Leather. By WILLIAM T. BRANNT. Illustrated by 39 Engravings, 338 pages. 12mo. \$3,00

#### BRANNT-The Practical Scourer and Garment Dyer:

#### BRANNT .- Petroleum.

Its History, Origin, Occurrence, Production, Physical and Chemical Constitution, Technology, Examination and Uses; Together with the Occurrence and Uses of Natural Gas. Edited chiefly from the German of Prof. Hans Hoefer and Dr. Alexander Veith, by WM. T. BRANNT. Illustrated by 3 Plates and 284 Engravings. 743 pp. 8vo. \$7.50

#### BRANNT.—A Practical Treatise on the Manufacture of Vinegar and Acetates, Cider, and Fruit-Wines:

Preservation of Fruits and Vegetables by Canning and Evaporation; Preparation of Fruit-Butters, Jellies, Marmalades, Catchups, Pickles, Mustards, etc. Edited from various sources. By WILLIAM T. BRANNT. Illustrated by 79 Engravings. 479 pp. 8vo. \$5.00

#### BRANNT.—The Metal Worker's Handy-Book of Receipts and Processes:

Being a Collection of Chemical Formulas and Practical Manipulations for the working of all Metals; including the Decoration and Beautifying of Articles Manufactured therefrom, as well as ther Preservation. Edited from various sources. By WILLIAM T. BRANNT. Illustrated. I2mo. \$2,50

31

#### DEITE.--A Practical Treatise on the Manufacture of Perfumery:

EDWARDS.—American Marine Engineer, Theoretical and Practical:

With Examples of the latest and most approved American Practice. By EMORY EDWARDS. 85 illustrations. 12mo. . \$2.50

- POSSELT.—Technology of Textile Design:
- Being a Practical Treatise on the Construction and Application of Weaves for all Textile Fabrics, with minute reference to the latest Inventions for Weaving. Containing also an Appendix, showing the Analysis and giving the Calculations necessary for the Manufacture of the various Textile Fabrics. By E. A. POSSELT, Head Master Textile Department, Pennsylvania Museum and School of Industrial Art, Philadelphia, with over 1000 illustrations. 292 pages. 4to. \$5.00

POSSELT.—The Structure of Fibres, Yarns and Fabrics: Being a Practical Treatise for the Use of all Persons Employed in the Manufacture of Textile Fabrics, containing a Description of the Growth and Manipulation of Cotton, Wool, Worsted, Silk Flax, Jute, Ramie, China Grass and Hemp, and Dealing with all Manufacturers' Calculations for Every Class of Material, also Giving Minute Details for the Structure of all kinds of Textile Fabrics, and an Appendix of Arithmetic, specially adapted for Textile Purposes. By E. A. POSSELT. Over 400 Illustrations. quarto. \$10.00

RICH.—Artistic Horse-Shoeing:

A Practical and Scientific Treatise, giving Improved Methods of Shoeing, with Special Directions for Shaping Shoes to Cure Different Diseases of the Foot, and for the Correction of Faulty Action in Trotters. By GEORGE E. RICH. 62 Illustrations. 153 pages. 12mo. \$1.00

#### RICHARDSON.—Practical Blacksmithing:

A Collection of Articles Contributed at Different Times by Skilled Workmen to the columns of "The Blacksmith and Wheelwright," and Covering nearly the Whole Range of Blacksmithing, from the Simplest Job of Work to some of the Most Complex Forgings. Compiled and Edited by M. T. RICHARDSON.

Vol. I.210 Illustrations.224 pages.12mo.\$1.00Vol. II.230 Illustrations.262 pages.12mo.\$1.00Vol. III.390 Illustrations.307 pages.12mo.\$1.00Vol. IV.226 Illustrations.276 pages.12mo.\$1.00

#### RICHARDSON .- The Practical Horseshoer:

Being a Collection of Articles on Horseshoeing in all its Branches which have appeared from time to time in the columns of "?he Blacksmith and Wheelwright," etc. Compiled and edited by M. T. RICHARDSON. 174 illustrations.

ROPER.—Instructions and Suggestions for Engineers and Firemen:

By STEPHEN ROPER, Engineer. 18mo. Morocco . \$2.00 ROPER.—The Steam Boiler: Its Care and Management:

By STEPHEN ROPER, Engineer. 12mo., tuck, gilt edges. \$2.00

### ROPER.—The Young Engineer's Own Book:

Containing an Explanation of the Principle and Theories on which the Steam Engine as a Prime Mover is Based. By STEPHEN ROPER, Engineer. 160 illustrations, 363 pages. 18mo., tuck . \$3.00

 
#### ROSE.-Modern Steam-Engines:

An Elementary Treatise upon the Steam-Engine, written in Plain language; for Use in the Workshop as well as in the Drawing Office. Giving Full Explanations of the Construction of Modern Steam-Engines: Including Diagrams showing their Actual operation. Together with Complete but Simple Explanations of the operations of Various Kinds of Valves, Valve Motions, and Link Motions, etc., thereby Enabling the Ordinary Engineer to clearly Understand the Principles Involved in their Construction and Use, and to Plot out their Movements upon the Drawing Board. By JOSHUA ROSE, M. E. Illustrated by 422 engravings. Revised. 358 pp. . . \$6.00

ROSE.-Steam Boilers:

### SCHRIBER.-The Complete Carriage and Wagon Painter:

A Concise Compendium of the Art of Painting Carriages, Wagons, and Sleighs, embracing Full Directions in all the Various Branches, including Lettering, Scrolling, Ornanenting, Striping, Varnishing, and Coloring, with numerous Recipes for Mixing Colors. 73 Illustrations. 177 pp. 12mo. \$1.00



· · · · ·

